



California Tree and Landscape Consulting, Inc.

March 16, 2022

Toni Connors C/O Area West Engineers, Inc.
 7478 Sandalwood Drive, Suite 400
 Citrus Heights, CA 95621
 Phone: (916) 725-5551
 Via Email: bob@areawesteng.com

PRE-DEVELOPMENT REPORT & TREE INVENTORY

RE: 6001 Beech Avenue & 6018 Roloff Way, APN 261-0250-032 & APN 261-0250-033, County of Sacramento jurisdiction, California

Executive Summary:

Bob Rozumowicz of Area West Engineering Inc., the civil engineer for the project, contacted California Tree and Landscape Consulting, Inc. on behalf of the property owner. The assignment was to inventory and evaluate the trees that are located on or adjacent to the parcels identified in the preliminary plans provided by Area West Engineering, Inc.¹ The adjacent properties are located at 6001 Beech Avenue & 6018 Roloff Way in Orangevale, California, and are subject to the jurisdiction of Sacramento County. See Supporting Information Appendix A –Tree Location Map.

Tyler Thomson, ISA Certified Arborist #WE-12751A, was on the site on February 22, 2022. A total of 23 trees were included in the inventory. 12 trees are protected by the Sacramento County [OAK] Tree Preservation Ordinance 19.12, however, the other trees still require permitting for removal². There were 8 individual trees included in the inventory that are off-site but were included because they could be impacted by future development of the parcel. There were also stands of multiple, non-protected trees included in the inventory table and map.

Tree Species	Trees Inventoried	Trees on the Site	Protected by Sacramento County Tree Preservation, 19.12 ³	Trees Proposed for Removal	Trees impacted by the proposed development and requiring special protection measures and/or mitigation
Protected (by species):					
Valley Oak, <i>Quercus lobata</i>	12	11	12	TBD	TBD
Non-Protected (by species):					
Coast Redwood, Chinese Pistache, Chinese Hackberry, Carolina Cherry Laurel, Liquidambar, Glossy Privet	11	4	0	TBD	TBD
Totals	23	15	12	TBD	TBD

See Appendices for specific information on each tree.

¹ October 11 2021, Parcel Map 15030 Layout 5.

² CalTLC is not a licensed land surveyor. Tree locations are approximate and we do not determine tree ownership. Trees which appear to be on another parcel are listed as off-site and treated as the property of that parcel. No evaluation of easement locations, such as required for street tree status, was conducted.

³ Native oak trees with a dbh under 6inches are not considered protected. Tree preservation pursuant to the zoning code of Sacramento County includes alternate protection standards for non-native species, mitigation trees previously planted, and commercial and/or multifamily residential landscapes.

Methods

Appendix B in this report is the detailed inventory and recommendations for the trees. The following terms and Table A – Ratings Description will further explain our findings.

A Level 2 – Basic Visual Assessment was performed in accordance with the International Society of Arboriculture’s best management practices. This assessment level is limited to the observation of conditions and defects which are readily visible. Additional limiting factors, such as blackberries, poison oak, and/or debris piled at the base of a tree can inhibit the visual assessment.

Tree Location: The GPS location of each tree was collected using the ESRI’s ArcGIS collector application on an Apple iPhone. The data was then processed in ESRI’s ArcMap by Julie McNamara, M.S. GISci, to produce the tree location map.

Tree Measurements: DBH (diameter breast high) is normally measured at 4’6” (above the average ground height for “Urban Forestry”), but if that varies then the location where it is measured is noted. A steel diameter tape was used to measure the diameter. The step pacing method was used to measure distances. Canopy radius measurements may also have been estimated due to obstructions, such as steep slopes, fences, or other trees.

Terms

Field Tag #	The pre-stamped tree number on the tag which is installed at approximately 6 feet above ground level on the north side of the tree.
Old Tag #	If additional field tags are found on the trees and are legible, they are listed here.
Species	The species of a tree is listed by our local and correct common name and botanical name by genus (capitalized) and species (lower case). Oaks frequently cross-pollinate and hybridize, but the identification is towards the strongest characteristics.
DBH	Diameter breast high' is normally measured at 4’6” (above the average ground height for “Urban Forestry”), but if that varies then the location where it is measured is noted in the next column “measured at”
Measured at	Height above average ground level where the measurement of DBH was taken
Canopy radius and Protection Area	The farthest extent of the crown composed of leaves and small twigs. Most trees are not evenly balanced. This measurement represents the longest extension from the trunk to the outer canopy. The dripline measurement is from the center point of the tree and is shown on the Tree Location Map as a circle. This measurement further defines the protection zone and can indicate if pruning may be required for development. Sacramento County specifies this measurement as the required ‘Protected Root Zone’
Critical Root Zone	The radius of the critical root zone is a circle equal to the trunk diameter inches converted to feet and factored by tree age, condition and health pursuant to the industry standard. Best Management Practices: Managing Trees During Construction, the companion publication to the Approved American National Standard, provides guidance regarding minimum tree root protection zones for long term survival. In instances where a tree is multi-stemmed the protected root zone is equal to the extrapolated diameter (sum of the area of each stem converted to a single stem) factored by tree age, condition and health.

Arborist Rating Subjective to condition and is based on both the health and structure of the tree. All of the trees were rated for condition, per the recognized national standard as set up by the Council of Tree and Landscape Appraisers and the International Society of Arboriculture (ISA) on a numeric scale of 5 (being the highest) to 0 (the worst condition, dead) as in Chart A. The rating was done in the field at the time of the measuring and inspection.

<u>Arborist Ratings</u>		<u>Sacramento County Ratings</u>	
No problem(s)	Excellent	5	Excellent
No apparent problem(s)	Good	4	Good
Minor problem(s)	Fair	3	Fair
Major problem(s)	Fair to Poor	2	Declining
Extreme problem(s)	Poor	1	Severe Decline
Dead	Dead	0	Dead

Rating #0: This indicates a tree that has no significant sign of life.

Rating #1: The problems are extreme. This rating is assigned to a tree that has structural and/or health problems that no amount of work or effort can change. The issues may or may not be considered a dangerous situation.

Rating #2: The tree has major problems. If the option is taken to preserve the tree, its condition could be improved with correct arboricultural work including, but not limited to: pruning, cabling, bracing, bolting, guying, spraying, mistletoe removal, vertical mulching, fertilization, etc. If the recommended actions are completed correctly, hazard can be reduced and the rating can be elevated to a 3. If no action is taken the tree is considered a liability and should be removed.

Rating #3: The tree is in fair condition. There are some minor structural or health problems that pose no immediate danger. When the recommended actions in an arborist report are completed correctly the defect(s) can be minimized or eliminated.

Rating #4: The tree is in good condition and there are no apparent problems that a Certified Arborist can see from a visual ground inspection. If potential structural or health problems are tended to at this stage future hazard can be reduced and more serious health problems can be averted.

Rating #5: No problems found from a visual ground inspection. Structurally, these trees have properly spaced branches and near perfect characteristics for the species. Highly rated trees are not common in natural or developed landscapes. No tree is ever perfect especially with the unpredictability of nature, but with this highest rating, the condition should be considered excellent.

Notes: Provide notable details about each tree which are factors considered in the determination of the tree rating including: (a) condition of root crown and/or roots; (b) condition of trunk; (c) condition of limbs and structure; (d) growth history and twig condition; (e) leaf appearance; and (f) dripline environment. Notes also indicate if the standard tree evaluation procedure was not followed (for example - why dbh may have been measured at a location other than the standard 54”). Additionally, notes will list any evaluation limiting factors such as debris at the base of a tree.

Discussion


Trees need to be protected from normal construction practices if they are to remain healthy and viable on the site. Our recommendations are based on experience and the County ordinance requirements to enhance tree longevity. This requires their root zones remain intact and viable despite the use of heavy equipment to install foundations, driveways, underground utilities, and landscape irrigation systems. Simply walking and driving on soil can have serious consequences for tree health. Tree Protection measures should be incorporated into the site plans in order to protect the trees.

Root Structure

The majority of a tree’s roots are contained in a radius from the main trunk outward approximately two to three times the canopy of the tree. These roots are located in the top 6” to 3’ of soil. It is a common misconception that a tree



underground resembles the canopy. The correct root structure of a tree is in the drawing below. All plants' roots need both water and air for survival. Poor canopy development or canopy decline in mature trees after development is often the result of inadequate root space and/or soil compaction.

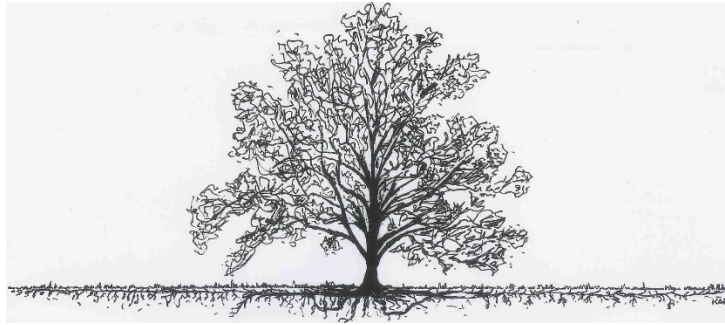

The reality of where roots are generally located

Pruning Mature Trees for Risk Reduction and/or Development Clearance

There are few good reasons to prune mature trees. Removal of deadwood, directional pruning, removal of decayed or damaged wood, and end-weight reduction as a method of mitigation for structural faults are the only reasons a mature tree should be pruned. Live wood over 3" should not be pruned unless absolutely necessary. Pruning cuts should be clean and correctly placed. Pruning should be done in accordance with the American National Standards Institute (ANSI) A300 standards.

Pruning causes an open wound in the tree. Trees do not "heal" they compartmentalize. It is far better to use more small cuts than a few large cuts as small pruning wounds reduce risk while large wounds increase risk. Any wound made today will always remain, but a healthy tree, in the absence of decay in the wound, will 'cover it' with callus tissue. Large, old pruning wounds which did not close with callous tissue often have advanced decay. These wounds are a likely failure point. Mature trees with large wounds have a high risk of failure.

Overweight limbs are a common structural fault in suppressed trees. There are two remedial actions for over-weight limbs (1) prune the limb to reduce the extension of the canopy, or (2) cable the limb to reduce movement. Cables do not hold weight they only stabilize the limb and additionally require annual inspection.

Arborist Classifications

There are different types of Arborists:

Tree Removal and/or Pruning Companies: These companies may be licensed by the State of California to do business as a tree removal company, but they do not necessarily know anything about trees biology.

Arborists: Arborist is a broad term intended to mean someone with specialized knowledge of trees, but it is often used to imply knowledge that is not there.

ISA Certified Arborist: An International Society of Arboriculture Certified Arborist is someone who has trained, met the qualifications for application, and been tested to have specialized knowledge of trees. You can look up certified arborists at the International Society of Arboriculture website: isa-arbor.org.

Consulting Arborist: An American Society of Consulting Arborists Registered Consulting Arborist is someone who has been trained and then tested to have specialized knowledge of trees; and trained and tested to provide high quality reports and documentation. You can look up registered consulting arborists at the American Society of Consulting Arborists website: ASCA-consultants.org.


RECOMMENDATIONS: Summary of Tree Protection Measures

- Follow the General Development Guidelines, Appendix 3, for all trees to be preserved on and off the site, unless otherwise indicated in the individual tree recommendations, Appendix 2.
- Project Arborist should review development plans prior to submittal.

The grading and site plans should include the following information:

- The project arborist for this project is California Tree & Landscape Consulting. The primary contact information is Cory Kinley (916) 955-6162. The secondary contact information is Nicole Harrison (530) 305-0165.
- Trees must be accurately located with base elevation and shown on the plans as a circle equal to the longest limb radius and cannot be depicted with an irregular canopy.
- The protection zone for trees is specified as the ‘canopy radius’ in Appendix 2 unless otherwise specified in the preservation requirements. The location of the tree protection fencing shall be depicted on the plans pursuant to the arborist recommendations. Note ‘dripline’ is not an acceptable location for installation of tree protection fencing.
- The Tree Protection Detail drawing shall be included on the plans. See Appendix 5.
- The root impact area shall be depicted on the plans as a hatched area with a percentage impact. Impacts are calculated using the tree protection fence location.
- The project arborist will monitor the site during construction and may make additional recommendations to ensure the survivability of the trees.

Report Prepared by:



ISA Certified Arborist #WC-9717A, TRAQ

Attachments

Appendix 1 – Tree Location Map

Appendix 2 – Tree Data

Appendix 3 – General Development Guidelines

Appendix 4 – Site Photographs

Bibliography

International Society of Arboriculture. (2015). *Glossary of Arboricultural Terms*. Champaign: International Society of Arboriculture.

L.R., C. (2003). *Reducing Infrastructure Damage by Tree Roots*. Porterville: International Society of Arboriculture.


Matheny, J. C. (1994). *Evaluation of Hazard Trees in Urban Areas, Second Edition*. Champaign: International Society of Arboriculture.

Menzer, K. (2008). *Consulting Arborist Report*.

Smiley. (2008). *Managing Trees During Construction, Best Management Practices*. Champaign: International Society of Arboriculture.

Tree Care Industry Association. (2017). *Tree, Shrub, and Other Woody Plant Management - Standard Practices (Pruning)*. Londonderry: Tree Care Industry Association.

Urban, J. (2008). *Up by the Roots*. Champaign: International Society of Arboriculture.

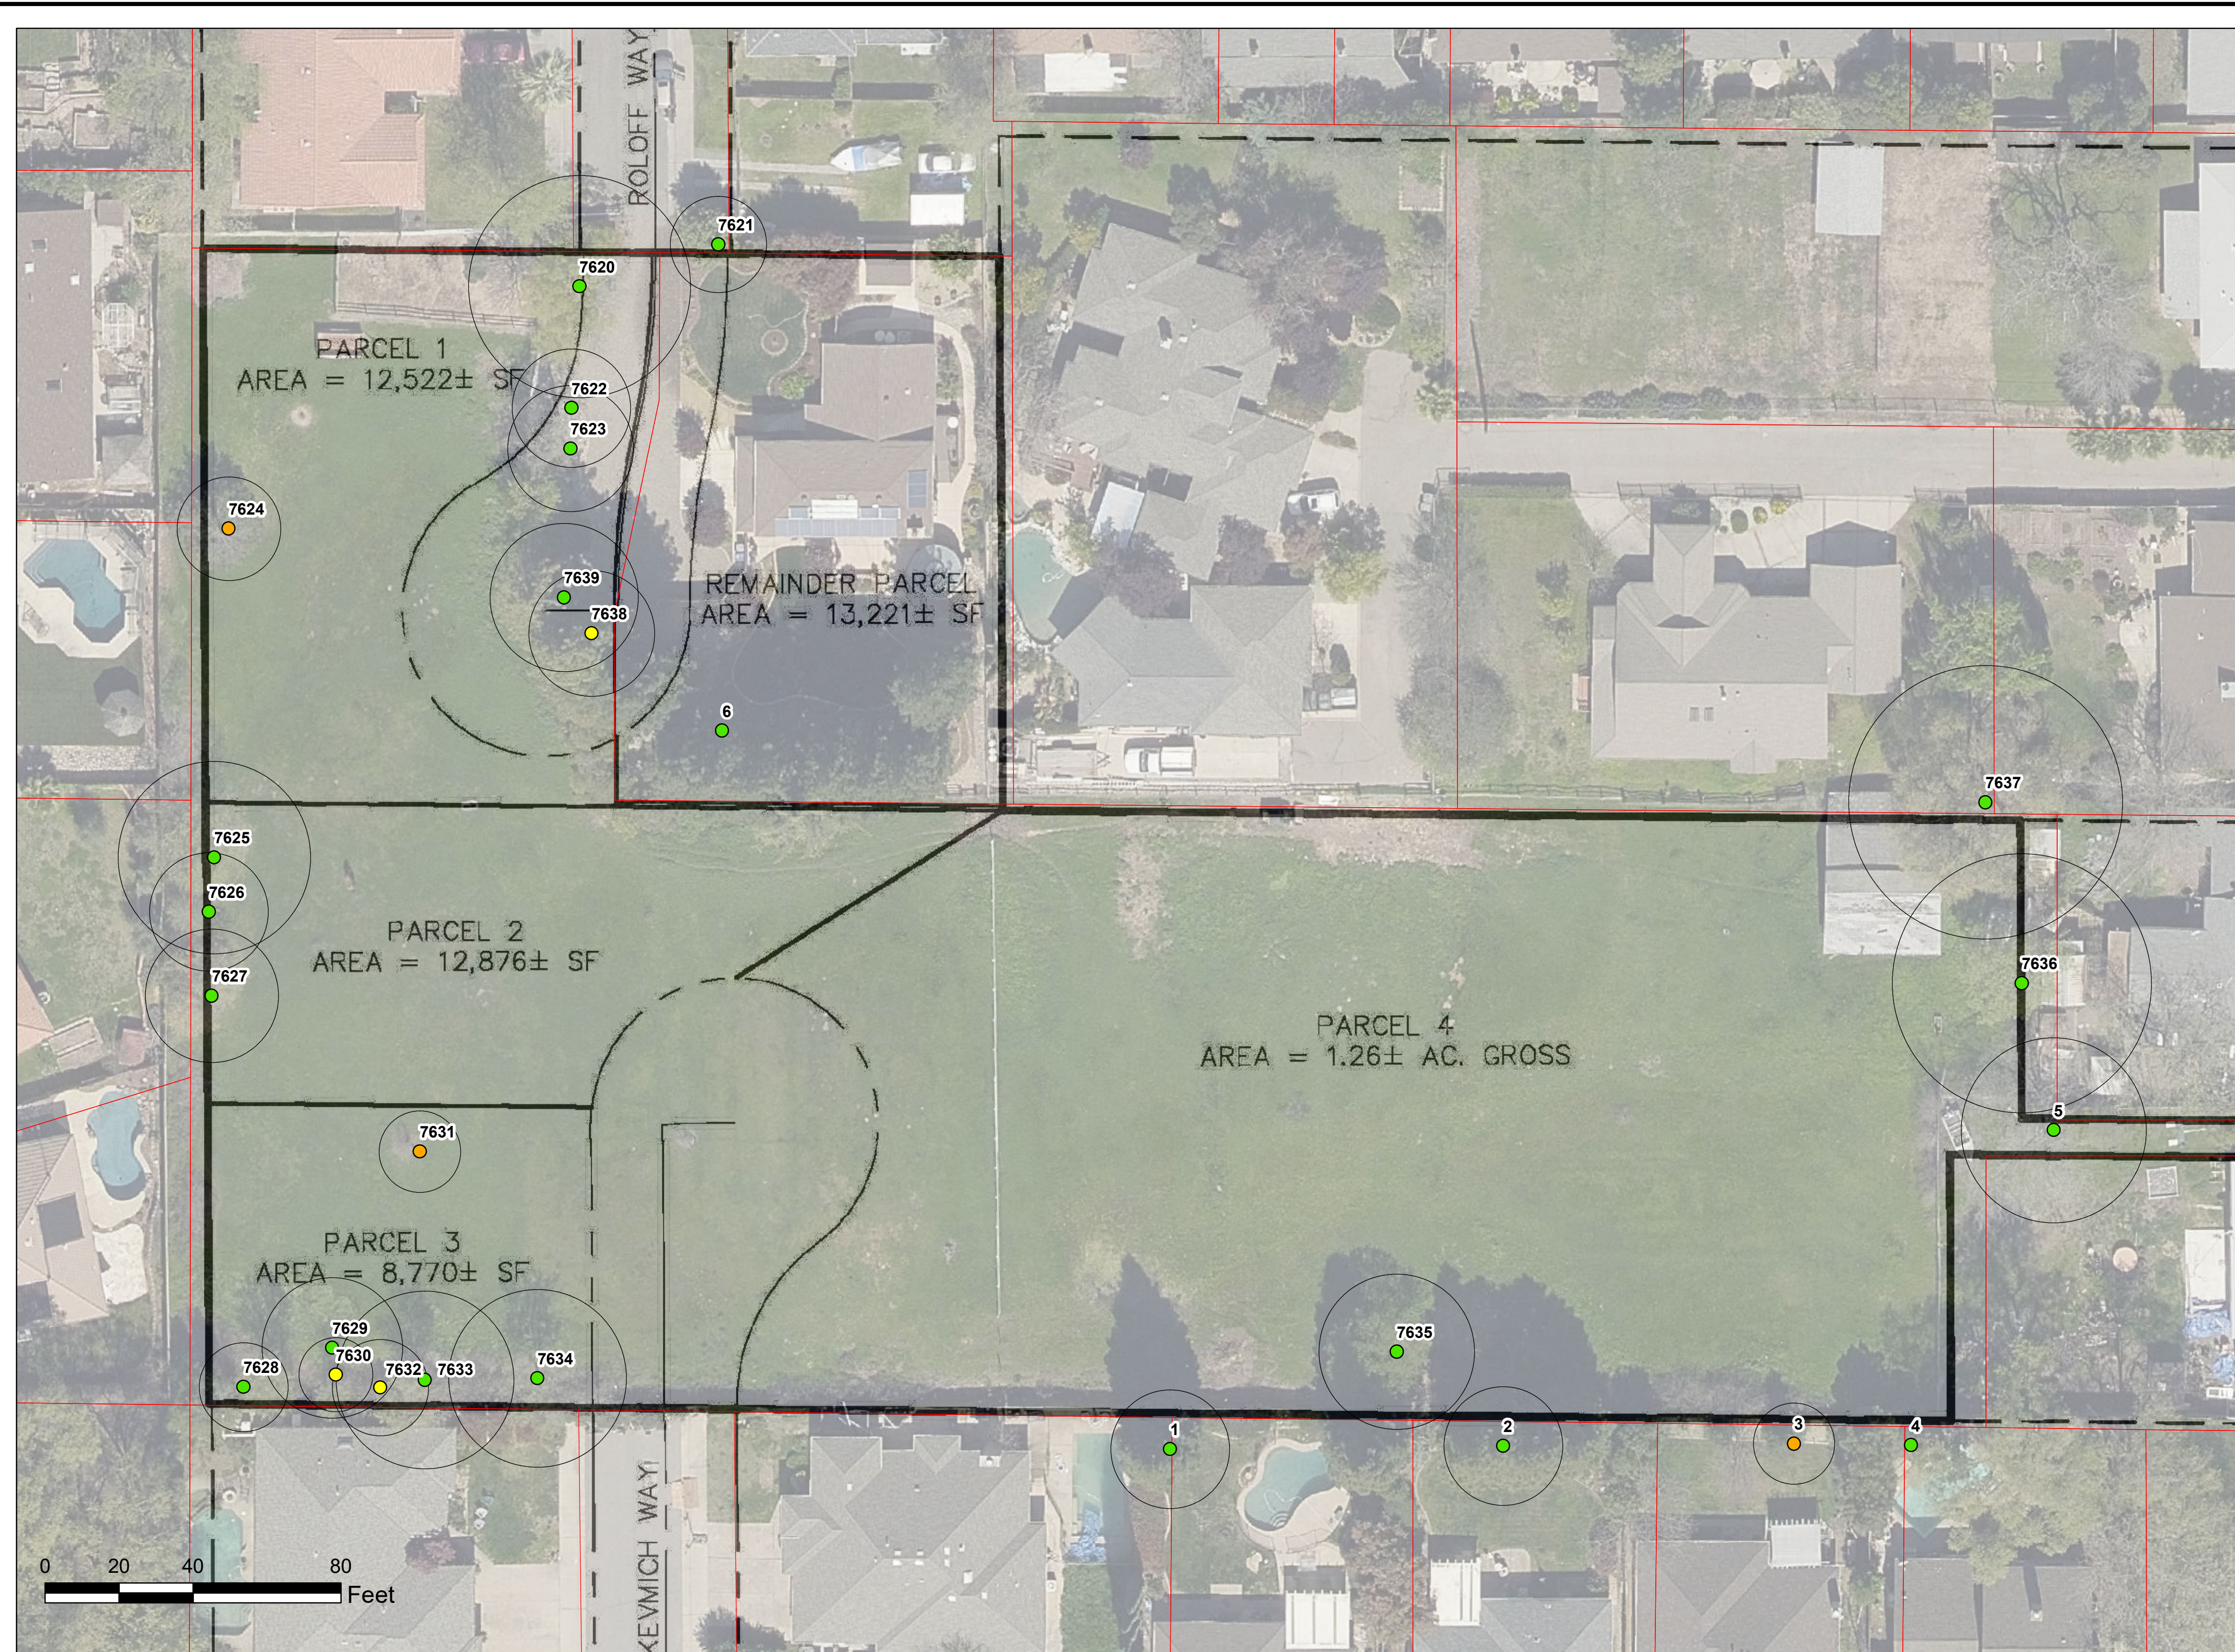


California Tree & Landscape Consulting, Inc.

359 Nevada Street, Suite 201
Auburn, CA 95603

Tree Protection General Requirements

1. The project arborist for this project is California Tree & Landscape Consulting. The primary contact information is R. Cory Kinley (916) 955-6162. The project arborist may continue to provide expertise and make additional recommendations during the construction process if and when additional impacts occur or tree response is poor. Monitoring and construction oversight by the project arborist is recommended for all projects and required when a final letter of assessment is required by the jurisdiction.
2. The project arborist should inspect the exclusionary root protection fencing installed by the contractor prior to any grading and/or grubbing for compliance with the recommended protection zones. Additionally, the project arborist shall inspect the fencing at the onset of each phase of construction. The protection zone for trees is specified as the 'canopy radius' in Appendix 2 unless otherwise specified in the preservation requirements. The location of the tree protection fencing shall be depicted on the plans pursuant to the arborist recommendations. Note 'dripline' is not an acceptable location for installation of tree protection fencing.
3. The project arborist should directly supervise any clearance pruning, irrigation, fertilization, placement of mulch and/or chemical treatments. If clearance pruning is required, the Project Arborist should approve the extent of foliage elevation and oversee the pruning to be performed by a contractor who is an ISA Certified Arborist. Clearance pruning should include removal of all the lower foliage that may interfere with equipment PRIOR to having grading or other equipment on site.
4. No trunk within the root protection zone of any trees shall be removed using a backhoe or other piece of grading equipment.
5. Clearly designate an area on the site outside the drip line of all trees where construction materials may be stored, and parking can take place. No materials or parking shall take place within the root zones of protected trees.
6. Any and all work to be performed inside the protected root zone fencing, including all grading and utility trenching, shall be approved and/or supervised by the project arborist.
7. Trenching, if required, inside the protected root zone shall be approved and/or supervised by the project arborist and may be required to be by a hydraulic or air spade, placing pipes underneath the roots, or boring deeper trenches underneath the roots.

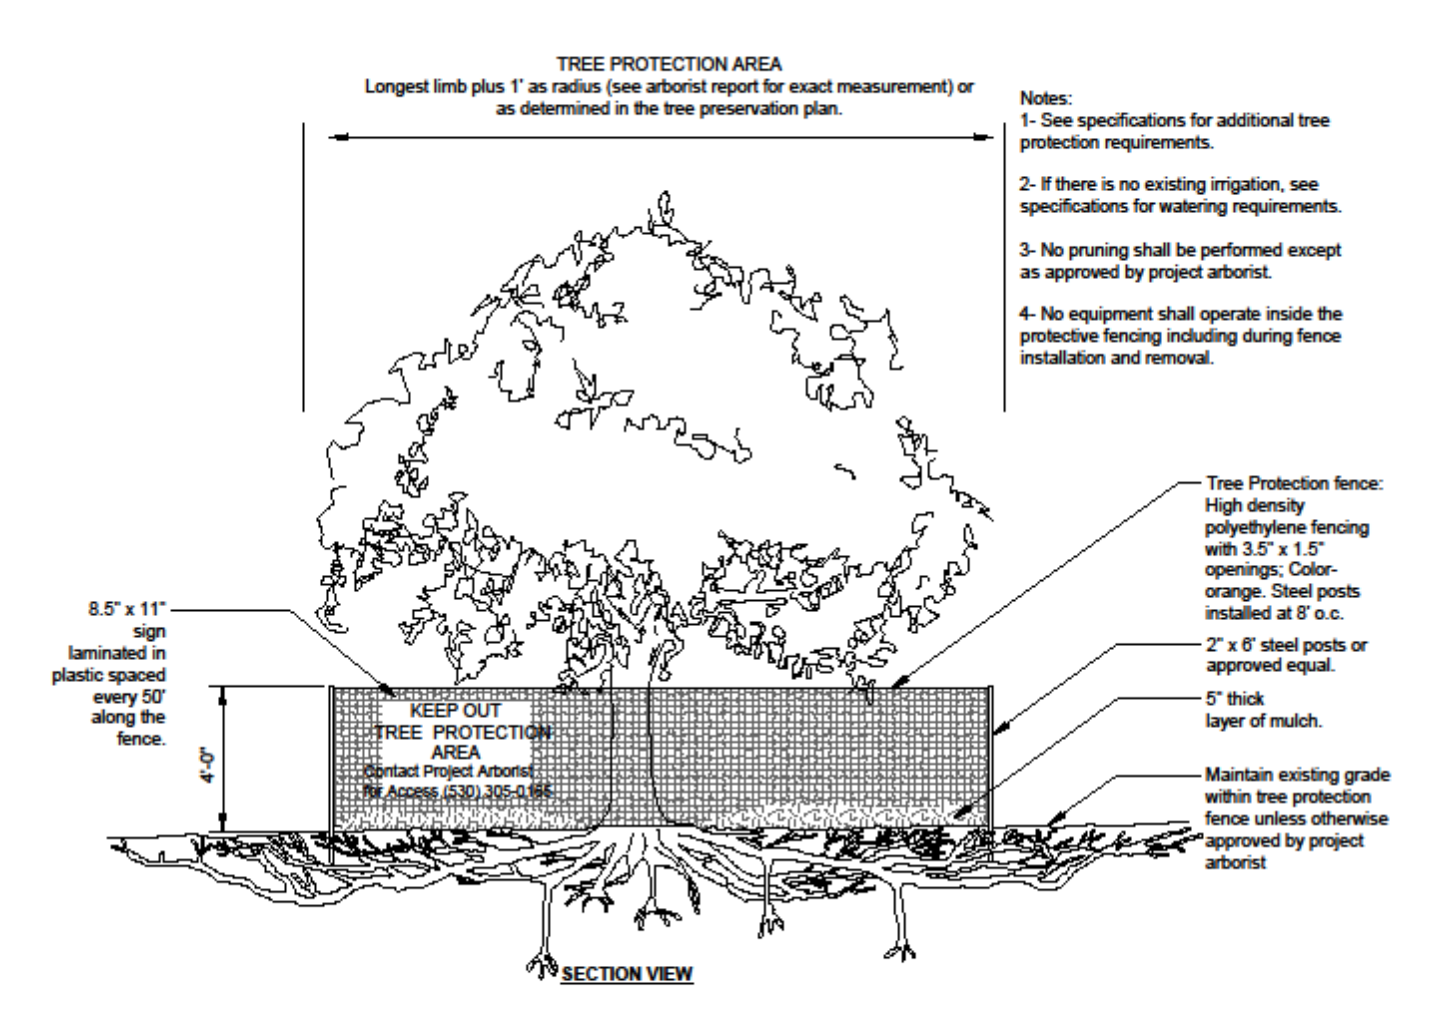

Tree Protection
URBAN TREE FOUNDATION © 2014
OPEN SOURCE FREE TO USE

TREE INVENTORY MAP

>Tree locations are approximate and were collected using apple iOS products.
>Property line information was downloaded from Sacramento County on 02/22/2022.
>Development plans provided by Area West Engineers dated 10/11/2021.

Property Line	Arborist Rating
Measured Tree Canopy	0 Dead
	1 Extreme Structure or Health Problems
	2 Major Structure or Health Problems
	3 Fair - Minor Problems
	4 Good - No Apparent Problems
	5 Excellent



Sheet No.
TPP 1.0

BEECH AVE

6001 Beech Ave, 6018 Roloff Ave
Orangevale, Sacramento County, CA

Date: 2/22/2022

Document Path: C:\Users\User\Desktop\Personal-net\CalTLC\Maps 2022\Beech Ave\BeechAve.mxd

Appendix 2 – Tree Data

Tag #	Protected By Code	Off-Site	Species Botanical Name	Species Common Name	DBH	Multi-Stem DBH (in.)	Measured At (in.)	Measured Canopy Radius (ft.)	Arborist Rating	Dvlpmt Status	Notes
1		Yes	<i>Sequoia sempervirens</i>	Coast Redwood	21		54	16	3 Fair - Minor Problems		6' from fence. good base, structure and vigor.
2		Yes	<i>Sequoia sempervirens</i>	Coast Redwood Stand			54	16	3 Fair - Minor Problems		row of 6 redwoods 4' from fence. branches over hang lot by 12'. good structure and vigor.
3		Yes	<i>Sequoia sempervirens</i>	Coast Redwood	7		54	11	1 Extreme Structure or Health Problems		dying redwood. 4' from fence.
4		Yes	<i>Acacia abyssinica</i>	Acacia Stand			54		3 Fair - Minor Problems		row of 5 off site acasia trees 1' from fence.
5		Yes	<i>Pistacia chinensis</i>	Chinese Pistache	16		54	25	3 Fair - Minor Problems		good vigor. branches lean 15' over lot.
6		Yes	<i>Sequoia sempervirens</i> & <i>Ligustrum lucidum</i>	Coast Redwood & Glossy Privet Stand			54		3 Fair - Minor Problems		row of redwoods 17 to 28 dbh. branches lean over property line 8'. bases 8 to 12' from property line.
7620		Yes	<i>Celtis sinensis</i>	Chinese Hackberry	17		54	30	3 Fair - Minor Problems		good base, structure and vigor. 10' from access road.
7621		Yes	<i>Prunus caroliniana</i>	Carolina Cherry Laurel	7		54	13	3 Fair - Minor Problems		good base, structure and vigor. 15' from road.
7622		Yes	<i>Liquidambar formosana</i>	Liquid Ambar	16		54	16	3 Fair - Minor Problems		good base, structure and vigor. rocks at base. 8' from fence.
7623		Yes	<i>Liquidambar formosana</i>	Liquid Ambar	15		54	17	3 Fair - Minor Problems		good base, structure and vigor. rocks at base. 8' from fence.

Tag #	Protected By Code	Off-Site	Species Botanical Name	Species Common Name	DBH	Multi-Stem DBH (in.)	Measured At (in.)	Measured Canopy Radius (ft.)	Arborist Rating	Dvlpmt Status	Notes
7624			<i>Sequoia sempervirens</i>	Coast Redwood	20		54	14	1 Extreme Structure or Health Problems		water sprouts at base. 10' dead canopy top. dying branches. low vigor.
7625	Yes		<i>Quercus lobata</i>	Valley Oak	16		54	26	3 Fair - Minor Problems		good base, next to 3' by 4' ground utility box. good structure and vigor. leans slightly east.
7626	Yes		<i>Quercus lobata</i>	Valley Oak	14		12	16	3 Fair - Minor Problems		good base, on slope. inclusion on base below codom union at 1'. good structure and vigor.
7627	Yes		<i>Quercus lobata</i>	Valley Oak	12		54	18	3 Fair - Minor Problems		good base, on slope. grafted stems at 7' and 10'. fair structure, leans slightly east. good vigor.
7628			<i>Ligustrum lucidum</i>	Glossy Privet	10.3	4, 4, 5, 5.5	54	12	3 Fair - Minor Problems		multi stem at grade, growing through wooden fence. good vigor.
7629	Yes		<i>Quercus lobata</i>	Valley Oak	8.5		54	19	3 Fair - Minor Problems		dirt on base, good base. good structure and vigor.
7630	Yes		<i>Quercus lobata</i>	Valley Oak	5		54	10	2 Major Structure or Health Problems		good base. swollen inclusion below codom union at 6', crowded stems. understory, poor structure. fair vigor.
7631	Yes		<i>Quercus lobata</i>	Valley Oak	8.5	4.5, 4.5, 3, 3, 3.5	36	11	1 Extreme Structure or Health Problems		tree was cut to a stump in the past. what remains is new growth. poor base structure with decay and weak attachments. low vigor.

Tag #	Protected By Code	Off-Site	Species Botanical Name	Species Common Name	DBH	Multi-Stem DBH (in.)	Measured At (in.)	Measured Canopy Radius (ft.)	Arborist Rating	Dvlpmt Status	Notes
7632	Yes		<i>Quercus lobata</i>	Valley Oak	7		54	13	2 Major Structure or Health Problems		fair base. swollen lower trunk with small openings around it. good canopy structure. fair vigor.
7633	Yes		<i>Quercus lobata</i>	Valley Oak	12		54	24	3 Fair - Minor Problems		good base, elevated buttress roots with minor damage. good structure and vigor.
7634	Yes		<i>Quercus lobata</i>	Valley Oak	11.5		54	24	3 Fair - Minor Problems		good base, structure and vigor.
7635	Yes		<i>Quercus lobata</i>	Valley Oak	11.5		54	21	3 Fair - Minor Problems		girdling roots, fair base, small equipment damage on base and trunk. good structure, leans north. good vigor.
7636	Yes		<i>Quercus lobata</i>	Valley Oak	17.5		54	35	3 Fair - Minor Problems		good base, structure and vigor. leans south. next to fence.
7637	Yes	Yes	<i>Quercus lobata</i>	Valley Oak	33.5	21, 26	54	37	3 Fair - Minor Problems		offsite tree. codom at grade. good structure and vigor. south stem leans southwest. 30' over property line.
7638			<i>Ligustrum lucidum</i>	Glossy Privet	15.5	5, 6, 8, 11	54	17	2 Major Structure or Health Problems		codom at 1'. small dead stems in codom union. sunken spots in trunks. understory. fair vigor.
7639			<i>Sequoia sempervirens</i>	Coast Redwood	27.5		54	20	3 Fair - Minor Problems		good base, structure and vigor.

Appendix 3**General Practices for Tree Protection****Definitions**

Root zone: The roots of trees grow fairly close to the surface of the soil, and spread out in a radial direction from the trunk of tree. A general rule of thumb is that they spread 2 to 3 times the radius of the canopy, or 1 to 1 ½ times the height of the tree. It is generally accepted that disturbance to root zones should be kept as far as possible from the trunk of a tree.

Inner Bark: The bark on large valley oaks and coast live oaks is quite thick, usually 1” to 2”. If the bark is knocked off a tree, the inner bark, or cambial region, is exposed or removed. The cambial zone is the area of tissue responsible for adding new layers to the tree each year, so by removing it, the tree can only grow new tissue from the edges of the wound. In addition, the wood of the tree is exposed to decay fungi, so the trunk present at the time of the injury becomes susceptible to decay. Tree protection measures require that no activities occur which can knock the bark off the trees.

Methods Used in Tree Protection:

No matter how detailed Tree Protection Measures are in the initial Arborist Report, they will not accomplish their stated purpose unless they are applied to individual trees and a Project Arborist is hired to oversee the construction. The Project Arborist should have the ability to enforce the Protection Measures. The Project Arborist should be hired as soon as possible to assist in design and to become familiar with the project. He must be able to read and understand the project drawings and interpret the specifications. He should also have the ability to cooperate with the contractor, incorporating the contractor’s ideas on how to accomplish the protection measures, wherever possible. It is advisable for the Project Arborist to be present at the Pre-Bid tour of the site, to answer questions the contractors may have about Tree Protection Measures. This also lets the contractors know how important tree preservation is to the developer.

Root Protection Zone (RPZ): Since in most construction projects it is not possible to protect the entire root zone of a tree, a Root Protection Zone is established for each tree to be preserved. The minimum Root Protection Zone is the area underneath the tree’s canopy (out to the dripline, or edge of the canopy), plus 10’. The Project Arborist must approve work within the RPZ.

Irrigate, Fertilize, Mulch: Prior to grading on the site near any tree, the area within the Tree Protection fence should be fertilized with 4 pounds of nitrogen per 1000 square feet, and the fertilizer irrigated in. The irrigation should percolate at least 24 inches into the soil. This should be done no less than 2 weeks prior to grading or other root disturbing activities. After irrigating, cover the RPZ with at least 12” of leaf and twig mulch. Such mulch can be obtained from chipping or grinding the limbs of any trees removed on the site. Acceptable mulches can be obtained from nurseries or other commercial sources. Fibrous or shredded redwood or cedar bark mulch shall not be used anywhere on site.

Fence: Fence around the Root Protection Zone and restrict activity therein to prevent soil compaction by vehicles, foot traffic or material storage. The fenced area shall be off limits to all construction equipment, unless there is express written notification provided by the Project Arborist, and impacts are discussed and mitigated prior to work commencing.

No storage or cleaning of equipment or materials, or parking of any equipment can take place within the fenced off area, known as the RPZ.

The fence should be highly visible, and stout enough to keep vehicles and other equipment out. I recommend the fence be made of orange plastic protective fencing, kept in place by t-posts set no farther apart than 6’.

In areas of intense impact, a 6’ chain link fence is preferred.

In areas with many trees, the RPZ can be fenced as one unit, rather than separately for each tree.

Where tree trunks are within 3’ of the construction area, place 2” by 4” boards vertically against the tree trunks, even if fenced off. Hold the boards in place with wire. Do not nail them directly to the tree. The purpose of the boards is to protect the trunk, should any equipment stray into the RPZ.

Elevate Foliage: Where indicated, remove lower foliage from a tree to prevent limb breakage by equipment. Low foliage can usually be removed without harming the tree, unless more than 25% of the foliage is removed. Branches need to be removed at the anatomically correct location in order to prevent decay organisms from entering the trunk. For this reason, a contractor who is an ISA Certified Arborist should perform all pruning on protected trees.⁴

Expose and Cut Roots: Breaking roots with a backhoe, or crushing them with a grader, causes significant injury, which may subject the roots to decay. Ripping roots may cause them to splinter toward the base of the tree, creating much more injury than a clean cut would make. At any location where the root zone of a tree will be impacted by a trench or a cut (including a cut required for a fill and compaction), the roots shall be exposed with either a backhoe digging radially to the trunk, by hand digging, or by a hydraulic air spade, and then cut cleanly with a sharp instrument, such as chainsaw with a carbide chain. Once the roots are severed, the area behind the cut should be moistened and mulched. A root protection fence should also be erected to protect the remaining roots, if it is not already in place. Further grading or backhoe work required outside the established RPZ can then continue without further protection measures.

Protect Roots in Deeper Trenches: The location of utilities on the site can be very detrimental to trees. Design the project to use as few trenches as possible, and to keep them away from the major trees to be protected. Wherever possible, in areas where trenches will be very deep, consider boring under the roots of the trees, rather than digging the trench through the roots. This technique can be quite useful for utility trenches and pipelines.

Protect Roots in Small Trenches: After all construction is complete on a site, it is not unusual for the landscape contractor to come in and sever a large number of “preserved” roots during the installation of irrigation systems. The Project Arborist must therefore approve the landscape and irrigation plans. The irrigation system needs to be designed so the main lines are located outside the root zone of major trees, and the secondary lines are either laid on the surface (drip systems), or carefully dug with a hydraulic or air spade, and the flexible pipe fed underneath the major roots.

Design the irrigation system so it can slowly apply water (no more than ¼” to ½” of water per hour) over a longer period of time. This allows deep soaking of root zones. The system also needs to accommodate infrequent irrigation settings of once or twice a month, rather than several times a week.

⁴ International Society of Arboriculture (ISA), maintains a program of Certifying individuals. Each Certified Arborist has a number and must maintain continuing education credits to remain Certified.



Monitoring Tree Health During and After Construction: The Project Arborist should visit the site at least twice a month during construction to be certain the tree protection measures are being followed, to monitor the health of impacted trees, and make recommendations as to irrigation or other needs. After construction is complete, the arborist should monitor the site monthly for one year and make recommendations for care where needed. If longer term monitoring is required, the arborist should report this to the developer and the planning agency overseeing the project.



Appendix 4
Site Photographs



View from the southwest corner of parcel facing north.



View from the southeast corner of parcel facing west.



View of off-site stand of trees on the north property line.