


California High-Speed Rail Authority

Palmdale to Burbank *Project Section*

Final Environmental Impact Report/
Environmental Impact Statement

Appendix 3.10-B: Sites of Potential
Environmental Concern

April 2024

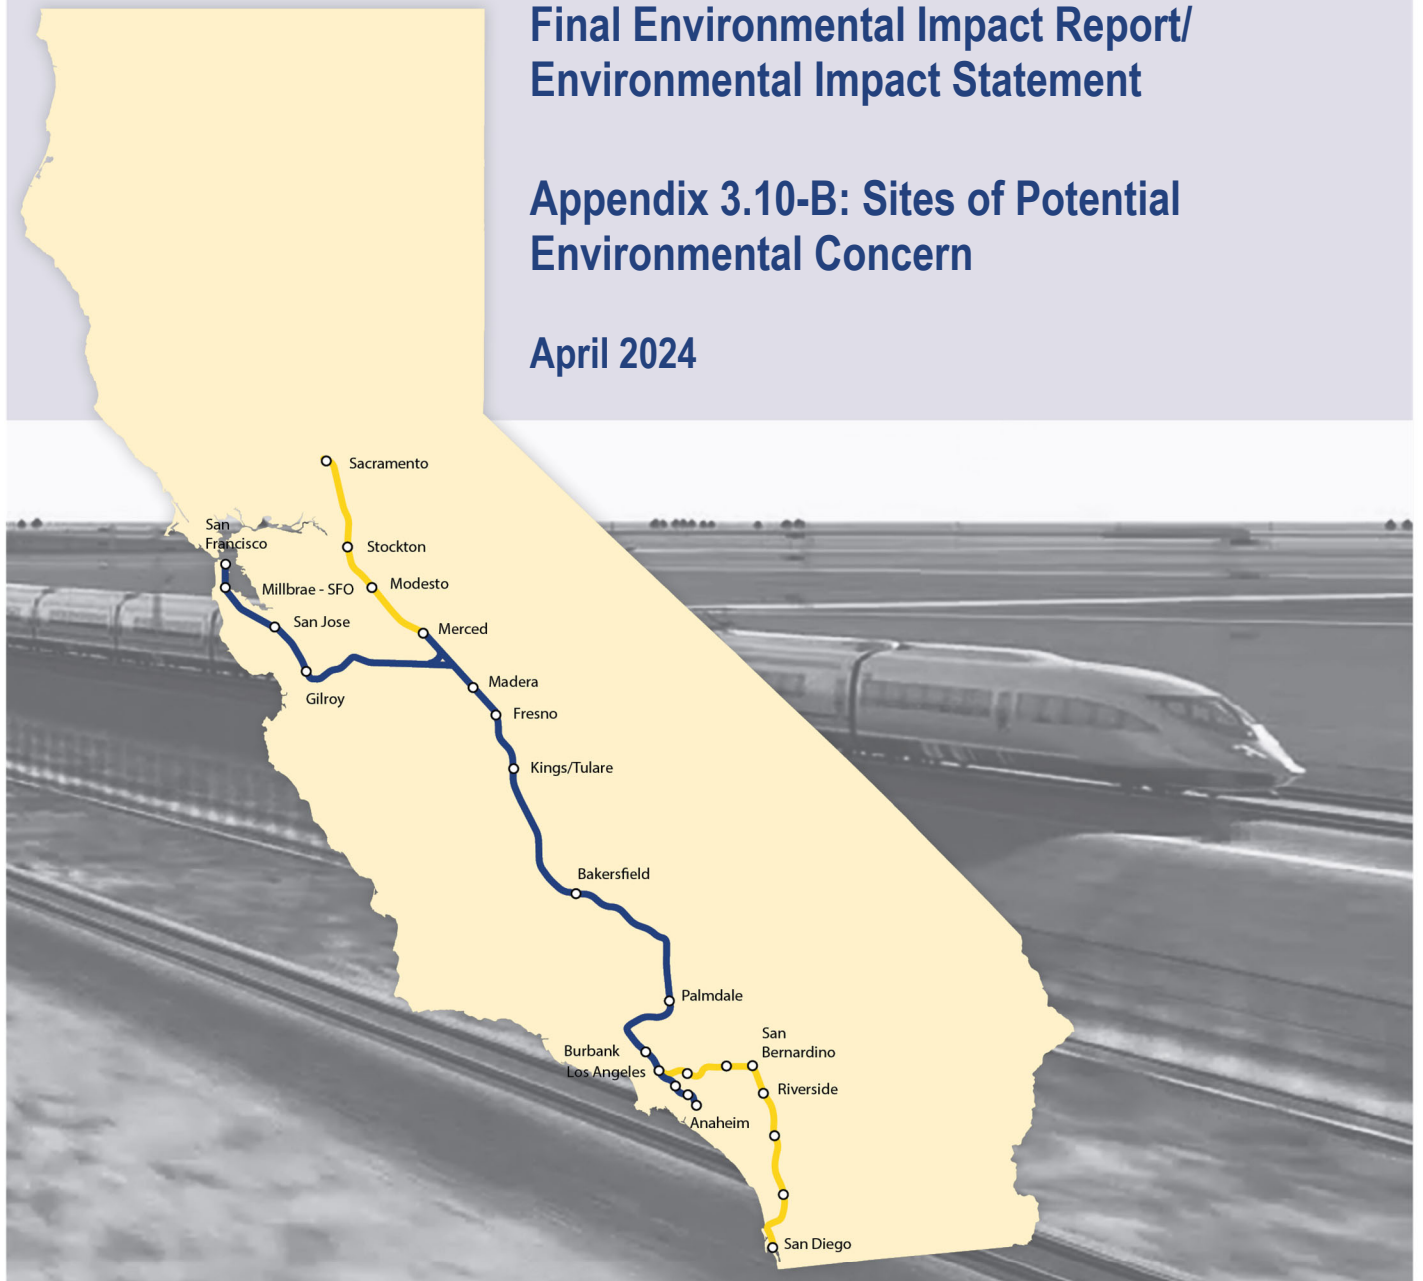

The environmental review, consultation, and other actions required by applicable federal environmental laws for this project are being or have been carried out by the State of California pursuant to 23 U.S.C. 327 and a Memorandum of Understanding dated July 23, 2019, and executed by the Federal Railroad Administration and the State of California.

This page intentionally left blank

TABLE OF CONTENTS

1 POTENTIAL ENVIRONMENTAL CONCERN SITES 3.10-B-1

Tables

Table 3.10-B-1 Potential Environmental Concern Ranking Criteria 3.10-B-1

Table 3.10-B-2: Build Alternatives Palmdale Subsection PEC Sites 3.10-B-3

Table 3.10-B-3: Refined SR14 Central Subsection PEC Sites 3.10-B-7

Table 3.10-B-4: SR14A Central Subsection PEC Sites 3.10-B-34

Table 3.10-B-5: Refined SR14 and SR14A Burbank Subsection PEC Sites 3.10-B-62

Table 3.10-B-6: E1 Central Subsection PEC Sites 3.10-B-71

Table 3.10-B-7: E1A Central Subsection PEC Sites 3.10-B-92

Table 3.10-B-8: E1 and E1A Burbank Subsection PEC Sites 3.10-B-114

Table 3.10-B-9: E2 Central Subsection PEC Sites 3.10-B-123

Table 3.10-B-10: E2A Central Subsection PEC Sites 3.10-B-133

Table 3.10-B-11: E2 and E2A Burbank Subsection PEC Sites 3.10-B-143

This page intentionally left blank

1 POTENTIAL ENVIRONMENTAL CONCERN SITES

Potential Environmental Concern (PEC) sites within the Palmdale to Burbank Project Section resource study area have been categorized into low, medium, and high priority criteria as shown in Table 3.10-B-1 and as included in Table 3.10-3 in Section 3.10, Hazardous Materials and Waste of the Draft EIR/EIS. Table 3.10-B-2 to Table 3.10-B-11 list PEC sites which indicate a potential presence of a hazardous material or waste within the resource study area. Table 3.10-B-2, which discloses PEC sites in the Palmdale Subsection, was included for informational purposes only. The Burbank Subsection PECs are identical for the Refined SR14/SR14A Build Alternatives (Table 3.10-B-5), the E1/E1A Build Alternatives (Table 3.10-B-8), and the E2/E2A Build Alternatives (Table 3.10-B-11). The Refined SR14, SR14A, E1, E1A, E2, and E2A Build Alternative study areas would encompass numerous PEC sites, but impacts would be reduced by the implementation of impact avoidance and minimization features (IAMF) listed in Section 3.10, Hazardous Materials and Waste.

Table 3.10-B-1 Potential Environmental Concern Ranking Criteria

PEC Rank	Ranking Criteria
High	<ul style="list-style-type: none"> Open cases involving a hazardous materials or waste release within 0.1 mile of the alignment centerline Open or closed cases that have affected groundwater below the alignment centerline Landfills and mines within 0.25 mile of the alignment centerline Sites within 0.1 mile of the alignment centerline listed on the following databases: Formerly Used Defense Sites, California Bond Expenditure Plan, Calsites, Cortese List, and California Response
Medium	<ul style="list-style-type: none"> Closed cases involving a hazardous materials or waste release within 0.1 mile of the alignment centerline Closed cases between 0.1 mile and 0.25 mile of the alignment centerline where groundwater has been affected Open cases between 0.1 mile and 0.5 mile of the alignment centerline Landfills and mines between 0.25 and 0.5 mile of the alignment centerline Transfer facilities and waste haulers within 0.1 mile of the alignment centerline Reported hazardous material releases within 0.1 mile of the alignment centerline that might have residual on-site contamination Sites between 0.1 mile and 1.0 mile of the alignment centerline listed on the following databases: Formerly Used Defense Sites, California Bond Expenditure Plan, Calsites, Cortese List, California Response, State Active Underground Storage Tank Facilities, California Facility Inventory Database of Historical Active and Inactive Underground Storage Tank Locations, State Hazardous Substance Storage Container Database of Historic Underground Storage Tank Sites, California Drycleaners, EDR Historical Automotive Repair Facilities, EDR Historical Drycleaner Facilities
Low	<ul style="list-style-type: none"> Closed cases involving a hazardous materials or waste release more than 0.1 mile from the alignment centerline Landfills and mines more than 0.5 mile from the alignment centerline Transfer facilities and waste haulers more than 0.1 mile from the alignment centerline Sites investigated as part of Los Angeles Regional Water Quality Control Board Aquifer Investigation that were not determined to contribute to regional groundwater contamination Reported hazardous material releases at any distance that do not appear to have the potential for residual contamination at the site

Source: Authority, 2019

EDR = Environmental Data Resources

PEC = potential environmental concern

This page intentionally left blank

Table 3.10-B-2: Build Alternatives Palmdale Subsection PEC Sites

HSR Site No	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
SR14P-1	3-4	68	S101297701, S114668864	PETRO-LOCK INC	38206 SIERRA, 38206 SIERRA HWY N	475 ft. (0.09 mi) ENE	At-Grade	HIST Cortese, LUST, RGA LUST	Site in Open - Verification Monitoring status due to gasoline release from UST in 1991. Soil, soil vapor, and aquifer used for drinking water reported to be impacted.	High	
SR14P-2	3-4	42	S114724438	8TH ST EAST WTS	39125 8TH ST EAST	1,131 ft. (0.21 mi) ENE	At-Grade	RGA LF	Listed on the RGA LF database. No further information.	High	
SR14P-3	4	76	S114724537	AFFORDABLE TIRE	924 EAST AVENUE Q-6	1,413 ft. (0.27 mi) ENE	At-Grade	RGA LF	Listed on the RGA LF database. No further information.	Low	
SR14P-4	1	4	S114568960	AFP 42 SITE 7 BLDG 722	1011 LOCKHEED WAY, B7222 STE 7	1,265 ft. (0.24 mi) NNE	At-Grade	RGA LUST	LUSTMCS - Three diesel USTs were removed and soil samples from the stockpile were determined to be impacted. Case closed in 1996. MCS/LUST - During closure of a tank containing paint thinner, soil surrounding the tank was noted to have been impacted. Only minor impact was noted and remediation was not necessary. Case closed in 1995.	Low	
SR14P-5	1	4	S114568961	AFP 42 SITE 7 BLDG 727	1011 LOCKHEED WAY, BLDG 7222	1,265 ft. (0.24 mi) NNE	At-Grade	RGA LUST	LUSTMCS - Three diesel USTs were removed and soil samples from the stockpile were determined to be impacted. Case closed in 1996. MCS/LUST - During closure of a tank containing paint thinner, soil surrounding the tank was noted to have been impacted. Only minor impact was noted and remediation was not necessary. Case closed in 1995.	Low	
SR14P-6	4	36	S111239499	ALLAN CO	39530 12TH ST E	3,941 ft. (0.75 mi) ENE	At-Grade	SWF/LF	Large volume transfer/processing facility for construction/demolition, food wastes, green materials, mixed municipal, and other designated wastes.	Low	
SR14P-7	3	40	S114726491, S104580804	CITY OF PALMDALE LIMITED VOLUME S T	39110 3RD ST	1,348 ft. (0.26 mi) WSW	At-Grade	SWF/LF, RGA LF	City of Palmdale inert/municipal waste transfer/processing center. Facility is currently active with waste being disposed of off-site.	Med	
SR14P-8	3	80	S101307397	EXXON #7-1501	400 PALMDALE BLVD W	1,379 ft. (0.26 mi) WSW	At-Grade	HIST Cortese, LUST	Soil reported to be impacted from gasoline LUST. Remedial action performed and case closed in 1998.	Low	
SR14P-9	4	68	S117231595	KANGAROO OIL AND MARKET	960 EAST PALMDALE BLVD	1,581 ft. (0.3 mi) ENE	At-Grade	LUST	Two gasoline LUSTs were discovered to have impacted surrounding soil during removal. Case closed in 2015.	Low	
SR14P-10	4	68	S102948955, S114641456, U001562284	LA CO FIRE STATION #037	38318 9TH ST E	1,097 ft. (0.21 mi) ENE	At-Grade	HIST Cortese, LUST, RGA LUST	A LUST with unspecified contents impacted soil. Case closed in 1994. In a separate case, a LUST with unspecified contents impacted soils. Case closed in 1997.	Low	
SR14P-11	1	4	S114644643, S114644640, S114644685	LOCKHEED AIR TERMINAL COMPLEX 10, LOCKHEED PLANT 10, BLDG 603	1011 LOCKHEED WAY E, 1011 LOCKHEED WAY E	1,265 ft. (0.24 mi) NNE	At-Grade	RGA LUST	A diesel LUST and associated piping was reported to have impacted surrounding soil. The site was assessed and the case was closed in 1994.	Low	
SR14P-12	1	4	1016114355, S114644641, S114644653, S114644659	LOCKHEED MARTIN AERONAUTICS COMPANY, LOCKHEED AIR TERMINAL BLDG 617	1011 LOCKHEED WAY	1,265 ft. (0.24 mi) NNE	At-Grade	TRIS, RGA LUST	A jet fuel LUST was reported to have impacted surrounding soil. The site was assessed and the case was closed in 2013. Several additional jet fuel LUST incidents are reported for the site with the most recent case being closed in November 2015. Three CHMIRS releases are reported for the facility. The releases consist of the following: 1) In 2011, a timer stuck on a mist eliminator resulting in a release of 500 gallons of hazardous waste rinse water (contains chromium and dye penetrate oil) to a storm water percolation system. No outside waterways were impacted. Vacuum trucks were used to recover the material releases to concrete and soil sampling and characterization were performed on the percolation basin. 2) In 1997, personnel were cleaning a pipeline and unknowingly filled a pipe with detergent while the other end was not capped resulting in 300 gallons of	Low	

HSR Site No	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
									"Jet Fuel A and JP 5" being released. Waterways were reported to not have been involved and a company named A.E. Schmidt Environmental were retained to contain and cleanup the release. 3) In 1990, a release of an unspecified material was reported to an unspecified media.		
SR14P-13	4	82	U003778134	PALMDALE CARWASH	1520 E PALMDALE BLVD	4,887 ft. (0.93 mi) ENE	At-Grade	SLIC	Leaking gasoline and diesel USTs listed to have impacted soil. Case closed in 2008.	Low	
SR14P-14	4	68	S114669663, S106916263	PIERCE PROPERTY	932 EAST AVENUE Q-10	1,300 ft. (0.25 mi) ENE	At-Grade	LUST, RGA LUST	A gasoline LUST was discovered at the site. Assessment was performed and media was determined to not have been impacted. Case closed in 2006.	Low	
SR14P-15	3	59	S107737145	REX PERRIS VALLEY CONTINUATION HIGH SCHOOL	AVENUE Q/6TH ST	191 ft. (0.04 mi) WSW	At-Grade	ENVIROSTOR	School investigation site. Soil sampling indicated that no VOCs or pesticides were detected and low SVOCs were detected. Case closed 2001.	High	
SR14P-16	3	80	S114717710, S108245679	VALLARTA STATION	470 EAST PALMDALE BLVD	947 ft. (0.18 mi) WSW	At-Grade	LUST, RGA LUST	Soil reported to be impacted from diesel and gasoline LUSTs. Remedial action performed and case closed in 2008.	Low	
SR14P-17	3-4	68	S110423494, S112827063		PALMDALE BLVD AND SIERRA HWY	445 ft. (0.08 mi) ENW	At-Grade	CHMIRS	In 2008, a service vehicle had a faulty (leaking) transmission. The release was to asphalt on the street only.	Low	
SR14P-18	3-4	68	S108402150		SIERRA HWY AT PALMDALE BLVD	445 ft. (0.08 mi) ENW	At-Grade	CHMIRS	In 2005, 140 gallons of mineral oil were released and 10-20 gallons went into the gutter; however, none of the release went into the storm drain. The remainder was contained to the slab box. The release was due to equipment failure.	Low	
SR14P-19	3-4	94	91241891		37925 SIERRA HWY	446 ft. (0.08 mi) ENE	At-Grade	ERNS	A small meth lab was found operating at this location-no environmental damage was discovered on-site.	Low	
SR14P-20	3-4	114	2002022955, 95060543, 95071211, 9998061372, 2000031088, 2000031089, 2000091022, 2002055764, 2002056322, 95090122, 2002055778, 2003133530, 9998081195, 94080741, 95041001		37731 6TH ST E	211 ft. (0.04 mi) WSW	At-Grade	HMIRS	A FedEx representative noted that a package had spilled approximately 0.5 gallons of monoethanolamine. The spill was cleaned up and returned to the sender. A FedEx representative noted that a package had spilled approximately 0.25 gallon of isopropanol. The spill was cleaned up and returned to the sender.	Low	
SR14P-21	3-4	110	S114567684, U001587005, S102064711, S113471877	A V READY MIX	37815 6TH ST E	136 ft. (0.03 mi) WSW	At-Grade	HIST Cortese, LUST, CHMIRS, RGA LUST, SWRCY	A leak was noted from a diesel LUST to surrounding soil. Assessment was performed and case was closed in 1990.	Med	

HSR Site No	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
SR14P-22	3	13	S102437610, S114568959	AIR FORCE PLANT 42 - SITE 2 UST T2-6 (BLDG 210), AFP 42 SITE 2 BLDG 210	39959 SIERRA HWY	69 ft. (0.01 mi) ENE	At-Grade	HIST Cortese, LUST, MCS, RGA LUST	A gasoline LUST was discovered to have impacted surrounding soil. Majority of soil was excavated and disposed of off-site. Four cubic yards of impacted soil remain in place due to close proximity to a fire hydrant. Case closed in 1996.	Med	
SR14P-23	3-4	94	S114572117, S104402920, S105025483	ANTELOPE VALLEY REFRIGERATING	602 AVE R E	11 ft. (0 mi) WSW	At-Grade	HIST Cortese, LUST, RGA LUST	A diesel LUST was reported to be discovered at the facility. The impacted media was not reported. Case closed in 1991.	Med	
SR14P-24	3-4	103	U001586965, S114572125, S105032921	ANTELOPE VALLEY TRUCKING	37900 6TH ST E	235 ft. (0.04 mi) WSW	At-Grade	HIST Cortese, LUST, RGA LUST	A diesel LUST was reported to be discovered at the facility. The impacted media was not reported. Case closed in 1996.	Med	
SR14P-25	3-4	68	S114603113, S114603114, S106352943, S103656525, S114567058, S114602108, S103282127	CITY OF PALMDALE COMMUNITY REDEVELOPMENT, UNION OIL SERVICE STATION 101, 76 PRODUCT FACILITY #1016, CIRCLE K STORES #5608	38405 N SIERRA HWY, 38405 SIERRA HWY	434 ft. (0.08 mi) ENE	At-Grade	HIST Cortese, LUST, RGA LUST	Two gasoline LUSTs were discovered to have impacted surrounding soil during removal. Case closed in 2010.	Med	
SR14P-26	3-4	64	S113016717	HANKS SERVICE CENTER	38519 6TH ST	28 ft. (0.01 mi) WSW	At-Grade	LUST	Petroleum hydrocarbons reported to have impacted soils from previous USTs. Case closed in 2015.	Med	
SR14P-27	3-4	68	S102431269, S114625800, S114631471, S102430620	HDOC #055, GAS CO - HIGH DESERT STATION #055	38627 SIERRA HWY N	438 ft. (0.08 mi) ENE	At-Grade	HIST Cortese, LUST, RGA LUST	Former gasoline LUST impacted soil. The soil was excavated and disposed of off-site. Case closed in 1996.	Med	
SR14P-28	3-4	94	S102432441, S114641373, S103957867, U001586989, S114642075, S114729497	LADPW MD-5, LA CO DPW ROAD MD5 PALMDALE, LA CO PUBLIC WORKS, ROADS DEPT #557	38126 SIERRA HWY	240 ft. (0.05 mi) ENE	At-Grade	SWF/LF, HIST Cortese, LUST, RGA LUST, RGA LF	Petroleum hydrocarbons reported to have impacted soils from previous USTs. Case closed in 2012. Limited volume transfer operation listed for green materials, inert, and mixed municipal waste.	Med	
SR14P-29	3	31	S102948957, S114648609, S114648611	MASSARAI PROPERTIES	39500 SIERRA HWY	118 ft. (0.02 mi) ENE	At-Grade	HIST Cortese, LUST, RGA LUST	Soil reported to be impacted from gasoline LUST. Remedial action performed and case closed in 2008.	Med	
SR14P-30	3-4	55	S114661670, S109432174	NORTHRIDGE EQUIPMENT RENTALS	38860 N SIERRA HWY	488 ft. (0.09 mi) ENE	At-Grade	LUST, RGA LUST	A gasoline LUST was discovered. Impacted media not reported. Case closed 2010.	Med	
SR14P-31	3-4	94	S114693841, S102437849, S114693843	SOUTHERN PACIFIC - PALMDALE	38021 SIERRA HWY	434 ft. (0.08 mi) ENE	At-Grade	HIST Cortese, LUST, RGA LUST	A gasoline LUST was reported to impact soil. Case closed in 1993.	Med	
SR14P-32	3-4	110	S105025487, S114721643, S101620956, S114721641	WESTON BUILDERS SUPPLY CO	37822 N. 6TH ST E	98 ft. (0.02 mi) WSW	At-Grade	HIST Cortese, LUST, RGA LUST	A gasoline LUST is reported to have impacted surrounding soils. The soils were assessed, excavated, and removed. Case closed in 1992.	Med	

HSR Site No	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
SR14P-33	3-4	85	S103656452, S114722551	WILSON AMBULANCE SERVICE	38241 6TH ST E	17 ft. (0 mi) WSW	At-Grade	HIST Cortese, LUST, RGA LUST	A LUST with unspecified content was discovered. Impacted media not reported. Case closed 1998.	Med	
SR14P-34	3	28	S107450357, S106397283		520 AVENUE P	433 ft. (0.08 mi) ENE	At-Grade	CHMIRS	An auto shut-off sensor failed during fueling, causing a spill of an unspecified amount of gasoline from a service station in 2004. The spill is reported to have been contained although it is unknown if cleanup was performed.	Med	
SR14P-35	3-4	64	2015123580, S118189590		38554 6TH ST E	4 ft. (0 mi) WSW	At-Grade	ERNS, CHMIRS	Used oil and ethylene glycol reported to be leaking from barrels sitting outside of auto shop and also reported to be poured down toilets and sinks. Incident occurred in 2015. Additional information not provided.	Med	
SR14P-36	3-4	68	S100222789		38659 SIERRA HWY	438 ft. (0.08 mi) ENE	At-Grade	CHMIRS	Information not provided of substance or cleanup. Case closed in 1988.	Med	
SR14P-37	2	3	S103442480	AIR FORCE PLANT 42	AIR FORCE PLANT 42	4840 ft (0.92 mi) ENE	At-Grade	WMUDS/SWAT	Facility is listed to be is Solid Waste Assessment Test Program. Little additional information is provided.	Low	
SR14P-38	3-4	94	S107616256	PALMDALE RECYCLING	38022 SIERRA HWY	475 ft (0.09 mi) ENE	At-Grade	SWRCY	Facility is listed to be a recycling center that accepts aluminum/glass/plastic/bimetal products. Operation begin date listed to be 7/12/2013.	Med	
SR14P-39	2	20	S117625401	PEDRO M TORRES III	305 E BOGIE ST	3692 ft (0.7 mi) WSW	At-Grade	CERCLIS-NFRAP	Listed on the PEST LIC database. No spills reported.	Low	
SR14P-40	2	65	S117649449	TERRY L STEWART	38745 15TH STREET EAST #7	4773 ft (0.9 mi) ENE	At-Grade	CERCLIS-NFRAP	Listed on the PEST LIC database. No spills reported.	Low	

Table 3.10-B-3: Refined SR14 Central Subsection PEC Sites

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
SR14C-1	26	416	1011812498	12127 MONTAGUE ST	12127 MONTAGUE ST	2255 ft (0.43 mi) ENE	Tunnel	US BROWNFIELDS	Site is listed to be part of a Targeted Brownfield Assessment (TBA) Cooperative Agreement for potentially impacted properties. A Phase I ESA indicated cleanup is not required for the property.	Low	
SR14C-2	26	416	1011812499	12237 MONTAGUE ST	12237 MONTAGUE ST	1263 ft (0.24 mi) ENE	Tunnel	US BROWNFIELDS	Site is listed to be part of a TBA Cooperative Agreement for potentially impacted properties. A Phase I ESA indicated cleanup is not required for the property.	Low	
SR14C-3	25-26	416	1011812500	12269 MONTAGUE ST	12269 MONTAGUE ST	982 ft (0.19 mi) ENE	Tunnel	US BROWNFIELDS	Site is listed to be part of a TBA Cooperative Agreement for potentially impacted properties. A Phase I ESA indicated cleanup is not required for the property.	Low	
SR14C-4	25-26	416	1011812501	12333 BRANFORD ST	12333 BRANFORD ST	417 ft (0.08 mi) WSW	Retained Cut / Trench	US BROWNFIELDS	Site is listed to be part of a TBA Cooperative Agreement for potentially impacted properties. A Phase I ESA indicated cleanup is not required for the property.	Low	
SR14C-5	25-26	416	2008439502, 2004041369, 2004090543, 2004090552, 2007432171, 9900016774, 9900017582, S118188860, S101618411, S112829940, 2008426052, 2004061278, 9999010984	12466 MONTAGUE ST, ABF FREIGHT SYSTEM INC	12466 MONTAGUE ST (CON-WAY FREIGHT TERMINAL UFV)	251 ft (0.05 mi) WSW	Retained Cut / Trench	HMIRS, CHMIRS	Various spill incidents were reported in relation to transportation of chemicals. Upon review, a majority of the spills occurred while in off-site transit, were contained, and appeared to be minor.	Low	
SR14C-6	26	433	2008442399, 2000018444, 2005702069, 2005705141, 9900015353, 2000018445, 2000023111, 2000023112, 2000026381, 2000026382, 2000027914, 2000027915, 2000081231, 2000100313, 2000100954, 2000101199, 2001010286, 2001010613, 2002079730,	9210 SAN FERNANDO RD, 9210 SAN FERANND RD	9210 SAN FERNANDO RD, 9210 SAN FERNANDO RD	8 ft (0 mi) SW	At-grade	HMIRS	Various spill incidents were reported in relation to transportation of chemicals. Upon review, a majority of the spills occurred while in off-site transit, were contained, and appeared to be minor.	Low	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
			2005702976, 2005703130, 2005703330, 2005703331, 2005703577, 2005704791, 2007429157, 2007429162, 2007432971, 2007442551, 2007444444, 2008429400, 2008431179, 2008431180, 2008433054, 2008433055, 2008433086, 2008434346, 2008434348, 2008444447, 2008444627, 2008449059, 2008449060, 2008451713, 2008454720, 2008454739, 2008456578, 2008456980, 2008456981, 2008456982, 2008457201, 2009046142, 2009046164, 2009046617, 2009046710, 2009048306, 2009049875, 2009054666, 2009054926, 2009055157, 2009057241, 2009057797, 2010010313, 2010011261, 2010011414, 2010011629, 2010101751,								

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
			2010101985, 2010102765, 2010105563, 2010106669, 2010109580, 2011000197, 2011003725, 2011006546, 2011009758, 2012102499, 2012106977, 2012107847, 2012108000, 2012109960, 2012110238, 2013001837, 2013003207, 2013005296, 2013009758, 9900015352, 2000018562, 2000018563, 2000019551, 2000019552, 2000021244, 2000021245, 2000021568, 2000021569, 2000021833, 2000021834, 2000025532, 2000025533, 2000027912, 2000027913, 2000090448, 2000090457, 2000101198, 200115787, 20018561, 2003122338, 2003125978, 2003126125, 2003126563, 2003127112, 2003129141, 2003130046, 2003132923,								

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
			2003133027, 2004010896, 2004020247, 2004020299, 2004020302, 2004021060, 2004030014, 2004030373, 2004030377, 2004030385, 2004030738, 2004031144, 2004040325, 2004041101, 2004050169, 2004050819, 2004060622, 2004060739, 2004070940, 2004090196, 2004110607, 2004400081, 2004400082, 2004400083, 2004400138, 2004400139, 2005010934, 2005703767, 2005703780, 2005706255, 2005706356, 2005706924, 2011007673, 2013005567, 2013008284								
SR14C-7	28	504	S113001921	ABBOTT TECHNOLOGIES INC	8203 VINELAND	260 ft (0.05 mi) SW	Cut and Cover	CHMIRS	In 2013, a caller reported an illegal dumping of sewage from motor homes. Approximately 100 gallons were reported and the material was contained with the sewage system.	Low	
SR14C-8	28	490	1000426895, 1012010283	ACCURATE ENGINEERING INC	8710 TELFAIR AVE	1509 ft (0.29 mi) SW	At-grade	TRIS, ENVIROSTOR	ENVIROSTOR (1000426895) - Facility is reported to have been assessed via a Phase I ESA for potential COCs. No COCs were confirmed for the site and the facility was determined to not be subject to the NPL and/or land use restrictions. TRIS (1012010283) - Facility is listed to have notified the EPA under SARA Title II, Section 313. Copper and lead compounds are reported to be transferred from the facility for further waste management.	Low	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
SR14C-9	26	433	1007739312, S110275515, S106484865	ACTIVE MAGNETIC INSPECTION INC, EAGLE TECH	9356 1/2 SAN FERNANDO RD, UNIT B, 93561 SAN FERNANDO RD, #1/2	24 ft (0 mi) NE	At-grade	TRIS, SLIC, ENVIROSTOR	ENVIROSTOR (S110275515) - Facility was evaluated for the NPL and determined not to be eligible as of 9/8/2011. The site was referred to the EPA. SLIC (S106484865) - Facility was evaluated by the LARWQCB in 1997 in relation to a chromium VI source assessment for the area. The facility was determined to need "No Further Requirements" in relation to the investigation in 1997 and is listed as "Completed - Case Closed" as of 11/14/2014. TRIS (1007739312) - Facility is listed to have notified the EPA under SARA Title II, Section 313 in related to chromium, nickel, and nitric acid waste transferred for metal recovery from the site operations.	Med	
SR14C-10	10	178	S103656361, S114704737, S114705412, S103282018	ACTON PLAZA, TOSCO - 76 STATION #0781, TOSCO S.S. #0781	3807 SIERRA HWY, 3807 SIERRA HWY W	2171 ft (0.41 mi) SSW, groundwater flow to the east	Tunnel	HIST Cortese, LUST, RGA LUST	Facility is listed to have impacted soil and an aquifer used for drinking water supply with petroleum hydrocarbons as result of a LUST containing gasoline. Remedial excavation was performed from 1995 through 1999. Site is listed with a status of "Completed - Case Closed" as of 9/8/2010.	Low	
SR14C-11	28	504	S100229464, S114568808	ADVANCED PACKAGING TECHNIQUES	11340 PENROSE ST	714 ft (0.14 mi) SW	Retained Cut / Trench	HIST Cortese, LUST, RGA LUST	Facility is listed to have impacted soils with alcohols due to a LUST. The site status is reported as "Completed - Case Closed" as of 7/22/1996.	Low	
SR14C-12	26	433	1000905404, 1014202314	ALERT PLATING COMPANY	9939 GLENOAKS BLVD	3355 ft (0.64 mi) ENE	At-grade	CERCLIS NFRAP, SLIC	CERCLIS-NFRAP (1014202314) - Site assessed for contamination in 2010 and is listed as NFRAP due to not qualifying for the NPL based on existing information. SLIC (1000905404) - Facility was evaluated by the LARWQCB in 2001 in relation to a chromium VI source assessment for the area. The facility was determined to need "No Further Requirements" in relation to the investigation in 2003 and is listed as "Completed - Case Closed" as of 12/22/2012.	Low	
SR14C-13	26	433	1018119623	ALLEGHENY SITE	11933-11941 W ALLEGHENY ST	541 ft (0.1 mi) SW	At-grade	US BROWNFIELDS	Site is listed to be part of a TBA Cooperative Agreement for potentially impacted properties. A Phase I ESA indicated cleanup is not required for the property. Unknown media was indicated to have been affected at the site.	Low	
SR14C-14	26	416	1011812514	ANGELUS OXYGEN	12173-79 BRANFORD ST	977 ft (0.19 mi) ENE	Retained Cut / Trench	US BROWNFIELDS	Site is listed to be part of a TBA Cooperative Agreement for potentially impacted properties. A Phase I ESA indicated cleanup is not required for the property.	Low	
SR14C-15	9	166	S104404805	ANTELOPE VALLEY FWY SPILL	7600 ESCONDIDO CANYON	3007 ft (0.57 mi) NNW	Tunnel	SLIC	Facility is listed to have spilled TPH to an unspecified media. Facility status is listed as "No Further Action Required" and little additional information is provided.	Low	
SR14C-16	23	300	S105088508	ANTHONY INC	12364 GLADSTONE AVE	1329 ft (0.25 mi) WNW	Tunnel	ENVIROSTOR	Facility is listed to be part of a tiered permit. Site is not subject to the NPL or land use restrictions. Current site status is listed as "Inactive - Needs Evaluation."	Low	
SR14C-17	23	300	1000477327, S114572144	ANTHONY MANUFACTURING CO INC	12812 ARROYO AVE	1298 ft (0.25 mi) WNW	Tunnel	HIST Cortese, LUST, SLIC, ENVIROSTOR, RGA LUST	Facility is listed as "Completed - Case Closed" as of 1997 for an aquifer used for drinking water supply impacted by gasoline and VOCs. A conditional closure was issued pursuant to report of proper sealing of well.	Low	
SR14C-18	25	360	S114574855, S104891039	ARCO #9630	12579 VAN NUYS BLVD	170 ft (0.03 mi) ESE	Tunnel	LUST, RGA LUST	Facility is listed as "Leak Being Confirmed" for a gasoline leak to soil as of 2001.	High	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
SR14C-19	25	385	S114574856, S114702758, S102438981, S103066084, S114575341, S114703282	ARCO FACILITY NO. 09630, THRIFTY OIL CO STATION #230	12957 VAN NUYS BLVD	2266 ft (0.43 mi) WSW, groundwater flow to the southwest	Tunnel	HIST Cortese, LUST, RGA LUST	LUST - Facility is listed to have impacted soil due to a LUST containing gasoline. Site status is listed to be "Case Closed" as of 1/9/1991. LUST/HIST CORTESE (S103066084) - Facility is listed to have impacted other groundwater (used other than drinking water) with gasoline due to a LUST at the site. Site status is listed to be "Completed - Case Closed" as of 3/28/2013.	Low	
SR14C-20	26-28	485	1017400940	ASSOCIATED READY MIXED CONCRETE INC	8946 BRADLEY AVE	1570 ft (0.3 mi) NE	At-grade	TRIS	Facility is listed as a hazardous waste/enforcement and compliance history site for lead compounds with a status date of 2014. The lead compounds are reported to be transferred off-site for further waste management.	Low	
SR14C-21	28	505	S113145672	ASTRO CHROME & POLISHING	8136 LANKERSHIM BLVD	3951 ft (0.75 mi) SW	At-grade	SLIC	Facility listed as "Open - Site Assessment" as of 2014 for chlorinated hydrocarbons for impacting an unspecified media.	Low	
SR14C-22	26	463	S103587984	ATHENS SUN VALLEY MAT REC & T.S.	11121 PENDLETON ST	3801 ft (0.72 mi) NE	At-grade	SWF/LF	Facility is listed as an active large volume transfer and processing facility that accepts green materials, household trash, and inert metals. Monthly inspections are reported for the site and a daily capacity is listed to be 1,500 tons.	Low	
SR14C-23	26	463	S103441295	BENTZ DUMP	11251 PENDLETON ST	3368 ft (0.64 mi) NE	At-grade	LDS,WMUDS/S WAT	Facility is listed as a land disposal site with a status of "Completed - Case Closed" as of 5/25/2016. Accepted materials are listed to be clean dirt, broken concrete, asphalt, brick, block and rock.	Low	
SR14C-24	26	433	S112205497	BINS BINS BINS INC.	11835 SHELDON ST	859 ft (0.16 mi) NE	Elevated / Aerial Structure	SWF/LF	Facility is listed as an active waste hauler. Limited additional information is provided.	Low	
SR14C-25	28	463	S113724443	BIOMEDICAL WASTE DISPOSAL	11152 FLEETWOOD ST #9	1846 ft (0.35 mi) NE	Retained Cut / Trench	MWMP	Facility is listed to be a transfer only medical waste facility. No additional information is provided.	Low	
SR14C-26	28	525	1000590036, S114583652	BLACTOP MATERIALS CO #2, BLACKTOP MATERIALS CO	11462 PENROSE ST	1653 ft (0.31 mi) SW	Retained Cut / Trench	HIST Cortese, LUST, RGA LUST	Facility is reported to have impacted soil with diesel fuel due to a LUST. Site status is listed as "Completed - Case Closed" as of 9/7/1995.	Low	
SR14C-27	25	460	S117661157	BOULEVARD	9108 LAUREL CANYON BLVD	2550 ft (0.48 mi) SW	At-grade	CA MINES	Facility is listed as an idle sand and gravel open pit, plant, or mill operation. Reclamation is reported to be in progress and the facility is listed to be 124 acres in size. Information for the site was updated in 2014.	Med	
SR14C-28	26	463	U003060793	BRADLEY AVE DUMP	9050 BRADLEY AVE	1603 ft (0.3 mi) NE	At-grade	LDS,WMUDS/S WAT	Facility is listed as a land disposal site with a status of "Open-Inactive" as of 11/29/2012. Groundwater monitoring was conducted at the site and elevated VOC and PCE/TCE concentrations were identified.	Med	
SR14C-29	26	465	S113887321	BRADLEY EAST LANDFILL	9229 TUJUNGA AVE	2430 ft (0.46 mi) NE, groundwater flow to the southeast	At-grade	LDS	Facility is a former sand and gravel pit that was subsequently used as an unlined non-hazardous solid waste landfill that is listed as "Open - Closed/With Monitoring" as of 5/22/2016. Groundwater and soil/soil vapor are listed to have been impacted with VOCs, metals, and landfill related gases. The facility is reported to have leaking waste constituents in excess of DHS/MCLs and may be affecting groundwater in the vicinity of the landfill.	Med	
SR14C-30	26	461	S100931059, S109286318, S111075797, S103341425	BRADLEY EAST LANDFILL, BRADLEY LANDFILL & RECYCLING CENTER, BRADLEY LANDFILL	9227 TUJUNGA AVE	2005 ft (0.38 mi) NE	At-grade	SWF/LF, LDS,WMUDS/S WAT	Facility is listed to be a closed solid waste landfill that accepts construction/demolition, industrial, mixed municipal, and other designated wastes. The closure date is listed as 6/1/2007 and the facility is reported to be 126 acres in size. Facility is also listed to be a solid waste landfill with	Med	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
									quarterly inspections with a closure date of 12/31/1980. Facility is also listed to be a closed large volume transfer/processing facility with a closure date of 3/10/1988. Currently, the facility is listed to be an active large volume transfer/processing facility accepting agricultural, green materials, and manure with monthly inspections.		
SR14C-31	25-26	416	S103441737, 1000200264, 1003880073, S103441393	BRANFORD EXPERIMENT SITE, BRANFORD LANDFILL, LOS ANGELES DWP-BRANFORD STREE	9701 SAN FERNANDO RD	659 ft (0.12 mi) WSW	At-grade	CERCLIS NFRAP, HIST Cortese, LDS, ENVIROSTOR, WMUDS/SWAT	LDS/ENVIROSTOR (S103441737) - Facility is listed to be a closed land disposal site with a status of "Open - Closed/With Monitoring" as of 2/25/2016. A landfill gas collection system is reported to be operated continuously to mitigate methane gas migration from the facility. ENVIROSTOR (S103441737) - Facility is listed to have impacted groundwater, soil, and soil vapor with methane due to landfill operations. Site status is reported to be "No Further Action" as of 9/30/1998. CERCLIS-NFRAP (1003880073) - Site assessed for contamination in 1997 and is listed as NFRAP due to not qualifying for the National Priority List (NPL) based on existing information provided in October 2013.	Med	
SR14C-32	25	416	S102360935	BRANFORD LF	12456 BRANFORD ST	1682 ft (0.32 mi) WSW	At-grade	SWF/LF	Facility is listed to be a closed solid waste landfill. Detail of the accepted material is not provided; however, quarterly inspections are reported. The closure date is not reported for the site.	Med	
SR14C-33	26	463	U001567850	BROWNING FERRIS INDUSTRIES INC	9200 GLENOAKS BLVD	3777 ft (0.72 mi) NE	At-grade	SWF/LF	Facility is listed to be an active waste hauler. Limited additional information was provided in relation to site operations.¹	Low	X
SR14C-34	28	504	S103621795	BURBANK AIRCRAFT SUPPLY INC	10671 LANARK	414 ft (0.08 mi) NE	Tunnel	SLIC	Facility is listed to have impacted an aquifer used for drinking water supply with VOCs and chromium. Current status is listed as "Open-Inactive" as of 10/29/2014. Groundwater gradient information was not reported but is anticipated to be toward the southeast per typical flow within the San Fernando Valley area.	High	
SR14C-35	28	564	S111828968	BURBANK AIRPORT AUTHORITY	2627 HOLLYWOOD WAY	2159 ft (0.41 mi) NE	Tunnel	SLIC	Facility was evaluated by the LARWQCB in 2004 in relation to a chromium VI source assessment for the area. The facility was determined to need "No Further Requirements" in relation to the investigation in 2004 as is listed as "Completed - Case Closed" as of 12/22/2014.	Low	
SR14C-36	14	207	1000296883	C A RASMUSSEN INC	1010 SHILOH RD	5183 ft (0.98 mi) NW	Tunnel	US MINES	Facility is listed to be an abandoned non-coal mining operation. Ten violations of unknown nature were issued for the facility between 2007 and 2011.	Low	
SR14C-37	23	307	S116497301	C&M TOPSOIL INC	12087-40 LOPEZ CANYON RD	741 ft (0.14 mi) ESE	Tunnel	SWF/LF	Site is listed as an active facility accepting green waste for composting operations as of 2014.	Low	
SR14C-38	23	300	S101298230, S114588823, S114588822	C. E. MACMILLAN INC	12355 GLADSTONE AVE	1306 ft (0.25 mi) WNW	Tunnel	HIST Cortese, LUST, RGA LUST	Facility is reported to have impacted soil with other solvents or non-petroleum hydrocarbons due to a LUST. Site status is listed as "Completed - Case Closed" as of 9/4/1996.	Low	
SR14C-39	28	561	1000252200	CALIFORNIA BIONUCLEAR CORP	7654 SAN FERNANDO RD	66 ft (0.01 mi) SW	Tunnel	CERCLIS NFRAP, PRP	Facility was evaluated in relation to the San Fernando NPL case for potentially impacting groundwater with VOCs and/or chromium. The site was determined to require removal only, no site assessment work needed as of 1987.	Med	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
SR14C-40	25	457	1011961457	CALIFORNIA CHEMICAL MANUFACTURING, LLC (AMR)	12734 BRANFORD ST, SUITE 20	3517 ft (0.67 mi) SW	At-grade	CERCLIS NFRAP	Site assessed for contamination in 2009 and is listed as No Further Remedial Action Planned (NFRAP) due to not qualifying for the National Priority List (NPL) based on existing information.	Low	
SR14C-41	28	505	S112274179	CALIFORNIA PROPELLER	8101 LANKERSHIM BLVD	4127 ft (0.78 mi) SW	Retained Cut / Trench	SLIC	Facility was investigated in relation to chromic acid, and 1,1,1-TCA use at the site. Soil samples were collected adjacent to an abandoned clarifier that indicated elevated concentrations of chromium. A soil gas survey was subsequently performed that indicated elevated 1,1-DCE and 1,1,1-TCA concentrations in soils adjacent to the clarifier. The site received a letter of "No Further Action" in regard to soil and soil vapor impacts from the LARWQCB in 1994. The site received a notice of "No Further Action" subsequently in 1996 for the USEPA. Due to concerns regarding emerging chemicals detection in the groundwater of the North Hollywood Operable Unit, the LARWQCB issued a notice for further investigation for potential groundwater impact. In response, a technical report was prepared in 2012 by a consultant. A notice of "No Further Action" in relation to potential groundwater impacts was issued in 2015 by the LARWQCB. The site status is listed as "Completed - Case Closed" as of 5/21/2015.	Low	
SR14C-42	28	463	1016467998	CALMAT CO		439 ft (0.08 mi) NE	At-grade	US MINES	Facility is listed as "Non-Coal Mining" as of 1973. Limited additional information was provided.	High	
SR14C-43	26-28	463	1006816059	CALPORTLAND CO SUN VALLEY PLANT	8981 BRADLEY AVE	1556 ft (0.29 mi) NE	At-grade	TRIS	Facility is listed to produce lead compounds with off-site transfer for disposal of approximately 13 pounds of the compounds per year.	Low	
SR14C-44	23	318	S106079129	CITY OF SAN FERNANDO CORP YARD	535 GLENOAKS BLVD	5265 ft (1 mi) WNW	Tunnel	SWF/LF	Facility is listed to be an active limited volume transfer operation accepting construction/demolition, green material, inert, and metal wastes. The site is reported to be inspected quarterly and the permit date for the facility is 9/15/2003.	Low	
SR14C-45	28	463	1000591490, S109821484	COAST LIQUID GAS, GREGG PIT (PICK YOUR PART)	11370 PENDLETON ST	583 ft (0.11 mi) NE	Elevated / Aerial Structure	SWF/LF, LUST	SWF/LF -Very limited information provided for facility but site is listed in SWF/LF database. LUST - During steam cleaning of a sump, contaminated soil was excavated and disposed of for an unknown contaminant in 1988.	Med	
SR14C-46	23	300	1003878859, S104573531	COMMODORE PRODUCTS, P & G PRODUCTS	12800 FOOTHILL BLVD	2307 ft (0.44 mi) WNW	Tunnel	CERCLIS NFRAP, ENVIROSTOR	CERCLIS - NFRAP (1003878859) - Site assessed for contamination in 2010 and is listed as NFRAP due to not qualifying for the NPL based on existing information. ENVIROSTOR (S104573531) - Facility was investigated in relation to multiple potential COCs at the site under a site characterization and assessment grant. No COCs were confirmed for the facility and the case was referred to another agency as of 8/21/1995.	Low	
SR14C-47	26	463	1000155657, S103340305, 1000409068	COMMUNITY RECYCLING / RES RECOVERY INC, SOUTHERN CALIFORNIA WASTE REDUCTION	9147 DE GARMO AVE, 9147 DE GARMO AVE	3142 ft (0.6 mi) NE	At-grade	CERCLIS NFRAP, CORRACTS, SWF/LF	SWF/LF (1000155657) - Facility is listed to be an active (permit date of 1997) limited volume transfer operation that accepts construction/demolition and other designated wastes with quarterly inspections. SWF/LF (S103340305) - Facility is listed as an active (permit date of 1998) large volume transfer/processing facility that accepts construction/demolition, industrial, mixed municipal waste. Inspections are reported to be performed on a monthly basis. CERCLIS-NFRAP/CORRACTS - Facility is listed to not qualify for NPL based on information updated in October 2013.	Low	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
SR14C-48	25	416	1011812530, S104809415	CONDORA CONSTRUCTION SERVICES	12506 MONTAGUE ST	570 ft (0.11 mi) WSW	Retained Cut / Trench	US BROWNFIELDS, SWF/LF	LF- Site is listed as a transfer and processing facility for construction/demolition, green waste, and household hazardous waste with a capacity of 21,000 cubic yards per day. Brownfields - Site was investigated under a Phase I ESA as part of a Brownfields Assessment Cooperative Agreement, impacted media was not reported.	Low	
SR14C-49	28	463	S105024700, S114605987, S114605986	CONROCK COMPANY	11401 TUXFORD ST	583 ft (0.11 mi) NE	Elevated / Aerial Structure	HIST Cortese, LUST, RGA LUST	HIST CORTESE/LUST (S105024700) - Facility is listed to have impacted soil with an unspecified COC. Site status is listed as "Completed - Case Closed" as of 10/7/1994.	Low	
SR14C-50	23	300	S105026143, S114606987, S102428394	COSMIC PLASTICS	12314 GLADSTONE AVE	1087 ft (0.21 mi) WNW	Tunnel	HIST Cortese, LUST, RGA LUST	HIST CORTESE/LUST (S105026143) - Facility is listed to have impacted soil with an aviation fuel due to a LUST. Site status is listed as "Completed - Case Closed" as of 4/22/1988.	Low	
SR14C-51	25	416	S101584556	COUNTY OF LA-FIRE DEPARTMENT	12605 OSBORNE ST	979 ft (0.19 mi) WSW	Tunnel	LUST	Site is listed as "Open - Site Assessment" as of 2014. Soil and soil vapor at the facility is listed to have been impacted with petroleum hydrocarbons and VOCs.	Med	
SR14C-52	26	463	S104567759, S112891096	CROWN DISPOSAL COMPANY INC, RECOLOGY LOS ANGELES	9189 DE GARMO AVE	3142 ft (0.6 mi) NE	At-grade	SWF/LF	SWF/LF (S104567759) - Facility is listed to be a closed waste hauling site. The type of waste accepted is not reported. LUST (S104567759) - The facility is reported to have impacted soil due to a LUST containing other solvents or non-petroleum hydrocarbons. The site status is listed as "Completed - Case Closed" as of 9/2/1997. A note in the LUST file (1000437523) notes that landfill gas has migrated beneath the site. SWF/LF (S112891096) - Facility is listed to be an active waste hauler/transfer and processing facility that accepts construction/demolition, green materials, trash, and non-hazardous industrial waste. ¹	Low	X
SR14C-53	14	216	U001567742, S117662667, S117661921, S105023065, 1011976958	CURTIS SAND & GRAVEL, SOLEDAD CANYON, LANG STATION	14320 SOLEDAD CANYON RD	2566 ft (0.49 mi) NW	At-grade Covered	US MINES, HIST Cortese, LUST, CA MINES	LUST (U001567742) - Facility is listed to have impacted soil with diesel fuel due to a LUST. Site status is listed as "Completed - Case Closed" as of 5/30/1996. MINES (S117662667) - Site is listed to be an idle sand and gravel open pit. Reclamation is reported to not have been started as of 2003. Mine is reported to be approximately 168 acres. MINES (S117661921) - Site is listed to be an idle sand and gravel streambed or gravel bar skimming and pitting mine. Reclamation is reported to not have been started as of 2011. Mine is reported to be approximately 185 acres.	Med	
SR14C-54	25	388	S114608777, S109117602	D & K MILK PALACE (BEACON)	11045 N GLENOAKS BLVD	235 ft (0.04 mi) WSW	Tunnel	LUST, RGA LUST	Facility is listed to have impacted soil with gasoline. Site is listed as "Case Closed" as of 1992.	Med	
SR14C-55	26	463	S116282717, S103441524	DE GARMO LANDFILL/DEGARMO	9135 DE GARMO AVE	3101 ft (0.59 mi) NE	At-grade	LDS,WMUDS/S WAT	Site is an "Open - Inactive" land disposal site. Specifics on methane mitigation in relation to the site were not provided.	Low	
SR14C-56	26	463	S103441512	DE GARMO PIT LANDFILL	11201 RANDALL ST	2936 ft (0.56 mi) NE	At-grade	SWF/LF	Site is listed as "Closed" for landfill operations and presently is used for commercial purposes. The facility is reported to have been part of the Solid Waste Assessment Test Program.	Low	
SR14C-57	28	490	1006816060	DIXON HARD CHROME INC	11645 PENDLETON ST	969 ft (0.18 mi) SW	At-grade	ENVIROSTOR	Facility is listed to have a site assessment screening in relation to potential impacts as a results of past use. NPL and restricted use is not reported. The case was referred to the USEPA with a status date of 9/8/2011.	Med	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
SR14C-58	26	433	S109442393, S106528956	EAST VALLEY DIVERSION, LOONEY BINS/EAST VALLEY DIVERSION	11616 SHELDON ST	3115 ft (0.59 mi) NE	At-grade	SWF/LF	Facility is a limited volume transfer/processing operation for construction/demolition and industrial non-hazardous wastes.	Low	
SR14C-59	26	455	1018119626	EL DORADO SITE	9444 N EL DORADO AVE	1040 ft (0.2 mi) SW	At-grade	US BROWNFIELDS	Site is listed to be part of a TBA Cooperative Agreement for potentially impacted properties. A Phase I ESA indicated cleanup is not required for the property. Unknown media was indicated to have been affected at the site.	Low	
SR14C-60	25-26	416	1011812534, S106102747	EXPRESS METAL RECYCLING	12207 BRANFORD ST	453 ft (0.09 mi) ENE	Retained Cut / Trench	US BROWNFIELDS, ENVIROSTOR	Site is listed to be part of a TBA Cooperative Agreement for potentially impacted properties. A Phase I ESA indicated cleanup is not required for the property.	Low	
SR14C-61	28	504	1000857356, 1014202338	EXPRESS PLATING DIV MASTERWORK, MONITOR POLISHING AND PLATING	8050 SAN FERNANDO RD	45 ft (0.01 mi) NE	Tunnel	CERCLIS NFRAP, ENVIROSTOR	ENVIROSTOR (1000857356) - Site listed to be "Inactive - Needs Evaluation" for potential impacts from unspecified COCs to an unspecified media. The site status date is listed to be 9/4/2014. CERCLIS-NFRAP (1014202338) - Facility is listed to not qualify for NPL based on information updated in October 2013.	High	
SR14C-62	25	370	S102429425, S114616106, S114616439	EXXON #7-3332	12786 VAN NUYS BLVD	1022 ft (0.19 mi) WSW	Tunnel	HIST Cortese, LUST, RGA LUST	Facility is listed to have impacted soil with gasoline. Site is listed as "Case Closed" as of 1994.	Low	
SR14C-63	25-26	416	S102796761	FOOTHILL AUTO ELECTRIC	12326 MONTAGUE ST	506 ft (0.1 mi) ENE	Tunnel	ENVIROSTOR	Site is listed to have been evaluated for NPL in 2013 for historic impacts and is reported to have been referred to the EPA. No COCs were specified for the facility.	Med	
SR14C-64	23-24	304	S114727864, S114727868	FOOTHILL WASTE RECLAMINATION INC	12221 LOPEZ CANYON RD	1952 ft (0.37 mi) ESE	Tunnel	RGA LF	Facility is listed to be a landfill related site in 2005 through 2009. No additional information was provided.	Med	
SR14C-65	26	416	S111120541	FORMER TURBO PRODUCTS	12177 MONTAGUE ST	1781 ft (0.34 mi) ENE	Tunnel	ENVIROSTOR	Site is listed to have been evaluated for NPL in 2013 and is reported to have been referred to the EPA. No COCs were specified for the facility.	Med	
SR14C-66	25	416	1000726516, S114623560, S114623570, S114623574	FORTIN INDUSTRIES #610, FORTIN INDUSTRIES INC	9880 SAN FERNANDO RD	959 ft (0.18 mi) WSW	Retained Cut / Trench	HIST Cortese, LUST, SLIC, RGA LUST	Facility is listed to have impacted groundwater (uses other than drinking water) with copper. Case is listed as "Completed - Case Closed" as of 1996.	Med	
SR14C-67	26	416	1011812539	GLENOAKS MOBILE MANOR	10471 GLENOAKS BLVD	2365 ft (0.45 mi) ENE	Tunnel	US BROWNFIELDS	Site is listed to be part of a TBA Cooperative Agreement for potentially impacted properties.	Low	
SR14C-68	25	396	S110493872	GOLDEN STATE MAGNETIC & PENETRANT LAB	12770 PIERCE ST, #7	1082 ft (0.2 mi) WSW	Tunnel	ENVIROSTOR	Site is listed to have been part of a tiered permit and is reported to have been referred to another agency. No COCs were specified for the facility.	Low	
SR14C-69	26-28	463	S105911516	GOODWIN CHEMICAL	9007 NORRIS	2145 ft (0.41 mi) NE	At-grade	SLIC	The facility is listed to have impacted soil with PCE due to storage at the site. Various phases of site assessment were completed from 1990 through 2001. The LARWQCB issued a notice of "No Further Action" on 12/14/2001.	Low	
SR14C-70	26	421	S103985140, S114633701, S114633704, 1000404171, S102628856,	H.R. TEXTRON, H.R. TEXTRON - GLENOAKS	10445 GLENOAKS BLVD	1996 ft (0.38 mi) ENE	Tunnel	CERCLIS NFRAP, HIST Cortese, LUST, SLIC, RGA LUST	HIST CORTESE/LUST (S103985140) - Facility is listed to have impacted soils with solvents due to a LUST at the site. Current case status is listed to be "Completed - Case Closed" as of 3/1/1996. SLIC (S103985140) - Facility was evaluated by the LARWQCB in relation to a chromium VI source assessment for impacts to an aquifer used for	Low	X

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
			S114633700, 1015732716, S105025438						drinking water the area (San Fernando Valley). Subsequently, a work plan was prepared for the site in 2004 to address concerns. The facility was determined to need "No Further Requirements" in relation to the investigation in 2004 and is listed as "Completed - Case Closed" as of 12/22/2014. LUST (1000404171) - Facility is listed to have impacted soil with waste/motor/hydraulic/lubricating oil. Site status is listed as "Completed - Case Closed" as of 3/22/2016. LUST (S102628856) - Facility is listed to have impacted soils with solvents. Site status is listed as "Case Closed" as of 3/1/1996. CERCLIS-NFRAP (1015732716) - Facility is listed to not qualify for NPL based on information updated in October 2013. ¹		
SR14C-71	23-24	333	S107736420	HANSEN FLOOD CON BAS/D		2116 ft (0.4 mi) ESE	Tunnel	ENVIROSTOR	Facility is listed as "Inactive - Needs Evaluation" as of 7/1/2005 as a military evaluation. No COCs were identified for the site.	Med	
SR14C-72	25	416	S108199262	HAULING SOLUTIONS INC	9871 SAN FERNANDO RD	1120 ft (0.21 mi) WSW	Retained Cut / Trench	SWF/LF	Facility is listed as active waste hauling business. Additional information not provided.	Low	
SR14C-73	28	586	S101586790	HENSLER GENERAL CONSTRUCTION	7550 WHEATLAND AVE	2003 ft (0.38 mi) SW	Tunnel	SLIC	The site is listed as Completed - Case Closed as of 12/22/2014 for VOC contamination that has impacted an aquifer used for drinking water supply.	Low	
SR14C-74	28	504	1017816849	HOLLIDAY ROCK CO	11420 PENROSE ST	1182 ft (0.22 mi) SW	Retained Cut / Trench	TRIS	Facility is listed to have notified the EPA under SARA Title III, Section 313. Lead compounds (three pounds per year) are reported to be produced at the site. In addition, the facility is listed in the EPA's index system in relation to release of toxic chemicals to air, water, land, or are transported off-site.	Low	
SR14C-75	26	416	S105628352	HR TEXTRON	12137 MONTAGUE ST	2167 ft (0.41 mi) ENE	Tunnel	ENVIROSTOR	Facility is listed to have been evaluated for impacts in relation to historical usage. No confirmed COCs are reported for the site. A status of "Inactive - Needs Evaluation" is reported as of 1/30/2001. ¹	Med	X
SR14C-76	26	463	1000428465	INDUSTRIAL BATTERY ENGINEERING	9121 DE GARMO AVE	3092 ft (0.59 mi) NE	At-grade	SLIC	Facility was evaluated by the LARWQCB in 2001 in relation to a chromium VI source assessment for the area. The facility was determined to need "No Further Requirements" in relation to the investigation in 2003 as is listed as "Completed - Case Closed" as of 12/22/2014.	Low	
SR14C-77	26	416	1011812541	INDUSTRIAL-BUSINESS PARK	12085 BRANFORD ST	1773 ft (0.34 mi) ENE	Retained Cut / Trench	US BROWNFIELDS	Site is listed to be part of a TBA Cooperative Agreement for potentially impacted properties. A Phase I ESA indicated cleanup is not required for the property.	Low	
SR14C-78	23	314	1008371158	J L SHEPHERD AND ASSOC	1010 ARROYO AVE	4067 ft (0.77 mi) WNW	Tunnel	MLTS	Facility was evaluated for the NPL in relation to a historical evaluation and determined not to be eligible as of 1/30/2001. Site restrictions are not reported for the facility. The site is currently listed as "Inactive - Needs Evaluation."	Low	
SR14C-79	26	416	S118504792, S108749114	JESSE'S PLATING (FORMER HVC)	12229 MONTAGUE ST	1332 ft (0.25 mi) ENE	Tunnel	SLIC, ENVIROSTOR	SLIC (S118504792) - Facility is listed to have impacted soil, soil vapor, and an aquifer used for drinking water supply with PCE, TCE, and chromium VI. Site status is listed to be "Open - Site Assessment" as of 2/11/2016. ENVIROSTOR (S108749114) - Facility is listed as "Inactive - Needs Evaluation" as of 9/8/2011. Past use of metal finishing/metal plating/metal plating - chrome is indicated for the facility and no COCs are specified for the site.	Med	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
SR14C-80	6	140	S114637448, S102431920	JILL R RATCLIFFE	36200 SIERRA HWY, N, SIERRA HWY	1464 ft (0.28 mi) ESE	At-grade	HIST Cortese, LUST, RGA LUST	A LUST containing gasoline is reported to have impacted surrounding soil. Case closed in 1991.	Low	
SR14C-81	26	463	S106102586	KC NISSAN AUTO DISMANTLING	10967 TUXFORD ST	4334 ft (0.82 mi) NE	At-grade	SLIC	Facility was evaluated by the LARWQCB in 2001 in relation to a chromium VI source assessment for the area. The facility was determined to need "No Further Requirements" in relation to the investigation in 2003 and is listed as "Completed - Case Closed" as of 11/29/2012.	Low	
SR14C-82	28	463	S103674790	KENWALT DIE CASTING CO	8719 BRADLEY AVE	1357 ft (0.26 mi) NE	Retained Cut / Trench	SLIC	Facility was evaluated by the LARWQCB in 2001 in relation to a chromium VI source assessment for the area. The facility was determined to need "No Further Requirements" in relation to the investigation in 2003 and is listed as "Completed - Case Closed" as of 12/22/2014.	Low	
SR14C-83	26	459	S112186489	LA CITY DWP PENDLETON (PENDLETON STREET LANDFILL)	11000 PENDLETON ST	5115 ft (0.97 mi) NE	At-grade	LDS	Facility is listed as a land disposal site with status of "Completed - Case Closed" as of 2012. However, VOC and solvent concentrations were reported during groundwater monitoring at the facility with flow migration toward the south.	Low	
SR14C-84	21	242	S103891221	LA CO FD CAMP #9	21521 SAND CANYON RD	2499 ft (0.47 mi) ENE	Tunnel	LUST	Facility is listed to have impacted soils with other solvents or non-petroleum hydrocarbons due to a LUST. The site status is reported as "Completed - Case Closed" as of 3/10/1998.	Low	
SR14C-85	18	239	S109548241	LA DEF AREA HOUS SITE		2449 ft (0.46 mi) WNW	Tunnel	ENVIROSTOR	Facility was evaluated for the NPL in relation to a military evaluation and determined not to be eligible as of 7/1/2005. Site restrictions are not reported for the facility. The site is currently listed as "Inactive - Needs Evaluation."	Med	
SR14C-86	26	433	S101588330, 1001491848	LA DEPARTMENT OF WATER/POWER, TRUESDALE CENTER	11791 TRUESDALE CENTER	3491 ft (0.66 mi) NE	At-grade	CERCLIS NFRAP, VCP	VCP/ENVIROSTOR - Facility is reported to have entered a voluntary cleanup agreement in 2000 due to PCB, TPH-d, and TPH-g impacts to soil as a result of use as an electrical generation/substation. Current site status is listed as "Active."	Low	
SR14C-87	28	504	S106484855	LADO MFG CO	11400 LUDDINGTON ST, #A	448 ft (0.08 mi) SW	Retained Cut / Trench	SLIC	Facility was evaluated by the LARWQCB in 2001 in relation to a chromium VI source assessment for the area. The facility was determined to need "No Further Requirements" in relation to the investigation in 2014 as is listed as "Completed - Case Closed."	Low	
SR14C-88	14	219	S117661920	LANG STATION - SWEETWATER	14212 LANG STATION RD	2112 ft (0.4 mi) NW	At-grade Covered	CA MINES	Facility is listed as an open pit, plant, or mill sand and gravel mine. Mine status listed as "Closed, No Intent to Resume" as of 2014. The mine is listed to be 22.8 acres in size.	Med	
SR14C-89	26	416	U001567439, S114728243, S109821476, S111075979	LEDGER LANDFILL, GLENOAKS DUMP, LEDGER #2	10403 GLENOAKS BLVD	2486 ft (0.47 mi) ENE	Tunnel	SWF/LF, ENVIROSTOR, RGA LF	ENVIROSTOR (U001567439) - Facility was evaluated for the NPL and determined not to be eligible as of 1/22/2001. Site status is listed to be "Inactive - Needs Evaluation." SWF/LF (S111075979) - Facility is listed to be a closed landfill that accepted commercial, inert, liquid, and residential waste. Current use is reported to be commercial properties and a parking lot.	Med	
SR14C-90	26	416	S116282712, S103441358	LEDGER NO. 2	GLENOAKS BLVD & MONTAGUE ST	2534 ft (0.48 mi) ENE	Tunnel	LDS, WMUDS/S WAT	Facility is listed to be a land disposal site with a status of "Open - Inactive" as of 12/24/2013. Limited additional information was provided.	Med	
SR14C-91	25	416	S109821545	LEWIS VISCO - VALLEY IRON & METAL COMPAN	9050 AND 9116 BRADLEY AVE	261 ft (0.05 mi) WSW	Tunnel	SWF/LF	Facility is listed to be a SWF/LF site with limited additional information reported.	High	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
SR14C-92	26	433	1017817032	LEX PRODUCTS WEST	11847 SHELDON ST	767 ft (0.15 mi) NE	Elevated / Aerial Structure	TRIS	Facility is listed to have notified the EPA under SARA Title III, Section 313. Copper (up to 7,552 pounds per year) are reported to be produced at the site and subject to waste broker disposal. In addition, the facility is listed in the EPA's index system in relation to release of toxic chemicals to air, water, land, or off-site transport.	Med	
SR14C-93	28	463	S116282735	LIVINGSTON - GRAHAM SUN VALLEY SANITARY LANDFILL	ADJACENT TO BRADLEY WEST	82 ft (0.02 mi) SW	At-grade	LDS	Facility is listed as a land disposal site with status of "Open - Inactive" as of 2013. The landfill is comingled with the Bradley West landfill and is reported to have continual groundwater and methane monitoring performed in relation to operations.	High	
SR14C-94	26	467	S114644511, S114644510, 1000591737, S114644509	LIVINGSTON GRAHAM BLUE DIAMOND	11720 WICKES ST	450 ft (0.09 mi) NE	At-grade	HIST Cortese, LUST, RGA LUST	HIST CORTESE/LUST (1000591737) - Facility is listed to have impacted soil with aviation fuel due to a LUST. Site status is reported to be "Completed - Case Closed" as of 11/13/1997.	Med	
SR14C-95	26	433	1014202344	LNL ANODIZING	9900 GLENOAKS BLVD, #3	3478 ft (0.66 mi) NE	At-grade	CERCLIS NFRAP	Facility is reported to have been investigated in relation to the San Fernando Valley Superfund Site. The site was determined to not qualify for the NPL based on information provided as of 2010.	Low	
SR14C-96	28	490	S106484456	LOCKHEED A-1, B85, LOTS 16, 16A	3220 W THORTON	648 ft (0.12 mi) SW	At-grade	SLIC	Site is listed as "Open - Site Assessment" as of 1990. An aquifer used for drinking water supply beneath the facility is listed to have been impacted by chromium and VOCs. ¹	Med	X
SR14C-97	28	561	S114644699, S102432702	LOCKHEED PLANT B-6-F	7575 SAN FERNANDO RD N	257 ft (0.05 mi) SW	Tunnel	LUST, RGA LUST	Facility is listed to have impacted an aquifer used for drinking water supply with diesel fuel. Current site status is listed as "Completed - Case Closed" as of 1/1/1996.	High	
SR14C-98	26	433	S111075989	LOONEY BINS/SPACCARELLI HAULING	11616 1/2 SHELDON ST	3114 ft (0.59 mi) NE	At-grade	SWF/LF	Facility is listed as an active waste hauler. Limited additional information is provided.	Low	
SR14C-99	23	290	S107736633	LOPEZ FLOOD CONTROL BASIN		661 ft (0.13 mi) WNW	Tunnel	ENVIROSTOR	Facility was evaluated for the NPL in relation to a military evaluation and determined not to be eligible as of 7/1/2005. Site restrictions are not reported for the facility. The site is currently listed as "Inactive - Needs Evaluation."	Med	
SR14C-100	14	213	1000360639, S101480692, 1006494653	LUBRICATION COMPANY OF AMERICA	12500 LANG STATION RD	1315 ft (0.25 mi) NW	At-grade Covered	CERCLIS NFRAP, CORRACTS, RCRA-TSDF, HIST Cal-Sites, Cortese, HIST Cortese, ENVIROSTOR, RESPONSE, CA Bond Exp. Plan	CERCLIS - NFRAP (1000360639) - Site assessed for contamination in 2010 and is listed as NFRAP due to not qualifying for the NPL based on existing information. HIST CORTESE/CORTESE (S101480692) - Facility is listed to be an active State Response site with a status date of 2/14/2012. RESPONSE/ENVIROSTOR (S101480692) - Facility is listed to be an active State Response facility with numerous confirmed COCs (PCBs, PAHs, VOCs, PCE, TCE, TPH, BTEX) to soil, soil vapor, and groundwater used from other uses from prior use as a used oil recycling facility. Cleanup is reported to still be in progress and include prior removal of 358 drums of hazardous waste in 1990, 19 hazardous waste tanks and 55,250 gallons of liquid/sludge and solid hazardous waste in 1992, 150 ASTs, 1,400 tons of solid hazardous waste and 83,000 gallons of liquid hazardous waste in 2002, and removal of numerous other hazardous waste materials to date. Remediation is ongoing at the facility. HIST Cal-Sites (1006494653) - Facility is listed to be an active site in relation to	Med	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
									historic usage of the site as a waste oil recycling facility as well as an oil refinery.		
SR14C-101	28	586	S113003727	LYN-TRON INC	3150 N DAMON WAY	2502 ft (0.47 mi) SW	Tunnel	SLIC	Facility is reported to have been investigated in relation to the San Fernando Valley Superfund Site due to manufacturing of metal and non-metal fasteners used in relation to the aerospace industry. Environmental assessment of the site was performed in 2013 in relation to a LARWQCB Order. The assessment concluded that no chromium and or other VOCs were used at the Site. A notice of "No Further Requirements" was issued in respect to soils only in 2013. The site status is listed as "Completed - Case Closed" as of 12/16/2013.	Low	
SR14C-102	25-26	384	S107736650	MACLAY ES ADDTION, SITE 1 5640040	11071 BORDEN AVE	1327 ft (0.25 mi) ENE	Tunnel	ENVIROSTOR	Facility was evaluated for the NPL in relation to a school evaluation and determined not to be eligible as of 10/2/2006. Site restrictions are not reported for the facility. The site is currently listed as "No Further Action."	Low	
SR14C-103	25-26	384	S105754243	MACLAY NEW PRIMARY CENTER	11035, 11063 & 11051 BORDEN AVE	1409 ft (0.27 mi) ENE	Tunnel	ENVIROSTOR	Facility was evaluated for the NPL in relation to a school evaluation and determined not to be eligible as of 10/6/2003. Site restrictions and confirmed COCs are not reported for the facility. The site is currently listed as "No Further Action."	Low	
SR14C-104	28	504	S105026814, S114647195, U001567798, S104160057	MANNING FUEL INC, CEE JAY MACHINE	8407 TUJUNGA AVE, 8407 TUJUNGA	1062 ft (0.2 mi) SW	Retained Cut / Trench	HIST Cortese, LUST, RGA LUST	LUST (U001567798) - Facility is listed to have impacted soil with aviation fuel as a result of a LUST. Site status is listed as "Completed - Case Closed" as of 2/27/1996. LUST (S104160057) - Facility is listed to have impacted soils with an unspecified COC. Site status is listed as "Case Closed" as of 2/27/1996.	Low	
SR14C-105	26	416	S118504711	MAYONI ENTERPRISES INC	10340 GLENOAKS BLVD	2538 ft (0.48 mi) ENE, groundwater gradient not reported but anticipated to be to south, southeast in relation to regional flow	Tunnel	SLIC	Facility is listed to have impacted an aquifer used for drinking water, soil, and soil vapor with 1,1,1-TCA, 1,4-dioxane, and PCE. Site status is currently listed as "Open - Site Assessment" as of 12/16/2015.	Med	
SR14C-106	25	454	S106484866, 1011961419	MILES CHEMICAL COMPANY INC	12801 RANGOON ST	4631 ft (0.88 mi) SW	At-grade	CERCLIS NFRAP, SLIC	SLIC (S106484866) - Facility was evaluated by the LARWQCB in 2004 in relation to a chromium VI source assessment for potential impacts to an aquifer used for drinking water in the area. The facility was determined to need "No Further Requirements" in relation to the investigation in 2004 as is listed as "Completed - Case Closed" as of 7/15/2004. ENVIROSTOR (S106484866) - Facility is listed to be evaluated for impacted due to historic use of the site as a transfer station or transportation - warehouse. Soil and soil vapor are listed as potential impacted media. Site status is listed as "No Further Action" as of 6/15/2011. CERCLIS-NFRAP (1011961419) - Facility is listed to not qualify for the NPL based on existing information.	Low	
SR14C-107	23-24	340	S109548322	MILLER STEPHENSON CHEMICAL CO	12261 FOOTHILL BLVD	1294 ft (0.25 mi) ESE	Tunnel	ENVIROSTOR	Facility is listed to have been evaluated for impacts in relation to potential soil and soil vapor. No confirmed COC are reported for the site. A status of "No Further Action" is reported as of 9/8/2011.	Low	
SR14C-108	23-24	317	S113096047, S102360706, S107144883,	MM LOPEZ ENERGY LLC, LA CITY, BUREAU OF SANITATION, LOPEZ	11950 LOPEZ CANYON RD	1862 ft (0.35 mi) ESE, groundwater flow to the south-southwest	Tunnel	SWF/LF, LDS,WMUDS/S WAT	SWF/LF (S113096047) - Facility is reported to be an active chipping and grinding operation for green materials. SWF/LF (S102360706) - Facility is reported to be a closed (closure date 6/30/1996) solid waste landfill that	Med	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
			S106528955, S109286180, S103866717	CANYON LANDFILL, LOPEZ CANYON ENVIRONMENTAL CENTER					accepted mixed municipal waste. Quarterly inspections are reported. SWF/LF (S107144883) - Facility is listed to be a closed class III landfill (closed 7/1/1996) consisting of approximately 166 acres. The landfill is listed to still be producing methane as a result of prior use, however, the facility is a landfill gas to energy project that utilized the methane for energy production for residences in the area. Methane extraction in relation to energy production continues to be performed at the site today and an active SWF/LF composting operation (S106528955) for green waste is also present. LDS (S109286180) - Facility is listed to be "Open - Verification Monitoring" in relation to groundwater, soil, and soil vapor impacts from previous use of the property as a land disposal site.		
SR14C-109	25-26	416	S111120538	MOC PRODUCTS	12306-12308 MONTAGUE ST	651 ft (0.12 mi) ENE	Tunnel	ENVIROSTOR	Facility is listed to have been evaluated for impacts. No confirmed COCs are reported for the site. A status of "Refer: EPA" is reported as of 6/27/2013.	Med	
SR14C-110	25-26	416	1000128768, S114655820, S114655821	MOC PRODUCTS COMPANY INC	12306 MONTAGUE ST	651 ft (0.12 mi) ENE	Tunnel	TRIS, HIST Cortese, LUST, RGA LUST	TRIS (1000128768) - Facility has multiple listings under that database. A LUST is reported to have impacted soil with aviation fuel. Site status is reported to be "Completed - Case Closed" as of 4/28/1997. Facility is listed to have notified EPA under SARA Title II, Section 313. N-methyl-2-pyrrolidone is reported to be used/produced on the site. Toluene, C.I. food red 15, methanol, ethylbenzene, certain glycol ethers, zinc compounds, PAHs, xylene (mixed isomers) and ethylene glycol are also reported to be used/produced at the facility. The site is also reported to be in multiple other databases.	Low	
SR14C-111	25-26	416	1011812545	MOC THE PROFESSIONAL CHOICE	12307 MONTAGUE ST	618 ft (0.12 mi) ENE	Tunnel	US BROWNFIELDS	Site is listed to be part of a TBA Cooperative Agreement for potentially impacted properties. A Phase I ESA indicated cleanup is reported for the property.	Low	
SR14C-112	26	451	U001567802, S114656201, S104160058, S114656202	MONARCH RECORD MFG CORP INC	9545 SAN FERNANDO RD	418 ft (0.08 mi) SW	At-grade	HIST Cortese, LUST, RGA LUST	HIST CORTESE/LUST (U001567802) - Facility is listed to have impacted soil with gasoline due to a LUST. Site status is listed as "Completed - Case Closed" as of 4/30/1987. LUST (S104160058) - Same information as provided above.	Low	
SR14C-113	23	253	S103978520	MOUNTAIN VIEW GATED VILLAS	12831 HUBBARD ST	2601 ft (0.49 mi) WNW	Tunnel	VCP, ENVIROSTOR	Facility is reported to be part of the VCP program with a status of "No Further Action" as of 4/19/2000 due to illegal dumping and medical related incineration. Soil was confirmed to be impacted with copper and compounds, furans, and arsenic dioxin.	Low	
SR14C-114	26-28	463	1008381793	NATIONAL READY MIX CONCRETE CO	9010 NORRIS AVE	2193 ft (0.42 mi) NE	At-grade	TRIS	Facility is listed to have notified the EPA under SARA Title III, Section 313. Lead compounds (up to 7.1 pounds per year) are reported to be produced at the site.	Low	
SR14C-115	26	416	1011812546	NEWHALL JUNK & SALVAGE RECYCLERS	12011 BRANFORD ST	2422 ft (0.46 mi) ENE	Retained Cut / Trench	US BROWNFIELDS	Facility is listed to have had a Phase I ESA performed in relation to assessment of the site. The Phase I ESA was performed under an US-EPA Brownfields Assessment Cooperative Agreement. Results of the Phase I ESA were not reported.	Low	
SR14C-116	14	222	S107736890	NIKE BATTERY - LANG STATION		45 ft (0.01 mi) NW	At-grade Covered	ENVIROSTOR	Facility was evaluated for the NPL in relation to a military evaluation and determined not to be eligible as of 7/1/2005. Site restrictions and confirmed COCs are not reported for the facility. The site is currently listed	High	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
									as "Inactive - Needs Further Evaluation." Historical information indicates that the "Nike" facilities were previously used as Minute Man missile launch installations in the 1950s to 1960s. It is reported that nuclear missiles were stored, assembled, fueled, and armed in a fortified bunker (battery) in a subterranean bunker.		
SR14C-117	20	244	S109548330	NIKE BTRY - LOS PINETOS		1977 ft (0.37 mi) WSW	Tunnel	ENVIROSTOR	Facility was evaluated for the NPL in relation to a military evaluation and determined not to be eligible as of 7/1/2005. Site restrictions and confirmed COCs are not reported for the facility. The site is currently listed as "Inactive - Needs Further Evaluation." Historical information indicates that the "Nike" facilities were previously used as Minute Man missile launch installations in the 1950s to 1960s. It is reported that nuclear missiles were stored, assembled, fueled, and armed in a fortified bunker (battery) in a subterranean bunker.	Med	
SR14C-118	8-15	201	S109548329	NIKE BTRY - MAGIC MT		2232 ft (0.42 mi) NNW	At-grade	ENVIROSTOR	Facility was evaluated for the NPL in relation to a military evaluation and determined not to be eligible as of 7/1/2005. Site restrictions and confirmed COCs are not reported for the facility. The site is currently listed as "Inactive - Needs Further Evaluation." Historical information indicates that the "Nike" facilities were previously used as Minute Man missile launch installations in the 1950s to 1960s. It is reported that nuclear missiles were stored, assembled, fueled, and armed in a fortified bunker (battery) in a subterranean bunker.	Med	
SR14C-119	26	416	1011812547	NUMBER 1 ELECTRIC	12051 BRANFORD ST	2093 ft (0.4 mi) ENE	Retained Cut / Trench	US BROWNFIELDS	Facility is listed to have had a Phase I ESA performed in relation to assessment of the site. The Phase I ESA was performed under an US-EPA Brownfields Assessment Cooperative Agreement. Results of the Phase I ESA were not reported.	Low	
SR14C-120	28	525	S106484857	OCCUPANT-AUTO SHOP	8431 TELFAIR AVE	1685 ft (0.32 mi) SW	Retained Cut / Trench	SLIC	Facility was evaluated by the LARWQCB in 2001 in relation to a chromium VI source assessment for the area. The facility was determined to need "No Further Requirements" in relation to the investigation in 2014 as is listed as "Completed - Case Closed."	Low	
SR14C-121	25	364	1018119710	ORNELAS SITE	11340 N GLENOAKS BLVD	2010 ft (0.38 mi) WNW	Tunnel	US BROWNFIELDS	Facility is listed to have had a Phase I ESA performed in relation to assessment of the site. The Phase I ESA was performed under an US-EPA Brownfields Assessment Cooperative Agreement. Results of the Phase I ESA were not reported.	Low	
SR14C-122	10	176	S114665723, S101295489, S114665724	PACIFIC BELL	3013 SIERRA HWY W	1999 ft (0.38 mi) SSW	Tunnel	HIST Cortese, LUST, RGA LUST	HIST CORTESE/LUST (S101295489) - Facility is listed to have impacted soil with diesel fuel due to a LUST. Site status is listed as "Completed - Case Closed" as of 5/20/1991.	Low	
SR14C-123	28	504	S110060769, S114666067, S106517286, S114666066	PACIFIC ENERGY	8309 TUJUNGA AVE	1232 ft (0.23 mi) SW	Retained Cut / Trench	HIST Cortese, LUST, RGA LUST	HIST CORTESE/LUST (S110060769) - Facility is listed to have impacted soil with aviation fuel due to a LUST. Site status is listed as "Completed - Case Closed" as of 10/6/1997.	Low	
SR14C-124	26	416	1016170548, 1000252793	PACIFIC PLATING	12113 BRANFORD ST	1444 ft (0.27 mi) ENE	Retained Cut / Trench	CERCLIS NFRAP, ENVIROSTOR	CERCLIS-NFRAP (1016170548) - Site was assessed for contamination in 2013 and is listed as NFRAP due to not qualifying for the NPL based on existing information. ENVIROSTOR (1000252793) - Facility is listed to be part of a Tiered Permit with a status of "Refer: Other Agency."	Med	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
									Furthermore, the site is listed as "Inactive - Action Required" with a status date of 9/8/2011.		
SR14C-125	20	241	1003878409	PARKER AIRCRAFT CO	25977A SAND CYN	4082 ft (0.77 mi) WNW	Tunnel	CERCLIS NFRAP	Site assessed for contamination in 2003 and is listed as NFRAP due to not qualifying for the NPL based on existing information.	Low	
SR14C-126	26	416	1000229142, 1012043061	PB FIBERGLASS PRODUCTS INC	12177 BRANFORD ST	856 ft (0.16 mi) ENE	Retained Cut / Trench	CERCLIS NFRAP, ENVIROSTOR	ENVIROSTOR (1000229142) - Facility was evaluated for the NPL and determined not to be eligible as of 9/5/2014. Site status is listed to be "Inactive - Needs Evaluation." Numerous PAH compounds are listed as confirmed COCs for the site to soil. CERCLIS-NFRAP (1012043061) - Site was assessed for contamination in 2013 and is listed as NFRAP due to not qualifying for the NPL based on existing information.	Med	
SR14C-127	26	463	1006932050	PDQ AUTO SALVAGE	10975 TUXFORD ST	4250 ft (0.8 mi) NE	At-grade	CERCLIS NFRAP, LEAD SMELTERS	Site assessed for contamination in 1979 through 1982 and is listed as NFRAP due to not qualifying for the NPL based on existing information.	Low	
SR14C-128	26	463	S109821518, S108432318	PENDLETON STREET DUMP	11050 PENDLETON ST	3673 ft (0.7 mi) NE	At-grade	SWF/LF	SWF/LF (S108432318) - Facility is listed to be a closed solid waste landfill facility. Limited additional information was provided for site. SWF/LF (S109821518) - Facility is listed to be an active limited volume transfer/processing operation for metal, mixed municipal, tire, passenger, and wood waste.	Low	
SR14C-129	28	463	S109117694	PENHALL COMPANY	11182 W PENROSE AVE	959 ft (0.18 mi) NE	Retained Cut / Trench	LUST	Soil is reported to have been impacted from a LUST of diesel fuel at the facility. Current status listed as "Completed - Case Closed" as of 2012.	Low	
SR14C-130	28	504	S102360907	PENROSE PIT	8251 - 8301 TUJUNGA AVE	1354 ft (0.26 mi) SW	Retained Cut / Trench	SWF/LF	Site is listed as a closed solid waste disposal facility for residential/industrial/commercial waste. Facility was closed in 1987.	Med	
SR14C-131	28	504	S109287258, 1001115478	PENROSE SANITARY LANDFILL, PENROSE LANDFILL GAS CONVERSION LLC	8301 TUJUNGA AVE	1367 ft (0.26 mi) SW	Retained Cut / Trench	CERCLIS NFRAP, SLIC, LDS, ENVIROSTOR	An aquifer used for drinking water supply is reported to have been impacted from a LUST of diesel fuel at the facility. Current status listed as "Completed - Case Closed" as of 2012.	Low	
SR14C-132	28	561	1000415250	PHOTO CHEM ETCH CORP	7710 SAN FERNANDO RD	30 ft (0.01 mi) SW	Tunnel	SLIC, ENVIROSTOR	The site is listed as "Completed - Case Closed" as of 12/22/2014 for VOC contamination that has impacted an aquifer used for drinking water supply.	Low	
SR14C-133	25-26	416	874580, 93328129, 1011812550	PMC		126 ft (0.02 mi) ENE	Retained Cut / Trench	ERNS, US BROWNFIELDS	ERNS (874580) - Facility is reported to have a release to soil. In 1987, a truck had a fuel tank plug knocked out when it ran over a steel plate in the road resulting in 100 gallons of diesel fuel being spilled. The fire department responded to the scene and cleanup is not planned in relation to the spill. ERNS (93328129) - Facility is reported to have an emergency release to the soil. In 1993, a sight glass on a storage tank broke resulting in 25,000 pounds of trichlorofluoromethane being spilled to surrounding soil and the atmosphere. BROWNFIELD (1011812550) - Facility is listed to have had a Phase I ESA performed in relation to assessment of the site. The Phase I ESA was performed under an US-EPA Brownfields Assessment Cooperative Agreement. Results of the Phase I ESA were not reported.	High	
SR14C-134	26	416	1011812551	PRE-FAB GRANITE COUNTERTOPS	12065 BRANFORD ST	1962 ft (0.37 mi) ENE	Retained Cut / Trench	US BROWNFIELDS	Facility is listed to have had a Phase I ESA performed in relation to assessment of the site. The Phase I ESA was performed under an US-	Low	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
									EPA Brownfields Assessment Cooperative Agreement. Results of the Phase I ESA were not reported.		
SR14C-135	28	504	1017428034, 1000297142	PRIME PLATING INC	11321 GOSS ST	797 ft (0.15 mi) SW	Retained Cut / Trench	TRIS, SLIC	SLIC - An aquifer used for drinking water supply is reported to have been impacted from chromium and VOCs. Current status listed as "Completed - Case Closed" as of 1997. TRIS - The facility is listed to use toxic chemicals (cyanide/lead/nitrate compounds) which are reported to be transported offsite for disposal.	Med	
SR14C-136	26	433	1016112148	QEP INC	11912 SHELDON ST	289 ft (0.05 mi) NE	Elevated / Aerial Structure	TRIS	Facility is listed to have notified the EPA under SARA Title III, Section 313. Styrene is reported to be released to the air.	Med	
SR14C-137	26	416	S110494226	QUALITY FINISHING INC	12109 BRANFORD ST, SUITE D2 & D4-D6	1543 ft (0.29 mi) ENE	Retained Cut / Trench	ENVIROSTOR	Facility is listed to be part of a tiered permit and referred to another agency. Site is not subject to the NPL or land use restrictions.	Low	
SR14C-138	26	416	1011812553	QUALITY USED AUTO PARTS	12055 A BRANFORD ST	1922 ft (0.36 mi) ENE	Retained Cut / Trench	US BROWNFIELDS	Facility is listed to have had a Phase I ESA performed in relation to assessment of the site. The Phase I ESA was performed under an US-EPA Brownfields Assessment Cooperative Agreement. Results of the Phase I ESA were not reported.	Low	
SR14C-139	28	504	1001217364	R L ANODIZING	11331 PENROSE ST	542 ft (0.1 mi) SW	Retained Cut / Trench	ENVIROSTOR	Facility was evaluated in 2012. Site is listed to not be NPL eligible and not have land restrictions. A status of "No Further Action" was issued on 7/9/2013.	Low	
SR14C-140	14	207	1011125816	RASMUSSEN R&R INC		5183 ft (0.98 mi) NW	Tunnel	US MINES	Facility is listed to be an active non-coal mining operation. Twelve violations of unknown nature were issued for the facility between 2009 and 2015.	Low	
SR14C-141	14	220	S117662420	RASMUSSEN SOLEDAD ROCK QUARRY	12000 SOLEDAD CYN. RD	4462 ft (0.85 mi) SE	At-grade	CA MINES	Facility is listed to be an active sand and gravel quarry mine. Reclamation is report to be in progress as of 2014.	Low	
SR14C-142	26-28	463	1014202571	RECYCLED BASE MATERIALS INC		2320 ft (0.44 mi) NE	At-grade	US MINES	Facility is listed as an abandoned non-coal mining operation as of 2010.	Med	
SR14C-143	10	164	1015768452	RED ROVER MINE 2 LLC		914 ft (0.17 mi) SSE	At-grade	US MINES	Facility is listed to be an abandoned non-coal mining operation. Twenty violations of unknown nature were issued for the facility between 2012 and 2013.	High	
SR14C-144	25-26	416	S111076059, 1006932051, S117038718	REDUCE PRICE DISPOSAL, BRANFORD AUTO WRECKING	12276 BRANFORD ST	29 ft (0.01 mi) ENE	Retained Cut / Trench	CERCLIS NFRAP, LEAD SMELTERS, SWF/LF, ENVIROSTOR	SWF/LF (S111076059) - Facility is listed as an active waste hauler. CERCLIS-NFRAP (1006932051) - Site was assessed for contamination in 2013 and is listed as NFRAP due to not qualifying for the NPL based on existing information. LEAD SMELTER (1006932051) - Facility is listed to not be on the NPL with a primary site function of recycling. ENVIROSTOR (S117038718) Facility is listed to be evaluated for impacts. Site status is listed as "Inactive - Needs Evaluation" as of 8/31/2014.	High	
SR14C-145	25	416	S118504837, 1011812525	REYNOLDS PRINTASIGN (FORMER), CADILLAC KING AUTO DISMANTLING	9830 SAN FERNANDO RD	837 ft (0.16 mi) WSW	Retained Cut / Trench	US BROWNFIELDS, SLIC	SLIC (S118504837) - Facility is listed to have operated from 1955 through 1989, manufacturing equipment for making signs. The operations involved the use and storage of VOCs, including TCE and 1,1,1-TCA. Site usage and storage is reported to have impacted the subsurface. Site status is listed as "Open - Site Assessment" as of 3/23/2016. BROWNFIELDS (1011812525) - Facility is listed to have had a Phase I ESA performed in relation to assessment of the site. The Phase I ESA was performed under	Med	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
									an US-EPA Brownfields Assessment Cooperative Agreement. Results of the Phase I ESA were not reported.		
SR14C-146	26	472	S102808013	RICHARD E BYRD HIGH SCHOOL	9171 TELFAIR AVE	1589 ft (0.3 mi) SW	At-grade	ENVIROSTOR	Facility was evaluated for the NPL in relation to a school evaluation and determined not to be eligible as of 11/4/2011. Site restrictions are not reported for the facility. The site is currently listed as "No Further Action."	Low	
SR14C-147	25-26	416	S104572887, S114677632, S104160034, 2002033528, S114677633	ROADWAY EXPRESS INC	12355 MONTAGUE ST	142 ft (0.03 mi) ENE	Tunnel	HMIRS, HIST Cortese, LUST, RGA LUST	HIST CORTESE/LUST (S104572887/S104160034) - Facility is listed to have impacted an aquifer used for drinking water supply with gasoline due to a LUST. Site status is reported to be "Completed - Case Closed" as of 9/4/1996. HMIRS (2002033528) - Release of approximately 5.5-gallons of nitric oxide compressed gas is reported as a result of a damaged cylinder in 2002. The fire department is reported to have responded and emptied the remaining product from the cylinder.	High	
SR14C-148	26	463	1003879001	ROIC/SUN VALLEY	9068 DE GARMO AVE	3114 ft (0.59 mi) NE	At-grade	CERCLIS NFRAP, LIENS 2, PRP	CERCLIS-NFRAP - Site is listed as "removal only site (no site assessment work needed)." A lien was recorded against the property on 9/30/1987.	Low	
SR14C-149	26	416	1011812556	ROSS BAKER TOWING INC	12025 BRANFORD ST	2307 ft (0.44 mi) ENE	Retained Cut / Trench	US BROWNFIELDS	Facility is listed to have had a Phase I ESA performed in relation to assessment of the site. The Phase I ESA was performed under an US-EPA Brownfields Assessment Cooperative Agreement. Results of the Phase I ESA were not reported.	Low	
SR14C-150	23-24	309	1003878824	RUSSELL MOE DUMP	12021 N LOPEZ CANYON RD	1777 ft (0.34 mi) ESE	Tunnel	CERCLIS NFRAP	Facility is listed to have been evaluated and not qualify for the NPL based on existing information provided on 12/1/1987.	Low	
SR14C-151	23-24	309	S101612993	RUSSELL MOE LANDFILL	12089 LOPEZ CANYON RD	1913 ft (0.36 mi) ESE	Tunnel	SWF/LF, LDS,WMUDS/S WAT	Facility is listed to be an unpermitted solid waste disposal site with quarterly inspections. Site is listed to have been closed on 12/31/1964.	Med	
SR14C-152	28	534	S116497300	SA RECYCLING LLC	8270 TUJUNGA AVE	1077 ft (0.2 mi) SW	Retained Cut / Trench	SWF/LF	Facility is listed to be a medium volume transfer/processing facility for mixed municipal waste with a permit date of 2014.	Low	
SR14C-153	26	433	1018119624	SAN FERNANDO SITE	9319-9325 N SAN FERNANDO RD	164 ft (0.03 mi) SW	At-grade	US BROWNFIELDS	Facility is listed to have had a Phase I ESA performed in relation to assessment of the site. The Phase I ESA was performed under an US-EPA Brownfields Assessment Cooperative Agreement. A petroleum related industry is reported to be located within close proximity of the property and potentially contributed to contamination at the site. Results of the Phase I ESA were not reported.	High	
SR14C-154	25-26	416	1000119933	SDS INDUSTRIES INC	10241 NORRIS AVE	506 ft (0.1 mi) ENE	Tunnel	SLIC	Facility is listed to have been reevaluated by the LARWQCB in 1997 in relation to impacts to the San Fernando Valley NPL site. A notice of "No Further Requirements" was issued on 1/30/1997 and site status is listed as "Completed Case Closed."	Low	
SR14C-155	25-26	416	S116497299	SEGOVIA ROLL-OFF	12215 BRANFORD ST	307 ft (0.06 mi) ENE	Retained Cut / Trench	SWF/LF	Facility is listed to be an active limited volume transfer operation for construction/demolition, green materials, and mixed municipal wastes with quarterly inspections. The permit status is listed to have been updated on 3/6/2014.	Med	
SR14C-156	26	435	S117662604	SHELDON	11401 W TUXFORD ST	5087 ft (0.96 mi) NE	At-grade	CA MINES	Facility is listed as an active open pit sand and gravel mining operation as of 2014. Reclamation is reported to be in progress.	Low	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
SR14C-157	6	128	S102437520, S114660362, S114690985, S114690913, S114690983	SIERRA HWY & AVE S, NETAL INC	37205 SIERRA HWY	38 ft (0.01 mi) ENE	At-grade	HIST Cortese, LUST, RGA LUST	A LUST containing waste/motor/hydraulic oil was present at the site. Soil and an aquifer used for drinking water supply was reported to have been impacted. Assessment/remediation performed and case closed in 2014.	High	
SR14C-158	6	135	S114690986, S109348411	SIERRA HWY ANTELOPE VALLEY S CONVIENCE PLAZA	37167 N SIERRA HWY	179 ft (0.03 mi) WSW	At-grade	LUST, RGA LUST	A LUST with unspecified contents was present at the site. The impacted media was not reported. Case closed in 2007.	Med	
SR14C-159	10	180	S102004283, S114691160, S102437536	SIERRA VIEW APARTMENTS	3927 SIERRA HWY	2251 ft (0.43 mi) SSW	Tunnel	HIST Cortese, LUST, RGA LUST	HIST CORTESE/LUST (S102004283/S102437536) - Facility is listed to have impacted soil with gasoline due to a LUST. The site status is listed as "Completed - Case Closed" as of 12/5/1985. CHMIRS (S102004283) - A caller reported that sewage from the facility was being released very evening onto the ground and into the storm drain system. Containment and cleanup are not reported.	Low	
SR14C-160	26	463	S116497298	SINGH DISPOSAL	11401 PENDLETON ST	1882 ft (0.36 mi) NE	At-grade	SWF/LF	Facility is listed to be an active limited volume transfer operation for construction/demolition and inert materials with quarterly inspections. The permit status is listed to have been updated on 2/12/2014.	Low	
SR14C-161	14-15	204	S117662665	SOLEDAD CANYON - EXEMPT		4286 ft (0.81 mi) SE	At-grade	CA MINES	Facility is listed to be an idle sand and gravel quarry operation. Reclamation is not started as of 1991.	Low	
SR14C-162	26-28	484	1009629960	SOUTHERN CALIFORNIA GAS CO	10632 PENROSE ST	4721 ft (0.89 mi) NE	Cut and Cover	DOT OPS	Facility is listed to be a natural gas distribution line that was damaged by outside forces (outside/third party) in 1987.	Low	
SR14C-163	28	504	S103988817, S114694413, U001567823, S114694414	SOUTHLAND TRANSMISSIONS	8283 SAN FERNANDO RD	140 ft (0.03 mi) SW	Cut and Cover	HIST Cortese, LUST, RGA LUST	An aquifer used for drinking water supply is reported to have been impacted from a LUST containing aviation fuel at the facility. Current status listed as "Completed - Case Closed" as of 1996.	High	
SR14C-164	25-26	416	S101586554, S114694690, S114694689	SPARTAN TRUCK COMPANY, SPARTAN TRUCK EQUIPMENT	12266 BRANFORD ST	87 ft (0.02 mi) ENE	Retained Cut / Trench	HIST Cortese, LUST, RGA LUST	HIST CORTESE/LUST (S101586554) - Facility is listed to have impacted soil with waste/motor/hydraulic/lubricating oil due to a LUST. The site status is reported as "Completed - Case Closed" as of 6/6/1986.	Med	
SR14C-165	28	489	S106484844	SPECTRA AMERICAN	11037 PENROSE ST	2269 ft (0.43 mi) NE	Retained Cut / Trench	SLIC, ENVIROSTOR	Facility was evaluated by the LARWQCB in 2001 in relation to a chromium VI and VOC impact to an aquifer used for drinking water source assessment for the area. The facility was determined to need "No Further Requirements" in relation to the investigation in 2014 as is listed as "Completed - Case Closed."	Low	
SR14C-166	23	300	1000181713	SPECTROLAB INC	12500 GLADSTONE AVE	1955 ft (0.37 mi) WNW	Tunnel	TRIS, ENVIROSTOR	TRIS - Facility is listed to generate hazardous waste, have notified EPA under EPA SARA Title III, Section 313, and is in the EPA's index system due to semiconductor and related device manufacturing. ENVIROSTOR - Facility is listed to have a tiered permit. Site is reported to not be subject to the NPL or have restricted land use as a result of facility operations.	Low	
SR14C-167	28	557	S102360919, S109286992	STRATHERN INERT LANDFILL	11201 STRATHERN ST	2154 ft (0.41 mi) SW	Cut and Cover	SWF/LF, LDS	Facility is listed as a land disposal site with a status of "Open - Verification Monitoring."	Med	
SR14C-168	28	504	S111076116	STRATHERN SANITARY LANDFILL	8230 TUJUNGA AVE	1635 ft (0.31 mi) SW	Retained Cut / Trench	SWF/LF	The facility is listed as a closed landfilling operation that accepted inert waste. Currently, the site is listed to be an inert debris engineered fill operation over an area of 34 acres.	Med	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
SR14C-169	26	452	S103426966, S109287408, S102266815	SUN VALLEY LANDFILL - THERMAL TREATMENT UNIT/SUN VALLEY INERT LANDFILL	9436 GLENOAKS BLVD	3773 ft (0.71 mi) NE	At-grade	SWF/LF, LDS,WMUDS/S WAT	SWF/LF (S103426966) - Facility is listed to be an active inert debris engineered fill operation at a closed landfill. The site is reported to be 125 acres in size. LDS (S109287408) - Facility is listed to be a land disposal site with a status of "Completed - Case Closed" as of 5/30/2016.	Low	
SR14C-170	28	463	S106528959, S117711954	SUN VALLEY PAPER STOCK MRF AND TS	8701 N SAN FERNANDO RD	160 ft (0.03 mi) SW	Elevated / Aerial Structure	SWF/LF	LF - Facility is an active large volume transfer/processing site for industrial and mixed municipal waste. Permit issued for the site in 2006.	Med	
SR14C-171	25	454	1011961420	SUPERIOR THREAD ROLLING COMPANY	12801 WENTWORTH ST	5169 ft (0.98 mi) SW	At-grade	CERCLIS NFRAP	Facility is listed to have been evaluated and not qualify for the NPL based on existing information provided.	Low	
SR14C-172	18	239	S102860878, S100833291, S111842200	SOS - PLACERITA CANYON	25977 SAND CANYON RD	2777 ft (0.53 mi) WNW	Tunnel	HIST CAL-SITES, CA BOND EXP. PLAN, RESPONSE, ENVIROSTOR	Facility was utilized from 1967 through 1990 by Space Ordinance Systems (SOS) to manufacture specialty devices. Propellant explosive and pyrotechnic (PEP) and numerous additional COCs were determined to have impacted soil, soil vapor, and groundwater at the site. Groundwater remediation is reported to still be taking place at the facility.	Med	
SR14C-173	28	505	S114697881, 1000288928	SWELLDOM COMPANY, SWELLDOM HOME CARE SERVICE INC	8531 LANKERSHIM BLVD	2300 ft (0.44 mi) SW	At-grade	HIST Cortese, LUST, RGA LUST	HIST CORTESE/LUST (1000288928) - Facility is listed to have impacted soil with aviaional fuel. Site status is reported to be "Completed - Case Closed" as of 7/22/1996.	Low	
SR14C-174	26-28	463	U001567825	TAM CERAMICS INC	11078 FLEETWOOD ST	2505 ft (0.47 mi) NE	Retained Cut / Trench	ENVIROSTOR	Facility is reported to have a Tiered Permit, however, land use restrictions and NPL subjectivity were not reported.	Low	
SR14C-175	25-26	416	1000310559	TEKTOPLATE INC	12280 MONTAGUE ST	896 ft (0.17 mi) ENE	Tunnel	SLIC, ENVIROSTOR	Facility was evaluated by the LARWQCB in 2001 in relation to a chromium VI and VOC impact to an aquifer used for drinking water source assessment for the area. The facility was determined to need "No Further Requirements" in relation to the investigation in 2003 as is listed as "Completed - Case Closed."	Low	
SR14C-176	28	504	S109117739, S114703961, U001567767	TEXACO - KEEBLE, ROBERT, TIMM FUEL & TIRE SERVICE INC	8579 SAN FERNANDO RD	154 ft (0.03 mi) SW	Retained Cut / Trench	LUST, RGA LUST	LUST (S109117739/U001567767) - Facility is listed to have impacted soil with gasoline. Site status is reported to be "Completed - Case Closed" as of 4/26/2010.	Med	
SR14C-177	26	433	1000195400	TIME AVIATION SERVICES INC	9255 SAN FERNANDO RD	172 ft (0.03 mi) SW	At-grade	SLIC	Facility was evaluated by a consultant in 2005 in relation to a chromium VI and VOC impact to an aquifer used for drinking water source assessment for the area. Arsenic was detected in soil concentrations above PRG levels but were determined to be within typical background concentrations for the southern California area. The facility was determined to need "No Further Requirements" in relation to the investigation in 2005 and is listed as "Completed - Case Closed" as of 12/23/2014.	Low	
SR14C-178	26	433	9999040782, 90080790, 91070272, 94020232, 94021240, 94031220, 94031475, 94040501, 9998051231,	TINY BUT MIGHTY PRODUCTIONS INC BHC 2	9175 SAN FERNANDO RD, 9175 SAN FERNANDO BLVD, 9175 SAN FERNANDO BLVD, 9175 SAN FERNANDO BLVD	166 ft (0.03 mi) SW	At-grade	HMIRS, CHMIRS	Various spill incidents were reported in relation to transportation of chemicals. Upon review, a majority of the spills occurred while in off-site transit, were contained, and appeared to be minor.	Low	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)	
			9999020521, 9999020902, 9999030882, 9999050952, 9999081691, 9998081224, 91020479, 91040501, 91080928, 94071368, 95050633, 95051264, 95101164, 96010156, 9900013901, 9998070946, 9998091179, 9998091469, 9998111235, 9998120091, 9998120348, 9998120361, 9999030907, 9999040852, 9999040853, 9999091586, 1000400275, 9998120367, 91020160, 91070556, 91070561, 92020071, 92020378, 92030689, 92040320, 92050404, 92090464, 94060912, 94120396, 94121018, 96060116, 9998030095, S110420996, 9999070529, 9999010676									

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
SR14C-179	26-28	485	S114706151, S109117745	TRANSIT MIXED CONCRETE (FMR SOUTHDOWN CONCRETE)	8960 N BRADLEY AVE	1579 ft (0.3 mi) NE	At-grade	LUST, RGA LUST	LUST (S109117745) - Facility is reported to have impacted soil with diesel fuel. Site status is listed as "Completed - Case Closed" as of 1/13/2015.	Low	
SR14C-180	14	213	U001567727, S114665046, S114665129, S114706774, S114665128, S117662666, S102434815, S114706775	TRIANGLE ROCK PROD INC SOLEDAD, P W GILLIBRAND COMPANY	13900 LANG STATION RD, 13900 LONG STATION	1400 ft (0.27 mi) NW	At-grade Covered	HIST Cortese, LUST, CA MINES, RGA LUST	LUST (U001567727) - Facility is listed to have impacted soil with diesel (heating oil/fuel oil). Site status is listed as "Completed - Case Closed" as of 2/15/2012. MINES (S117662666) - Facility is listed as an idle sand and gravel streambed or gravel bar skimming and pitting, open pit, or plant mine. Site information was updated in 2014 and is listed to be 96 acres in size. HIST CORTESE/LUST (S102434815) - Facility is listed to have impacted soil with diesel fuel. Site status is listed as "Completed - Case Closed" as of 7/19/1996. Mine property appears to be very close to the proposed alignment contrary to reported distance.	High	
SR14C-181	26	433	1000102029	TRUESDALE ESM EAST VALLEY	11781 TRUESDALE ST	3503 ft (0.66 mi) NE	At-grade	RCRA-TSDF	Facility is listed to treat, store, or dispose of numerous types of hazardous waste. Groundwater monitoring and evaluation is reported to have occurred between 1984 and 1985.	Low	
SR14C-182	28	504	S109821493, S103441383	TUJUNGA PIT	8250 TUJUNGA AVE	1597 ft (0.3 mi) SW	Retained Cut / Trench	SWF/LF,WMUD S/SWAT	Very limited information provided for facility. Site assessed for SWAT program. Impact to media not reported.	Med	
SR14C-183	28	505	S113482310	TUXFORD PIT LANDFILL	11590 TUXFORD ST (TUXFORD ST AND GOLDEN STATE FWY)	1532 ft (0.29 mi) SW	Elevated / Aerial Structure	LDS	Facility is listed as a closed solid waste disposal site with a current regulation status as "unpermitted."	Med	
SR14C-184	26	416	1000353463	ULTRAMET	12173 MONTAGUE ST	1816 ft (0.34 mi) ENE	Tunnel	US BROWNFIELDS, ENVIROSTOR	Brownfields - Facility is listed to have had a Phase I ESA performed in relation to assessment of the site. The Phase I ESA was performed under an US-EPA Brownfields Assessment Cooperative Agreement. The property use is reported to consist of light manufacturing. Results of the Phase I ESA were not reported and no COCs were identified for the site. ENVIROSTOR - Facility is reported to have had a site screening performed in 2007 to determine potential impacts to the site due to past use as metal plating. Hydrochloric acid was confirmed as a COC to have impacted soils. Current site status is listed as "Inactive - Action Required" as of 6/30/2007.	Med	
SR14C-185	23	301	U001567595, S114709810	UPS SAN FERNANDO CASFR, UNITED PARCEL SERVICE	12745 ARROYO ST	812 ft (0.15 mi) WNW	Tunnel	LUST, RGA LUST	Facility is listed to have impacted an unknown media with an unknown COC. Site status is listed as "Completed - Case Closed" as of 5/10/2011.	Low	
SR14C-186	25	388	S101618430	VALLEY CIRCUITS INC	11031 GLENOAKS BLVD	196 ft (0.04 mi) WSW	Tunnel	ENVIROSTOR	Facility is reported to have a Tiered Permit, however, land use restrictions and NPL subjectivity were not reported. Current status is listed as "Refer: Other Agency" as of an unspecified date.	Low	
SR14C-187	26	449	1004676152	VALLEY GENERATING STATION	11801 SHELDON ST	1217 ft (0.23 mi) NE	At-grade	SLIC, VCP, ENVIROSTOR	VCP - Facility is listed to be in DTSC Site Cleanup Program with status of active as of 6/28/2000. Numerous COCs are confirmed to have impacted soil at the site and remedial actions are reported to have taken place. SLIC - Facility is reported to have been investigated in relation to the San Fernando Valley Superfund Site due to previous site usage. Soil investigation at the site was performed in 2005 to 2006 in relation to a LARWQCB Order. The assessment concluded that no chromium and or other VOCs were used at the Site. A notice of "No Further Requirements"	Med	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
									was issued in 2006. The site status is listed as "Completed - Case Closed" as of 12/19/2014. ENVIROSTOR - facility is listed to be involved with a voluntary cleanup due to past use as and electrical generation/substation. Confirmed COCs consist of arsenic, total chromium, lead, PCBs, PAHs, copper and compounds, nickel, and vanadium and compounds to soil. Site status is listed as "Active" as of 6/28/2000.		
SR14C-188	26	453	S101618546, U001567848, S104156390	VALLEY GENERATING STATION - DWP/VALLEY GENERATING STATION DISP	9430 SAN FERNANDO RD	81 ft (0.02 mi) SW	At-grade	LDS, ENVIROSTOR, WMUDS/SWAT	LDS (S101618546) - Facility is listed to be an "Open-Inactive" land disposal site with a status date of 8/20/2013. ENVIROSTOR (U001567848) - Facility is listed to have been evaluated for impacts due to historical usage. A Non-Emergency Hazardous Material Substance Release Report for the site (July 8, 1994) stated the facility is impacted with oil fly ash containing metals, including chromium, copper, lead, nickel, and vanadium. During assessment of the site, no COCs are reported to have been confirmed and the facility is listed to not be applicable to NPL or have land use restrictions. Site status is listed as "Inactive - Needs Evaluation" as of 9/14/1995.	High	
SR14C-189	26	452	S116282732	VALLEY RECLAMATION COMPANY - PIT NO. 3	11311 PEORIA ST	3933 ft (0.74 mi) NE	At-grade	LDS	Facility is listed as a land disposal site with a status of "Open - Inactive" as of 2013. Reports for the facility have indicated PCE impacts to groundwater.	Low	
SR14C-190	23-24	309	S114718054, S108935371, 1003878394, 1000200422	VALLEYCREST LANDSCAPE, FIREBALL INDUSTRIES INC	12087 N LOPEZ CANYON ROAD	1908 ft (0.36 mi) ESE	Tunnel	CERCLIS NFRAP, LUST, ENVIROSTOR, RGA LUST	LUST (S108935371) - Facility is listed to have impacted an aquifer used for drinking water supply with diesel, xylenes, MTBE, TBA, and other fuel oxygenates. Site status is listed as "Completed - Case Closed" as of 9/9/2008. CERCLIS-NFRAP (1003878394) - Site was assessed for contamination in 2013 and is listed as NFRAP due to not qualifying for the NPL based on existing information. ENVIROSTOR (1000200422) - Facility listed to have had site screening performed due to historical usage. No confirmed COCs and/or impacted media are reported. Site status is listed as "Refer: Other Agency" with a status date of 8/31/1995.	Low	
SR14C-191	25	376	S109422396	VAUGHN ELEMENTARY LANGUAGE ACADEMY	11176, 11180, 11182, 11188 HERRICK AVE	2531 ft (0.48 mi) WSW	Tunnel	ENVIROSTOR	Facility was evaluated for the NPL in relation to a school evaluation and determined not to be eligible as of 6/22/2009. Site restrictions are not reported for the facility. The site is currently listed as "No Further Action."	Low	
SR14C-192	28	504	S106484837	VINTEN EQUIPMENT INC	8115 CLYBORN	406 ft (0.08 mi) NE	Tunnel	SLIC	The site is listed as Completed - Case Closed as of 12/22/2014 for VOC contamination that has impacted an aquifer used for drinking water supply.	High	
SR14C-193	26	433	S111076161	VULCAN MATERIALS (SUN VALLEY)	11520 SHELDON ST	4330 ft (0.82 mi) NE	At-grade	SWF/LF	Facility is listed to be an active landfilling operation that accepts inert waste as an inert debris engineered fill operation.	Low	
SR14C-194	28	463	1014677847, S106399137, 2003642460	VULCAN MATERIALS CO SUN VALLEY	11447 W TUXFORD ST	246 ft (0.05 mi) NE	Elevated / Aerial Structure	ERNS, TRIS, CHMIRS	TRIS (1000128768) - Facility is listed to have notified the EPA under SARA Title III, Section 313. The site is listed to release up to eight pounds of naphthalene and PAHs to the atmosphere due to operations. CHMIRS/ERNS (S106399137/2003642460) - Facility is reported to have released 4,000 gallons of asphalt materials due to a plugged operation line in 2003. A waterway (storm drain) is reported to have been involved. Spill containment is not reported and cleanup was listed to have been completed.	Med	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
SR14C-195	26	475	1005775701	WASTE MANAGEMENT	9081 TUJUNGA AVE	1954 ft (0.37 mi) NE	Elevated / Aerial Structure	SWF/LF	Facility is listed as an active waste hauler. Limited additional information is provided.	Low	
SR14C-196	26	463	S103697090	WEST COAST WINERY	11115 PENDLETON ST	3804 ft (0.72 mi) NE	At-grade	SLIC	Facility is listed to be a cleanup program site with a status of "Completed - Case Closed" as of 9/27/1995. The impacted media and COCs for the site are not reported.	Low	
SR14C-197	25	416	1011812566	WILLIES AUTO REPAIR	9954 SAN FERNANDO RD	1158 ft (0.22 mi) WSW	Retained Cut / Trench	US BROWNFIELDS	Facility is listed to have had a Phase I ESA performed in relation to assessment of the site. The Phase I ESA was performed under an US-EPA Brownfields Assessment Cooperative Agreement. Results of the Phase I ESA were not reported.	Low	
SR14C-198	28	504	S105026815, S114723172, U003904755, S114723381	WORLD OIL STATION NO. 19	8181 SUNLAND BLVD	175 ft (0.03 mi) SW	Tunnel	HIST Cortese, LUST, RGA LUST	A LUST was reported to have impacted soil with gasoline. Case closed as of 1996.	Med	
SR14C-199	11	162	S110419601		33958 MC ENNERY CANYON RD	30 ft (0.01 mi) SSW	Tunnel	CHMIRS	A spill of non-PCB containing mineral oil (50 gallons) was reported from a pad mounted transformer when it was hit by a vehicle. The spill occurred in 2008 and is reported to have impacted the roadway and surrounding soils. Cleanup is reported to have been performed by a contractor.	Low	
SR14C-200	14	208	92293554		13200 SOLEDAD CANYON RD	515 ft (0.1 mi) SE	Elevated / Aerial Structure	ERNS	A citizen reported that an unknown amount of sewage spilled during a storm in a canyon area in 1992. The caller was referred to the EPA by Los Angeles County Department of Health.	Low	
SR14C-201	25	360	S110977421, S110417948		12600 VAN NUYS BLVD, SHADOW HILLS MOBILE HOME PARK	122 ft (0.02 mi) ESE	Tunnel	CHMIRS	CHMIRS (S110977421) - A caller reported that the cap to a sewage clean out valve was removed resulting in 100 gallons of sewage being released to the surrounding area. The spill occurred in 2010 and is not reported to have been contained and/or cleaned up. CHMIRS (S110417948) - A caller reported that approximately 1,000-gallons of sewage was released due to a clog in the sewer main. A contractor is reported to have cleaned up the spill.	Low	
SR14C-202	25	388	S110981113		11000 GLEN OAKS BLVD, CROSS STREET IS PIERCE ST	107 ft (0.02 mi) ENE	Tunnel	CHMIRS	In 2010, a caller reported that approximately 1,500-gallons of sewage was released into a catch basin due to a semi carrying the sewage overturning due to a vehicle accident. The release was contained by placement of sandbags and booms before it could reach a waterway. Clean up was performed by United Pumping using a vacuum truck.	Low	
SR14C-203	25-26	416	8865637		12318 BRANFORD ST 818-899-7924; ROB MEHAN(FOREMAN)/JOE E	249 ft (0.05 mi) WSW	Retained Cut / Trench	ERNS	Facility is reported to have had an emergency release to the soil. In 1988, a caller stated that a green liquid material was eating through drums it was contained in. The material was reported to have been smoking and business employees were hosing down the spill resulting in intense fumes in the area. Containment and cleanup are not reported.	Med	
SR14C-204	26	433	90178746		CONSTRUCTION SITE 9175 SAN FERNANDO RD	408 ft (0.08 mi) SW	At-grade	ERNS	Facility is reported to have spilled approximately 45 gallons of lacquer thinner/paint thinner in 1990. An agency was reported to be retained to handle and dispose of the product moving forward.	Med	
SR14C-205	26-28	483	2014083694, S116779407		9027 SAN FERNANDO RD	164 ft (0.03 mi) SW	At-grade	ERNS, CHMIRS	ERNS (2014083694) - Facility is reported to have a release to soil. In 2014, dumping of an unknown material was reported to an alley	High	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
									way/asphalt. The material was reported to have been cleaned up by an employee of the company. CHMIRS (S116779407) - A caller reported a discharge of motor oil into an alley behind the facility. The caller stated that the business is pumping the product into the alley on a regular basis. Containment and cleanup are not reported.		
SR14C-206	28	504	S109035661, 2007306845		11275 PENROSE ST	71 ft (0.01 mi) NE	Retained Cut / Trench	ERNS, CHMIRS	CHMIRS (S109035661) - A spill of approximately 20 pounds of ammonia was discovered during a pump down. The spill occurred in 2007 and is reported to have been contained. Cleanup is not reported. ERNS (2007306845) - A caller reported a release of approximate 20 pounds of anhydrous ammonia during a pump down of a refrigeration unit. The spill is reported to the atmosphere. The spill occurred in 2007 and is reported to have been contained. Cleanup is not reported.	Low	
SR14C-207	28	552	S105651191		7975 CLYBOURN AVE, SUN VALLEY TB 533 A2	264 ft (0.05 mi) SW	Tunnel	CHMIRS	A tanker truck is reported to have had a leaking valve, resulting in asphalt emulsion being spread over the street into the gutter and storm drain and ending up in the flood control channel in 1997. The street was closed and sand was spread over the surface. A contractor was retained to clean up the spill.	Low	
SR14C-208	28	561	2004100406		7649 SAN FERNANDO RD	249 ft (0.05 mi) SW	Tunnel	HMIRS	A spill of five gallons of TCE was reported in 2004 to an unspecified media. A certified hazardous materials team responded to contain and clean up the spill.	Low	
SR14C-209	18	239	S107736888	NIKE 94 MCA HOU SITE		3050 ft (0.58 mi) WNW	Tunnel	ENVIROSTOR	Facility was evaluated for the NPL in relation to a military evaluation and determined not to be eligible as of 7/1/2005. Site restrictions and confirmed COCs are not reported for the facility. The site is currently listed as "Inactive - Needs Further Evaluation." Historical information indicates that the "Nike" facilities were previously used as Minute Man missile launch installations in the 1950s to 1960s. It is reported that nuclear missiles were stored, assembled, fueled, and armed in a fortified bunker (battery) in a subterranean bunker.	Low	
SR14C-210	28	574	S101298216, S105032930	U-HAUL CENTER OF SUN VALLEY	7721 HOLLYWOOD WAY	1752 ft (0.33 mi) ENE	Cut and Cover	HIST Cortese, LUST	Facility was evaluated by the LARWQCB in relation to waste oil, motor, hydraulic, and lubricating oil impacts to soil. The facility is listed as "Completed - Case Closed" as of 3/31/92.	Low	
SR14C-211	28	564	S107735843	SUPERIOR PLATING	4001 GLENOAKS BLVD	2150 ft (0.41 mi) NE	Tunnel	ENVIROSTOR	Facility was evaluated by the DTSC and is listed as "Inactive - Needs Evaluation" as of 5/24/12.	Med	
SR14C-212	26	416	S112283606	CALDERON RECYCLING	12231 BRANFORD ST	424 ft (0.08 mi) ENE	Retained Cut / Trench	SWRCY	Facility is listed to be a recycling center that accepts aluminum/glass/plastic/bimetal products. Operation begin date listed to be 7/5/2015.	Med	
SR14C-213	26	465	S103441474	BRADLEY AVENUE DUMP NO. 2		2464 ft (0.47 mi) NE	At-grade	WMUDS/SWAT	Facility is listed to be in Solid Waste Assessment Test Program. Little additional information is provided.	Med	
SR14C-214	25-27	482	S103441429	BRIGHT REALITY	LAUREL CANYON & JEROME	4260 ft (0.81 mi) SW	At-grade	WMUDS/SWAT	Facility is listed to be in Solid Waste Assessment Test Program. Little additional information is provided.	Low	
SR14C-215	28	504	S103441729	PENROSE LANDFILL	8221 TUJUNGA AVE	1689 ft (0.32 mi) SW	Retained Cut / Trench	WMUDS/SWAT	Facility is listed as Category B – Any facility having a physical, chemical, or biological waste treatment system (except for septic systems with subsurface disposal), or any Class II or II disposal site, or facilities without	Med	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
									treatment systems that are complex, such as marinas with petroleum products, solid wastes, and sewage pump out facilities. The facility is listed to "not fall into the category of Municipal/Domestic, Industrial, Agricultural or Solid Waste (Class I, II or III) and to be a minor threat to water quality.		
SR14C-216	28	554	S103441730	TUJUNGA AVE/SITE 8-PENROSE PIT	8145 N. TUJUNGA AVE.	2836 ft (0.54 mi) SW	Cut and Cover	WMUDS/SWAT	Facility is listed as Category B – Any facility having a physical, chemical, or biological waste treatment system (except for septic systems with subsurface disposal), or any Class II or II disposal site, or facilities without treatment systems that are complex, such as marinas with petroleum products, solid wastes, and sewage pump out facilities. The facility is listed to "not fall into the category of Municipal/Domestic, Industrial, Agricultural or Solid Waste (Class I, II or III) and to be a minor threat to water quality.	Low	
SR14C-217	28	561	S107137870	LEOS RECYCLING INC	7636 SAN FERNANDO RD	62 ft (0.01 mi) SW	Tunnel	SWRCY	Facility is listed to be a recycling center that accepts aluminum/glass/plastic/bimetal products. Operation begin date listed to be 1/2/2016.	Med	
SR-14C-218	25	388	S101584960	SEUNG HO KIM/MAL NAM KIM	11045 GLENOAKS BLVD	235 ft (0.04 mi) WSW	Tunnel	SWRCY	Facility is listed to be a recycling center that accepts aluminum/glass/plastic/bimetal products. Operation begin date listed to be 9/28/1998.	Med	

¹The site is included in a group of industrial facilities that are documented to be included as "Responsible Parties" in relation to the San Fernando Valley Superfund Site for VOC/solvent/metal/chlorinated hydrocarbon impacts to groundwater used for drinking water. Listed sites with the same designation have the Case Background description associated with the listing presented in BOLD font and contain an "X" in the "Associated with the Superfund Site (Area #1)" column. While the San Fernando Superfund Site currently has a status of "Open - Remediation" or similar, some of the associated sites may have since been closed or have a status of "Completed - Case Closed". The remaining sites continue to be open and undergoing remediation for the associated contamination.

Table 3.10-B-4: SR14A Central Subsection PEC Sites

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
SR14C-1	26	416	1011812498	12127 MONTAGUE ST	12127 MONTAGUE ST	2255 ft (0.43 mi) ENE	Tunnel	US BROWNFIELDS	Site is listed to be part of a Targeted Brownfield Assessment (TBA) Cooperative Agreement for potentially impacted properties. A Phase I ESA indicated cleanup is not required for the property.	Low	
SR14C-2	26	416	1011812499	12237 MONTAGUE ST	12237 MONTAGUE ST	1263 ft (0.24 mi) ENE	Tunnel	US BROWNFIELDS	Site is listed to be part of a TBA Cooperative Agreement for potentially impacted properties. A Phase I ESA indicated cleanup is not required for the property.	Low	
SR14C-3	25-26	416	1011812500	12269 MONTAGUE ST	12269 MONTAGUE ST	982 ft (0.19 mi) ENE	Tunnel	US BROWNFIELDS	Site is listed to be part of a TBA Cooperative Agreement for potentially impacted properties. A Phase I ESA indicated cleanup is not required for the property.	Low	
SR14C-4	25-26	416	1011812501	12333 BRANFORD ST	12333 BRANFORD ST	417 ft (0.08 mi) WSW	Retained Cut / Trench	US BROWNFIELDS	Site is listed to be part of a TBA Cooperative Agreement for potentially impacted properties. A Phase I ESA indicated cleanup is not required for the property.	Low	
SR14C-5	25-26	416	2008439502, 2004041369, 2004090543, 2004090552, 2007432171, 9900016774, 9900017582, S118188860, S101618411, S112829940, 2008426052, 2004061278, 9999010984	12466 MONTAGUE ST, ABF FREIGHT SYSTEM INC	12466 MONTAGUE ST (CON-WAY FREIGHT TERMINAL UFV)	251 ft (0.05 mi) WSW	Retained Cut / Trench	HMIRS, CHMIRS	Various spill incidents were reported in relation to transportation of chemicals. Upon review, a majority of the spills occurred while in off-site transit, were contained, and appeared to be minor.	Low	
SR14C-6	26	433	2008442399, 2000018444, 2005702069, 2005705141, 9900015353, 2000018445, 2000023111, 2000023112, 2000026381, 2000026382, 2000027914, 2000027915, 2000081231, 2000100313, 2000100954, 2000101199, 2001010286, 2001010613, 2002079730,	9210 SAN FERNANDO RD, 9210 SAN FERANND RD	9210 SAN FERNANDO RD, 9210 SAN FERNANDO RD	8 ft (0 mi) SW	At-grade	HMIRS	Various spill incidents were reported in relation to transportation of chemicals. Upon review, a majority of the spills occurred while in off-site transit, were contained, and appeared to be minor.	Low	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
			2005702976, 2005703130, 2005703330, 2005703331, 2005703577, 2005704791, 2007429157, 2007429162, 2007432971, 2007442551, 2007444444, 2008429400, 2008431179, 2008431180, 2008433054, 2008433055, 2008433086, 2008434346, 2008434348, 2008444447, 2008444627, 2008449059, 2008449060, 2008451713, 2008454720, 2008454739, 2008456578, 2008456980, 2008456981, 2008456982, 2008457201, 2009046142, 2009046164, 2009046617, 2009046710, 2009048306, 2009049875, 2009054666, 2009054926, 2009055157, 2009057241, 2009057797, 2010010313, 2010011261, 2010011414, 2010011629, 2010101751,								

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)	
			2010101985, 2010102765, 2010105563, 2010106669, 2010109580, 2011000197, 2011003725, 2011006546, 2011009758, 2012102499, 2012106977, 2012107847, 2012108000, 2012109960, 2012110238, 2013001837, 2013003207, 2013005296, 2013009758, 9900015352, 2000018562, 2000018563, 2000019551, 2000019552, 2000021244, 2000021245, 2000021568, 2000021569, 2000021833, 2000021834, 2000025532, 2000025533, 2000027912, 2000027913, 2000090448, 2000090457, 2000101198, 200115787, 20018561, 2003122338, 2003125978, 2003126125, 2003126563, 2003127112, 2003129141, 2003130046, 2003132923,									

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
			2003133027, 2004010896, 2004020247, 2004020299, 2004020302, 2004021060, 2004030014, 2004030373, 2004030377, 2004030385, 2004030738, 2004031144, 2004040325, 2004041101, 2004050169, 2004050819, 2004060622, 2004060739, 2004070940, 2004090196, 2004110607, 2004400081, 2004400082, 2004400083, 2004400138, 2004400139, 2005010934, 2005703767, 2005703780, 2005706255, 2005706356, 2005706924, 2011007673, 2013005567, 2013008284								
SR14C-7	28	504	S113001921	ABBOTT TECHNOLOGIES INC	8203 VINELAND	260 ft (0.05 mi) SW	Cut and Cover	CHMIRS	In 2013, a caller reported an illegal dumping of sewage from motor homes. Approximately 100 gallons were reported and the material was contained with the sewage system.	Low	
SR14C-8	28	490	1000426895, 1012010283	ACCURATE ENGINEERING INC	8710 TELFAIR AVE	1509 ft (0.29 mi) SW	At-grade	TRIS, ENVIROSTOR	ENVIROSTOR (1000426895) - Facility is reported to have been assessed via a Phase I ESA for potential COCs. No COCs were confirmed for the site and the facility was determined to not be subject to the NPL and/or land use restrictions. TRIS (1012010283) - Facility is listed to have notified the EPA under SARA Title II, Section 313. Copper and lead compounds are reported to be transferred from the facility for further waste management.	Low	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
SR14C-9	26	433	1007739312, S110275515, S106484865	ACTIVE MAGNETIC INSPECTION INC, EAGLE TECH	9356 1/2 SAN FERNANDO RD, UNIT B, 93561 SAN FERNANDO RD, #1/2	24 ft (0 mi) NE	At-grade	TRIS, SLIC, ENVIROSTOR	ENVIROSTOR (S110275515) - Facility was evaluated for the NPL and determined not to be eligible as of 9/8/2011. The site was referred to the EPA. SLIC (S106484865) - Facility was evaluated by the LARWQCB in 1997 in relation to a chromium VI source assessment for the area. The facility was determined to need "No Further Requirements" in relation to the investigation in 1997 and is listed as "Completed - Case Closed" as of 11/14/2014. TRIS (1007739312) - Facility is listed to have notified the EPA under SARA Title II, Section 313 in related to chromium, nickel, and nitric acid waste transferred for metal recovery from the site operations.	Med	
SR14C-10	10	178	S103656361, S114704737, S114705412, S103282018	ACTON PLAZA, TOSCO - 76 STATION #0781, TOSCO S.S. #0781	3807 SIERRA HWY, 3807 SIERRA HWY W	2171 ft (0.41 mi) SSW, groundwater flow to the east	Tunnel	HIST Cortese, LUST, RGA LUST	Facility is listed to have impacted soil and an aquifer used for drinking water supply with petroleum hydrocarbons as result of a LUST containing gasoline. Remedial excavation was performed from 1995 through 1999. Site is listed with a status of "Completed - Case Closed" as of 9/8/2010.	Low	
SR14C-11	28	504	S100229464, S114568808	ADVANCED PACKAGING TECHNIQUES	11340 PENROSE ST	714 ft (0.14 mi) SW	Retained Cut / Trench	HIST Cortese, LUST, RGA LUST	Facility is listed to have impacted soils with alcohols due to a LUST. The site status is reported as "Completed - Case Closed" as of 7/22/1996.	Low	
SR14C-12	26	433	1000905404, 1014202314	ALERT PLATING COMPANY	9939 GLENOAKS BLVD	3355 ft (0.64 mi) ENE	At-grade	CERCLIS NFRAP, SLIC	CERCLIS-NFRAP (1014202314) - Site assessed for contamination in 2010 and is listed as NFRAP due to not qualifying for the NPL based on existing information. SLIC (1000905404) - Facility was evaluated by the LARWQCB in 2001 in relation to a chromium VI source assessment for the area. The facility was determined to need "No Further Requirements" in relation to the investigation in 2003 and is listed as "Completed - Case Closed" as of 12/22/2012.	Low	
SR14C-13	26	433	1018119623	ALLEGHENY SITE	11933-11941 W ALLEGHENY ST	541 ft (0.1 mi) SW	At-grade	US BROWNFIELDS	Site is listed to be part of a TBA Cooperative Agreement for potentially impacted properties. A Phase I ESA indicated cleanup is not required for the property. Unknown media was indicated to have been affected at the site.	Low	
SR14C-14	26	416	1011812514	ANGELUS OXYGEN	12173-79 BRANFORD ST	977 ft (0.19 mi) ENE	Retained Cut / Trench	US BROWNFIELDS	Site is listed to be part of a TBA Cooperative Agreement for potentially impacted properties. A Phase I ESA indicated cleanup is not required for the property.	Low	
SR14C-15	9	166	S104404805	ANTELOPE VALLEY FWY SPILL	7600 ESCONDIDO CANYON	3007 ft (0.57 mi) NNW	Tunnel	SLIC	Facility is listed to have spilled TPH to an unspecified media. Facility status is listed as "No Further Action Required" and little additional information is provided.	Low	
SR14C-16	23	300	S105088508	ANTHONY INC	12364 GLADSTONE AVE	1329 ft (0.25 mi) WNW	Tunnel	ENVIROSTOR	Facility is listed to be part of a tiered permit. Site is not subject to the NPL or land use restrictions. Current site status is listed as "Inactive - Needs Evaluation."	Low	
SR14C-17	23	300	1000477327, S114572144	ANTHONY MANUFACTURING CO INC	12812 ARROYO AVE	1298 ft (0.25 mi) WNW	Tunnel	HIST Cortese, LUST, SLIC, ENVIROSTOR, RGA LUST	Facility is listed as "Completed - Case Closed" as of 1997 for an aquifer used for drinking water supply impacted by gasoline and VOCs. A conditional closure was issued pursuant to report of proper sealing of well.	Low	
SR14C-18	25	360	S114574855, S104891039	ARCO #9630	12579 VAN NUYS BLVD	170 ft (0.03 mi) ESE	Tunnel	LUST, RGA LUST	Facility is listed as "Leak Being Confirmed" for a gasoline leak to soil as of 2001.	High	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
SR14C-19	25	385	S114574856, S114702758, S102438981, S103066084, S114575341, S114703282	ARCO FACILITY NO. 09630, THRIFTY OIL CO STATION #230	12957 VAN NUYS BLVD	2266 ft (0.43 mi) WSW, groundwater flow to the southwest	Tunnel	HIST Cortese, LUST, RGA LUST	LUST - Facility is listed to have impacted soil due to a LUST containing gasoline. Site status is listed to be "Case Closed" as of 1/9/1991. LUST/HIST CORTESE (S103066084) - Facility is listed to have impacted other groundwater (used other than drinking water) with gasoline due to a LUST at the site. Site status is listed to be "Completed - Case Closed" as of 3/28/2013.	Low	
SR14C-20	26-28	485	1017400940	ASSOCIATED READY MIXED CONCRETE INC	8946 BRADLEY AVE	1570 ft (0.3 mi) NE	At-grade	TRIS	Facility is listed as a hazardous waste/enforcement and compliance history site for lead compounds with a status date of 2014. The lead compounds are reported to be transferred off-site for further waste management.	Low	
SR14C-21	28	505	S113145672	ASTRO CHROME & POLISHING	8136 LANKERSHIM BLVD	3951 ft (0.75 mi) SW	At-grade	SLIC	Facility listed as "Open - Site Assessment" as of 2014 for chlorinated hydrocarbons for impacting an unspecified media.	Low	
SR14C-22	26	463	S103587984	ATHENS SUN VALLEY MAT REC & T.S.	11121 PENDLETON ST	3801 ft (0.72 mi) NE	At-grade	SWF/LF	Facility is listed as an active large volume transfer and processing facility that accepts green materials, household trash, and inert metals. Monthly inspections are reported for the site and a daily capacity is listed to be 1,500 tons.	Low	
SR14C-23	26	463	S103441295	BENTZ DUMP	11251 PENDLETON ST	3368 ft (0.64 mi) NE	At-grade	LDS,WMUDS/S WAT	Facility is listed as a land disposal site with a status of "Completed - Case Closed" as of 5/25/2016. Accepted materials are listed to be clean dirt, broken concrete, asphalt, brick, block and rock.	Low	
SR14C-24	26	433	S112205497	BINS BINS BINS INC.	11835 SHELDON ST	859 ft (0.16 mi) NE	Elevated / Aerial Structure	SWF/LF	Facility is listed as an active waste hauler. Limited additional information is provided.	Low	
SR14C-25	28	463	S113724443	BIOMEDICAL WASTE DISPOSAL	11152 FLEETWOOD ST #9	1846 ft (0.35 mi) NE	Retained Cut / Trench	MWMP	Facility is listed to be a transfer only medical waste facility. No additional information is provided.	Low	
SR14C-26	28	525	1000590036, S114583652	BLACTOP MATERIALS CO #2, BLACKTOP MATERIALS CO	11462 PENROSE ST	1653 ft (0.31 mi) SW	Retained Cut / Trench	HIST Cortese, LUST, RGA LUST	Facility is reported to have impacted soil with diesel fuel due to a LUST. Site status is listed as "Completed - Case Closed" as of 9/7/1995.	Low	
SR14C-27	25	460	S117661157	BOULEVARD	9108 LAUREL CANYON BLVD	2550 ft (0.48 mi) SW	At-grade	CA MINES	Facility is listed as an idle sand and gravel open pit, plant, or mill operation. Reclamation is reported to be in progress and the facility is listed to be 124 acres in size. Information for the site was updated in 2014.	Med	
SR14C-28	26	463	U003060793	BRADLEY AVE DUMP	9050 BRADLEY AVE	1603 ft (0.3 mi) NE	At-grade	LDS,WMUDS/S WAT	Facility is listed as a land disposal site with a status of "Open-Inactive" as of 11/29/2012. Groundwater monitoring was conducted at the site and elevated VOC and PCE/TCE concentrations were identified.	Med	
SR14C-29	26	465	S113887321	BRADLEY EAST LANDFILL	9229 TUJUNGA AVE	2430 ft (0.46 mi) NE, groundwater flow to the southeast	At-grade	LDS	Facility is a former sand and gravel pit that was subsequently used as an unlined non-hazardous solid waste landfill that is listed as "Open - Closed/With Monitoring" as of 5/22/2016. Groundwater and soil/soil vapor are listed to have been impacted with VOCs, metals, and landfill related gases. The facility is reported to have leaking waste constituents in excess of DHS/MCLs and may be affecting groundwater in the vicinity of the landfill.	Med	
SR14C-30	26	461	S100931059, S109286318, S111075797, S103341425	BRADLEY EAST LANDFILL, BRADLEY LANDFILL & RECYCLING CENTER, BRADLEY LANDFILL	9227 TUJUNGA AVE	2005 ft (0.38 mi) NE	At-grade	SWF/LF, LDS,WMUDS/S WAT	Facility is listed to be a closed solid waste landfill that accepts construction/demolition, industrial, mixed municipal, and other designated wastes. The closure date is listed as 6/1/2007 and the facility is reported to be 126 acres in size. Facility is also listed to be a solid waste landfill with	Med	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
									quarterly inspections with a closure date of 12/31/1980. Facility is also listed to be a closed large volume transfer/processing facility with a closure date of 3/10/1988. Currently, the facility is listed to be an active large volume transfer/processing facility accepting agricultural, green materials, and manure with monthly inspections.		
SR14C-31	25-26	416	S103441737, 1000200264, 1003880073, S103441393	BRANFORD EXPERIMENT SITE, BRANFORD LANDFILL, LOS ANGELES DWP-BRANFORD STREE	9701 SAN FERNANDO RD	659 ft (0.12 mi) WSW	At-grade	CERCLIS NFRAP, HIST Cortese, LDS, ENVIROSTOR, WMUDS/SWAT	LDS/ENVIROSTOR (S103441737) - Facility is listed to be a closed land disposal site with a status of "Open - Closed/With Monitoring" as of 2/25/2016. A landfill gas collection system is reported to be operated continuously to mitigate methane gas migration from the facility. ENVIROSTOR (S103441737) - Facility is listed to have impacted groundwater, soil, and soil vapor with methane due to landfill operations. Site status is reported to be "No Further Action" as of 9/30/1998. CERCLIS-NFRAP (1003880073) - Site assessed for contamination in 1997 and is listed as NFRAP due to not qualifying for the National Priority List (NPL) based on existing information provided in October 2013.	Med	
SR14C-32	25	416	S102360935	BRANFORD LF	12456 BRANFORD ST	1682 ft (0.32 mi) WSW	At-grade	SWF/LF	Facility is listed to be a closed solid waste landfill. Detail of the accepted material is not provided; however, quarterly inspections are reported. The closure date is not reported for the site.	Med	
SR14C-33	26	463	U001567850	BROWNING FERRIS INDUSTRIES INC	9200 GLENOAKS BLVD	3777 ft (0.72 mi) NE	At-grade	SWF/LF	Facility is listed to be an active waste hauler. Limited additional information was provided in relation to site operations.¹	Low	X
SR14C-34	28	504	S103621795	BURBANK AIRCRAFT SUPPLY INC	10671 LANARK	414 ft (0.08 mi) NE	Tunnel	SLIC	Facility is listed to have impacted an aquifer used for drinking water supply with VOCs and chromium. Current status is listed as "Open-Inactive" as of 10/29/2014. Groundwater gradient information was not reported but is anticipated to be toward the southeast per typical flow within the San Fernando Valley area.	High	
SR14C-35	28	564	S111828968	BURBANK AIRPORT AUTHORITY	2627 HOLLYWOOD WAY	2159 ft (0.41 mi) NE	Tunnel	SLIC	Facility was evaluated by the LARWQCB in 2004 in relation to a chromium VI source assessment for the area. The facility was determined to need "No Further Requirements" in relation to the investigation in 2004 as is listed as "Completed - Case Closed" as of 12/22/2014.	Low	
SR14C-36	14	207	1000296883	C A RASMUSSEN INC	1010 SHILOH RD	5183 ft (0.98 mi) NW	Tunnel	US MINES	Facility is listed to be an abandoned non-coal mining operation. Ten violations of unknown nature were issued for the facility between 2007 and 2011.	Low	
SR14C-37	23	307	S116497301	C&M TOPSOIL INC	12087-40 LOPEZ CANYON RD	741 ft (0.14 mi) ESE	Tunnel	SWF/LF	Site is listed as an active facility accepting green waste for composting operations as of 2014.	Low	
SR14C-38	23	300	S101298230, S114588823, S114588822	C. E. MACMILLAN INC	12355 GLADSTONE AVE	1306 ft (0.25 mi) WNW	Tunnel	HIST Cortese, LUST, RGA LUST	Facility is reported to have impacted soil with other solvents or non-petroleum hydrocarbons due to a LUST. Site status is listed as "Completed - Case Closed" as of 9/4/1996.	Low	
SR14C-39	28	561	1000252200	CALIFORNIA BIONUCLEAR CORP	7654 SAN FERNANDO RD	66 ft (0.01 mi) SW	Tunnel	CERCLIS NFRAP, PRP	Facility was evaluated in relation to the San Fernando NPL case for potentially impacting groundwater with VOCs and/or chromium. The site was determined to require removal only, no site assessment work needed as of 1987.	Med	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
SR14C-40	25	457	1011961457	CALIFORNIA CHEMICAL MANUFACTURING, LLC (AMR)	12734 BRANFORD ST, SUITE 20	3517 ft (0.67 mi) SW	At-grade	CERCLIS NFRAP	Site assessed for contamination in 2009 and is listed as No Further Remedial Action Planned (NFRAP) due to not qualifying for the National Priority List (NPL) based on existing information.	Low	
SR14C-41	28	505	S112274179	CALIFORNIA PROPELLER	8101 LANKERSHIM BLVD	4127 ft (0.78 mi) SW	Retained Cut / Trench	SLIC	Facility was investigated in relation to chromic acid, and 1,1,1-TCA use at the site. Soil samples were collected adjacent to an abandoned clarifier that indicated elevated concentrations of chromium. A soil gas survey was subsequently performed that indicated elevated 1,1-DCE and 1,1,1-TCA concentrations in soils adjacent to the clarifier. The site received a letter of "No Further Action" in regard to soil and soil vapor impacts from the LARWQCB in 1994. The site received a notice of "No Further Action" subsequently in 1996 for the USEPA. Due to concerns regarding emerging chemicals detection in the groundwater of the North Hollywood Operable Unit, the LARWQCB issued a notice for further investigation for potential groundwater impact. In response, a technical report was prepared in 2012 by a consultant. A notice of "No Further Action" in relation to potential groundwater impacts was issued in 2015 by the LARWQCB. The site status is listed as "Completed - Case Closed" as of 5/21/2015.	Low	
SR14C-42	28	463	1016467998	CALMAT CO		439 ft (0.08 mi) NE	At-grade	US MINES	Facility is listed as "Non-Coal Mining" as of 1973. Limited additional information was provided.	High	
SR14C-43	26-28	463	1006816059	CALPORTLAND CO SUN VALLEY PLANT	8981 BRADLEY AVE	1556 ft (0.29 mi) NE	At-grade	TRIS	Facility is listed to produce lead compounds with off-site transfer for disposal of approximately 13 pounds of the compounds per year.	Low	
SR14C-44	23	318	S106079129	CITY OF SAN FERNANDO CORP YARD	535 GLENOAKS BLVD	5265 ft (1 mi) WNW	Tunnel	SWF/LF	Facility is listed to be an active limited volume transfer operation accepting construction/demolition, green material, inert, and metal wastes. The site is reported to be inspected quarterly and the permit date for the facility is 9/15/2003.	Low	
SR14C-45	28	463	1000591490, S109821484	COAST LIQUID GAS, GREGG PIT (PICK YOUR PART)	11370 PENDLETON ST	583 ft (0.11 mi) NE	Elevated / Aerial Structure	SWF/LF, LUST	SWF/LF -Very limited information provided for facility but site is listed in SWF/LF database. LUST - During steam cleaning of a sump, contaminated soil was excavated and disposed of for an unknown contaminant in 1988.	Med	
SR14C-46	23	300	1003878859, S104573531	COMMODORE PRODUCTS, P & G PRODUCTS	12800 FOOTHILL BLVD	2307 ft (0.44 mi) WNW	Tunnel	CERCLIS NFRAP, ENVIROSTOR	CERCLIS - NFRAP (1003878859) - Site assessed for contamination in 2010 and is listed as NFRAP due to not qualifying for the NPL based on existing information. ENVIROSTOR (S104573531) - Facility was investigated in relation to multiple potential COCs at the site under a site characterization and assessment grant. No COCs were confirmed for the facility and the case was referred to another agency as of 8/21/1995.	Low	
SR14C-47	26	463	1000155657, S103340305, 1000409068	COMMUNITY RECYCLING / RES RECOVERY INC, SOUTHERN CALIFORNIA WASTE REDUCTION	9147 DE GARMO AVE, 9147 DE GARMO AVE	3142 ft (0.6 mi) NE	At-grade	CERCLIS NFRAP, CORRACTS, SWF/LF	SWF/LF (1000155657) - Facility is listed to be an active (permit date of 1997) limited volume transfer operation that accepts construction/demolition and other designated wastes with quarterly inspections. SWF/LF (S103340305) - Facility is listed as an active (permit date of 1998) large volume transfer/processing facility that accepts construction/demolition, industrial, mixed municipal waste. Inspections are reported to be performed on a monthly basis. CERCLIS-NFRAP/CORRACTS - Facility is listed to not qualify for NPL based on information updated in October 2013.	Low	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
SR14C-48	25	416	1011812530, S104809415	CONDORA CONSTRUCTION SERVICES	12506 MONTAGUE ST	570 ft (0.11 mi) WSW	Retained Cut / Trench	US BROWNFIELDS, SWF/LF	LF- Site is listed as a transfer and processing facility for construction/demolition, green waste, and household hazardous waste with a capacity of 21,000 cubic yards per day. Brownfields - Site was investigated under a Phase I ESA as part of a Brownfields Assessment Cooperative Agreement, impacted media was not reported.	Low	
SR14C-49	28	463	S105024700, S114605987, S114605986	CONROCK COMPANY	11401 TUXFORD ST	583 ft (0.11 mi) NE	Elevated / Aerial Structure	HIST Cortese, LUST, RGA LUST	HIST CORTESE/LUST (S105024700) - Facility is listed to have impacted soil with an unspecified COC. Site status is listed as "Completed - Case Closed" as of 10/7/1994.	Low	
SR14C-50	23	300	S105026143, S114606987, S102428394	COSMIC PLASTICS	12314 GLADSTONE AVE	1087 ft (0.21 mi) WNW	Tunnel	HIST Cortese, LUST, RGA LUST	HIST CORTESE/LUST (S105026143) - Facility is listed to have impacted soil with an aviation fuel due to a LUST. Site status is listed as "Completed - Case Closed" as of 4/22/1988.	Low	
SR14C-51	25	416	S101584556	COUNTY OF LA-FIRE DEPARTMENT	12605 OSBORNE ST	979 ft (0.19 mi) WSW	Tunnel	LUST	Site is listed as "Open - Site Assessment" as of 2014. Soil and soil vapor at the facility is listed to have been impacted with petroleum hydrocarbons and VOCs.	Med	
SR14C-52	26	463	S104567759, S112891096	CROWN DISPOSAL COMPANY INC, RECOLOGY LOS ANGELES	9189 DE GARMO AVE	3142 ft (0.6 mi) NE	At-grade	SWF/LF	SWF/LF (S104567759) - Facility is listed to be a closed waste hauling site. The type of waste accepted is not reported. LUST (S104567759) - The facility is reported to have impacted soil due to a LUST containing other solvents or non-petroleum hydrocarbons. The site status is listed as "Completed - Case Closed" as of 9/2/1997. A note in the LUST file (1000437523) notes that landfill gas has migrated beneath the site. SWF/LF (S112891096) - Facility is listed to be an active waste hauler/transfer and processing facility that accepts construction/demolition, green materials, trash, and non-hazardous industrial waste.¹	Low	X
SR14C-53	14	216	U001567742, S117662667, S117661921, S105023065, 1011976958	CURTIS SAND & GRAVEL, SOLEDAD CANYON, LANG STATION	14320 SOLEDAD CANYON RD	2566 ft (0.49 mi) NW	At-grade Covered	US MINES, HIST Cortese, LUST, CA MINES	LUST (U001567742) - Facility is listed to have impacted soil with diesel fuel due to a LUST. Site status is listed as "Completed - Case Closed" as of 5/30/1996. MINES (S117662667) - Site is listed to be an idle sand and gravel open pit. Reclamation is reported to not have been started as of 2003. Mine is reported to be approximately 168 acres. MINES (S117661921) - Site is listed to be an idle sand and gravel streambed or gravel bar skimming and pitting mine. Reclamation is reported to not have been started as of 2011. Mine is reported to be approximately 185 acres.	Med	
SR14C-54	25	388	S114608777, S109117602	D & K MILK PALACE (BEACON)	11045 N GLENOAKS BLVD	235 ft (0.04 mi) WSW	Tunnel	LUST, RGA LUST	Facility is listed to have impacted soil with gasoline. Site is listed as "Case Closed" as of 1992.	Med	
SR14C-55	26	463	S116282717, S103441524	DE GARMO LANDFILL/DEGARMO	9135 DE GARMO AVE	3101 ft (0.59 mi) NE	At-grade	LDS, WMUDS/S WAT	Site is an "Open - Inactive" land disposal site. Specifics on methane mitigation in relation to the site were not provided.	Low	
SR14C-56	26	463	S103441512	DE GARMO PIT LANDFILL	11201 RANDALL ST	2936 ft (0.56 mi) NE	At-grade	SWF/LF	Site is listed as "Closed" for landfill operations and presently is used for commercial purposes. The facility is reported to have been part of the Solid Waste Assessment Test Program.	Low	
SR14C-57	28	490	1006816060	DIXON HARD CHROME INC	11645 PENDLETON ST	969 ft (0.18 mi) SW	At-grade	ENVIROSTOR	Facility is listed to have a site assessment screening in relation to potential impacts as a results of past use. NPL and restricted use is not reported. The case was referred to the USEPA with a status date of 9/8/2011.	Med	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
SR14C-58	26	433	S109442393, S106528956	EAST VALLEY DIVERSION, LOONEY BINS/EAST VALLEY DIVERSION	11616 SHELDON ST	3115 ft (0.59 mi) NE	At-grade	SWF/LF	Facility is a limited volume transfer/processing operation for construction/demolition and industrial non-hazardous wastes.	Low	
SR14C-59	26	455	1018119626	EL DORADO SITE	9444 N EL DORADO AVE	1040 ft (0.2 mi) SW	At-grade	US BROWNFIELDS	Site is listed to be part of a TBA Cooperative Agreement for potentially impacted properties. A Phase I ESA indicated cleanup is not required for the property. Unknown media was indicated to have been affected at the site.	Low	
SR14C-60	25-26	416	1011812534, S106102747	EXPRESS METAL RECYCLING	12207 BRANFORD ST	453 ft (0.09 mi) ENE	Retained Cut / Trench	US BROWNFIELDS, ENVIROSTOR	Site is listed to be part of a TBA Cooperative Agreement for potentially impacted properties. A Phase I ESA indicated cleanup is not required for the property.	Low	
SR14C-61	28	504	1000857356, 1014202338	EXPRESS PLATING DIV MASTERWORK, MONITOR POLISHING AND PLATING	8050 SAN FERNANDO RD	45 ft (0.01 mi) NE	Tunnel	CERCLIS NFRAP, ENVIROSTOR	ENVIROSTOR (1000857356) - Site listed to be "Inactive - Needs Evaluation" for potential impacts from unspecified COCs to an unspecified media. The site status date is listed to be 9/4/2014. CERCLIS-NFRAP (1014202338) - Facility is listed to not qualify for NPL based on information updated in October 2013.	High	
SR14C-62	25	370	S102429425, S114616106, S114616439	EXXON #7-3332	12786 VAN NUYS BLVD	1022 ft (0.19 mi) WSW	Tunnel	HIST Cortese, LUST, RGA LUST	Facility is listed to have impacted soil with gasoline. Site is listed as "Case Closed" as of 1994.	Low	
SR14C-63	25-26	416	S102796761	FOOTHILL AUTO ELECTRIC	12326 MONTAGUE ST	506 ft (0.1 mi) ENE	Tunnel	ENVIROSTOR	Site is listed to have been evaluated for NPL in 2013 for historic impacts and is reported to have been referred to the EPA. No COCs were specified for the facility.	Med	
SR14C-64	23-24	304	S114727864, S114727868	FOOTHILL WASTE RECLAMINATION INC	12221 LOPEZ CANYON RD	1952 ft (0.37 mi) ESE	Tunnel	RGA LF	Facility is listed to be a landfill related site in 2005 through 2009. No additional information was provided.	Med	
SR14C-65	26	416	S111120541	FORMER TURBO PRODUCTS	12177 MONTAGUE ST	1781 ft (0.34 mi) ENE	Tunnel	ENVIROSTOR	Site is listed to have been evaluated for NPL in 2013 and is reported to have been referred to the EPA. No COCs were specified for the facility.	Med	
SR14C-66	25	416	1000726516, S114623560, S114623570, S114623574	FORTIN INDUSTRIES #610, FORTIN INDUSTRIES INC	9880 SAN FERNANDO RD	959 ft (0.18 mi) WSW	Retained Cut / Trench	HIST Cortese, LUST, SLIC, RGA LUST	Facility is listed to have impacted groundwater (uses other than drinking water) with copper. Case is listed as "Completed - Case Closed" as of 1996.	Med	
SR14C-67	26	416	1011812539	GLENOAKS MOBILE MANOR	10471 GLENOAKS BLVD	2365 ft (0.45 mi) ENE	Tunnel	US BROWNFIELDS	Site is listed to be part of a TBA Cooperative Agreement for potentially impacted properties.	Low	
SR14C-68	25	396	S110493872	GOLDEN STATE MAGNETIC & PENETRANT LAB	12770 PIERCE ST, #7	1082 ft (0.2 mi) WSW	Tunnel	ENVIROSTOR	Site is listed to have been part of a tiered permit and is reported to have been referred to another agency. No COCs were specified for the facility.	Low	
SR14C-69	26-28	463	S105911516	GOODWIN CHEMICAL	9007 NORRIS	2145 ft (0.41 mi) NE	At-grade	SLIC	The facility is listed to have impacted soil with PCE due to storage at the site. Various phases of site assessment were completed from 1990 through 2001. The LARWQCB issued a notice of "No Further Action" on 12/14/2001.	Low	
SR14C-70	26	421	S103985140, S114633701, S114633704, 1000404171, S102628856,	H.R. TEXTRON, H.R. TEXTRON - GLENOAKS	10445 GLENOAKS BLVD	1996 ft (0.38 mi) ENE	Tunnel	CERCLIS NFRAP, HIST Cortese, LUST, SLIC, RGA LUST	HIST CORTESE/LUST (S103985140) - Facility is listed to have impacted soils with solvents due to a LUST at the site. Current case status is listed to be "Completed - Case Closed" as of 3/1/1996. SLIC (S103985140) - Facility was evaluated by the LARWQCB in relation to a chromium VI source assessment for impacts to an aquifer used for	Low	X

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
			S114633700, 1015732716, S105025438						drinking water the area (San Fernando Valley). Subsequently, a work plan was prepared for the site in 2004 to address concerns. The facility was determined to need "No Further Requirements" in relation to the investigation in 2004 and is listed as "Completed - Case Closed" as of 12/22/2014. LUST (1000404171) - Facility is listed to have impacted soil with waste/motor/hydraulic/lubricating oil. Site status is listed as "Completed - Case Closed" as of 3/22/2016. LUST (S102628856) - Facility is listed to have impacted soils with solvents. Site status is listed as "Case Closed" as of 3/1/1996. CERCLIS-NFRAP (1015732716) - Facility is listed to not qualify for NPL based on information updated in October 2013. ¹		
SR14C-71	23-24	333	S107736420	HANSEN FLOOD CON BAS/D		2116 ft (0.4 mi) ESE	Tunnel	ENVIROSTOR	Facility is listed as "Inactive - Needs Evaluation" as of 7/1/2005 as a military evaluation. No COCs were identified for the site.	Med	
SR14C-72	25	416	S108199262	HAULING SOLUTIONS INC	9871 SAN FERNANDO RD	1120 ft (0.21 mi) WSW	Retained Cut / Trench	SWF/LF	Facility is listed as active waste hauling business. Additional information not provided.	Low	
SR14C-73	28	586	S101586790	HENSLER GENERAL CONSTRUCTION	7550 WHEATLAND AVE	2003 ft (0.38 mi) SW	Tunnel	SLIC	The site is listed as Completed - Case Closed as of 12/22/2014 for VOC contamination that has impacted an aquifer used for drinking water supply.	Low	
SR14C-74	28	504	1017816849	HOLLIDAY ROCK CO	11420 PENROSE ST	1182 ft (0.22 mi) SW	Retained Cut / Trench	TRIS	Facility is listed to have notified the EPA under SARA Title III, Section 313. Lead compounds (three pounds per year) are reported to be produced at the site. In addition, the facility is listed in the EPA's index system in relation to release of toxic chemicals to air, water, land, or are transported off-site.	Low	
SR14C-75	26	416	S105628352	HR TEXTRON	12137 MONTAGUE ST	2167 ft (0.41 mi) ENE	Tunnel	ENVIROSTOR	Facility is listed to have been evaluated for impacts in relation to historical usage. No confirmed COCs are reported for the site. A status of "Inactive - Needs Evaluation" is reported as of 1/30/2001.¹	Med	X
SR14C-76	26	463	1000428465	INDUSTRIAL BATTERY ENGINEERING	9121 DE GARMO AVE	3092 ft (0.59 mi) NE	At-grade	SLIC	Facility was evaluated by the LARWQCB in 2001 in relation to a chromium VI source assessment for the area. The facility was determined to need "No Further Requirements" in relation to the investigation in 2003 as is listed as "Completed - Case Closed" as of 12/22/2014.	Low	
SR14C-77	26	416	1011812541	INDUSTRIAL-BUSINESS PARK	12085 BRANFORD ST	1773 ft (0.34 mi) ENE	Retained Cut / Trench	US BROWNFIELDS	Site is listed to be part of a TBA Cooperative Agreement for potentially impacted properties. A Phase I ESA indicated cleanup is not required for the property.	Low	
SR14C-78	23	314	1008371158	J L SHEPHERD AND ASSOC	1010 ARROYO AVE	4067 ft (0.77 mi) WNW	Tunnel	MLTS	Facility was evaluated for the NPL in relation to a historical evaluation and determined not to be eligible as of 1/30/2001. Site restrictions are not reported for the facility. The site is currently listed as "Inactive - Needs Evaluation."	Low	
SR14C-79	26	416	S118504792, S108749114	JESSE'S PLATING (FORMER HVC)	12229 MONTAGUE ST	1332 ft (0.25 mi) ENE	Tunnel	SLIC, ENVIROSTOR	SLIC (S118504792) - Facility is listed to have impacted soil, soil vapor, and an aquifer used for drinking water supply with PCE, TCE, and chromium VI. Site status is listed to be "Open - Site Assessment" as of 2/11/2016. ENVIROSTOR (S108749114) - Facility is listed as "Inactive - Needs Evaluation" as of 9/8/2011. Past use of metal finishing/metal plating/metal plating - chrome is indicated for the facility and no COCs are specified for the site. ¹	Med	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
SR14C-80	6	140	S114637448, S102431920	JILL R RATCLIFFE	36200 SIERRA HWY, N, SIERRA HWY	452 ft (0.09 mi) W	At-grade	HIST Cortese, LUST, RGA LUST	Facility is listed to have impacted soil with gasoline due to a LUST. The site status is reported as "Completed - Case Closed" as of 11/21/1991.	Med	
SR14C-81	26	463	S106102586	KC NISSAN AUTO DISMANTLING	10967 TUXFORD ST	4334 ft (0.82 mi) NE	At-grade	SLIC	Facility was evaluated by the LARWQCB in 2001 in relation to a chromium VI source assessment for the area. The facility was determined to need "No Further Requirements" in relation to the investigation in 2003 and is listed as "Completed - Case Closed" as of 11/29/2012.	Low	
SR14C-82	28	463	S103674790	KENWALT DIE CASTING CO	8719 BRADLEY AVE	1357 ft (0.26 mi) NE	Retained Cut / Trench	SLIC	Facility was evaluated by the LARWQCB in 2001 in relation to a chromium VI source assessment for the area. The facility was determined to need "No Further Requirements" in relation to the investigation in 2003 and is listed as "Completed - Case Closed" as of 12/22/2014.	Low	
SR14C-83	26	459	S112186489	LA CITY DWP PENDLETON (PENDLETON STREET LANDFILL)	11000 PENDLETON ST	5115 ft (0.97 mi) NE	At-grade	LDS	Facility is listed as a land disposal site with status of "Completed - Case Closed" as of 2012. However, VOC and solvent concentrations were reported during groundwater monitoring at the facility with flow migration toward the south.	Low	
SR14C-84	21	242	S103891221	LA CO FD CAMP #9	21521 SAND CANYON RD	2499 ft (0.47 mi) ENE	Tunnel	LUST	Facility is listed to have impacted soils with other solvents or non-petroleum hydrocarbons due to a LUST. The site status is reported as "Completed - Case Closed" as of 3/10/1998.	Low	
SR14C-85	18	239	S109548241	LA DEF AREA HOUS SITE		2449 ft (0.46 mi) WNW	Tunnel	ENVIROSTOR	Facility was evaluated for the NPL in relation to a military evaluation and determined not to be eligible as of 7/1/2005. Site restrictions are not reported for the facility. The site is currently listed as "Inactive - Needs Evaluation."	Med	
SR14C-86	26	433	S101588330, 1001491848	LA DEPARTMENT OF WATER/POWER, TRUESDALE CENTER	11791 TRUESDALE CENTER	3491 ft (0.66 mi) NE	At-grade	CERCLIS NFRAP, VCP	VCP/ENVIROSTOR - Facility is reported to have entered a voluntary cleanup agreement in 2000 due to PCB, TPH-d, and TPH-g impacts to soil as a result of use as an electrical generation/substation. Current site status is listed as "Active."	Low	
SR14C-87	28	504	S106484855	LADO MFG CO	11400 LUDDINGTON ST, #A	448 ft (0.08 mi) SW	Retained Cut / Trench	SLIC	Facility was evaluated by the LARWQCB in 2001 in relation to a chromium VI source assessment for the area. The facility was determined to need "No Further Requirements" in relation to the investigation in 2014 as is listed as "Completed - Case Closed."	Low	
SR14C-88	14	219	S117661920	LANG STATION - SWEETWATER	14212 LANG STATION RD	2112 ft (0.4 mi) NW	At-grade Covered	CA MINES	Facility is listed as an open pit, plant, or mill sand and gravel mine. Mine status listed as "Closed, No Intent to Resume" as of 2014. The mine is listed to be 22.8 acres in size.	Med	
SR14C-89	26	416	U001567439, S114728243, S109821476, S111075979	LEDGER LANDFILL, GLENOAKS DUMP, LEDGER #2	10403 GLENOAKS BLVD	2486 ft (0.47 mi) ENE	Tunnel	SWF/LF, ENVIROSTOR, RGA LF	ENVIROSTOR (U001567439) - Facility was evaluated for the NPL and determined not to be eligible as of 1/22/2001. Site status is listed to be "Inactive - Needs Evaluation." SWF/LF (S111075979) - Facility is listed to be a closed landfill that accepted commercial, inert, liquid, and residential waste. Current use is reported to be commercial properties and a parking lot.	Med	
SR14C-90	26	416	S116282712, S103441358	LEDGER NO. 2	GLENOAKS BLVD & MONTAGUE ST	2534 ft (0.48 mi) ENE	Tunnel	LDS, WMUDS/S WAT	Facility is listed to be a land disposal site with a status of "Open - Inactive" as of 12/24/2013. Limited additional information was provided.	Med	
SR14C-91	25	416	S109821545	LEWIS VISCO - VALLEY IRON & METAL COMPAN	9050 AND 9116 BRADLEY AVE	261 ft (0.05 mi) WSW	Tunnel	SWF/LF	Facility is listed to be a SWF/LF site with limited additional information reported.	High	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
SR14C-92	26	433	1017817032	LEX PRODUCTS WEST	11847 SHELDON ST	767 ft (0.15 mi) NE	Elevated / Aerial Structure	TRIS	Facility is listed to have notified the EPA under SARA Title III, Section 313. Copper (up to 7,552 pounds per year) are reported to be produced at the site and subject to waste broker disposal. In addition, the facility is listed in the EPA's index system in relation to release of toxic chemicals to air, water, land, or off-site transport.	Med	
SR14C-93	28	463	S116282735	LIVINGSTON - GRAHAM SUN VALLEY SANITARY LANDFILL	ADJACENT TO BRADLEY WEST	82 ft (0.02 mi) SW	At-grade	LDS	Facility is listed as a land disposal site with status of "Open - Inactive" as of 2013. The landfill is comingled with the Bradley West landfill and is reported to have continual groundwater and methane monitoring performed in relation to operations.	High	
SR14C-94	26	467	S114644511, S114644510, 1000591737, S114644509	LIVINGSTON GRAHAM BLUE DIAMOND	11720 WICKES ST	450 ft (0.09 mi) NE	At-grade	HIST Cortese, LUST, RGA LUST	HIST CORTESE/LUST (1000591737) - Facility is listed to have impacted soil with aviation fuel due to a LUST. Site status is reported to be "Completed - Case Closed" as of 11/13/1997.	Med	
SR14C-95	26	433	1014202344	LNL ANODIZING	9900 GLENOAKS BLVD, #3	3478 ft (0.66 mi) NE	At-grade	CERCLIS NFRAP	Facility is reported to have been investigated in relation to the San Fernando Valley Superfund Site. The site was determined to not qualify for the NPL based on information provided as of 2010.	Low	
SR14C-96	28	490	S106484456	LOCKHEED A-1, B85, LOTS 16, 16A	3220 W THORTON	648 ft (0.12 mi) SW	At-grade	SLIC	Site is listed as "Open - Site Assessment" as of 1990. An aquifer used for drinking water supply beneath the facility is listed to have been impacted by chromium and VOCs.¹	Med	X
SR14C-97	28	561	S114644699, S102432702	LOCKHEED PLANT B-6-F	7575 SAN FERNANDO RD N	257 ft (0.05 mi) SW	Tunnel	LUST, RGA LUST	Facility is listed to have impacted an aquifer used for drinking water supply with diesel fuel. Current site status is listed as "Completed - Case Closed" as of 1/1/1996.	High	
SR14C-98	26	433	S111075989	LOONEY BINS/SPACCARELLI HAULING	11616 1/2 SHELDON ST	3114 ft (0.59 mi) NE	At-grade	SWF/LF	Facility is listed as an active waste hauler. Limited additional information is provided.	Low	
SR14C-99	23	290	S107736633	LOPEZ FLOOD CONTROL BASIN		661 ft (0.13 mi) WNW	Tunnel	ENVIROSTOR	Facility was evaluated for the NPL in relation to a military evaluation and determined not to be eligible as of 7/1/2005. Site restrictions are not reported for the facility. The site is currently listed as "Inactive - Needs Evaluation."	Med	
SR14C-100	14	213	1000360639, S101480692, 1006494653	LUBRICATION COMPANY OF AMERICA	12500 LANG STATION RD	1315 ft (0.25 mi) NW	At-grade Covered	CERCLIS NFRAP, CORRACTS, RCRA-TSDF, HIST Cal-Sites, Cortese, HIST Cortese, ENVIROSTOR, RESPONSE, CA Bond Exp. Plan	CERCLIS - NFRAP (1000360639) - Site assessed for contamination in 2010 and is listed as NFRAP due to not qualifying for the NPL based on existing information. HIST CORTESE/CORTESE (S101480692) - Facility is listed to be an active State Response site with a status date of 2/14/2012. RESPONSE/ENVIROSTOR (S101480692) - Facility is listed to be an active State Response facility with numerous confirmed COCs (PCBs, PAHs, VOCs, PCE, TCE, TPH, BTEX) to soil, soil vapor, and groundwater used from other uses from prior use as a used oil recycling facility. Cleanup is reported to still be in progress and include prior removal of 358 drums of hazardous waste in 1990, 19 hazardous waste tanks and 55,250 gallons of liquid/sludge and solid hazardous waste in 1992, 150 ASTs, 1,400 tons of solid hazardous waste and 83,000 gallons of liquid hazardous waste in 2002, and removal of numerous other hazardous waste materials to date. Remediation is ongoing at the facility. HIST Cal-Sites (1006494653) - Facility is listed to be an active site in relation to historic usage of the site as a waste oil recycling facility as well as an oil refinery.	Med	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
SR14C-101	28	586	S113003727	LYN-TRON INC	3150 N DAMON WAY	2502 ft (0.47 mi) SW	Tunnel	SLIC	Facility is reported to have been investigated in relation to the San Fernando Valley Superfund Site due to manufacturing of metal and non-metal fasteners used in relation to the aerospace industry. Environmental assessment of the site was performed in 2013 in relation to a LARWQCB Order. The assessment concluded that no chromium and or other VOCs were used at the Site. A notice of "No Further Requirements" was issued in respect to soils only in 2013. The site status is listed as "Completed - Case Closed" as of 12/16/2013.	Low	
SR14C-102	25-26	384	S107736650	MACLAY ES ADDTION, SITE 1 5640040	11071 BORDEN AVE	1327 ft (0.25 mi) ENE	Tunnel	ENVIROSTOR	Facility was evaluated for the NPL in relation to a school evaluation and determined not to be eligible as of 10/2/2006. Site restrictions are not reported for the facility. The site is currently listed as "No Further Action."	Low	
SR14C-103	25-26	384	S105754243	MACLAY NEW PRIMARY CENTER	11035, 11063 & 11051 BORDEN AVE	1409 ft (0.27 mi) ENE	Tunnel	ENVIROSTOR	Facility was evaluated for the NPL in relation to a school evaluation and determined not to be eligible as of 10/6/2003. Site restrictions and confirmed COCs are not reported for the facility. The site is currently listed as "No Further Action."	Low	
SR14C-104	28	504	S105026814, S114647195, U001567798, S104160057	MANNING FUEL INC, CEE JAY MACHINE	8407 TUJUNGA AVE, 8407 TUJUNGA	1062 ft (0.2 mi) SW	Retained Cut / Trench	HIST Cortese, LUST, RGA LUST	LUST (U001567798) - Facility is listed to have impacted soil with aviatational fuel as a result of a LUST. Site status is listed as "Completed - Case Closed" as of 2/27/1996. LUST (S104160057) - Facility is listed to have impacted soils with an unspecified COC. Site status is listed as "Case Closed" as of 2/27/1996.	Low	
SR14C-105	26	416	S118504711	MAYONI ENTERPRISES INC	10340 GLENOAKS BLVD	2538 ft (0.48 mi) ENE, groundwater gradient not reported but anticipated to be to south, southeast in relation to regional flow	Tunnel	SLIC	Facility is listed to have impacted an aquifer used for drinking water, soil, and soil vapor with 1,1,1-TCA, 1,4-dioxane, and PCE. Site status is currently listed as "Open - Site Assessment" as of 12/16/2015.	Med	
SR14C-106	25	454	S106484866, 1011961419	MILES CHEMICAL COMPANY INC	12801 RANGOON ST	4631 ft (0.88 mi) SW	At-grade	CERCLIS NFRAP, SLIC	SLIC (S106484866) - Facility was evaluated by the LARWQCB in 2004 in relation to a chromium VI source assessment for potential impacts to an aquifer used for drinking water in the area. The facility was determined to need "No Further Requirements" in relation to the investigation in 2004 as is listed as "Completed - Case Closed" as of 7/15/2004. ENVIROSTOR (S106484866) - Facility is listed to be evaluated for impacted due to historic use of the site as a transfer station or transportation - warehouse. Soil and soil vapor are listed as potential impacted media. Site status is listed as "No Further Action" as of 6/15/2011. CERCLIS-NFRAP (1011961419) - Facility is listed to not qualify for the NPL based on existing information.	Low	
SR14C-107	23-24	340	S109548322	MILLER STEPHENSON CHEMICAL CO	12261 FOOTHILL BLVD	1294 ft (0.25 mi) ESE	Tunnel	ENVIROSTOR	Facility is listed to have been evaluated for impacts in relation to potential soil and soil vapor. No confirmed COC are reported for the site. A status of "No Further Action" is reported as of 9/8/2011.	Low	
SR14C-108	23-24	317	S113096047, S102360706, S107144883, S106528955, S109286180, S103866717	MM LOPEZ ENERGY LLC, LA CITY, BUREAU OF SANITATION, LOPEZ CANYON LANDFILL, LOPEZ CANYON ENVIRONMENTAL CENTER	11950 LOPEZ CANYON RD	1862 ft (0.35 mi) ESE, groundwater flow to the south-southwest	Tunnel	SWF/LF, LDS,WMUDS/S WAT	SWF/LF (S113096047) - Facility is reported to be an active chipping and grinding operation for green materials. SWF/LF (S102360706) - Facility is reported to be a closed (closure date 6/30/1996) solid waste landfill that accepted mixed municipal waste. Quarterly inspections are reported. SWF/LF (S107144883) - Facility is listed to be a closed class III landfill (closed 7/1/1996) consisting of approximately 166 acres. The landfill is	Med	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
									listed to still be producing methane as a result of prior use, however, the facility is a landfill gas to energy project that utilized the methane for energy production for residences in the area. Methane extraction in relation to energy production continues to be performed at the site today and an active SWF/LF composting operation (S106528955) for green waste is also present. LDS (S109286180) - Facility is listed to be "Open - Verification Monitoring" in relation to groundwater, soil, and soil vapor impacts from previous use of the property as a land disposal site.		
SR14C-109	25-26	416	S111120538	MOC PRODUCTS	12306-12308 MONTAGUE ST	651 ft (0.12 mi) ENE	Tunnel	ENVIROSTOR	Facility is listed to have been evaluated for impacts. No confirmed COCs are reported for the site. A status of "Refer: EPA" is reported as of 6/27/2013.	Med	
SR14C-110	25-26	416	1000128768, S114655820, S114655821	MOC PRODUCTS COMPANY INC	12306 MONTAGUE ST	651 ft (0.12 mi) ENE	Tunnel	TRIS, HIST Cortese, LUST, RGA LUST	TRIS (1000128768) - Facility has multiple listings under that database. A LUST is reported to have impacted soil with aviation fuel. Site status is reported to be "Completed - Case Closed" as of 4/28/1997. Facility is listed to have notified EPA under SARA Title II, Section 313. N-methyl-2-pyrrolidone is reported to be used/produced on the site. Toluene, C.I. food red 15, methanol, ethylbenzene, certain glycol ethers, zinc compounds, PAHs, xylene (mixed isomers) and ethylene glycol are also reported to be used/produced at the facility. The site is also reported to be in multiple other databases.	Low	
SR14C-111	25-26	416	1011812545	MOC THE PROFESSIONAL CHOICE	12307 MONTAGUE ST	618 ft (0.12 mi) ENE	Tunnel	US BROWNFIELDS	Site is listed to be part of a TBA Cooperative Agreement for potentially impacted properties. A Phase I ESA indicated cleanup is reported for the property.	Low	
SR14C-112	26	451	U001567802, S114656201, S104160058, S114656202	MONARCH RECORD MFG CORP INC	9545 SAN FERNANDO RD	418 ft (0.08 mi) SW	At-grade	HIST Cortese, LUST, RGA LUST	HIST CORTESE/LUST (U001567802) - Facility is listed to have impacted soil with gasoline due to a LUST. Site status is listed as "Completed - Case Closed" as of 4/30/1987. LUST (S104160058) - Same information as provided above.	Low	
SR14C-113	23	253	S103978520	MOUNTAIN VIEW GATED VILLAS	12831 HUBBARD ST	2601 ft (0.49 mi) WNW	Tunnel	VCP, ENVIROSTOR	Facility is reported to be part of the VCP program with a status of "No Further Action" as of 4/19/2000 due to illegal dumping and medical related incineration. Soil was confirmed to be impacted with copper and compounds, furans, and arsenic dioxin.	Low	
SR14C-114	26-28	463	1008381793	NATIONAL READY MIX CONCRETE CO	9010 NORRIS AVE	2193 ft (0.42 mi) NE	At-grade	TRIS	Facility is listed to have notified the EPA under SARA Title III, Section 313. Lead compounds (up to 7.1 pounds per year) are reported to be produced at the site.	Low	
SR14C-115	26	416	1011812546	NEWHALL JUNK & SALVAGE RECYCLERS	12011 BRANFORD ST	2422 ft (0.46 mi) ENE	Retained Cut / Trench	US BROWNFIELDS	Facility is listed to have had a Phase I ESA performed in relation to assessment of the site. The Phase I ESA was performed under an US-EPA Brownfields Assessment Cooperative Agreement. Results of the Phase I ESA were not reported.	Low	
SR14C-116	14	222	S107736890	NIKE BATTERY - LANG STATION		45 ft (0.01 mi) NW	At-grade Covered	ENVIROSTOR	Facility was evaluated for the NPL in relation to a military evaluation and determined not to be eligible as of 7/1/2005. Site restrictions and confirmed COCs are not reported for the facility. The site is currently listed as "Inactive - Needs Further Evaluation." Historical information indicates that the "Nike" facilities were previously used as Minute Man missile launch installations in the 1950s to 1960s. It is reported that nuclear missiles were	High	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
									stored, assembled, fueled, and armed in a fortified bunker (battery) in a subterranean bunker.		
SR14C-117	20	244	S109548330	NIKE BTRY - LOS PINETOS		1977 ft (0.37 mi) WSW	Tunnel	ENVIROSTOR	Facility was evaluated for the NPL in relation to a military evaluation and determined not to be eligible as of 7/1/2005. Site restrictions and confirmed COCs are not reported for the facility. The site is currently listed as "Inactive - Needs Further Evaluation." Historical information indicates that the "Nike" facilities were previously used as Minute Man missile launch installations in the 1950s to 1960s. It is reported that nuclear missiles were stored, assembled, fueled, and armed in a fortified bunker (battery) in a subterranean bunker.	Med	
SR14C-118	8-15	201	S109548329	NIKE BTRY - MAGIC MT		2232 ft (0.42 mi) NNW	At-grade	ENVIROSTOR	Facility was evaluated for the NPL in relation to a military evaluation and determined not to be eligible as of 7/1/2005. Site restrictions and confirmed COCs are not reported for the facility. The site is currently listed as "Inactive - Needs Further Evaluation." Historical information indicates that the "Nike" facilities were previously used as Minute Man missile launch installations in the 1950s to 1960s. It is reported that nuclear missiles were stored, assembled, fueled, and armed in a fortified bunker (battery) in a subterranean bunker.	Med	
SR14C-119	26	416	1011812547	NUMBER 1 ELECTRIC	12051 BRANFORD ST	2093 ft (0.4 mi) ENE	Retained Cut / Trench	US BROWNFIELDS	Facility is listed to have had a Phase I ESA performed in relation to assessment of the site. The Phase I ESA was performed under an US-EPA Brownfields Assessment Cooperative Agreement. Results of the Phase I ESA were not reported.	Low	
SR14C-120	28	525	S106484857	OCCUPANT-AUTO SHOP	8431 TELFAIR AVE	1685 ft (0.32 mi) SW	Retained Cut / Trench	SLIC	Facility was evaluated by the LARWQCB in 2001 in relation to a chromium VI source assessment for the area. The facility was determined to need "No Further Requirements" in relation to the investigation in 2014 as is listed as "Completed - Case Closed."	Low	
SR14C-121	25	364	1018119710	ORNELAS SITE	11340 N GLENOAKS BLVD	2010 ft (0.38 mi) WNW	Tunnel	US BROWNFIELDS	Facility is listed to have had a Phase I ESA performed in relation to assessment of the site. The Phase I ESA was performed under an US-EPA Brownfields Assessment Cooperative Agreement. Results of the Phase I ESA were not reported.	Low	
SR14C-122	10	176	S114665723, S101295489, S114665724	PACIFIC BELL	3013 SIERRA HWY W	1999 ft (0.38 mi) SSW	Tunnel	HIST Cortese, LUST, RGA LUST	HIST CORTESE/LUST (S101295489) - Facility is listed to have impacted soil with diesel fuel due to a LUST. Site status is listed as "Completed - Case Closed" as of 5/20/1991.	Low	
SR14C-123	28	504	S110060769, S114666067, S106517286, S114666066	PACIFIC ENERGY	8309 TUJUNGA AVE	1232 ft (0.23 mi) SW	Retained Cut / Trench	HIST Cortese, LUST, RGA LUST	HIST CORTESE/LUST (S110060769) - Facility is listed to have impacted soil with aviation fuel due to a LUST. Site status is listed as "Completed - Case Closed" as of 10/6/1997.	Low	
SR14C-124	26	416	1016170548, 1000252793	PACIFIC PLATING	12113 BRANFORD ST	1444 ft (0.27 mi) ENE	Retained Cut / Trench	CERCLIS NFRAP, ENVIROSTOR	CERCLIS-NFRAP (1016170548) - Site was assessed for contamination in 2013 and is listed as NFRAP due to not qualifying for the NPL based on existing information. ENVIROSTOR (1000252793) - Facility is listed to be part of a Tiered Permit with a status of "Refer: Other Agency." Furthermore, the site is listed as "Inactive - Action Required" with a status date of 9/8/2011.	Med	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
SR14C-125	20	241	1003878409	PARKER AIRCRAFT CO	25977A SAND CYN	4082 ft (0.77 mi) WNW	Tunnel	CERCLIS NFRAP	Site assessed for contamination in 2003 and is listed as NFRAP due to not qualifying for the NPL based on existing information.	Low	
SR14C-126	26	416	1000229142, 1012043061	PB FIBERGLASS PRODUCTS INC	12177 BRANFORD ST	856 ft (0.16 mi) ENE	Retained Cut / Trench	CERCLIS NFRAP, ENVIROSTOR	ENVIROSTOR (1000229142) - Facility was evaluated for the NPL and determined not to be eligible as of 9/5/2014. Site status is listed to be "Inactive - Needs Evaluation." Numerous PAH compounds are listed as confirmed COCs for the site to soil. CERCLIS-NFRAP (1012043061) - Site was assessed for contamination in 2013 and is listed as NFRAP due to not qualifying for the NPL based on existing information.	Med	
SR14C-127	26	463	1006932050	PDQ AUTO SALVAGE	10975 TUXFORD ST	4250 ft (0.8 mi) NE	At-grade	CERCLIS NFRAP, LEAD SMELTERS	Site assessed for contamination in 1979 through 1982 and is listed as NFRAP due to not qualifying for the NPL based on existing information.	Low	
SR14C-128	26	463	S109821518, S108432318	PENDLETON STREET DUMP	11050 PENDLETON ST	3673 ft (0.7 mi) NE	At-grade	SWF/LF	SWF/LF (S108432318) - Facility is listed to be a closed solid waste landfill facility. Limited additional information was provided for site. SWF/LF (S109821518) - Facility is listed to be an active limited volume transfer/processing operation for metal, mixed municipal, tire, passenger, and wood waste.	Low	
SR14C-129	28	463	S109117694	PENHALL COMPANY	11182 W PENROSE AVE	959 ft (0.18 mi) NE	Retained Cut / Trench	LUST	Soil is reported to have been impacted from a LUST of diesel fuel at the facility. Current status listed as "Completed - Case Closed" as of 2012.	Low	
SR14C-130	28	504	S102360907	PENROSE PIT	8251 - 8301 TUJUNGA AVE	1354 ft (0.26 mi) SW	Retained Cut / Trench	SWF/LF	Site is listed as a closed solid waste disposal facility for residential/industrial/commercial waste. Facility was closed in 1987.	Med	
SR14C-131	28	504	S109287258, 1001115478	PENROSE SANITARY LANDFILL, PENROSE LANDFILL GAS CONVERSION LLC	8301 TUJUNGA AVE	1367 ft (0.26 mi) SW	Retained Cut / Trench	CERCLIS NFRAP, SLIC, LDS, ENVIROSTOR	An aquifer used for drinking water supply is reported to have been impacted from a LUST of diesel fuel at the facility. Current status listed as "Completed - Case Closed" as of 2012.	Low	
SR14C-132	28	561	1000415250	PHOTO CHEM ETCH CORP	7710 SAN FERNANDO RD	30 ft (0.01 mi) SW	Tunnel	SLIC, ENVIROSTOR	The site is listed as "Completed - Case Closed" as of 12/22/2014 for VOC contamination that has impacted an aquifer used for drinking water supply.	Low	
SR14C-133	25-26	416	874580, 93328129, 1011812550	PMC		126 ft (0.02 mi) ENE	Retained Cut / Trench	ERNS, US BROWNFIELDS	ERNS (874580) - Facility is reported to have a release to soil. In 1987, a truck had a fuel tank plug knocked out when it ran over a steel plate in the road resulting in 100 gallons of diesel fuel being spilled. The fire department responded to the scene and cleanup is not planned in relation to the spill. ERNS (93328129) - Facility is reported to have an emergency release to the soil. In 1993, a sight glass on a storage tank broke resulting in 25,000 pounds of trichlorofluoromethane being spilled to surrounding soil and the atmosphere. BROWNFIELD (1011812550) - Facility is listed to have had a Phase I ESA performed in relation to assessment of the site. The Phase I ESA was performed under an US-EPA Brownfields Assessment Cooperative Agreement. Results of the Phase I ESA were not reported.	High	
SR14C-134	26	416	1011812551	PRE-FAB GRANITE COUNTERTOPS	12065 BRANFORD ST	1962 ft (0.37 mi) ENE	Retained Cut / Trench	US BROWNFIELDS	Facility is listed to have had a Phase I ESA performed in relation to assessment of the site. The Phase I ESA was performed under an US-EPA Brownfields Assessment Cooperative Agreement. Results of the Phase I ESA were not reported.	Low	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
SR14C-135	28	504	1017428034, 1000297142	PRIME PLATING INC	11321 GOSS ST	797 ft (0.15 mi) SW	Retained Cut / Trench	TRIS, SLIC	SLIC - An aquifer used for drinking water supply is reported to have been impacted from chromium and VOCs. Current status listed as "Completed - Case Closed" as of 1997. TRIS - The facility is listed to use toxic chemicals (cyanide/lead/nitrate compounds) which are reported to be transported offsite for disposal.	Med	
SR14C-136	26	433	1016112148	QEP INC	11912 SHELDON ST	289 ft (0.05 mi) NE	Elevated / Aerial Structure	TRIS	Facility is listed to have notified the EPA under SARA Title III, Section 313. Styrene is reported to be released to the air.	Med	
SR14C-137	26	416	S110494226	QUALITY FINISHING INC	12109 BRANFORD ST, SUITE D2 & D4-D6	1543 ft (0.29 mi) ENE	Retained Cut / Trench	ENVIROSTOR	Facility is listed to be part of a tiered permit and referred to another agency. Site is not subject to the NPL or land use restrictions.	Low	
SR14C-138	26	416	1011812553	QUALITY USED AUTO PARTS	12055 A BRANFORD ST	1922 ft (0.36 mi) ENE	Retained Cut / Trench	US BROWNFIELDS	Facility is listed to have had a Phase I ESA performed in relation to assessment of the site. The Phase I ESA was performed under an US-EPA Brownfields Assessment Cooperative Agreement. Results of the Phase I ESA were not reported.	Low	
SR14C-139	28	504	1001217364	R L ANODIZING	11331 PENROSE ST	542 ft (0.1 mi) SW	Retained Cut / Trench	ENVIROSTOR	Facility was evaluated in 2012. Site is listed to not be NPL eligible and not have land restrictions. A status of "No Further Action" was issued on 7/9/2013.	Low	
SR14C-140	14	207	1011125816	RASMUSSEN R&R INC		5183 ft (0.98 mi) NW	Tunnel	US MINES	Facility is listed to be an active non-coal mining operation. Twelve violations of unknown nature were issued for the facility between 2009 and 2015.	Low	
SR14C-141	14	220	S117662420	RASMUSSEN SOLEDAD ROCK QUARRY	12000 SOLEDAD CYN. RD	4462 ft (0.85 mi) SE	At-grade	CA MINES	Facility is listed to be an active sand and gravel quarry mine. Reclamation is report to be in progress as of 2014.	Low	
SR14C-142	26-28	463	1014202571	RECYCLED BASE MATERIALS INC		2320 ft (0.44 mi) NE	At-grade	US MINES	Facility is listed as an abandoned non-coal mining operation as of 2010.	Med	
SR14C-143	10	164	1015768452	RED ROVER MINE 2 LLC		914 ft (0.17 mi) SSE	At-grade	US MINES	Facility is listed to be an abandoned non-coal mining operation. Twenty violations of unknown nature were issued for the facility between 2012 and 2013.	High	
SR14C-144	25-26	416	S111076059, 1006932051, S117038718	REDUCE PRICE DISPOSAL, BRANFORD AUTO WRECKING	12276 BRANFORD ST	29 ft (0.01 mi) ENE	Retained Cut / Trench	CERCLIS NFRAP, LEAD SMELTERS, SWF/LF, ENVIROSTOR	SWF/LF (S111076059) - Facility is listed as an active waste hauler. CERCLIS-NFRAP (1006932051) - Site was assessed for contamination in 2013 and is listed as NFRAP due to not qualifying for the NPL based on existing information. LEAD SMELTER (1006932051) - Facility is listed to not be on the NPL with a primary site function of recycling. ENVIROSTOR (S117038718) Facility is listed to be evaluated for impacts. Site status is listed as "Inactive - Needs Evaluation" as of 8/31/2014.	High	
SR14C-145	25	416	S118504837, 1011812525	REYNOLDS PRINTASIGN (FORMER), CADILLAC KING AUTO DISMANTLING	9830 SAN FERNANDO RD	837 ft (0.16 mi) WSW	Retained Cut / Trench	US BROWNFIELDS, SLIC	SLIC (S118504837) - Facility is listed to have operated from 1955 through 1989, manufacturing equipment for making signs. The operations involved the use and storage of VOCs, including TCE and 1,1,1-TCA. Site usage and storage is reported to have impacted the subsurface. Site status is listed as "Open - Site Assessment" as of 3/23/2016. BROWNFIELDS (1011812525) - Facility is listed to have had a Phase I ESA performed in relation to assessment of the site. The Phase I ESA was performed under an US-EPA Brownfields Assessment Cooperative Agreement. Results of the Phase I ESA were not reported.	Med	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
SR14C-146	26	472	S102808013	RICHARD E BYRD HIGH SCHOOL	9171 TELFAIR AVE	1589 ft (0.3 mi) SW	At-grade	ENVIROSTOR	Facility was evaluated for the NPL in relation to a school evaluation and determined not to be eligible as of 11/4/2011. Site restrictions are not reported for the facility. The site is currently listed as "No Further Action."	Low	
SR14C-147	25-26	416	S104572887, S114677632, S104160034, 2002033528, S114677633	ROADWAY EXPRESS INC	12355 MONTAGUE ST	142 ft (0.03 mi) ENE	Tunnel	HMIRS, HIST Cortese, LUST, RGA LUST	HIST CORTESE/LUST (S104572887/S104160034) - Facility is listed to have impacted an aquifer used for drinking water supply with gasoline due to a LUST. Site status is reported to be "Completed - Case Closed" as of 9/4/1996. HMIRS (2002033528) - Release of approximately 5.5-gallons of nitric oxide compressed gas is reported as a result of a damaged cylinder in 2002. The fire department is reported to have responded and emptied the remaining product from the cylinder.	High	
SR14C-148	26	463	1003879001	ROIC/SUN VALLEY	9068 DE GARMO AVE	3114 ft (0.59 mi) NE	At-grade	CERCLIS NFRAP, LIENS 2, PRP	CERCLIS-NFRAP - Site is listed as "removal only site (no site assessment work needed)." A lien was recorded against the property on 9/30/1987.	Low	
SR14C-149	26	416	1011812556	ROSS BAKER TOWING INC	12025 BRANFORD ST	2307 ft (0.44 mi) ENE	Retained Cut / Trench	US BROWNFIELDS	Facility is listed to have had a Phase I ESA performed in relation to assessment of the site. The Phase I ESA was performed under an US-EPA Brownfields Assessment Cooperative Agreement. Results of the Phase I ESA were not reported.	Low	
SR14C-150	23-24	309	1003878824	RUSSELL MOE DUMP	12021 N LOPEZ CANYON RD	1777 ft (0.34 mi) ESE	Tunnel	CERCLIS NFRAP	Facility is listed to have been evaluated and not qualify for the NPL based on existing information provided on 12/1/1987.	Low	
SR14C-151	23-24	309	S101612993	RUSSELL MOE LANDFILL	12089 LOPEZ CANYON RD	1913 ft (0.36 mi) ESE	Tunnel	SWF/LF, LDS,WMUDS/S WAT	Facility is listed to be an unpermitted solid waste disposal site with quarterly inspections. Site is listed to have been closed on 12/31/1964.	Med	
SR14C-152	28	534	S116497300	SA RECYCLING LLC	8270 TUJUNGA AVE	1077 ft (0.2 mi) SW	Retained Cut / Trench	SWF/LF	Facility is listed to be a medium volume transfer/processing facility for mixed municipal waste with a permit date of 2014.	Low	
SR14C-153	26	433	1018119624	SAN FERNANDO SITE	9319-9325 N SAN FERNANDO RD	164 ft (0.03 mi) SW	At-grade	US BROWNFIELDS	Facility is listed to have had a Phase I ESA performed in relation to assessment of the site. The Phase I ESA was performed under an US-EPA Brownfields Assessment Cooperative Agreement. A petroleum related industry is reported to be located within close proximity of the property and potentially contributed to contamination at the site. Results of the Phase I ESA were not reported.	High	
SR14C-154	25-26	416	1000119933	SDS INDUSTRIES INC	10241 NORRIS AVE	506 ft (0.1 mi) ENE	Tunnel	SLIC	Facility is listed to have been reevaluated by the LARWQCB in 1997 in relation to impacts to the San Fernando Valley NPL site. A notice of "No Further Requirements" was issued on 1/30/1997 and site status is listed as "Completed Case Closed."	Low	
SR14C-155	25-26	416	S116497299	SEGOVIA ROLL-OFF	12215 BRANFORD ST	307 ft (0.06 mi) ENE	Retained Cut / Trench	SWF/LF	Facility is listed to be an active limited volume transfer operation for construction/demolition, green materials, and mixed municipal wastes with quarterly inspections. The permit status is listed to have been updated on 3/6/2014.	Med	
SR14C-156	26	435	S117662604	SHELDON	11401 W TUXFORD ST	5087 ft (0.96 mi) NE	At-grade	CA MINES	Facility is listed as an active open pit sand and gravel mining operation as of 2014. Reclamation is reported to be in progress.	Low	
SR14C-157	6	128	S102437520, S114660362, S114690985,	SIERRA HWY & AVE S, NETAL INC	37205 SIERRA HWY	38 ft (0.01 mi) ENE	At-grade	HIST Cortese, LUST, RGA LUST	A LUST containing waste/motor/hydraulic oil was present at the site. Soil and an aquifer used for drinking water supply was reported to have been impacted. Assessment/remediation performed and case closed in 2014.	High	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
			S114690913, S114690983								
SR14C-158	6	135	S114690986, S109348411	SIERRA HWY ANTELOPE VALLEY S CONVIENCE PLAZA	37167 N SIERRA HWY	179 ft (0.03 mi) WSW	At-grade	LUST, RGA LUST	A LUST with unspecified contents was present at the site. The impacted media was not reported. Case closed in 2007.	Med	
SR14C-159	10	180	S102004283, S114691160, S102437536	SIERRA VIEW APARTMENTS	3927 SIERRA HWY	2251 ft (0.43 mi) SSW	Tunnel	HIST Cortese, LUST, RGA LUST	HIST CORTESE/LUST (S102004283/S102437536) - Facility is listed to have impacted soil with gasoline due to a LUST. The site status is listed as "Completed - Case Closed" as of 12/5/1985. CHMIRS (S102004283) - A caller reported that sewage from the facility was being released very evening onto the ground and into the storm drain system. Containment and cleanup are not reported.	Low	
SR14C-160	26	463	S116497298	SINGH DISPOSAL	11401 PENDLETON ST	1882 ft (0.36 mi) NE	At-grade	SWF/LF	Facility is listed to be an active limited volume transfer operation for construction/demolition and inert materials with quarterly inspections. The permit status is listed to have been updated on 2/12/2014.	Low	
SR14C-161	14-15	204	S117662665	SOLEDAD CANYON - EXEMPT		4286 ft (0.81 mi) SE	At-grade	CA MINES	Facility is listed to be an idle sand and gravel quarry operation. Reclamation is not started as of 1991.	Low	
SR14C-162	26-28	484	1009629960	SOUTHERN CALIFORNIA GAS CO	10632 PENROSE ST	4721 ft (0.89 mi) NE	Cut and Cover	DOT OPS	Facility is listed to be a natural gas distribution line that was damaged by outside forces (outside/third party) in 1987.	Low	
SR14C-163	28	504	S103988817, S114694413, U001567823, S114694414	SOUTHLAND TRANSMISSIONS	8283 SAN FERNANDO RD	140 ft (0.03 mi) SW	Cut and Cover	HIST Cortese, LUST, RGA LUST	An aquifer used for drinking water supply is reported to have been impacted from a LUST containing aviation fuel at the facility. Current status listed as "Completed - Case Closed" as of 1996.	High	
SR14C-164	25-26	416	S101586554, S114694690, S114694689	SPARTAN TRUCK COMPANY, SPARTAN TRUCK EQUIPMENT	12266 BRANFORD ST	87 ft (0.02 mi) ENE	Retained Cut / Trench	HIST Cortese, LUST, RGA LUST	HIST CORTESE/LUST (S101586554) - Facility is listed to have impacted soil with waste/motor/hydraulic/lubricating oil due to a LUST. The site status is reported as "Completed - Case Closed" as of 6/6/1986.	Med	
SR14C-165	28	489	S106484844	SPECTRA AMERICAN	11037 PENROSE ST	2269 ft (0.43 mi) NE	Retained Cut / Trench	SLIC, ENVIROSTOR	Facility was evaluated by the LARWQCB in 2001 in relation to a chromium VI and VOC impact to an aquifer used for drinking water source assessment for the area. The facility was determined to need "No Further Requirements" in relation to the investigation in 2014 as is listed as "Completed - Case Closed."	Low	
SR14C-166	23	300	1000181713	SPECTROLAB INC	12500 GLADSTONE AVE	1955 ft (0.37 mi) WNW	Tunnel	TRIS, ENVIROSTOR	TRIS - Facility is listed to generate hazardous waste, have notified EPA under EPA SARA Title III, Section 313, and is in the EPA's index system due to semiconductor and related device manufacturing. ENVIROSTOR - Facility is listed to have a tiered permit. Site is reported to not be subject to the NPL or have restricted land use as a result of facility operations.	Low	
SR14C-167	28	557	S102360919, S109286992	STRATHERN INERT LANDFILL	11201 STRATHERN ST	2154 ft (0.41 mi) SW	Cut and Cover	SWF/LF, LDS	Facility is listed as a land disposal site with a status of "Open - Verification Monitoring."	Med	
SR14C-168	28	504	S111076116	STRATHERN SANITARY LANDFILL	8230 TUJUNGA AVE	1635 ft (0.31 mi) SW	Retained Cut / Trench	SWF/LF	The facility is listed as a closed landfilling operation that accepted inert waste. Currently, the site is listed to be an inert debris engineered fill operation over an area of 34 acres.	Med	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
SR14C-169	26	452	S103426966, S109287408, S102266815	SUN VALLEY LANDFILL - THERMAL TREATMENT UNIT/SUN VALLEY INERT LANDFILL	9436 GLENOAKS BLVD	3773 ft (0.71 mi) NE	At-grade	SWF/LF, LDS,WMUDS/S WAT	SWF/LF (S103426966) - Facility is listed to be an active inert debris engineered fill operation at a closed landfill. The site is reported to be 125 acres in size. LDS (S109287408) - Facility is listed to be a land disposal site with a status of "Completed - Case Closed" as of 5/30/2016.	Low	
SR14C-170	28	463	S106528959, S117711954	SUN VALLEY PAPER STOCK MRF AND TS	8701 N SAN FERNANDO RD	160 ft (0.03 mi) SW	Elevated / Aerial Structure	SWF/LF	LF - Facility is an active large volume transfer/processing site for industrial and mixed municipal waste. Permit issued for the site in 2006.	Med	
SR14C-171	25	454	1011961420	SUPERIOR THREAD ROLLING COMPANY	12801 WENTWORTH ST	5169 ft (0.98 mi) SW	At-grade	CERCLIS NFRAP	Facility is listed to have been evaluated and not qualify for the NPL based on existing information provided.	Low	
SR14C-172	18	239	S102860878, S100833291, S111842200	SOS - PLACERITA CANYON	25977 SAND CANYON RD	2777 ft (0.53 mi) WNW	Tunnel	HIST CAL-SITES, CA BOND EXP. PLAN, RESPONSE, ENVIROSTOR	Facility was utilized from 1967 through 1990 by Space Ordinance Systems (SOS) to manufacture specialty devices. Propellant explosive and pyrotechnic (PEP) and numerous additional COCs were determined to have impacted soil, soil vapor, and groundwater at the site. Groundwater remediation is reported to still be taking place at the facility.	Med	
SR14C-173	28	505	S114697881, 1000288928	SWELLDOM COMPANY, SWELLDOM HOME CARE SERVICE INC	8531 LANKERSHIM BLVD	2300 ft (0.44 mi) SW	At-grade	HIST Cortese, LUST, RGA LUST	HIST CORTESE/LUST (1000288928) - Facility is listed to have impacted soil with aviation fuel. Site status is reported to be "Completed - Case Closed" as of 7/22/1996.	Low	
SR14C-174	26-28	463	U001567825	TAM CERAMICS INC	11078 FLEETWOOD ST	2505 ft (0.47 mi) NE	Retained Cut / Trench	ENVIROSTOR	Facility is reported to have a Tiered Permit, however, land use restrictions and NPL subjectivity were not reported.	Low	
SR14C-175	25-26	416	1000310559	TEKTOPLATE INC	12280 MONTAGUE ST	896 ft (0.17 mi) ENE	Tunnel	SLIC, ENVIROSTOR	Facility was evaluated by the LARWQCB in 2001 in relation to a chromium VI and VOC impact to an aquifer used for drinking water source assessment for the area. The facility was determined to need "No Further Requirements" in relation to the investigation in 2003 as is listed as "Completed - Case Closed."	Low	
SR14C-176	28	504	S109117739, S114703961, U001567767	TEXACO - KEEBLE, ROBERT, TIMM FUEL & TIRE SERVICE INC	8579 SAN FERNANDO RD	154 ft (0.03 mi) SW	Retained Cut / Trench	LUST, RGA LUST	LUST (S109117739/U001567767) - Facility is listed to have impacted soil with gasoline. Site status is reported to be "Completed - Case Closed" as of 4/26/2010.	Med	
SR14C-177	26	433	1000195400	TIME AVIATION SERVICES INC	9255 SAN FERNANDO RD	172 ft (0.03 mi) SW	At-grade	SLIC	Facility was evaluated by a consultant in 2005 in relation to a chromium VI and VOC impact to an aquifer used for drinking water source assessment for the area. Arsenic was detected in soil concentrations above PRG levels but were determined to be within typical background concentrations for the southern California area. The facility was determined to need "No Further Requirements" in relation to the investigation in 2005 and is listed as "Completed - Case Closed" as of 12/23/2014.	Low	
SR14C-178	26	433	9999040782, 90080790, 91070272, 94020232, 94021240, 94031220, 94031475, 94040501, 9998051231,	TINY BUT MIGHTY PRODUCTIONS INC BHC 2	9175 SAN FERNANDO RD, 9175 SAN FERNANDO BLVD, 9175 SAN FERNANDO BLVD, 9175 SAN FERNANDO BLVD	166 ft (0.03 mi) SW	At-grade	HMIRS, CHMIRS	Various spill incidents were reported in relation to transportation of chemicals. Upon review, a majority of the spills occurred while in off-site transit, were contained, and appeared to be minor.	Low	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
			9999020521, 9999020902, 9999030882, 9999050952, 9999081691, 9998081224, 91020479, 91040501, 91080928, 94071368, 95050633, 95051264, 95101164, 96010156, 9900013901, 9998070946, 9998091179, 9998091469, 9998111235, 9998120091, 9998120348, 9998120361, 9999030907, 9999040852, 9999040853, 9999091586, 1000400275, 9998120367, 91020160, 91070556, 91070561, 92020071, 92020378, 92030689, 92040320, 92050404, 92090464, 94060912, 94120396, 94121018, 96060116, 9998030095, S110420996, 9999070529, 9999010676								

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
SR14C-179	26-28	485	S114706151, S109117745	TRANSIT MIXED CONCRETE (FMR SOUTHDOWN CONCRETE)	8960 N BRADLEY AVE	1579 ft (0.3 mi) NE	At-grade	LUST, RGA LUST	LUST (S109117745) - Facility is reported to have impacted soil with diesel fuel. Site status is listed as "Completed - Case Closed" as of 1/13/2015.	Low	
SR14C-180	14	213	U001567727, S114665046, S114665129, S114706774, S114665128, S117662666, S102434815, S114706775	TRIANGLE ROCK PROD INC SOLEDAD, P W GILLIBRAND COMPANY	13900 LANG STATION RD, 13900 LONG STATION	1400 ft (0.27 mi) NW	At-grade Covered	HIST Cortese, LUST, CA MINES, RGA LUST	LUST (U001567727) - Facility is listed to have impacted soil with diesel (heating oil/fuel oil). Site status is listed as "Completed - Case Closed" as of 2/15/2012. MINES (S117662666) - Facility is listed as an idle sand and gravel streambed or gravel bar skimming and pitting, open pit, or plant mine. Site information was updated in 2014 and is listed to be 96 acres in size. HIST CORTESE/LUST (S102434815) - Facility is listed to have impacted soil with diesel fuel. Site status is listed as "Completed - Case Closed" as of 7/19/1996. Mine property appears to be very close to the proposed alignment contrary to reported distance.	High	
SR14C-181	26	433	1000102029	TRUESDALE ESM EAST VALLEY	11781 TRUESDALE ST	3503 ft (0.66 mi) NE	At-grade	RCRA-TSDF	Facility is listed to treat, store, or dispose of numerous types of hazardous waste. Groundwater monitoring and evaluation is reported to have occurred between 1984 and 1985.	Low	
SR14C-182	28	504	S109821493, S103441383	TUJUNGA PIT	8250 TUJUNGA AVE	1597 ft (0.3 mi) SW	Retained Cut / Trench	SWF/LF,WMUDS /SWAT	Very limited information provided for facility. Site assessed for SWAT program. Impact to media not reported.	Med	
SR14C-183	28	505	S113482310	TUXFORD PIT LANDFILL	11590 TUXFORD ST (TUXFORD ST AND GOLDEN STATE FWY)	1532 ft (0.29 mi) SW	Elevated / Aerial Structure	LDS	Facility is listed as a closed solid waste disposal site with a current regulation status as "unpermitted."	Med	
SR14C-184	26	416	1000353463	ULTRAMET	12173 MONTAGUE ST	1816 ft (0.34 mi) ENE	Tunnel	US BROWNFIELDS, ENVIROSTOR	Brownfields - Facility is listed to have had a Phase I ESA performed in relation to assessment of the site. The Phase I ESA was performed under an US-EPA Brownfields Assessment Cooperative Agreement. The property use is reported to consist of light manufacturing. Results of the Phase I ESA were not reported and no COCs were identified for the site. ENVIROSTOR - Facility is reported to have had a site screening performed in 2007 to determine potential impacts to the site due to past use as metal plating. Hydrochloric acid was confirmed as a COC to have impacted soils. Current site status is listed as "Inactive - Action Required" as of 6/30/2007.	Med	
SR14C-185	23	301	U001567595, S114709810	UPS SAN FERNANDO CASFR, UNITED PARCEL SERVICE	12745 ARROYO ST	812 ft (0.15 mi) WNW	Tunnel	LUST, RGA LUST	Facility is listed to have impacted an unknown media with an unknown COC. Site status is listed as "Completed - Case Closed" as of 5/10/2011.	Low	
SR14C-186	25	388	S101618430	VALLEY CIRCUITS INC	11031 GLENOAKS BLVD	196 ft (0.04 mi) WSW	Tunnel	ENVIROSTOR	Facility is reported to have a Tiered Permit, however, land use restrictions and NPL subjectivity were not reported. Current status is listed as "Refer: Other Agency" as of an unspecified date.	Low	
SR14C-187	26	449	1004676152	VALLEY GENERATING STATION	11801 SHELDON ST	1217 ft (0.23 mi) NE	At-grade	SLIC, VCP, ENVIROSTOR	VCP - Facility is listed to be in DTSC Site Cleanup Program with status of active as of 6/28/2000. Numerous COCs are confirmed to have impacted soil at the site and remedial actions are reported to have taken place. SLIC - Facility is reported to have been investigated in relation to the San Fernando Valley Superfund Site due to previous site usage. Soil investigation at the site was performed in 2005 to 2006 in relation to a LARWQCB Order. The assessment concluded that no chromium and or other VOCs were used at the Site. A notice of "No Further Requirements" was issued in 2006. The site status is listed as "Completed - Case Closed" as of 12/19/2014. ENVIROSTOR - facility is listed to be involved with a	Med	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
									voluntary cleanup due to past use as and electrical generation/substation. Confirmed COCs consist of arsenic, total chromium, lead, PCBs, PAHs, copper and compounds, nickel, and vanadium and compounds to soil. Site status is listed as "Active" as of 6/28/2000.		
SR14C-188	26	453	S101618546, U001567848, S104156390	VALLEY GENERATING STATION - DWP/VALLEY GENERATING STATION DISP	9430 SAN FERNANDO RD	81 ft (0.02 mi) SW	At-grade	LDS, ENVIROSTOR, WMUDS/SWAT	LDS (S101618546) - Facility is listed to be an "Open-Inactive" land disposal site with a status date of 8/20/2013. ENVIROSTOR (U001567848) - Facility is listed to have been evaluated for impacts due to historical usage. A Non-Emergency Hazardous Material Substance Release Report for the site (July 8, 1994) stated the facility is impacted with oil fly ash containing metals, including chromium, copper, lead, nickel, and vanadium. During assessment of the site, no COCs are reported to have been confirmed and the facility is listed to not be applicable to NPL or have land use restrictions. Site status is listed as "Inactive - Needs Evaluation" as of 9/14/1995.	High	
SR14C-189	26	452	S116282732	VALLEY RECLAMATION COMPANY - PIT NO. 3	11311 PEORIA ST	3933 ft (0.74 mi) NE	At-grade	LDS	Facility is listed as a land disposal site with a status of "Open - Inactive" as of 2013. Reports for the facility have indicated PCE impacts to groundwater.	Low	
SR14C-190	23-24	309	S114718054, S108935371, 1003878394, 1000200422	VALLEYCREST LANDSCAPE, FIREBALL INDUSTRIES INC	12087 N LOPEZ CANYON ROAD	1908 ft (0.36 mi) ESE	Tunnel	CERCLIS NFRAP, LUST, ENVIROSTOR, RGA LUST	LUST (S108935371) - Facility is listed to have impacted an aquifer used for drinking water supply with diesel, xylenes, MTBE, TBA, and other fuel oxygenates. Site status is listed as "Completed - Case Closed" as of 9/9/2008. CERCLIS-NFRAP (1003878394) - Site was assessed for contamination in 2013 and is listed as NFRAP due to not qualifying for the NPL based on existing information. ENVIROSTOR (1000200422) - Facility listed to have had site screening performed due to historical usage. No confirmed COCs and/or impacted media are reported. Site status is listed as "Refer: Other Agency" with a status date of 8/31/1995.	Low	
SR14C-191	25	376	S109422396	VAUGHN ELEMENTARY LANGUAGE ACADEMY	11176, 11180, 11182, 11188 HERRICK AVE	2531 ft (0.48 mi) WSW	Tunnel	ENVIROSTOR	Facility was evaluated for the NPL in relation to a school evaluation and determined not to be eligible as of 6/22/2009. Site restrictions are not reported for the facility. The site is currently listed as "No Further Action."	Low	
SR14C-192	28	504	S106484837	VINTEN EQUIPMENT INC	8115 CLYBORN	406 ft (0.08 mi) NE	Tunnel	SLIC	The site is listed as Completed - Case Closed as of 12/22/2014 for VOC contamination that has impacted an aquifer used for drinking water supply.	High	
SR14C-193	26	433	S111076161	VULCAN MATERIALS (SUN VALLEY)	11520 SHELDON ST	4330 ft (0.82 mi) NE	At-grade	SWF/LF	Facility is listed to be an active landfilling operation that accepts inert waste as an inert debris engineered fill operation.	Low	
SR14C-194	28	463	1014677847, S106399137, 2003642460	VULCAN MATERIALS CO SUN VALLEY	11447 W TUXFORD ST	246 ft (0.05 mi) NE	Elevated / Aerial Structure	ERNS, TRIS, CHMIRS	TRIS (1000128768) - Facility is listed to have notified the EPA under SARA Title III, Section 313. The site is listed to release up to eight pounds of naphthalene and PAHs to the atmosphere due to operations. CHMIRS/ERNS (S106399137/2003642460) - Facility is reported to have released 4,000 gallons of asphalt materials due to a plugged operation line in 2003. A waterway (storm drain) is reported to have been involved. Spill containment is not reported and cleanup was listed to have been completed.	Med	
SR14C-195	26	475	1005775701	WASTE MANAGEMENT	9081 TUJUNGA AVE	1954 ft (0.37 mi) NE	Elevated / Aerial Structure	SWF/LF	Facility is listed as an active waste hauler. Limited additional information is provided.	Low	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
SR14C-196	26	463	S103697090	WEST COAST WINERY	11115 PENDLETON ST	3804 ft (0.72 mi) NE	At-grade	SLIC	Facility is listed to be a cleanup program site with a status of "Completed - Case Closed" as of 9/27/1995. The impacted media and COCs for the site are not reported.	Low	
SR14C-197	25	416	1011812566	WILLIES AUTO REPAIR	9954 SAN FERNANDO RD	1158 ft (0.22 mi) WSW	Retained Cut / Trench	US BROWNFIELDS	Facility is listed to have had a Phase I ESA performed in relation to assessment of the site. The Phase I ESA was performed under an US-EPA Brownfields Assessment Cooperative Agreement. Results of the Phase I ESA were not reported.	Low	
SR14C-198	28	504	S105026815, S114723172, U003904755, S114723381	WORLD OIL STATION NO. 19	8181 SUNLAND BLVD	175 ft (0.03 mi) SW	Tunnel	HIST Cortese, LUST, RGA LUST	A LUST was reported to have impacted soil with gasoline. Case closed as of 1996.	Med	
SR14C-199	11	162	S110419601		33958 MC ENNERY CANYON RD	30 ft (0.01 mi) SSW	Tunnel	CHMIRS	A spill of non-PCB containing mineral oil (50 gallons) was reported from a pad mounted transformer when it was hit by a vehicle. The spill occurred in 2008 and is reported to have impacted the roadway and surrounding soils. Cleanup is reported to have been performed by a contractor.	Low	
SR14C-200	14	208	92293554		13200 SOLEDAD CANYON RD	515 ft (0.1 mi) SE	Elevated / Aerial Structure	ERNS	A citizen reported that an unknown amount of sewage spilled during a storm in a canyon area in 1992. The caller was referred to the EPA by Los Angeles County Department of Health.	Low	
SR14C-201	25	360	S110977421, S110417948		12600 VAN NUYS BLVD, SHADOW HILLS MOBILE HOME PARK	122 ft (0.02 mi) ESE	Tunnel	CHMIRS	CHMIRS (S110977421) - A caller reported that the cap to a sewage clean out valve was removed resulting in 100 gallons of sewage being released to the surrounding area. The spill occurred in 2010 and is not reported to have been contained and/or cleaned up. CHMIRS (S110417948) - A caller reported that approximately 1,000-gallons of sewage was released due to a clog in the sewer main. A contractor is reported to have cleaned up the spill.	Low	
SR14C-202	25	388	S110981113		11000 GLEN OAKS BLVD, CROSS STREET IS PIERCE ST	107 ft (0.02 mi) ENE	Tunnel	CHMIRS	In 2010, a caller reported that approximately 1,500-gallons of sewage was released into a catch basin due to a semi carrying the sewage overturning due to a vehicle accident. The release was contained by placement of sandbags and booms before it could reach a waterway. Clean up was performed by United Pumping using a vacuum truck.	Low	
SR14C-203	25-26	416	8865637		12318 BRANFORD ST 818-899-7924; ROB MEHAN(FOREMAN)/JOE E	249 ft (0.05 mi) WSW	Retained Cut / Trench	ERNS	Facility is reported to have had an emergency release to the soil. In 1988, a caller stated that a green liquid material was eating through drums it was contained in. The material was reported to have been smoking and business employees were hosing down the spill resulting in intense fumes in the area. Containment and cleanup are not reported.	Med	
SR14C-204	26	433	90178746		CONSTRUCTION SITE 9175 SAN FERNANDO RD	408 ft (0.08 mi) SW	At-grade	ERNS	Facility is reported to have spilled approximately 45 gallons of lacquer thinner/paint thinner in 1990. An agency was reported to be retained to handle and dispose of the product moving forward.	Med	
SR14C-205	26-28	483	2014083694, S116779407		9027 SAN FERNANDO RD	164 ft (0.03 mi) SW	At-grade	ERNS, CHMIRS	ERNS (2014083694) - Facility is reported to have a release to soil. In 2014, dumping of an unknown material was reported to an alley way/asphalt. The material was reported to have been cleaned up by an employee of the company. CHMIRS (S116779407) - A caller reported a discharge of motor oil into an alley behind the facility. The caller stated that the business is	High	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
									pumping the product into the alley on a regular basis. Containment and cleanup are not reported.		
SR14C-206	28	504	S109035661, 2007306845		11275 PENROSE ST	71 ft (0.01 mi) NE	Retained Cut / Trench	ERNS, CHMIRS	CHMIRS (S109035661) - A spill of approximately 20 pounds of ammonia was discovered during a pump down. The spill occurred in 2007 and is reported to have been contained. Cleanup is not reported. ERNS (2007306845) - A caller reported a release of approximate 20 pounds of anhydrous ammonia during a pump down of a refrigeration unit. The spill is reported to the atmosphere. The spill occurred in 2007 and is reported to have been contained. Cleanup is not reported.	Low	
SR14C-207	28	552	S105651191		7975 CLYBOURN AVE, SUN VALLEY TB 533 A2	264 ft (0.05 mi) SW	Tunnel	CHMIRS	A tanker truck is reported to have had a leaking valve, resulting in asphalt emulsion being spread over the street into the gutter and storm drain and ending up in the flood control channel in 1997. The street was closed and sand was spread over the surface. A contractor was retained to clean up the spill.	Low	
SR14C-208	28	561	2004100406		7649 SAN FERNANDO RD	249 ft (0.05 mi) SW	Tunnel	HMIRS	A spill of five gallons of TCE was reported in 2004 to an unspecified media. A certified hazardous materials team responded to contain and clean up the spill.	Low	
SR14C-209	18	239	S107736888	NIKE 94 MCA HOU SITE		3050 ft (0.58 mi) WNW	Tunnel	ENVIROSTOR	Facility was evaluated for the NPL in relation to a military evaluation and determined not to be eligible as of 7/1/2005. Site restrictions and confirmed COCs are not reported for the facility. The site is currently listed as "Inactive - Needs Further Evaluation." Historical information indicates that the "Nike" facilities were previously used as Minute Man missile launch installations in the 1950s to 1960s. It is reported that nuclear missiles were stored, assembled, fueled, and armed in a fortified bunker (battery) in a subterranean bunker.	Low	
SR14C-210	28	574	S101298216, S105032930	U-HAUL CENTER OF SUN VALLEY	7721 HOLLYWOOD WAY	1752 ft (0.33 mi) ENE	Cut and Cover	HIST Cortese, LUST	Facility was evaluated by the LARWQCB in relation to waste oil, motor, hydraulic, and lubricating oil impacts to soil. The facility is listed as "Completed - Case Closed" as of 3/31/92.	Low	
SR14C-211	28	564	S107735843	SUPERIOR PLATING	4001 GLENOAKS BLVD	2150 ft (0.41 mi) NE	Tunnel	ENVIROSTOR	Facility was evaluated by the DTSC and is listed as "Inactive - Needs Evaluation" as of 5/24/12.	Med	
SR14C-212	26	416	S112283606	CALDERON RECYCLING	12231 BRANFORD ST	424 ft (0.08 mi) ENE	Retained Cut / Trench	SWRCY	Facility is listed to be a recycling center that accepts aluminum/glass/plastic/bimetal products. Operation begin date listed to be 7/5/2015.	Med	
SR14C-213	26	465	S103441474	BRADLEY AVENUE DUMP NO. 2		2464 ft (0.47 mi) NE	At-grade	WMUDS/SWAT	Facility is listed to be in Solid Waste Assessment Test Program. Little additional information is provided.	Med	
SR14C-214	25-27	482	S103441429	BRIGHT REALITY	LAUREL CANYON & JEROME	4260 ft (0.81 mi) SW	At-grade	WMUDS/SWAT	Facility is listed to be in Solid Waste Assessment Test Program. Little additional information is provided.	Low	
SR14C-215	28	504	S103441729	PENROSE LANDFILL	8221 TUJUNGA AVE	1689 ft (0.32 mi) SW	Retained Cut / Trench	WMUDS/SWAT	Facility is listed as Category B – Any facility having a physical, chemical, or biological waste treatment system (except for septic systems with subsurface disposal), or any Class II or II disposal site, or facilities without treatment systems that are complex, such as marinas with petroleum products, solid wastes, and sewage pump out facilities. The facility is listed	Med	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
									to "not fall into the category of Municipal/Domestic, Industrial, Agricultural or Solid Waste (Class I, II or III) and to be a minor threat to water quality.		
SR14C-216	28	554	S103441730	TUJUNGA AVE/SITE 8-PENROSE PIT	8145 N. TUJUNGA AVE.	2836 ft (0.54 mi) SW	Cut and Cover	WMUDS/SWAT	Facility is listed as Category B – Any facility having a physical, chemical, or biological waste treatment system (except for septic systems with subsurface disposal), or any Class II or II disposal site, or facilities without treatment systems that are complex, such as marinas with petroleum products, solid wastes, and sewage pump out facilities. The facility is listed to "not fall into the category of Municipal/Domestic, Industrial, Agricultural or Solid Waste (Class I, II or III) and to be a minor threat to water quality.	Low	
SR14C-217	28	561	S107137870	LEOS RECYCLING INC	7636 SAN FERNANDO RD	62 ft (0.01 mi) SW	Tunnel	SWRCY	Facility is listed to be a recycling center that accepts aluminum/glass/plastic/bimetal products. Operation begin date listed to be 1/2/2016.	Med	
SR-14C-218	25	388	S101584960	SEUNG HO KIM/MAL NAM KIM	11045 GLENOAKS BLVD	235 ft (0.04 mi) WSW	Tunnel	SWRCY	Facility is listed to be a recycling center that accepts aluminum/glass/plastic/bimetal products. Operation begin date listed to be 9/28/1998.	Med	
SR14AC-219	8	W112	S109148610, S109689957	ACTON DRY CLEANERS, ACTON CLEANERS	33338 SANTIAGO RD	909 ft (0.17 mi) N	Tunnel	CERS HAZ WASTE, LOS ANGELES CO. HMS	Facility is listed as a hazardous waste generator. This facility has received numerous administrative and facility compliance violations issued by the Los Angeles County Fire Department.	Low	
SR14AC-220	9	S99	S113138690	ALL VALLEY RV CENTER	1525 SIERRA HWY	756 ft (0.14 mi) S	Elevated / Aerial Structure	CERS, CERS HAZ WASTE	Facility is listed as a hazardous waste generator in 2005 and 2006. This facility has received numerous administrative and facility compliance violations issued by the Los Angeles County Fire Department.	Low	
SR14AC-221	4	G37	S106826011	ANTELOPE VALLEY - N SIERRA HIGHWAY	36007 N. SIERRA HWY	270 ft (0.05 mi) E	At-grade	CERS, CERS HAZ WASTE, LUST	Facility is listed as a chemical storage facility. This facility received numerous administrative and facility compliance violations issued by the Los Angeles County Fire Department.	Med	
SR14AC-222	1	H41	S103950319, 1000205297	ANTELOPE VALLEY PRESS	37404 SIERRA HWY	236 ft (0.04 mi) E	At-grade	CERS, CERS HAZ WASTE, LOS ANGELES CO. HMS	Facility is listed as a hazardous waste generator No violations have been reported.	Low	
SR14AC-223	7	P83	S104539659	ARCO #5495	33485 CROWN VALLEY PKWY	594 ft (0.11 mi) N	Tunnel	LUST	Facility is listed to have impacted soil with gasoline due to a LUST. The site status is reported as "Completed - Case Closed" as of 5/10/2010.	Med	
SR14AC-224	1	B14	U003060220	ARCO PRODUCTS CO (DEST)	37207 SIERRA HWY	59 ft (0.01 mi) W	At-grade	LOS ANGELES CO. HMS	Facility is listed as a hazardous material handler. The facility status is listed at "open".	Low	
SR14AC-225	7	P88	S113034165, S103653696	ARCO PRODUCTS COMPANY, ARCO #5495	33488 CROWN VALLEY PARK	674 ft (0.13 mi) N	Tunnel	CERS, CERS HAZ WASTE	Facility is listed as a hazardous waste generator for the years 1991, 1992, 1993, and 2001. This facility has received numerous administrative and facility compliance violations issued by the Los Angeles County Fire Department and Los Angeles County Department of Public Works.	Low	
SR14AC-226	4	121	S118756508	DESERT WILLOW SCHOOL	62ND STREET EAST/S-8 AVENUE	1029 ft (0.19 mi) NE	At-grade	ENVIROSTOR. CERS	Facility is reported to have been assessed via a Phase I ESA for potential COCs. No COCs were confirmed for the site and the facility was determined to not be subject to the NPL and/or land use restrictions. Current site status is listed as "No Action Required."	Low	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
SR14AC-227	9	D27	S106915912, S113162999	JASONS AUTO PARTS	415 SIERRA HWY	66 ft (0.01 mi) NW	Tunnel	LUST, CERS, CERS HAZ WASTE	LUST (S106915912) Facility is listed to have impacted soils with tetrachloroethylene, waste oil/ motor oil/ hydraulic oil/ and lubricating oil due to a LUST. Low levels of TRPH and PCE remain in subsurface soils. Groundwater is estimated at greater than 500 feet bgs and not anticipated to have been impacted from the release. The site status is reported as "Completed - Case Closed" as of 9/21/2010.	Med	
SR14AC-228	9	V111	S106928424	LA COUNTY FIRE STATION #80	1533 W SIERRA HWY	882 ft (0.17 mi) S	Tunnel	CERS, CERS HAZ WASTE	Facility is listed as a hazardous waste generator and chemical storage facility.	Low	
SR14AC-229	4	136	S112893437	MCI TELECOM. CORP. #2	1040 E RAE ST	1250 ft (0.24 mi) W	Elevated / Aerial Structure	LA Co. Site Mitigation, CERS	Facility is reported to have had abatement performed on 7/1/1992 and 12/2/1993. Limited information was provided by EDR.	Low	
SR14AC-230	1	AB140	S123501389	PALMDALE WATER DISTRICT-TRMT PLNT	700 E AVENUE S	1273 ft (0.24 mi) W	At-grade	CERS, CERS HAZ WASTE	Facility is listed as a hazardous waste generator and chemical storage facility. This facility has received numerous administrative and facility compliance violations issued by the Los Angeles County Fire Department.	Low	
SR14AC-231	9	D25	S104734900	SCOTTY'S NURSERY	352 SIERRA HWY	17 ft (0 mi) SE	Tunnel	LOS ANGELES CO. HMS	Facility is listed as a hazardous material handler. The facility status is listed at "open".	Low	
SR14AC-232	10	C23	1025569695, 1025689899	SHEBA FERTILIZER DEPOSIT		21 ft (0 mi) E	Tunnel	MINES MRDS	Facility is listed as a prospect producer of sand, gravel, calcium, and gypsum-anhydrite.	Med	
SR14AC-233	7	AC145	S102004271	SHELL STATION	3820 SIERRA HWY	1299 ft (0.25 mi) N	Tunnel	CERS, CERS HAZ WASTE	Facility is listed as a hazardous waste generator for the years 2007, and 2009 through 2013. Facility was issued a Notice of Violation (NOV) in 2013 for failure to submit quarterly monitoring reports.	Low	
SR14AC-234	1	B11	S109689978	SIERRA HWY & AVE S INC	37321 SIERRA HWY	20 ft (0 mi) W	At-grade	LOS ANGELES CO. HMS	Facility is listed as a hazardous material handler. The facility status is listed at "removed".	Low	
SR14AC-235	1	B12	S102064705	SIERRA HWY & AVE S INC	37305 SIERRA HWY	25 ft (0 mi) W	At-grade	LOS ANGELES CO. HMS	Facility is listed as a hazardous material handler. The facility status is listed at "open".	Low	
SR14AC-236	7	AA137	S113017556	T&J J AUTO REPAIR INC	3932 W SIERRA HWY UNIT B	1268 ft (0.24 mi) N	Tunnel	CERS, CERS HAZ WASTE	Facility is listed as a hazardous waste generator for the years 1995 and 2001. This facility has received numerous administrative and facility compliance violations issued by the Los Angeles County Fire Department.	Low	
SR14AC-237	7	AC143	U003777984	TESORO/ACTON SUBWAY	3820 SIERRA HWY #A	1299 ft (0.25 mi) N	Tunnel	LOS ANGELES CO. HMS	Facility is listed as a hazardous material handler. The facility status is listed at "closed".	Low	
SR14AC-238	7	131	S118757204, S118756589	VASQUEZ HIGH SCHOOL	33630 RED ROVER MINE ROAD	1154 ft (0.22 mi) N	Tunnel	ENVIROSTOR, CERS	Facility is reported to have been assessed via a Phase I ESA for potential COCs. No COCs were confirmed for the site and the facility was determined to not be subject to the NPL and/or land use restrictions. Current site status is listed as "No Action Required."	Low	

¹ The site is included in a group of industrial facilities that are documented to be included as "Responsible Parties" in relation to the San Fernando Valley Superfund Site for VOC/solvent/metal/chlorinated hydrocarbon impacts to groundwater used for drinking water. Listed sites with the same designation have the Case Background description associated with the listing presented in BOLD font and contain an "X" in the "Associated with the Superfund Site (Area #1)" column. While the San Fernando Superfund Site currently has a status of "Open - Remediation" or similar, some of the associated sites may have since been closed or have a status of "Completed - Case Closed". The remaining sites continue to be open and undergoing remediation for the associated contamination.

Table 3.10-B-5: Refined SR14 and SR14A Burbank Subsection PEC Sites

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
SR14B-2	28-29	561	S102414757	KAHR BEARING, A DOVER SARGENT	3010 N SAN FERNANDO BLVD	2613 ft (0.49 mi) ENE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to volatile organic compound impacts to an aquifer used for drinking water. The facility is listed as "Open - Inactive" as of 10/29/14. ¹	Med	X
SR14B-3	28	561	S114644703, S114644702, S101295680, S114644704, S103649152	LOCKHEED PLANT B-6, BURBANK PLANT B-6	2801 HOLLYWOOD WAY N	322 ft (0.06 mi) ENE	Cut and Cover	HIST Cortese, LUST, SLIC, RGA LUST	Facility was evaluated by the LARWQCB in relation to metals and volatile organic compound impacts to soil and an aquifer used for drinking water. The facility is listed as "Open - Remediation" as of 10/31/96. ¹	High	X
SR14B-4	28-29	561	1000209850, S114720502, 1000209849, S114720504	PH BURBANK, WEBER AIRCRAFT INC	2820 N ONTARIO ST, 2820 ONTARIO ST	2343 ft (0.44 mi) ENE	Cut and Cover	HIST Cortese, LUST, SLIC, RGA LUST	Facility was evaluated by the LARWQCB in relation to metals and volatile organic compound impacts to soil and an aquifer used for drinking water. The facility is listed as "Open - Remediation" as of 1/10/94. ¹	Med	X
SR14B-5	29	561	1014352264	SENIOR AEROSPACE INC SSP DIV	2980 N SAN FERNANDO BLVD	2905 ft (0.55 mi) ENE	Cut and Cover	TRIS	Facility was evaluated by the LARWQCB in relation to metals and volatile organic compound impacts to soil and an aquifer used for drinking water. The facility is listed as "Open - Site Assessment" as of 9/21/12. ¹	Low	X
SR14B-6	29	561	S105670833, S108214030, 90185855, S106484452, S113472852	STAINLESS STEEL PRODUCTS INC	2980 N SAN FERNANDO BLVD	2863 ft (0.54 mi) ENE	Cut and Cover	ERNS, SLIC, CHMIRS	Same as above. ¹	Low	X
SR14B-7	28-29	561	1000431948, S106392146	STEVE'S PLATING CORP	3111 N SAN FERNANDO BLVD	1969 ft (0.37 mi) ENE	Cut and Cover	SLIC, CHMIRS, ENVIROSTOR	Facility was evaluated by the LARWQCB in relation to chromium and volatile organic compound impacts to an aquifer used for drinking water. The facility is listed as "Open - Inactive" as of 1/28/16. ¹	Med	X
SR14B-11	28	647	S106484454	ABBY RENTS	2333 N VALLEY ST	3162 ft (0.6 mi) SW	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to chromium VI impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements" in relation to a soil investigation and is listed as "Completed - Case Closed" as of 12/23/14.	Low	
SR14B-12	28-29	561	S106764394	ADB INDUSTRIES	2523 N ONTARIO ST	2013 ft (0.38 mi) ESE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to metal impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements for soil only" and is listed as "Completed - Case Closed" as of 8/26/14.	Low	
SR14B-13	28-29	561	S103587492, S114568902, S114568903	AEROQUIP FACILITY (FORMER)	3015 WINONA AVE	2413 ft (0.46 mi) ESE	Cut and Cover	HIST Cortese, LUST, RGA LUST	Facility was evaluated by the LARWQCB in relation to volatile organic compound impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements" based on investigations performed prior to 1997 and is listed as "Completed - Case Closed" as of 8/30/96. ¹	Low	X
SR14B-14	28	633	1000180804, S114578215, S103282106	AIRCRAFT SERVICE INTERNATIONAL, ASII TANK FARM (SITE #1)	2761 HOLLYWOOD WAY	994 ft (0.19 mi) SE	Cut and Cover	HIST Cortese, LUST, RGA LUST	Facility was evaluated by the LARWQCB in relation to a leaking underground storage tank case where soil was impacted. The facility is listed as "Completed - Case Closed" as of 11/5/01.	Low	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
SR14B-15	28-29	561	S112186558	ALIGN-RITE INTERNATIONAL / PHOTRONICS INC	2422-2428 N ONTARIO ST	2535 ft (0.48 mi) SE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to chromium VI impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements with respect to soils only" and is listed as "Completed - Case Closed" as of 11/27/13. ¹	Low	X
SR14B-16	28-29	561	1000300331	ALUMINUM DIP BRAZE CO	2537 N ONTARIO ST	2013 ft (0.38 mi) ESE	Cut and Cover	CERCLIS NFRAP	Facility was evaluated by the LARWQCB in relation to chromium VI impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements for soils only" and is listed as "Completed - Case Closed" as of 8/26/14.	Low	
SR14B-17	29	561	1000857227, 1000818182	ALUMTREAT INC	2905 WINONA AVE	2784 ft (0.53 mi) ESE	Cut and Cover	CERCLIS NFRAP, CORRACTS, RCRA-TSDF, DEED, ENVIROSTOR	Facility was evaluated by the DTSC in relation to historic manufacturing activities. The facility is listed as "Land Use Restrictions Only" as of 9/19/97.	Low	
SR14B-18	28-29	561	S104567212	AMER. FINE ARTS FOUNDRY	2520 N ONTARIO ST	2312 ft (0.44 mi) ESE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to chromium VI and volatile organic compound impacts to an aquifer used for drinking water. The facility was determined to need "No Further Requirements" and is listed as "Completed - Case Closed" as of 12/22/14.	Low	
SR14B-19	28-29	561	S106484438	BONDED SERVICES	3205 BURTON AVE	2388 ft (0.45 mi) SE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to metal and volatile organic compound impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements" and is listed as "Completed - Case Closed" as of 10/29/14. ¹	Low	X
SR14B-20	28-29	561	S102860870, 1015732646	BRASS PRODUCTION COMPANY	3059-3063 NORTH CALIFORNIA ST	2143 ft (0.41 mi) ENE	Cut and Cover	CERCLIS NFRAP, ENVIROSTOR	Facility was evaluated by the DTSC and is listed as "No Further Action" as of 10/25/94.	Low	
SR14B-21	28	668	U001568394	BUDGET RENT-A-CAR	2220 N HOLLYWOOD WAY	4165 ft (0.79 mi) SSE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to chromium VI impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements" and is listed as "Completed - Case Closed" as of 12/22/14.	Low	
SR14B-22	28-29	561	S104827552	BUILDIT ENGINEERING	3074 N LIMA ST	1913 ft (0.36 mi) ENE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to metals and volatile organic compound impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements" and is listed as "Completed - Case Closed" as of 9/9/05.	Low	
SR14B-23	28-29	561	S106484432	BURBANK FOUNDRY INC	3083 N CALIFORNIA ST	2185 ft (0.41 mi) ENE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to volatile organic compound impacts to an aquifer used for drinking water. The facility is listed as "Completed - Case Closed" as of 8/25/95.	Low	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
SR14B-24	28	633	S103647859, S114595810, S114599402, S114595813, S114595811, S101295678	CHEVRON STATION #9-0839	2650 HOLLYWOOD WAY, 2650 HOLLYWOOD WAY N	1539 ft (0.29 mi) SE	Cut and Cover	HIST Cortese, UST, RGA LUST	Facility was evaluated by the LARWQCB in relation to a leaking underground storage tank case where gasoline impacted the soil. The facility is listed as "Completed - Case Closed" as of 11/5/01.	Low	
SR14B-25	28	561	1006825838	CONNELL PROCESSING INC	3094 N AVON ST	1602 ft (0.3 mi) ENE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to metals and volatile organic compound impacts to soil and an aquifer used for drinking water. The facility is listed as "Completed - Case Closed" as of 3/27/87.	Low	
SR14B-26	28	561	S100859292	CONNELL PROCESSING INC, CONNELL PROC CORP	3080 N AVON ST	1590 ft (0.3 mi) ENE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to metals and volatile organic compound impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements" and is listed as "Completed - Case Closed" as of 3/27/87.	Low	
SR14B-27	29	561	S102628781, S114607665, 1017428036, S114607667	CRANE CO, HYDRO-AIRE DIV	3000 WINONA AVE	2856 ft (0.54 mi) ESE	Cut and Cover	TRIS,HIST Cortese, LUST, SLIC, RGA LUST	Facility was evaluated by the LARWQCB in relation to metals and volatile organic compound impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements" and is listed as "Completed - Case Closed" as of 3/30/05.¹	Low	X
SR14B-28	28	647	1000818183	DUNLAP ABBOTT CHALCO CORP	2323 VALLEY ST	3185 ft (0.6 mi) SW	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to chromium VI impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements with respect to soils only" and is listed as "Completed - Case Closed" as of 8/28/14.	Low	
SR14B-29	28-29	561	1003878774	DUNRITE METAL PLATING	3055 CALIFORNIA ST	2136 ft (0.4 mi) ENE	Cut and Cover	CERCLIS NFRAP	Site does not qualify for the NPL.	Low	
SR14B-30	28-29	668	1000473071	EI DUPONT DENEMOURS & CO	3300 PACIFIC AVE	4522 ft (0.86 mi) SSE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to metal and volatile organic compound impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements" and is listed as "Completed - Case Closed" as of 12/23/14.¹	Low	X
SR14B-31	28-29	561	S112274185	FORMER B-G DETECTION SERVICE FACILITY	3071 N LIMA ST	1863 ft (0.35 mi) ENE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to metals impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements for soils only" and is listed as "Completed - Case Closed" as of 3/25/13.	Low	
SR14B-32	28	647	S100222505	FORMER LOCKHEED PLANT B-5	4207 EMPIRE AVE	2818 ft (0.53 mi) SW	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to metal and volatile organic compound impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements for soils only" based on investigations in 2001 and is listed as "Completed - Case Closed" as of 6/29/04.	Low	
SR14B-33	28-29	561	S102860886	HUGHEY & PHILLIPS INC	3050 CALIFORNIA ST	2168 ft (0.41 mi) ENE	Cut and Cover	ENVIROSTOR	Facility was evaluated by the DTSC and is listed as "No Further Action" as of 2/2/95.	Low	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
SR14B-34	28-29	561	1000175608	JANCO CORPORATION	3111 WINONA AVE	2060 ft (0.39 mi) ESE	Cut and Cover	SLIC, ENVIROSTOR	Facility was evaluated by the LARWQCB in relation to metals and volatile organic compound impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements" and is listed as "Completed - Case Closed" as of 3/2/15. ¹	Low	X
SR14B-35	28-29	561	S106484422	JAY DEE AIRCRAFT SUPPLY	2917 THORNTON AVE	3125 ft (0.59 mi) SE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to chromium VI impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements" and is listed as "Completed - Case Closed" as of 12/19/14.	Low	
SR14B-36	28-29	561	S106484423	JAY-DEE AIRCRAFT SUPPLY	2921 THORNTON AVE	3117 ft (0.59 mi) SE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to chromium VI impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements" and is listed as "Completed - Case Closed" as of 12/19/14.	Low	
SR14B-37	28-29	561	S101584875	K M RECORDS INC	2980 N ONTARIO ST	2488 ft (0.47 mi) ENE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to chromium VI impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements" based on an investigation in 2005 and is listed as "Completed - Case Closed" as of 12/23/14.	Low	
SR14B-38	28	668	S106484419	LEE FILTERS (FORMER ZIPCO)	2237 HOLLYWOOD	4052 ft (0.77 mi) SSE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to chromium VI impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements" and is listed as "Completed - Case Closed" as of 12/19/14.	Low	
SR14B-40	28-29	561	U001568367	MEL BERNIE CO	3000 W EMPIRE AVE	3863 ft (0.73 mi) SE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to chromium VI impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements" and is listed as "Completed - Case Closed" as of 12/23/14.	Low	
SR14B-41	28-29	561	S102812673	MID VALLEY ANODIZING	3075 N CALIFORNIA ST	2182 ft (0.41 mi) ENE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to metals and volatile organic compound impacts to soil and an aquifer used for drinking water. The facility is listed as "Completed - Case Closed" as of 11/3/15.	Low	
SR14B-42	28	633	S106483563	PREMIER CLEANERS (FORMER)	2708 NORTH HOLLYWOOD WAY	1300 ft (0.25 mi) SE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to volatile organic compound impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements for soils only" and is listed as "Completed - Case Closed" as of 12/23/14.	Low	
SR14B-43	28-29	561	S113026331	SPACE-LOK INC	2526 N ONTARIO ST	2302 ft (0.44 mi) ESE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to chromium VI impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements for soils only" following a soil assessment and is listed as "Completed - Case Closed" as of 10/21/15. ¹	Low	X
SR14B-44	28-29	561	U002285096, S114696972, S114696974	SUN BANK	3110 WINONA AVE	2049 ft (0.39 mi) ESE	Cut and Cover	HIST Cortese, LUST, RGA LUST	Facility was evaluated by the LARWQCB in relation to hydrocarbon impacts to soil. The facility is listed as "Completed - Case Closed" as of 11/5/01.	Low	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
SR14B-46	28-29	561	S106484437	THE PATRICK TATOPOULOS DESIGNS	1951 ONTARIO ST	4303 ft (0.81 mi) SSE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to chromium VI and volatile organic compound impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Action" and is listed as "Completed - Case Closed" as of 8/25/1995.	Low	
SR14B-47	28-29	561	S106484427	U.S. LABEL CORP	3100 W VANOWEN ST	3825 ft (0.72 mi) SE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to metal impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements" and is listed as "Open - Inactive" as of 12/19/14.	Low	
SR14B-50	29	561	S107735797	AUTO MATTERS	2812 N SAN FERNANDO BLVD	3650 ft (0.69 mi) ESE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to metals and volatile organic compound impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements" and is listed as "Completed - Case Closed" as of 6/16/06.	Low	
SR14B-51	28	561	S107735800	CAL-AIR PROCESSING	3014 N HOLLYWOOD WAY	1129 ft (0.21 mi) ENE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to chromium VI impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements" and is listed as "Completed - Case Closed" as of 12/23/14.	Low	
SR14B-52	28	561	S107735801	CAMELOT PRESS	2815 LIMA ST N	1501 ft (0.28 mi) ENE	Cut and Cover	HIST Cortese, LUST, RGA LUST	Facility was evaluated by the LARWQCB in relation to a leaking underground storage tank case where fuel may have impacted an aquifer used for drinking water. The facility was determined to need "No Further Requirements" and is listed as "Completed - Case Closed" as of 12/27/96.	Low	
SR14B-54	29	561	S107735805	COMCO INC	2151 N LINCOLN ST	5055 ft (0.96 mi) ESE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to a chromium VI and volatile organic compound impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Action" and is listed as "Completed - Case Closed" as of 9/22/2015.	Low	
SR14B-55	28-29	561	S107735809	FORMER TWISS HEATING & TREATING	2503 N ONTARIO BLVD	2275 ft (0.43 mi) ESE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to volatile organic compound impacts to soil. The facility was determined to need "No Further Requirements" as of 12/17/97.¹	Low	X
SR14B-56	29	561	S107735810	GRAPHIC ART SYSTEMS INC	2150 N LINCOLN ST	5149 ft (0.98 mi) ESE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in 2001 in relation to chromium VI and volatile organic compound impacts to soil and an aquifer used for drinking. The facility was determined to need "No Further Requirements" and is listed as "Completed - Case Closed" as of 12/22/14.	Low	
SR14B-57	28	561	S107735811	HERTZ ENTERTAINMENT SERVICES (9684-00), AVIALL INC	3111 KENWOOD ST	183 ft (0.03 mi) ENE	Cut and Cover	HIST Cortese, LUST, SLIC, RGA LUST	Facility was evaluated by the LARWQCB in relation to metal, TPH, and VOC impacts to soil and an aquifer used for drinking water. The facility is listed as "Open - Remediation" as of 3/25/96.¹	High	X
SR14B-58	28	561	S107735813	IMAGE TRANSFORM LAB	3611 N SAN FERNANDO BLVD	809 ft (0.15 mi) ENE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to metal impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Investigation" and is listed as "Completed - Case Closed" as of 12/31/96.	Low	
SR14B-59	28	561	S107735820	L. A. GAUGE CO INC	7440 SAN FERNANDO RD	646 ft (0.12 mi) ENE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to a volatile organic compound impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements" and is listed as "Completed - Case Closed" as of 12/1/98.¹	Low	X

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
SR14B-60	28	649	S107735821	LOCKHEED A-1 EAST	3401 W EMPIRE AVE	3061 ft (0.58 mi) SSE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to hydrocarbon and volatile organic compound impacts to soil and an aquifer used for drinking water. The facility is listed as "Open - Site Assessment" as of 7/17/96. ¹	Low	X
SR14B-61	28-29	561	S107735822	LOCKHEED A-1 EAST, BLDG 90	3110 W THORNTON AVE	2447 ft (0.46 mi) SE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to volatile organic compound impacts to an aquifer used for drinking water. The facility is listed as "Open - Remediation" as of 10/30/98. ¹	Med	X
SR14B-62	28	649	S107735824	LOCKHEED CAL. COMPANY PLANT A1, LOCKHEED AIRCRAFT CORPORATION	2555 N HOLLYWOOD WAY	2154 ft (0.41 mi) SSE	Cut and Cover	CERCLIS NFRAP, SLIC	Facility was evaluated by the LARWQCB in relation to metal and volatile organic compound impacts to soil and an aquifer used for drinking water. The facility is listed as "Open - Remediation" as of 9/24/01. ¹	Med	X
SR14B-63	28	668	S107735826	LOCKHEED PLANT A-1 SOUTH	2311 N HOLLYWOOD WAY	3616 ft (0.68 mi) SSE	Cut and Cover	SLIC	Facility is listed as "Open - Remediation" as of 5/24/1995 due to semi-volatile organic compounds and volatile organic compound impacts to an aquifer used for drinking water. ¹	Low	X
SR14B-64	28	561	S107735828	LOCKHEED-B6-371	2960 HOLLYWOOD WAY	1067 ft (0.2 mi) ENE	Cut and Cover	HIST Cortese, SLIC	Facility was evaluated by the LARWQCB in relation to volatile organic compound impacts to soil and an aquifer used for drinking water. The facility is listed as "Open - Site Assessment" as of 1/27/15. ¹	High	X
SR14B-65	28-29	561	S107735829	MAGNA PLATING COMPANY	3063 N CALIFORNIA ST	2149 ft (0.41 mi) ENE	Cut and Cover	SLIC, ENVIROSTOR	Facility was evaluated by the LARWQCB in relation to metals and volatile organic compound impacts to soil and an aquifer used for drinking water. The facility is listed as "Open - Site Assessment" as of 9/29/05.	Med	
SR14B-66	28	561	S107735832	PACIFIC AIRMOTIVE CORPORATION	2940/2840 N HOLLYWOOD WAY	1043 ft (0.2 mi) ENE	Cut and Cover	SLIC	See below.	High	
SR14B-67	28	561	S107735833	PACIFIC AIRMOTIVE CORPORATION	2940 N HOLLYWOOD WAY	1043 ft (0.2 mi) ENE	Cut and Cover	CERCLIS NFRAP, HIST Cortese, LUST, ENVIROSTOR, RGA LUST	Facility was evaluated by the LARWQCB in relation to volatile organic compound impacts to soil and an aquifer used for drinking water. The facility is listed as "Open - Remediation" as of 5/31/99.	High	
SR14B-68	28-29	561	S107735834	PREMIER DRY CLEANING	3238 N SAN FERNANDO BLVD	1934 ft (0.37 mi) ENE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to volatile organic compound impacts to soil and an aquifer used for drinking water. The facility is listed as "Completed - Case Closed" as of 4/15/88.	Low	
SR14B-69	28-29	561	S107735835	PROCESS CONTROL LABS	2520 N ONTARIO ST, #D	2312 ft (0.44 mi) ESE	Cut and Cover	SLIC, ENVIROSTOR	Facility was evaluated by the LARWQCB in relation to volatile organic compound impacts to an aquifer used for drinking water. The facility was determined to need "No Further Requirements" and is listed as "Completed - Case Closed" as of 12/23/14.	Low	
SR14B-70	29	561	S107735837	QUEEN CITY SHELL IN.	2801 SAN FERNANDO BLVD N	3074 ft (0.58 mi) ENE	Cut and Cover	HIST Cortese, LUST, RGA LUST	Facility was evaluated by the LARWQCB in relation to a leaking underground storage tank case where gasoline impacted soil and an aquifer used for drinking water. The facility is listed as "Completed - Case Closed" as of 11/5/01.	Low	
SR14B-71	28-29	561	S107735841	SIERRACIN-HARRISON	3020 EMPIRE AVE	3776 ft (0.72 mi) SE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to metals and volatile organic compound impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements" and is listed as "Open - Inactive" as of 10/29/14. ¹	Low	X

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
SR14B-72	28-29	561	S107735848	VALLEY ENAMELING CORP	2509 N ONTARIO ST	2267 ft (0.43 mi) ESE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to chromium VI impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements" and is listed as "Completed - Case Closed" as of 12/23/14. ¹	Low	X
SR14B-73	29	561	S107735851	WORLD OIL CO	2417 SAN FERNANDO BLVD N	4459 ft (0.84 mi) ESE	Cut and Cover	HIST Cortese, LUST, RGA LUST	Facility was evaluated by the LARWQCB in relation to chromium VI impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements" following soil vapor extraction remediation and is listed as "Completed - Case Closed" as of 6/26/06.	Low	
SR14B-75	28	561	S107735853		LOCKHEED BUILDING #199, LOCKHEED, PLANT B-1, 199	97 ft (0.02 mi) WSW	Cut and Cover	CHMIRS	Two incidents were reported in 1989. No further information was included.	Med	
SR14B-76	28	561	S107735854		LOCKHEED PLANT B-1 BLDG 166	97 ft (0.02 mi) WSW	Cut and Cover	CHMIRS	An incident was reported in 1988. No additional information was provided.	Med	
SR14B-77	28	561	S107735855		LOCKHEED PLANT B-1, BLDG #161	97 ft (0.02 mi) WSW	Cut and Cover	CHMIRS	An incident was reported in 1989. No additional information was provided.	Med	
SR14B-78	29	597	S107735858	OCEAN TECHNOLOGY INC	2835 NAOMI ST N	3675 ft (0.7 mi) ENE	Cut and Cover	HIST Cortese, LUST, RGA LUST	Facility was evaluated by the LARWQCB in relation to acetone impacts to soil and an aquifer used for drinking water. The facility is listed as "Completed - Case Closed" as of 2/11/97. ¹	Low	X
SR14B-79	23	389	S100833478	LOCKHEED-BURBANK PLANTS A-1, B-1, B-6 & C-1	2555 N HOLLYWOOD WAY	2154 ft (0.41 mi) SSE	Cut and Cover	CA BOND EXP. PLN	Facility is listed to be one of the responsible parties for the impacts to the San Fernando Valley groundwater basin resulting in the current Superfund site. Historical usage at the facility related to aircraft manufacturing and research resulted in PCE, TCE, and VOC impacts. Monitoring and remediation is reported to be in progress. ¹	High	X
SR14B-82	23	378	S108196068	BURBANK AIRPORT AUTHORITY	2627 HOLLYWOOD	1422 ft (0.27 mi) SSW	Cut and Cover	ENVIROSTOR	Facility was evaluated by the LARWQCB in relation to metals and volatile organic compound impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements" and is listed as "Completed - Case Closed" as of 12/22/14.	Low	
SR14B-84	23	387	S108974267	THE HERTZ CORP.	4521 EMPIRE AVE.	3401 ft (0.64 mi) SW	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to metal impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements" and is listed as "Completed - Case Closed" as of 12/22/14.	Low	
SR14B-85	23	392	S107737541	VEGA AIRCRAFT		2576 ft (0.49 mi) SSE	Cut and Cover	ENVIROSTOR	Facility was evaluated by the DTSC in relation to a Formerly Used Defense Site. The facility is listed as "Inactive - Needs Evaluation" as of 7/1/05.	Med	
SR14B-86	23	316	S100280525		2428 NORTH ONTARIO ST.	2498 ft (0.47 mi) ESE	Cut and Cover	CHMIRS	An incident was reported in 1988. No further information was provided.	Low	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
SR14B-87	28	618	S100356219	LOCKHEED PLANT C-1	10720 SHERMAN WY	3589 ft (0.68 mi) WSW	Cut and Cover	SLIC	LUST (S100356219) - Facility is listed to have impacted an aquifer used for drinking water supply with solvents. Site status is listed as "Completed - Case Closed" as of 12/7/1994. SLIC (S100356219) - Facility is listed to have impacted soil and an aquifer used for drinking water supply with metals (Chromium) and VOCs. Approximately 110,000 tons of impacted soil were removed from the site. A notice of "No Further Remediation" for soil was issued in 1990 and 1994. Continued remediation for the impacted aquifer is reported and site status is listed as "Open - Remediation" as of 7/28/1992.¹	Low	X
SR14B-88	28	618	1003878490, U001568412	PAC AIRCRAFT ENGINEERING CTR, MEDIA AVIATION	3000 N CLYBOURN AVE, 3000 N CLYBOURN AVE	3023 ft (0.57 mi) WSW	Cut and Cover	CERCLIS NFRAP, SLIC	CERCLIS-NFRAP (1003878490) - Site is listed to "not qualify for the NPL based on existing information" as of 1981. SLIC (U001568412) - Facility was evaluated by the LARWQCB in 2005 in relation to a chromium VI source assessment for the area. The facility was determined to need "No Further Requirements" in relation to the investigation in 2005 and is listed as "Completed - Case Closed" as of 12/23/2014.	Low	
SR14B-89	N/A	49	S122356468	FORMER ADEL PRECISION PRODUCTS - ADEL PRECISION PRODUCTS	10635-10703, 10725 VANOWEN	4330 ft (0.82 mi) WSW	Cut and Cover	CPS-SLIC	The facility is listed to have impacted an aquifer used for drinking water supply, soil, and soil vapor with chromium VI, PCE, and TCE due to historic aerospace industry operations. Current site status is listed to be "Open- Site Assessment."	Low	
SR14B-90	N/A	52	1000168300	PRICE CLUB	10950 SHERMAN WY	5019 ft (0.95 mi) WSW	Cut and Cover	ENVIROSTOR, HIST Cortese, LA Co. Site Mitigation	Facility was evaluated for impacts due to usage (fuel station, etc.) in 2011. Abatement for an unspecified compound was listed to have occurred and been performed.	Low	
SR14B-91	N/A	222	S108196068	LOCKHEED AIR TERMINAL	2627 NORTH HOLLYWOOD WAY	1637 ft (0.31 mi) SSE	Cut and Cover	ENVIROSTOR, CHMIRS	ENVIROSTOR - Facility was evaluated by the LARWQCB for potential impacts by halogenated solvents with "historical" listed for the site type with the last status date of 5/12/95. CHMIRS – An incident was reported in September 2013 stated that a blockage on private property created an overflow of raw sewage to a storm drain.	Med	
SR14B-92	N/A	AF191	1000685953	AMERIFLIGHT	4700 EMPIRE AVE HANGER ONE	3089 ft (0.59 mi) SW	Cut and Cover	LUST, CA FID UST	The facility is listed to have contained a LUST that impacted an unknown media. The case is listed as "Completed – Case Closed" with a status date of 12/15/92.	Low	
SR14B-93	N/A	AF197	S104406389	MERCURY AIR SERVICES	4331 EMPIRE AVE W	3015 ft (0.57 mi) SW	Cut and Cover	HIST CORTESE, LUST	The facility is listed to have impacted soil with aviation fuel. The status is listed to be "Completed – Cased Closed" as of 11/16/2011.	Low	
SR14B-94	N/A	AN214, AN215	S101586348, S100948720	R J MYERS & SONS, INCORPORATED	7333 CLYBOURN AVE	3060 ft (0.58 mi) WSW	Cut and Cover	HIST CORTESE, LUST	The facility is listed to have impacted soil with aviation fuel. The status is listed to be "Completed – Cased Closed" as of 6/5/1984.	Low	
SR14B-95	N/A	B31, B32, B34	S114683121, S114672991, S104406393	QUALITY AUTO REPAIR, SARKIS KRIKORIAN LEONS CO	10740 VANOWEN ST	4675 ft (0.89 mi) WSW	Cut and Cover	RGA LUST, LUST, HIST CORTESE	The facility is listed to have impacted soil with diesel and gasoline. The status is listed to be "Completed – Cased Closed" as of 4/20/2015.	Low	
SR14B-96	N/A	B8, B9	S122356477, S122354302	SUB-AREA OF FORMER ADEL PRECISION PRODUCTS	10717 VANOWEN	4589 ft (0.87 mi) WSW	Cut and Cover	CPS_SLIC	The facility is listed to have impacted soil and soil vapor with VOCs (PCE/TCE). The case is listed with a status of "Completed – Case Closed" as of 5/30/2018.	Low	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
SR14B-97	N/A	0	1000709322	SAN FERNANDO VALLEY (AREA 1)	NORTH HOLLYWOOD WELLFIELD AREA	0 ft	Cut and Cover	NPL, PRP, RODS, SEMS, CORTESE, ENVIROSTOR, CONSENT, ENG CONTROLS, HIST CALSITES, INST CONTROL	The case is in relation to the impacted groundwater of the San Fernando Valley Basin by TCE, PCE, and carbon tetrachloride and chloroform to a lesser extent. The impact is basically valley wide and has impacted groundwater used for drinking water. Remediation of the water is ongoing and has been divided into different areas for characterization, status, and remediation purposes.¹	High	X

¹The site is included in a group of industrial facilities that are documented to be included as "Responsible Parties" in relation to the San Fernando Valley Superfund Site for VOC/solvent/metal/chlorinated hydrocarbon impacts to groundwater used for drinking water. Listed sites with the same designation have the Case Background description associated with the listing presented in BOLD font and contain an "X" in the "Associated with the Superfund Site (Area #1)" column. While the San Fernando Superfund Site currently has a status of "Open - Remediation" or similar, some of the associated sites may have since been closed or have a status of "Completed - Case Closed". The remaining sites continue to be open and undergoing remediation for the associated contamination.

Table 3.10-B-6: E1 Central Subsection PEC Sites

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
E1C-1	27	355	1011812498	12127 MONTAGUE ST	12127 MONTAGUE ST	2255 ft (0.43 mi) ENE	Tunnel	US BROWNFIELDS	Site is listed to be part of a TBA Cooperative Agreement for potentially impacted properties. A Phase I ESA indicated cleanup is not required for the property.	Low	
E1C-2	26-27	355	1011812499	12237 MONTAGUE ST	12237 MONTAGUE ST	1263 ft (0.24 mi) ENE	Tunnel	US BROWNFIELDS	Site is listed to be part of a TBA Cooperative Agreement for potentially impacted properties. A Phase I ESA indicated cleanup is not required for the property.	Low	
E1C-3	26-27	355	1011812500	12269 MONTAGUE ST	12269 MONTAGUE ST	982 ft (0.19 mi) ENE	Tunnel	US BROWNFIELDS	Site is listed to be part of a TBA Cooperative Agreement for potentially impacted properties. A Phase I ESA indicated cleanup is not required for the property.	Low	
E1C-4	26	355	1011812501	12333 BRANFORD ST	12333 BRANFORD ST	417 ft (0.08 mi) WSW	Retained Cut / Trench	US BROWNFIELDS	Site is listed to be part of a TBA Cooperative Agreement for potentially impacted properties. A Phase I ESA indicated cleanup is not required for the property.	Low	
E1C-5	26	355	2008439502, 2004041369, 2004090543, 2004090552, 2007432171, 9900016774, 9900017582, S118188860, S101618411, S112829940, 2008426052, 2004061278, 9999010984	12466 MONTAGUE, ABF FREIGHT SYSTEM INC	12466 MONTAGUE ST (CON-WAY FREIGHT TERMINAL UFV)	251 ft (0.05 mi) WSW	Retained Cut / Trench	HMIRS, CHMIRS	Various spill incidents were reported in relation to transportation of chemicals. Upon review, a majority of the spills occurred while in off-site transit, were contained, and appeared to be minor.	Low	
E1C-6	27	372	2008442399, 2000018444, 2005702069, 2005705141, 9900015353, 2000018445, 2000023111, 2000023112, 2000026381, 2000026382, 2000027914, 2000027915, 2000081231, 2000100313, 2000100954, 2000101199, 2001010286, 2001010613, 2002079730,	9210 SAN FERANND0 RD	9210 SAN FERNANDO RD, 9210 SAN FERNANDO RD	8 ft (0 mi) SW	At-grade	HMIRS	Various spill incidents were reported in relation to transportation of chemicals. Upon review, a majority of the spills occurred while in off-site transit, were contained, and appeared to be minor.	Low	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
			2005702976, 2005703130, 20								
E1C-7	29	443	S113001921	ABBOTT TECHNOLOGIES INC	8203 VINELAND	260 ft (0.05 mi) SW	Cut and Cover	CHMIRS	In 2013, a caller reported an illegal dumping of sewage from motor homes. Approximately 100 gallons were reported and the material was contained with the sewage system.	Low	
E1C-8	29	429	1000426895, 1012010283	ACCURATE ENGINEERING INC	8710 TELFAIR AVE	1509 ft (0.29 mi) SW	At-grade	TRIS, ENVIROSTOR	ENVIROSTOR (1000426895) - Facility is reported to have been assessed via a Phase I ESA for potential COCs. No COCs were confirmed for the site and the facility was determined to not be subject to the NPL and/or land use restrictions. TRIS (1012010283) - Facility is listed to have notified the EPA under SARA Title II, Section 313. Copper and lead compounds are reported to be transferred from the facility for further waste management.	Low	
E1C-9	12	180	S106103358	ACTION CLAY QUARRIES	FOREST SERVICE RD 4N32	3475 ft (0.66 mi) SE	Tunnel	LDS	Facility is listed to be an active land disposal site in relation to mining operation byproducts that are being produced. Site status is listed to be "Open - Operating" as of 5/31/2016.	Low	
E1C-10	27	372	1007739312, S110275515, S106484865	ACTIVE MAGNETIC INSPECTION INC EAGLE TECH	9356 1/2 SAN FERNANDO ROAD, UNIT B	24 ft (0 mi) NE	At-grade	TRIS, ENVIROSTOR, SLIC	ENVIROSTOR (S110275515) - Facility was evaluated for the NPL and determined not to be eligible as of 9/8/2011. The site was referred to the EPA. SLIC (S106484865) - Facility was evaluated by the LARWQCB in 1997 in relation to a chromium VI source assessment for the area. The facility was determined to need "No Further Requirements" in relation to the investigation in 1997 and is listed as "Completed - Case Closed" as of 11/14/2014. TRIS (1007739312) - Facility is listed to have notified the EPA under SARA Title II, Section 313 in related to chromium, nickel, and nitric acid waste transferred for metal recovery from the site operations.	Med	
E1C-11	18	182	S117660933	ACTON CLAY QUARRIES	31375 N. ALISO CANYON RD	3279 ft (0.62 mi) SE	Tunnel	CA MINES	Facility is listed active clay open pit, plant or mill mine as of 2014.	Low	
E1C-12	29	443	S100229464, S114568808	ADVANCED PACKAGING TECHNIQUES	11340 PENROSE ST	714 ft (0.14 mi) SW	Retained Cut / Trench	HIST CORTESE, LUST, GA LUST	Facility is listed to have impacted soils with alcohols due to a LUST. The site status is reported as "Completed - Case Closed" as of 7/22/1996.	Low	
E1C-13	27	372	1000905404, 1014202314	ALERT PLATING COMPANY	9939 GLENOAKS BLVD	3355 ft (0.64 mi) ENE	At-grade	CERCLIS-NFRAP, SLIC	CERCLIS-NFRAP (1014202314) - Site assessed for contamination in 2010 and is listed as NFRAP due to not qualifying for the NPL based on existing information. SLIC (1000905404) - Facility was evaluated by the LARWQCB in 2001 in relation to a chromium VI source assessment for the area. The facility was determined to need "No Further Requirements" in relation to the investigation in 2003 and is listed as "Completed - Case Closed" as of 12/22/2012.	Low	
E1C-14	27	372	1018119623	ALLEGHENY SITE	11933-11941 W ALLEGHENY ST	541 ft (0.1 mi) SW	At-grade	US BROWNFIELDS	Site is listed to be part of a TBA Cooperative Agreement for potentially impacted properties. A Phase I ESA indicated cleanup is not required for the property. Unknown media was indicated to have been affected at the site.	Low	
E1C-15	26-27	355	1011812514	ANGELUS OXYGEN	12173-79 BRANFORD ST	977 ft (0.19 mi) ENE	Retained Cut / Trench	US BROWNFIELDS	Site is listed to be part of a TBA Cooperative Agreement for potentially impacted properties. A Phase I ESA indicated cleanup is not required for the property.	Low	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
E1C-16	24	239	S105088508	ANTHONY INC	12364 GLADSTONE AVE	1330 ft (0.25 mi) WNW	Tunnel	ENVIROSTOR	Facility is listed to be part of a tiered permit. Site is not subject to the NPL or land use restrictions. Current site status is listed as "Inactive - Needs Evaluation."	Low	
E1C-17	24	239	1000477327, S114572144	ANTHONY MANUFACTURING CO INC	12812 ARROYO AVE	1299 ft (0.25 mi) WNW	Tunnel	HIST CORTESE, LUST, SLIC, ENVIROSTOR, RGA LUST	Facility is listed as "Completed - Case Closed" as of 1997 for an aquifer used for drinking water supply impacted by gasoline and VOCs. A conditional closure was issued pursuant to report of proper sealing of well.	Low	
E1C-18	26	299	S114574855, S104891039	ARCO #9630	12579 VAN NUYS BLVD	170 ft (0.03 mi) ESE	Tunnel	LUST, RGA LUST	Facility is listed as "Leak Being Confirmed" for a gasoline leak to soil as of 2001.	High	
E1C-19	26	324	S114574856, S114702758, S102438981, S114575341, S114703282, S103066084	ARCO #9630, THRIFTY #230	12957 VAN NUYS BLVD	2266 ft (0.43 mi) WSW	Tunnel	HIST CORTESE, LUST, RGA LUST	LUST - Facility is listed to have impacted soil due to a LUST containing gasoline. Site status is listed to be "Case Closed" as of 1/9/1991. LUST/HIST CORTESE (S103066084) - Facility is listed to have impacted other groundwater (used other than drinking water) with gasoline due to a LUST at the site. Site status is listed to be "Completed - Case Closed" as of 3/28/2013.	Low	
E1C-20	27-29	424	1017400940	ASSOCIATED READY MIXED CONCRETE INC	8946 BRADLEY AVE	1570 ft (0.3 mi) NE	At-grade	TRIS	Facility is listed as a hazardous waste/enforcement and compliance history site for lead compounds with a status date of 2014. The lead compounds are reported to be transferred offsite for further waste management.	Low	
E1C-21	29	444	S113145672	ASTRO CHROME & POLISHING	8136 LANKERSHIM BLVD	3951 ft (0.75 mi) SW	At-grade	SLIC	Facility listed as "Open - Site Assessment" as of 2014 for chlorinated hydrocarbons for impacting an unspecified media.	Low	
E1C-22	27	402	S103587984	ATHENS SUN VALLEY MAT REC & T.S.	11121 PENDLETON ST	3801 ft (0.72 mi) NE	At-grade	SWF/LF	Facility is listed as an active large volume transfer and processing facility that accepts green materials, household trash, and inert metals. Monthly inspections are reported for the site and a daily capacity is listed to be 1,500 tons.	Low	
E1C-23	27	402	S103441295	BENTZ DUMP	11251 PENDLETON ST	3368 ft (0.64 mi) NE	At-grade	LDS,WMUDS/S WAT	Facility is listed as a land disposal site with a status of "Completed - Case Closed" as of 5/25/2016. Accepted materials are listed to be clean dirt, broken concrete, asphalt, brick, block and rock.	Low	
E1C-24	27	372	S112205497	BINS BINS BINS INC	11835 SHELDON ST	859 ft (0.16 mi) NE	Elevated / Aerial Structure	SWF/LF	Facility is listed as an active waste hauler. Limited additional information is provided.	Low	
E1C-25	29	402	S113724443	BIOMEDICAL WASTE DISPOSAL	11152 FLEETWOOD ST, #9	1846 ft (0.35 mi) NE	Retained Cut / Trench	MWMP	Facility is listed to be a transfer only medical waste facility. No additional information is provided.	Low	
E1C-26	29	464	S114583652, 1000590036	BLACKTOP MATERIALS COMPANY, BLACTOP MATERIALS CO #2	11462 PENROSE ST	1621 ft (0.31 mi) SW	Retained Cut / Trench	HIST CORTESE, LUST, RGA LUST	Facility is reported to have impacted soil with diesel fuel due to a LUST. Site status is listed as "Completed - Case Closed" as of 9/7/1995.	Low	
E1C-27	26	399	S117661157	BOULEVARD	9108 LAUREL CANYON BLVD	2550 ft (0.48 mi) SW	At-grade	CA MINES	Facility is listed as an idle sand and gravel open pit, plant, or mill operation. Reclamation is reported to be in progress and the facility is listed to be 124 acres in size. Information for the site was updated in 2014.	Med	
E1C-28	27	402	U003060793	BRADLEY AVE DUMP	9050 BRADLEY AVE	1603 ft (0.3 mi) NE	At-grade	LDS,WMUDS/S WAT	Facility is listed as a land disposal site with a status of "Open-Inactive" as of 11/29/2012. Groundwater monitoring was conducted at the site and elevated VOC and PCE/TCE concentrations were identified.	Med	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
E1C-29	27	404	S113887321	BRADLEY EAST LANDFILL	9229 TUJUNGA AVE	2430 ft (0.46 mi) NE	At-grade	LDS	Facility is a former sand and gravel pit that was subsequently used as an unlined non-hazardous solid waste landfill that is listed as "Open - Closed/With Monitoring" as of 5/22/2016. Groundwater and soil/soil vapor are listed to have been impacted with VOCs, metals, and landfill related gases. The facility is reported to have "leaking waste constituents in excess of DHS/MCLs and may be affecting groundwater in the vicinity of the landfill.	Med	
E1C-30	27	400	S100931059, S109286318, S111075797, S103341425	BRADLEY EAST LANDFILL, BRADLEY LANDFILL & RECYCLING CENTER	9227 TUJUNGA AVE	2005 ft (0.38 mi) NE	At-grade	SWF/LF,LDS,W MUDS/SWAT	Facility is listed to be a closed solid waste landfill that accepts construction/demolition, industrial, mixed municipal, and other designated wastes. The closure date is listed as 6/1/2007 and the facility is reported to be 126 acres in size. Facility is also listed to be a solid waste landfill with quarterly inspections with a closure date of 12/31/1980. Facility is also listed to be a closed large volume transfer/processing facility with a closure date of 3/10/1988. Currently, the facility is listed to be an active large volume transfer/processing facility accepting agricultural, green materials, and manure with monthly inspections.	Med	
E1C-31	26-27	355	1000200264, S103441737, 1003880073, S103441393	BRANFORD LANDFILL, BRANFORD EXPERIMENT SITE, LOS ANGELES DWP-BRANFORD STREE	9701 SAN FERNANDO	675 ft (0.13 mi) WSW	At-grade	CERCLIS-NFRAP, HIST CORTESE, LDS, ENVIROSTOR,W MUDS/SWAT	LDS ENVIROSTOR (S103441737) - Facility is listed to be a closed land disposal site with a status of "Open - Closed/With Monitoring" as of 2/25/2016. A landfill gas collection system is reported to be operated continuously to mitigate methane gas migration from the facility. ENVIROSTOR (S103441737) - Facility is listed to have impacted groundwater, soil, and soil vapor with methane due to landfill operations. Site status is reported to be "No Further Action" as of 9/30/1998. CERCLIS-NFRAP (1003880073) - Site assessed for contamination in 1997 and is listed as NFRAP due to not qualifying for the National Priority List (NPL) based on existing information provided in October 2013.	High	
E1C-32	26	355	S102360935	BRANFORD LF	12456 BRANFORD ST	1682 ft (0.32 mi) WSW	At-grade	SWF/LF	Facility is listed to be a closed solid waste landfill. Detail of the material accepted is not provided, however, quarterly inspections are reported. The closure date is not reported for the site.	Med	
E1C-33	27	402	U001567850	BROWNING FERRIS INDUSTRIES INC	9200 GLENOAKS BLVD	3777 ft (0.72 mi) NE	At-grade	SWF/LF	Facility is listed to be an active waste hauler. Limited additional information was provided in relation to site operations. ¹	Low	X
E1C-34	29	443	S103621795	BURBANK AIRCRAFT SUPPLY INC	10671 LANARK	414 ft (0.08 mi) NE	Tunnel	SLIC	Facility is listed to have impacted an aquifer used for drinking water supply with VOCs and chromium. Current status is listed as "Open-Inactive" as of 10/29/2014. Groundwater gradient information was not reported but is anticipated to be toward the southeast per typical flow within the San Fernando Valley area.	High	
E1C-35	29	503	S111828968	BURBANK AIRPORT AUTHORITY	2627 HOLLYWOOD WAY	2159 ft (0.41 mi) NE	Tunnel	SLIC	Facility was evaluated by the LARWQCB in 2004 in relation to a chromium VI source assessment for the area. The facility was determined to need "No Further Requirements" in relation to the investigation in 2004 as is listed as "Completed - Case Closed" as of 12/22/2014.	Low	
E1C-36	24	246	S116497301	C&M TOPSOIL INC	12087-40 LOPEZ CANYON RD.	740 ft (0.14 mi) ESE	Tunnel	SWF/LF	Site is listed as an active facility accepting green waste for composting operations as of 2014.	Low	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
E1C-37	24	239	S101298230, S114588823, S114588822	C. E. MACMILLAN INC	12355 GLADSTONE AVE	1307 ft (0.25 mi) WNW	Tunnel	HIST CORTESE, LUST, RGA LUST	Facility is reported to have impacted soil with other solvents or non-petroleum hydrocarbons due to a LUST. Site status is listed as "Completed - Case Closed" as of 9/4/1996.	Low	
E1C-38	29	500	2004100406, 1000252200	CALIFORNIA BIONUCLEAR CORP	7649 SAN FERNANDO RD	249 ft (0.05 mi) SW	Tunnel	CERCLIS-NFRAP, HMIRS, PRP	Facility was evaluated in relation to the San Fernando NPL case for potentially impacting groundwater with VOCs and/or chromium. The site was determined to require removal only, no site assessment work needed as of 1987.	Med	
E1C-39	26	396	1011961457	CALIFORNIA CHEMICAL MANUFACTURING LLC (AMR)	12734 BRANFORD ST, SUITE 20	3517 ft (0.67 mi) SW	At-grade	CERCLIS-NFRAP	Site assessed for contamination in 2009 and is listed as No Further Remedial Action Planned (NFRAP) due to not qualifying for the National Priority List (NPL) based on existing information.	Low	
E1C-40	29	444	S112274179	CALIFORNIA PROPELLER	8101 LANKERSHIM BLVD	4127 ft (0.78 mi) SW	Retained Cut / Trench	SLIC	Facility was investigated in relation to chromic acid, and 1,1,1-TCA use at the site. Soil samples were collected adjacent to an abandoned clarifier that indicated elevated concentrations of chromium. A soil gas survey was subsequently performed that indicated elevated 1,1-DCE and 1,1,1-TCA concentrations in soils adjacent to the clarifier. The site received a letter of "No Further Action" in regard to soil and soil vapor impacts from the LARWQCB in 1994. The site received a notice of "No Further Action" subsequently in 1996 for the USEPA. Due to concerns regarding emerging chemicals detection in the groundwater of the North Hollywood Operable Unit, the LARWQCB issued a notice for further investigation for potential groundwater impact. In response, a technical report was prepared in 2012 by a consultant. A notice of "No Further Action" in relation to potential groundwater impacts was issued in 2015 by the LARWQCB. The site status is listed as "Completed - Case Closed" as of 5/21/2015.	Low	
E1C-41	29	402	1016467998	CALMAT CO		439 ft (0.08 mi) NE	At-grade	US MINES	Facility is listed as "Non-Coal Mining" as of 1973. Limited additional information was provided.	High	
E1C-42	27-29	402	1006816059	CALPORTLAND CO SUN VALLEY PLANT	8981 BRADLEY AVE	1556 ft (0.29 mi) NE	At-grade	TRIS	Facility is listed to produce lead compounds with off-site transfer for disposal of approximately 13 pounds of the compounds per year.	Low	
E1C-43	24	257	S114726531, S106079129	CITY OF SAN FERNANDO CORP YARD	535 GLENOAKS BLVD	5265 ft (1 mi) WNW	Tunnel	SWF/LF, RGA LF	Facility is listed to be an active limited volume transfer operation accepting construction/demolition, green material, inert, and metal wastes. The site is reported to be inspected quarterly and the permit date for the facility is 9/15/2003.	Low	
E1C-44	29	402	1000591490	COAST LIQUID GAS	11370 PENDLETON ST	583 ft (0.11 mi) NE	Elevated / Aerial Structure	LUST	SWF/LF -Very limited information provided for facility but site is listed in SWF/LF database. LUST - During steam cleaning of a sump, contaminated soil was excavated and disposed of for an unknown contaminant in 1988.	Med	
E1C-45	24	239	1003878859, S104573531	COMMODORE PRODUCTS, P & G PRODUCTS	12800 FOOTHILL BLVD	2307 ft (0.44 mi) WNW	Tunnel	CERCLIS-NFRAP, ENVIROSTOR	CERCLIS - NFRAP (1003878859) - Site assessed for contamination in 2010 and is listed as NFRAP due to not qualifying for the NPL based on existing information. ENVIROSTOR (S104573531) - Facility was investigated in relation to multiple potential COCs at the site under a site characterization and assessment grant. No COCs were confirmed for the facility and the case was referred to another agency as of 8/21/1995.	Low	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
E1C-46	27	402	1000155657, S103340305, 1000409068	COMMUNITY RECYCLING / RES RECOVERY, INC, SOUTHERN CALIFORNIA WASTE REDUCTION	9147 DE GARMO AVEE	3142 ft (0.6 mi) NE	At-grade	CERCLIS-NFRAP, CORRACTS, SWF/LF	SWF/LF (1000155657) - Facility is listed to be an active (permit date of 1997) limited volume transfer operation that accepts construction/demolition and other designated wastes with quarterly inspections. SWF/LF (S103340305) - Facility is listed as an active (permit date of 1998) large volume transfer/processing facility that accepts construction/demolition, industrial, mixed municipal waste. Inspections are reported to be performed on a monthly basis. CERCLIS-NFRAP/CORRACTS - Facility is listed to not qualify for NPL based on information updated in October 2013.	Low	
E1C-47	26	355	1011812530, S104809415	CONDORA CONSTRUCTION SERVICES	12506 MONTAGUE ST	570 ft (0.11 mi) WSW	Retained Cut / Trench	US BROWNFIELDS, SWF/LF	LF- Site is listed as a transfer and processing facility for construction/demolition, green waste, and household hazardous waste with a capacity of 21,000 cubic yards per day. Brownfields - Site was investigated under a Phase I ESA as part of a Brownfields Assessment Cooperative Agreement, impacted media was not reported.	Med	
E1C-48	29	402	S105024700, S114605987, S114605986	CONROCK COMPANY	11401 TUXFORD ST	583 ft (0.11 mi) NE	Elevated / Aerial Structure	HIST CORTESE, LUST, RGA LUST	HIST CORTESE/LUST (S105024700) - Facility is listed to have impacted soil with an unspecified COC. Site status is listed as "Completed - Case Closed" as of 10/7/1994.	Low	
E1C-49	24	239	S114606987, S105026143, S102428394	COSMIC PLASTICS	12314 GLADSTONE AVE	1087 ft (0.21 mi) WNW	Tunnel	HIST CORTESE, LUST, RGA LUST	HIST CORTESE/LUST (S105026143) - Facility is listed to have impacted soil with an aviation fuel due to a LUST. Site status is listed as "Completed - Case Closed" as of 4/22/1988.	Low	
E1C-50	26	355	S101584556	COUNTY OF LA-FIRE DEPARTMENT	12605 OSBORNE ST	979 ft (0.19 mi) WSW	Tunnel	LUST	Site is listed as "Open - Site Assessment" as of 2014. Soil and soil vapor at the facility is listed to have been impacted with petroleum hydrocarbons and VOCs.	Med	
E1C-51	27	402	S104567759, S112891096	CROWN DISPOSAL COMPANY IN, RECOLOGY LOS ANGELES	9189 DE GARMO AVE	3142 ft (0.6 mi) NE	At-grade	SWF/LF	SWF/LF (S104567759) - Facility is listed to be a closed waste hauling site. The type of waste accepted is not reported. LUST (S104567759) - The facility is reported to have impacted soil due to a LUST containing other solvents or non-petroleum hydrocarbons. The site status is listed as "Completed - Case Closed" as of 9/2/1997. A note in the LUST file (1000437523) notes that landfill gas has migrated beneath the site. SWF/LF (S112891096) - Facility is listed to be an active waste hauler/transfer and processing facility that accepts construction/demolition, green materials, trash, and non-hazardous industrial waste.¹	Low	X
E1C-52	26	327	S114608777, S109117602	D & K MILK PALACE (BEACON)	11045 N GLENOAKS BLVD	235 ft (0.04 mi) WSW	Tunnel	LUST, RGA LUST	Facility is listed to have impacted soil with gasoline. Site is listed as "Case Closed" as of 1992.	Med	
E1C-53	27	402	S116282717, S103441524	DE GARMO LANDFILL/DEGARMO	9135 DE GARMO AVE	3101 ft (0.59 mi) NE	At-grade	LDS,WMUDS/S WAT	Site is an "Open - Inactive" land disposal site. Specifics on methane mitigation in relation to the site were not provided.	Low	
E1C-54	27	402	S103441512	DE GARMO PIT LANDFILL	11201 RANDALL STREET	2936 ft (0.56 mi) NE	At-grade	SWF/LF,WMUDS /SWAT	Site is listed as "Closed" for landfill operations and presently is used for commercial purposes. The facility is reported to have been part of the Solid Waste Assessment Test Program.	Low	
E1C-55	29	429	1006816060	DIXON HARD CHROME INC	11645 PENDLETON ST	969 ft (0.18 mi) SW	At-grade	ENVIROSTOR	Facility is listed to have a site assessment screening in relation to potential impacts as a results of past use. NPL and restricted use is not reported. The case was referred to the USEPA with a status date of 9/8/2011.	Med	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
E1C-56	26-27	394	1018119626	EL DORADO SITE	9444 N EL DORADO AVE	1040 ft (0.2 mi) SW	At-grade	US BROWNFIELDS	Site is listed to be part of a TBA Cooperative Agreement for potentially impacted properties. A Phase I ESA indicated cleanup is not required for the property. Unknown media was indicated to have been affected at the site.	Low	
E1C-57	26-27	355	1011812534, S106102747	EXPRESS METAL RECYCLING	12207 BRANFORD ST	453 ft (0.09 mi) ENE	Retained Cut / Trench	US BROWNFIELDS, ENVIROSTOR	Site is listed to be part of a TBA Cooperative Agreement for potentially impacted properties. A Phase I ESA indicated cleanup is not required for the property.	Low	
E1C-58	29	443	1000857356, 1014202338	EXPRESS PLATING DIV MASTERWORK, MONITOR POLISHING AND PLATING	8050 SAN FERNANDO RD	45 ft (0.01 mi) NE	Tunnel	CERCLIS-NFRAP, ENVIROSTOR	ENVIROSTOR (1000857356) - Site listed to be "Inactive - Needs Evaluation" for potential impacts from unspecified COCs to an unspecified media. The site status date is listed to be 9/4/2014. CERCLIS-NFRAP (1014202338) - Facility is listed to not qualify for NPL based on information updated in October 2013.	High	
E1C-59	26	309	S102429425, S114616106, S114616439	EXXON #7-3332	12786 VAN NUYS BLVD	1022 ft (0.19 mi) WSW	Tunnel	HIST CORTESE, LUST, RGA LUST	Facility is listed to have impacted soil with gasoline. Site is listed as "Case Closed" as of 1994.	Low	
E1C-60	26-27	355	S102796761	FOOTHILL AUTO ELECTRIC	12326 MONTAGUE ST	506 ft (0.1 mi) ENE	Tunnel	ENVIROSTOR	Site is listed to have been evaluated for NPL in 2013 for historic impacts and is reported to have been referred to the EPA. No COCs were specified for the facility.	High	
E1C-61	24-25	243	S114727864, S114727868	FOOTHILL WASTE RECLAMATION INC	12221 LOPEZ CANYON RD	1936 ft (0.37 mi) ESE	Tunnel	RGA LF	Facility is listed to be a landfill related site in 2005 through 2009. No additional information was provided.	Med	
E1C-62	26-27	355	S111120541	FORMER TURBO PRODUCTS	12177 MONTAGUE ST	1781 ft (0.34 mi) ENE	Tunnel	ENVIROSTOR	Site is listed to have been evaluated for NPL in 2013 and is reported to have been referred to the EPA. No COCs were specified for the facility.	Med	
E1C-63	26	355	1000726516, S114623560, S114623570, S114623574	FORTIN INDUSTRIES INC FORTIN INDUSTRIES #610	9880 SAN FERNANDO RD	959 ft (0.18 mi) WSW	Retained Cut / Trench	HIST CORTESE, LUST, SLIC, RGA LUST	Facility is listed to have impacted groundwater (uses other than drinking water) with copper. Case is listed as "Completed - Case Closed" as of 1996.	Med	
E1C-64	27	355	1011812539	GLENOAKS MOBILE MANOR	10471 GLENOAKS BLVD	2365 ft (0.45 mi) ENE	Tunnel	US BROWNFIELDS	Site is listed to be part of a TBA Cooperative Agreement for potentially impacted properties.	Low	
E1C-65	26	335	S110493872	GOLDEN STATE MAGNETIC & PENETRANT LAB	12770 PIERCE ST, #7	1082 ft (0.2 mi) WSW	Tunnel	ENVIROSTOR	Site is listed to have been part of a tiered permit and is reported to have been referred to another agency. No COCs were specified for the facility.	Low	
E1C-66	27-29	402	S105911516	GOODWIN CHEMICAL	9007 NORRIS	2145 ft (0.41 mi) NE	At-grade	SLIC	The facility is listed to have impacted soil with PCE due to storage at the site. Various phases of site assessment were completed from 1990 through 2001. The LARWQCB issued a notice of "No Further Action" on 12/14/2001.	Low	
E1C-67	27	402	S109821484	GREGG PIT (PICK YOUR PART)	11370 PENDLETON ST	2137 ft (0.4 mi) NE	At-grade	SWF/LF	SWF/LF -Very limited information provided for facility but site is listed in SWF/LF database. LUST - During steam cleaning of a sump, contaminated soil was excavated and disposed of for an unknown contaminant in 1988.	Med	
E1C-68	24-25	272	S107736420	HANSEN FLOOD CON BAS/D		2116 ft (0.4 mi) ESE	Tunnel	ENVIROSTOR	Facility is listed as "Inactive - Needs Evaluation" as of 7/1/2005 as a military evaluation. No COCs were identified for the site.	Med	
E1C-69	26	355	S108199262	HAULING SOLUTIONS INC	9871 SAN FERNANDO RD	1120 ft (0.21 mi) WSW	Retained Cut / Trench	SWF/LF	Facility is listed as active waste hauling business. Additional information not provided.	Low	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
E1C-70	29	525	S101586790	HENSLER GENERAL CONSTRUCTION	7550 WHEATLAND AVE	2003 ft (0.38 mi) SW	Tunnel	SLIC	Facility was evaluated by the LARWQCB in 2001 in relation to a chromium VI source assessment for the area. The facility was determined to need "No Further Requirements" in relation to the investigation in 2003 as is listed as "Completed - Case Closed" as of 12/22/2014.	Low	
E1C-71	29	443	1017816849	HOLLIDAY ROCK CO	11420 PENROSE ST	1182 ft (0.22 mi) SW	Retained Cut / Trench	TRIS	Facility is listed to have notified the EPA under SARA Title III, Section 313. Lead compounds (three pounds per year) are reported to be produced at the site. In addition, the facility is listed in the EPA's index system in relation to release of toxic chemicals to air, water, land, or are transported off-site.	Low	
E1C-72	27	355	S105628352	HR TEXTRON	12137 MONTAGUE ST	2167 ft (0.41 mi) ENE	Tunnel	ENVIROSTOR	Facility is listed to have been evaluated for impacts in relation to historical usage. No confirmed COCs are reported for the site. A status of "Inactive - Needs Evaluation" is reported as of 1/30/2001. ¹	Med	X
E1C-73	26-27	360	S103985140, S114633701, S114633704, S102628856, 1000404171, S114633700, 1015732716, S105025438	HR TEXTRON INC	10445 GLENOAKS BLVD	1996 ft (0.38 mi) ENE	Tunnel	CERCLIS-NFRAP, HIST CORTESE, LUST, SLIC, RGA LUST	HIST CORTESE/LUST (S103985140/S102628856) - Solvents reported to have impacted soil at the site. Significant interim remedial action was reported to have been taken. Case closed in 1996. SLIC (S103985140) - A work plan was submitted in 2004 for the facility in relation to a LQRWQCB request for information. The site was reported to receive a notice of "No Further Requirements" in relation to the San Fernando Valley Chromium VI investigation. Site status listed as "Completed - Case Closed" as of 12/22/2014. LUST (1000404171) - Facility listed to have impacted soil with waste/motor/hydraulic/lubricating oil. Site status listed as "Completed - Case Closed" as of 3/22/2016. CERCLIS-NFRAP (1015732716) - Facility was evaluated for the NPL in relation to a historical evaluation and determined to not qualify based on information provided in October 2013. ¹	Low	X
E1C-74	27	402	1000428465	INDUSTRIAL BATTERY ENGINEERING	9121 DE GARMO AVE	3092 ft (0.59 mi) NE	At-grade	SLIC	Facility was evaluated by the LARWQCB in 2001 in relation to a chromium VI source assessment for the area. The facility was determined to need "No Further Requirements" in relation to the investigation in 2003 as is listed as "Completed - Case Closed" as of 12/22/2014.	Low	
E1C-75	27	355	1011812541	INDUSTRIAL-BUSINESS PARK	12085 BRANFORD ST	1773 ft (0.34 mi) ENE	Retained Cut / Trench	US BROWNFIELDS	Site is listed to be part of a TBA Cooperative Agreement for potentially impacted properties. A Phase I ESA indicated cleanup in not required for the property.	Low	
E1C-76	24	253	1008371158	J L SHEPHERD AND ASSOC	1010 ARROYO AVE	4067 ft (0.77 mi) WNW	Tunnel	MLTS	Facility was evaluated for the NPL in relation to a historical evaluation and determined not to be eligible as of 1/30/2001. Site restrictions are not reported for the facility. The site is currently listed as "Inactive - Needs Evaluation."	Low	
E1C-77	8-9	152	S114636951, S106915912, S114636952	JASONS AUTO PARTS	415 SIERRA HWY, 415 W SIERRA HWY	894 ft (0.17 mi) WNW	Retained Cut / Trench	LUST, RGA LUST	LUSTs containing PCE, waste/motor/hydraulic/lubricating oil were reported to impact an unknown media. Case closed in 2010.	Med	
E1C-78	26-27	355	S118504792, S108749114	JESSE'S PLATING (FORMER HVC)	12229 MONTAGUE ST	1332 ft (0.25 mi) ENE	Tunnel	SLIC, ENVIROSTOR	SLIC (S118504792) - Facility is listed to impacted soil, soil vapor, and an aquifer used for drinking water supply with PCE, TCE, and chromium VI. Site status is listed to be "Open - Site Assessment" as of 2/11/2016. ENVIROSTOR (S108749114) - Facility is listed as "Inactive - Needs Evaluation" as of 9/8/2011. Past use of metal finishing/metal plating/metal	Med	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
									plating - chrome is indicated for the facility and no COCs are specified for the site.		
E1C-79	6	140	S114637448, S102431920	JILL R RATCLIFFE	36200 SIERRA HWY N, SIERRA HWY	734 ft (0.14 mi) ENE	At-grade	HIST CORTESE, LUST, RGA LUST	A LUST containing gasoline is reported to have impacted surrounding soil. Case closed in 1991.	Low	
E1C-80	27	402	S106102586	KC NISSAN AUTO DISMANTLING	10967 TUXFORD ST	4334 ft (0.82 mi) NE	At-grade	SLIC	Facility was evaluated by the LARWQCB in 2001 in relation to a chromium VI source assessment for the area. The facility was determined to need "No Further Requirements" in relation to the investigation in 2003 and is listed as "Completed - Case Closed" as of 11/29/2012.	Low	
E1C-81	29	402	S103674790	KENWALT DIE CASTING CO	8719 BRADLEY AVE	1357 ft (0.26 mi) NE	Retained Cut / Trench	SLIC	Facility was evaluated by the LARWQCB in 2001 in relation to a chromium VI source assessment for the area. The facility was determined to need "No Further Requirements" in relation to the investigation in 2003 and is listed as "Completed - Case Closed" as of 12/22/2014.	Low	
E1C-82	27	398	S112186489	LA CITY DWP PENDLETON (PENDLETON STREET LANDFILL)	11000 PENDLETON ST	5115 ft (0.97 mi) NE	At-grade	LDS	Facility is listed as a land disposal site with status of "Completed - Case Closed" as of 2012. However, VOC and solvent concentrations were reported during groundwater monitoring at the facility with flow migration toward the south.	Low	
E1C-83	27	372	S101588330, 1001491848	LA DEPARTMENT OF WATER/POWER, TRUESDALE CENTER	11791 TRUESDALE CENTER	3491 ft (0.66 mi) NE	At-grade	CERCLIS-NFRAP, VCP	VCP/ENVIROSTOR - Facility is reported to have entered a voluntary cleanup agreement in 2000 due to PCB, TPH-d, and TPH-g impacts to soil as a result of use as an electrical generation/substation. Current site status is listed as "Active."	Low	
E1C-84	29	443	S106484855	LADO MFG CO	11400 LUDDINGTON ST, #A	448 ft (0.08 mi) SW	Retained Cut / Trench	SLIC	Facility was evaluated by the LARWQCB in 2001 in relation to a chromium VI source assessment for the area. The facility was determined to need "No Further Requirements" in relation to the investigation in 2014 as is listed as "Completed - Case Closed."	Low	
E1C-85	27	355	U001567439, S114728243, S109821476, S111075979	LEDGER LANDFILL, GLENOAKS DUMP, LEDGER #2	10403 GLENOAKS BLVD	2486 ft (0.47 mi) ENE	Tunnel	SWF/LF, ENVIROSTOR, RGA LF	ENVIROSTOR (U001567439) - Facility was evaluated for the NPL and determined not to be eligible as of 1/22/2001. Site status is listed to be "Inactive - Needs Evaluation." SWF/LF (S111075979) - Facility is listed to be a closed landfill that accepted commercial, inert, liquid, and residential waste. Current use is reported to be commercial properties and a parking lot.	Med	
E1C-86	27	355	S116282712, S103441358	LEDGER NO. 2	GLENOAKS BLVD & MONTAGUE ST	2534 ft (0.48 mi) ENE	Tunnel	LDS, WMUDS/S WAT	Facility is listed to be a land disposal site with a status of "Open - Inactive" as of 12/24/2013. Limited additional information was provided.	Med	
E1C-87	26	355	S109821545	LEWIS VISCO - VALLEY IRON & METAL CO	9050 AND 9116 BRADLEY AVE	261 ft (0.05 mi) WSW	Tunnel	SWF/LF	Facility is listed to be a SWF/LF site with limited additional information reported.	High	
E1C-88	27	372	1017817032	LEX PRODUCTS WEST	11847 SHELDON ST	767 ft (0.15 mi) NE	Elevated / Aerial Structure	TRIS	Facility is listed to have notified the EPA under SARA Title III, Section 313. Copper (up to 7,552 pounds per year) are reported to be produced at the site and subject to waste broker disposal. In addition, the facility is listed in the EPA's index system in relation to release of toxic chemicals to air, water, land, or off-site transport.	Med	
E1C-89	29	402	S116282735	LIVINGSTON - GRAHAM SUN VALLEY SANITARY LANDFILL	ADJACENT TO BRADLEY WEST	82 ft (0.02 mi) SW	At-grade	LDS	Facility is listed as a land disposal site with status of "Open - Inactive" as of 2013. The landfill is comingled with the Bradley West landfill and is	High	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
									reported to have continual groundwater and methane monitoring performed in relation to operations.		
E1C-90	27	406	S114644511, S114644510, S114644509, 1000591737	LIVINGSTON GRAHAM BLUE DIAMOND	11720 WICKES ST, 11720 WICKS ST	450 ft (0.09 mi) NE	At-grade	HIST CORTESE, LUST, RGA LUST	HIST CORTESE/LUST (1000591737) - Facility is listed to have impacted soil with aviation fuel due to a LUST. Site status is reported to be "Completed - Case Closed" as of 11/13/1997.	Med	
E1C-91	27	372	1014202344	LNL ANODIZING	9900 GLENOAKS BLVD, #3	3478 ft (0.66 mi) NE	At-grade	CERCLIS-NFRAP	Facility is reported to have been investigated in relation to the San Fernando Valley Superfund Site. The site was determined to not qualify for the NPL based on information provided as of 2010.	Low	
E1C-92	29	429	S106484456	LOCKHEED A-1, B85, LOTS 16, 16A	3220 W THORTON	648 ft (0.12 mi) SW	At-grade	SLIC	Site is listed as "Open - Site Assessment" as of 1990. An aquifer used for drinking water supply beneath the facility is listed to have been impacted by chromium and VOCs. ¹	Med	X
E1C-93	29	500	S114644699, S102432702	LOCKHEED PLANT B-6-F	7575 SAN FERNANDO RD N	257 ft (0.05 mi) SW	Tunnel	LUST, RGA LUST	Facility is listed to have impacted an aquifer used for drinking water supply with diesel fuel. Current site status is listed as "Completed - Case Closed" as of 1/1/1996.	High	
E1C-94	27	372	S109442393, S106528956	LOONEY BINS/EAST VALLEY DIVERSION	11616 SHELDON ST	3115 ft (0.59 mi) NE	At-grade	SWF/LF	SWF/LF (S109442393) - Facility is listed to be an active transfer/processing facility accepting construction/demolition and non-hazardous industrial debris. SWF/LF (S106528956) - Facility is listed to be an active large volume construction/demolition processing facility with monthly inspections.	Low	
E1C-95	27	372	S111075989	LOONEY BINS/SPACCARELLI HAULING	11616 1/2 SHELDON ST	3114 ft (0.59 mi) NE	At-grade	SWF/LF	Facility is listed as an active waste hauler. Limited additional information is provided.	Low	
E1C-96	24	229	S107736633	LOPEZ FLOOD CONTROL BASIN		893 ft (0.17 mi) WNW	Tunnel	ENVIROSTOR	Facility was evaluated for the NPL in relation to a military evaluation and determined not to be eligible as of 7/1/2005. Site restrictions are not reported for the facility. The site is currently listed as "Inactive - Needs Evaluation."	Med	
E1C-97	29	525	S113003727	LYN-TRON, INC	3150 N. DAMON WAY	2502 ft (0.47 mi) SW	Tunnel	SLIC	Facility is reported to have been investigated in relation to the San Fernando Valley Superfund Site due to manufacturing of metal and non-metal fasteners used in relation to the aerospace industry. Environmental assessment of the site was performed in 2013 in relation to a LARWQCB Order. The assessment concluded that no chromium and or other VOCs were used at the Site. A notice of "No Further Requirements" was issued in respect to soils only in 2013. The site status is listed as "Completed - Case Closed" as of 12/16/2013.	Low	
E1C-98	26	323	S107736650	MACLAY ES ADDITION, SITE 1 5640040	11071 BORDEN AVE	1327 ft (0.25 mi) ENE	Tunnel	ENVIROSTOR	Facility was evaluated for the NPL in relation to a school evaluation and determined not to be eligible as of 10/2/2006. Site restrictions are not reported for the facility. The site is currently listed as "No Further Action."	Low	
E1C-99	26	323	S105754243	MACLAY NEW PRIMARY CENTER	11035, 11063 & 11051 BORDEN AVE	1409 ft (0.27 mi) ENE	Tunnel	ENVIROSTOR	Facility was evaluated for the NPL in relation to a school evaluation and determined not to be eligible as of 10/6/2003. Site restrictions and confirmed COCs are not reported for the facility. The site is currently listed as "No Further Action."	Low	
E1C-100	29	443	S105026814, S114647195,	MANNING FUEL INC CEE JAY MACHINE	8407 TUJUNGA AVE, 8407 TUJUNGA	1062 ft (0.2 mi) SW	Retained Cut / Trench	HIST CORTESE, LUST, RGA LUST	LUST (U001567798) - Facility is listed to have impacted soil with aviation fuel as a result of a LUST. Site status is listed as "Completed - Case Closed" as of 2/27/1996. LUST (S104160057) - Facility is listed to have	Low	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
			U001567798, S104160057						impacted soils with an unspecified COC. Site status is listed as "Case Closed" as of 2/27/1996.		
E1C-101	27	355	S118504711	MAYONI ENTERPRISES INC	10340 GLENOAKS BLVD	2538 ft (0.48 mi) ENE	Tunnel	SLIC	Facility is listed to have impacted an aquifer used for drinking water, soil, and soil vapor with 1,1,1-TCA, 1,4-dioxane, and PCE. Site status is currently listed as "Open - Site Assessment" as of 12/16/2015.	Med	
E1C-102	26	393	1011961419, S106484866	MILES CHEMICAL COMPANY INC	12801 RANGOON ST	4631 ft (0.88 mi) SW	At-grade	CERCLIS-NFRAP, SLIC	SLIC (S106484866) - Facility was evaluated by the LARWQCB in 2004 in relation to a chromium VI source assessment for potential impacts to an aquifer used for drinking water in the area. The facility was determined to need "No Further Requirements" in relation to the investigation in 2004 as is listed as "Completed - Case Closed" as of 7/15/2004. ENVIROSTOR (S106484866) - Facility is listed to be evaluated for impacted due to historic use of the site as a transfer station or transportation - warehouse. Soil and soil vapor are listed as potential impacted media. Site status is listed as "No Further Action" as of 6/15/2011. CERCLIS-NFRAP (1011961419) - Facility is listed to not qualify for the NPL based on existing information.	Low	
E1C-103	24	279	S109548322	MILLER STEPHENSON CHEMICAL COMPANY	12261 FOOTHILL BLVD	1294 ft (0.25 mi) ESE	Tunnel	ENVIROSTOR	Facility is listed to have been evaluated for impacts in relation to potential soil and soil vapor. No confirmed COCs are reported for the site. A status of "No Further Action" is reported as of 9/8/2011.	Low	
E1C-104	24-25	256	S113096047, S102360706, S107144883, S106528955, S109286180, S103866717	MM LOPEZ ENERGY LLC, LA CITY, BUREAU OF SANITATION, LOPEZ CANYON LANDFILL, LOPEZ CANYON ENVIRONMENTAL CENTER	11950 LOPEZ CANYON RD	1862 ft (0.35 mi) ESE	Tunnel	SWF/LF, LDS,WMUDS/S WAT	SWF/LF (S113096047) - Facility is reported to be an active chipping and grinding operation for green materials. SWF/LF (S102360706) - Facility is reported to be a closed (closure date 6/30/1996) solid waste landfill that accepted mixed municipal waste. Quarterly inspections are reported. SWF/LF (S107144883) - Facility is listed to be a closed Class III landfill (closed 7/1/1996) consisting of approximately 166 acres. The landfill is listed to still be producing methane as a result of prior use, however, the facility is a landfill gas to energy project that utilized the methane for energy production for residences in the area. Methane extraction in relation to energy production continues to be performed at the site today and an active SWF/LF composting operation (S106528955) for green waste is also present. LDS (S109286180) - Facility is listed to be "Open - Verification Monitoring" in relation to groundwater, soil, and soil vapor impacts from previous use of the property as a land disposal site.	Med	
E1C-105	26-27	355	S111120538	MOC PRODUCTS	12306-12308 MONTAGUE ST	651 ft (0.12 mi) ENE	Tunnel	ENVIROSTOR	Facility is listed to have been evaluated for impacts. No confirmed COCs are reported for the site. A status of "Refer: EPA" is reported as of 6/27/2013.	Med	
E1C-106	26-27	355	S114655820, 1000128768, S114655821	MOC PRODUCTS COMPANY INC	12306 MONTAGUE ST	651 ft (0.12 mi) ENE	Tunnel	TRIS, HIST CORTESE, LUST, RGA LUST	TRIS (1000128768) - Facility has multiple listings under that database. A LUST is reported to have impacted soil with aviation fuel. Site status is reported to be "Completed - Case Closed" as of 4/28/1997. Facility is listed to have notified EPA under SARA Title II, Section 313. N-methyl-2-pyrrolidone is reported to be used/produced on the site. Toluene, C.I. food red 15, methanol, ethylbenzene, certain glycol ethers, zinc compounds, PAHs, xylene (mixed isomers) and ethylene glycol are also reported to be used/produced at the facility. The site is also reported to be in multiple other databases.	Med	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
E1C-107	26-27	355	1011812545	MOC THE PROFESSIONAL CHOICE	12307 MONTAGUE ST	618 ft (0.12 mi) ENE	Tunnel	US BROWNFIELDS	Site is listed to be part of a TBA Cooperative Agreement for potentially impacted properties. A Phase I ESA indicated cleanup is reported for the property.	Med	
E1C-108	26-27	390	S114656201, U001567802, S104160058, S114656202	MONARCH RECORD MFG CORP INC	9545 SAN FERNANDO RD	418 ft (0.08 mi) SW	At-grade	HIST CORTESE, LUST, RGA LUST	HIST CORTESE/LUST (U001567802) - Facility is listed to have impacted soil with gasoline due to a LUST. Site status is listed as "Completed - Case Closed" as of 4/30/1987. LUST (S104160058) - Same information as provided above.	Med	
E1C-109	24	194	S103978520	MOUNTAIN VIEW GATED VILLAS	12831 HUBBARD ST	4065 ft (0.77 mi) WNW	Tunnel	VCP	Facility is reported to be part of the VCP program with a status of "No Further Action" as of 4/19/2000 due to illegal dumping and medical related incineration. Soil was confirmed to be impacted with copper and compounds, furans, and arsenic dioxin.	Low	
E1C-110	27-29	402	1008381793	NATIONAL READY MIX CONCRETE CO	9010 NORRIS AVE	2193 ft (0.42 mi) NE	At-grade	TRIS	Facility is listed to have notified the EPA under SARA Title III, Section 313. Lead compounds (up to 7.1 pounds per year) are reported to be produced at the site.	Low	
E1C-111	5-6	128	S114660362, S114690985, S102437520, S114690913, S114690983	NETAL INC, SIERRA HWY & AVE S	37205 SIERRA HWY, 37205 SIERRA HWY N	61 ft (0.01 mi) ENE	At-grade	HIST CORTESE, LUST, RGA LUST	A LUST containing waste/motor/hydraulic oil was present at the site. Soil and an aquifer used for drinking water supply was reported to have been impacted. Assessment/remediation performed and case closed in 2014.	High	
E1C-112	27	355	1011812546	NEWHALL JUNK & SALVAGE RECYCLERS	12011 BRANFORD ST	2422 ft (0.46 mi) ENE	Retained Cut / Trench	US BROWNFIELDS	Facility is listed to have had a Phase I ESA performed in relation to assessment of the site. The Phase I ESA was performed under an US-EPA Brownfields Assessment Cooperative Agreement. Results of the Phase I ESA were not reported.	Low	
E1C-113	12	177	1011130614	NORTH STAR MINERALS INC		2387 ft (0.45 mi) NW	At-grade	US MINES	Site is listed as an active non-coal mining company. Numerous citations are reported for unspecified reasons.	Med	
E1C-114	27	355	1011812547	NUMBER 1 ELECTRIC	12051 BRANFORD ST	2093 ft (0.4 mi) ENE	Retained Cut / Trench	US BROWNFIELDS	Facility is listed to have had a Phase I ESA performed in relation to assessment of the site. The Phase I ESA was performed under an US-EPA Brownfields Assessment Cooperative Agreement. Results of the Phase I ESA were not reported.	Low	
E1C-115	29	464	S106484857	OCCUPANT-AUTO SHOP	8431 TELFAIR AVE	1685 ft (0.32 mi) SW	Retained Cut / Trench	SLIC	Facility was evaluated by the LARWQCB in 2001 in relation to a chromium VI source assessment for the area. The facility was determined to need "No Further Requirements" in relation to the investigation in 2014 as is listed as "Completed - Case Closed."	Low	
E1C-116	26	303	1018119710	ORNELAS SITE	11340 N GLENOAKS BLVD	2010 ft (0.38 mi) WNW	Tunnel	US BROWNFIELDS	Facility is listed to have had a Phase I ESA performed in relation to assessment of the site. The Phase I ESA was performed under an US-EPA Brownfields Assessment Cooperative Agreement. Results of the Phase I ESA were not reported.	Low	
E1C-117	29	443	S114666067, S110060769, S106517286, S114666066	PACIFIC ENERGY	8309 TUJUNGA AVE	1232 ft (0.23 mi) SW	Retained Cut / Trench	HIST CORTESE, LUST, RGA LUST	HIST CORTESE/LUST (S110060769) - Facility is listed to have impacted soil with aviation fuel due to a LUST. Site status is listed as "Completed - Case Closed" as of 10/6/1997.	Low	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
E1C-118	27	355	1016170548, 1000252793	PACIFIC PLATING	12113 BRANFORD ST	1444 ft (0.27 mi) ENE	Retained Cut / Trench	CERCLIS-NFRAP, ENVIROSTOR	CERCLIS-NFRAP (1016170548) - Site was assessed for contamination in 2013 and is listed as NFRAP due to not qualifying for the NPL based on existing information. ENVIROSTOR (1000252793) - Facility is listed to be part of a Tiered Permit with a status of "Refer: Other Agency." Furthermore, the site is listed as "Inactive - Action Required" with a status date of 9/8/2011.	Med	
E1C-119	26-27	355	1000229142, 1012043061	PB FIBERGLASS PRODUCTS INC	12177 BRANFORD ST	856 ft (0.16 mi) ENE	Retained Cut / Trench	CERCLIS-NFRAP, ENVIROSTOR	ENVIROSTOR (1000229142) - Facility was evaluated for the NPL and determined not to be eligible as of 9/5/2014. Site status is listed to be "Inactive - Needs Evaluation." Numerous PAH compounds are listed as confirmed COCs for the site to soil. CERCLIS-NFRAP (1012043061) - Site was assessed for contamination in 2013 and is listed as NFRAP due to not qualifying for the NPL based on existing information.	Med	
E1C-120	27	402	1006932050	PDQ AUTO SALVAGE	10975 TUXFORD ST	4250 ft (0.8 mi) NE	At-grade	CERCLIS-NFRAP, LEAD SMELTERS	Site assessed for contamination in 1979 through 1982 and is listed as NFRAP due to not qualifying for the NPL based on existing information.	Low	
E1C-121	27	402	S109821518, S108432318	PENDLETON STREET DUMP	11050 PENDLETON ST	3673 ft (0.7 mi) NE	At-grade	SWF/LF	SWF/LF (S108432318) - Facility is listed to be a closed solid waste landfill facility. Limited additional information was provided for site. SWF/LF (S109821518) - Facility is listed to be an active limited volume transfer/processing operation for metal, mixed municipal, tire, passenger, and wood waste.	Low	
E1C-122	29	402	S109117694	PENHALL COMPANY	11182 W PENROSE AVE	959 ft (0.18 mi) NE	Retained Cut / Trench	LUST	Soil is reported to have been impacted from a LUST of diesel fuel at the facility. Current status listed as "Completed - Case Closed" as of 2012.	Low	
E1C-123	29	443	1001115478, S109287258	PENROSE LANDFILL GAS CONVERSION LLC, PENROSE SANITARY LANDFILL	8301 TUJUNGA AVE	1367 ft (0.26 mi) SW	Retained Cut / Trench	CERCLIS-NFRAP, SLIC, LDS, ENVIROSTOR	An aquifer used for drinking water supply is reported to have been impacted from a LUST of diesel fuel at the facility. Current status listed as "Completed - Case Closed" as of 2012.	Low	
E1C-124	29	443	S102360907	PENROSE PIT	8251 - 8301 TUJUNGA AVE	1354 ft (0.26 mi) SW	Retained Cut / Trench	SWF/LF	Site is listed as a closed solid waste disposal facility for residential/industrial/commercial waste. Facility was closed in 1987.	Med	
E1C-125	29	500	1000415250	PHOTO CHEM ETCH CORP	7710 SAN FERNANDO RD	30 ft (0.01 mi) SW	Tunnel	SLIC, ENVIROSTOR	The site is listed as "Completed - Case Closed" as of 12/22/2014 for VOC contamination that has impacted an aquifer used for drinking water supply.	Low	
E1C-126	26-27	355	1011812550, 874580	PMC	12243 BRANFORD ST	126 ft (0.02 mi) ENE	Retained Cut / Trench	US BROWNFIELDS, ERNS	ERNS (874580) - Facility is reported to have a release to soil. In 1987, a truck had a fuel tank plug knocked out when it ran over a steel plate in the road resulting in 100 gallons of diesel fuel being spilled. The fire department responded to the scene and cleanup is not planned in relation to the spill. ERNS (93328129) - Facility is reported to have an emergency release to the soil. In 1993, a sight glass on a storage tank broke resulting in 25,000 pounds of trichlorofluoromethane being spilled to surrounding soil and the atmosphere. BROWNFIELD (1011812550) - Facility is listed to have had a Phase I ESA performed in relation to assessment of the site. The Phase I ESA was performed under an US-EPA Brownfields Assessment Cooperative Agreement. Results of the Phase I ESA were not reported.	High	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
E1C-127	27	355	1011812551	PRE-FAB GRANITE COUNTERTOPS	12065 BRANFORD ST	1962 ft (0.37 mi) ENE	Retained Cut / Trench	US BROWNFIELDS	Facility is listed to have had a Phase I ESA performed in relation to assessment of the site. The Phase I ESA was performed under an US-EPA Brownfields Assessment Cooperative Agreement. Results of the Phase I ESA were not reported.	Low	
E1C-128	29	443	1017428034, 1000297142	PRIME PLATING INC	11321 GOSS ST	797 ft (0.15 mi) SW	Retained Cut / Trench	TRIS, SLIC	SLIC - An aquifer used for drinking water supply is reported to have been impacted from chromium and VOCs. Current status listed as "Completed - Case Closed" as of 1997. TRIS - The facility is listed to use toxic chemicals (cyanide/lead/nitrate compounds) which are reported to be transported offsite for disposal.	Med	
E1C-129	27	372	1016112148	QEP INC	11912 SHELDON ST	289 ft (0.05 mi) NE	Elevated / Aerial Structure	TRIS	Facility is listed to have notified the EPA under SARA Title III, Section 313. Styrene is reported to be released to the air.	Low	
E1C-130	27	355	S110494226	QUALITY FINISHING INC	12109 BRANFORD ST, SUITE D2 & D4-D6	1543 ft (0.29 mi) ENE	Retained Cut / Trench	ENVIROSTOR	Facility is listed to be part of a tiered permit and referred to another agency. Site is not subject to the NPL or land use restrictions.	Low	
E1C-131	27	355	1011812553	QUALITY USED AUTO PARTS	12055 A BRANFORD ST	1922 ft (0.36 mi) ENE	Retained Cut / Trench	US BROWNFIELDS	Facility is listed to have had a Phase I ESA performed in relation to assessment of the site. The Phase I ESA was performed under an US-EPA Brownfields Assessment Cooperative Agreement. Results of the Phase I ESA were not reported.	Low	
E1C-132	29	443	1001217364	R L ANODIZING	11331 PENROSE ST	542 ft (0.1 mi) SW	Retained Cut / Trench	ENVIROSTOR	Facility was evaluated in 2012. Site is listed to not be NPL eligible and not have land restrictions. A status of "No Further Action" was issued on 7/9/2013.	Low	
E1C-133	27-29	402	1014202571	RECYCLED BASE MATERIALS INC		2320 ft (0.44 mi) NE	At-grade	US MINES	Facility is listed as an abandoned non-coal mining operation as of 2010.	Med	
E1C-134	26-27	355	S111076059, 1006932051, S117038718	REDUCE PRICE DISPOSAL, BRANFORD AUTO WRECKING	12276 BRANFORD ST	29 ft (0.01 mi) ENE	Retained Cut / Trench	CERCLIS-NFRAP, LEAD SMELTERS, SWF/LF, ENVIROSTOR	SWF/LF (S111076059) - Facility is listed as an active waste hauler. CERCLIS-NFRAP (1006932051) - Site was assessed for contamination in 2013 and is listed as NFRAP due to not qualifying for the NPL based on existing information. LEAD SMELTER (1006932051) - Facility is listed to not be on the NPL with a primary site function of recycling. ENVIROSTOR (S117038718) Facility is listed to be evaluated for impacts. Site status is listed as "Inactive - Needs Evaluation" as of 8/31/2014.	High	
E1C-135	26	355	S118504837, 1011812525	REYNOLDS PRINTASIGN (FORMER), CADILLAC KING AUTO DISMANTLING	9830 SAN FERNANDO RD	837 ft (0.16 mi) WSW	Retained Cut / Trench	US BROWNFIELDS, SLIC	SLIC (S118504837) - Facility is listed to have operated from 1955 through 1989, manufacturing equipment for making signs. The operations involved the use and storage of VOCs, including TCE and 1,1,1-TCA. Site usage and storage is reported to have impacted the subsurface. Site status is listed as "Open - Site Assessment" as of 3/23/2016. BROWNFIELDS (1011812525) - Facility is listed to have had a Phase I ESA performed in relation to assessment of the site. The Phase I ESA was performed under an US-EPA Brownfields Assessment Cooperative Agreement. Results of the Phase I ESA were not reported.	Med	
E1C-136	27	411	S102808013	RICHARD E BYRD HIGH SCHOOL	9171 TELFAIR AVE	1589 ft (0.3 mi) SW	At-grade	ENVIROSTOR	Facility was evaluated for the NPL in relation to a school evaluation and determined not to be eligible as of 11/4/2011. Site restrictions are not reported for the facility. The site is currently listed as "No Further Action."	Low	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
E1C-137	26	355	S114677632, S104572887, S104160034, 2002033528, S114677633	ROADWAY EXPRESS INC	12355 MONTAGUE ST	142 ft (0.03 mi) ENE	Tunnel	HMIRS, HIST CORTESE, LUST, RGA LUST	HIST CORTESE/LUST (S104572887/S104160034) - Facility is listed to have impacted an aquifer used for drinking water supply with gasoline due to a LUST. Site status is reported to be "Completed - Case Closed" as of 9/4/1996. HMIRS (2002033528) - Release of approximately 5.5-gallons of nitric oxide compressed gas is reported as a result of a damaged cylinder in 2002. The fire department is reported to have responded and emptied the remaining product from the cylinder.	High	
E1C-138	27	402	1003879001	ROIC/SUN VALLEY	9068 DE GARMO AVE	3114 ft (0.59 mi) NE	At-grade	CERCLIS-NFRAP, LIENS 2, PRP	CERCLIS-NFRAP - Site is listed as "removal only site (no site assessment work needed)." A lien was recorded against the property on 9/30/1987.	Low	
E1C-139	27	355	1011812556	ROSS BAKER TOWING INC	12025 BRANFORD ST	2307 ft (0.44 mi) ENE	Retained Cut / Trench	US BROWNFIELDS	Facility is listed to have had a Phase I ESA performed in relation to assessment of the site. The Phase I ESA was performed under an US-EPA Brownfields Assessment Cooperative Agreement. Results of the Phase I ESA were not reported.	Low	
E1C-140	24-25	248	1003878824	RUSSELL MOE DUMP	12021 N LOPEZ CANYON RD	1777 ft (0.34 mi) ESE	Tunnel	CERCLIS-NFRAP	Facility is listed to have been evaluated and not qualify for the NPL based on existing information provided on 12/1/1987.	Low	
E1C-141	24-25	248	S101612993	RUSSELL MOE LANDFILL	12089 LOPEZ CANYON RD	1913 ft (0.36 mi) ESE	Tunnel	SWF/LF, LDS,WMUDS/S WAT	Facility is listed to be an unpermitted solid waste disposal site with quarterly inspections. Site is listed to have been closed on 12/31/1964.	Med	
E1C-142	29	473	S116497300	SA RECYCLING LLC	8270 TUJUNGA AVE	1077 ft (0.2 mi) SW	Retained Cut / Trench	SWF/LF	Facility is listed to be a medium volume transfer/processing facility for mixed municipal waste with a permit date of 2014.	Low	
E1C-143	27	372	1018119624	SAN FERNANDO SITE	9319-9325 N SAN FERNANDO RD	164 ft (0.03 mi) SW	At-grade	US BROWNFIELDS	Facility is listed to have had a Phase I ESA performed in relation to assessment of the site. The Phase I ESA was performed under an US-EPA Brownfields Assessment Cooperative Agreement. A petroleum related industry is reported to be located within close proximity of the property and potentially contributed to contamination at the site. Results of the Phase I ESA were not reported.	Med	
E1C-144	26	355	1000119933	SDS INDUSTRIES INC	10241 NORRIS AVE	506 ft (0.1 mi) ENE	Tunnel	SLIC	Facility is listed to have been re-evaluated by the LARWQCB in 1997 in relation to impacts to the San Fernando Valley NPL site. A notice of "No Further Requirements" was issued on 1/30/1997 and site status is listed as "Completed Case Closed."	Low	
E1C-145	26-27	355	S116497299	SEGOVIA ROLL-OFF	12215 BRANFORD ST	307 ft (0.06 mi) ENE	Retained Cut / Trench	SWF/LF	Facility is listed to be an active limited volume transfer operation for construction/demolition, green materials, and mixed municipal wastes with quarterly inspections. The permit status is listed to have been updated on 3/6/2014.	Med	
E1C-146	27	374	S117662604	SHELDON	11401 W TUXFORD STREET	5087 ft (0.96 mi) NE	At-grade	CA MINES	Facility is listed as an active open pit sand and gravel mining operation as of 2014. Reclamation is reported to be in progress.	Low	
E1C-147	5-6	135	S114690986, S109348411	SIERRA HWY ANTELOPE VALLEY S CONVIENCE PLAZA	37167 N SIERRA HWY	180 ft (0.03 mi) WSW	At-grade	LUST, RGA LUST	A LUST with unspecified contents was present at the site. The impacted media was not reported. Case closed in 2007.	Med	
E1C-148	27	402	S116497298	SINGH DISPOSAL	11401 PENDLETON ST	1882 ft (0.36 mi) NE	At-grade	SWF/LF	Facility is listed to be an active limited volume transfer operation for construction/demolition and inert materials with quarterly inspections. The permit status is listed to have been updated on 2/12/2014.	Low	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
E1C-149	27-29	423	1009629960	SOUTHERN CALIFORNIA GAS CO	10632 PENROSE ST	4721 ft (0.89 mi) NE	Cut and Cover	DOT OPS	Facility is listed to be a natural gas distribution line that was damaged by outside forces (outside/third party) in 1987.	Low	
E1C-150	29	443	S114694413, S103988817, U001567823, S114694414	SOUTHLAND TRANSMISSIONS	8283 SAN FERNANDO RD	140 ft (0.03 mi) SW	Cut and Cover	HIST CORTESE, LUST, RGA LUST	An aquifer used for drinking water supply is reported to have been impacted from a LUST containing aviation fuel at the facility. Current status listed as "Completed - Case Closed" as of 1996.	High	
E1C-151	26-27	355	S114694690, S101586554, S114694689	SPARTAN TRUCK EQUIPMENT, SPARTAN TRUCK COMPANY	12266 BRANFORD ST	87 ft (0.02 mi) ENE	Retained Cut / Trench	HIST CORTESE, LUST, RGA LUST	HIST CORTESE/LUST (S101586554) - Facility is listed to have impacted soil with waste/motor/hydraulic/lubricating oil due to a LUST. The site status is reported as "Completed - Case Closed" as of 6/6/1986.	Med	
E1C-152	29	428	S106484844	SPECTRA AMERICAN	11037 PENROSE ST	2269 ft (0.43 mi) NE	Retained Cut / Trench	SLIC, ENVIROSTOR	Facility was evaluated by the LARWQCB in 2001 in relation to a chromium VI and VOC impact to an aquifer used for drinking water source assessment for the area. The facility was determined to need "No Further Requirements" in relation to the investigation in 2014 as is listed as "Completed - Case Closed."	Low	
E1C-153	24	239	1000181713	SPECTROLAB INC	12500 GLADSTONE AVE	1973 ft (0.37 mi) WNW	Tunnel	TRIS, ENVIROSTOR	TRIS - Facility is listed to generate hazardous waste, have notified EPA under EPA SARA Title III, Section 313, and is in the EPA's index system due to semiconductor and related device manufacturing. ENVIROSTOR - Facility is listed to have a tiered permit. Site is reported to not be subject to the NPL or have restricted land use as a result of facility operations.	Low	
E1C-154	29	496	S102360919, S109286992	STRATHERN INERT LANDFILL	11201 STRATHERN ST	2154 ft (0.41 mi) SW	Cut and Cover	SWF/LF, LDS	Facility is listed as a land disposal site with a status of "Open - Verification Monitoring."	Med	
E1C-155	29	443	S111076116	STRATHERN SANITARY LANDFILL	8230 TUJUNGA AVE	1635 ft (0.31 mi) SW	Retained Cut / Trench	SWF/LF	The facility is listed as a closed landfilling operation that accepted inert waste. Currently, the site is listed to be an inert debris engineered fill operation over an area of 34 acres.	Med	
E1C-156	27	391	S103426966, S109287408, S102266815	SUN VALLEY LANDFILL - THERMAL TREATMENT UNIT/SUN VALLEY INERT LANDFILL	9436 GLENOAKS BLVD	3773 ft (0.71 mi) NE	At-grade	SWF/LF, LDS, WMUDS/S WAT	SWF/LF (S103426966)- Facility is listed to be an active inert debris engineered fill operation at a closed landfill. The site is reported to be 125 acres in size. LDS (S109287408) - Facility is listed to be a land disposal site with a status of "Completed - Case Closed" as of 5/30/2016. .	Low	
E1C-157	29	402	S106528959, S117711954	SUN VALLEY PAPER STOCK MRF AND TS	8701 NORTH SAN FERNANDO RD	160 ft (0.03 mi) SW	Elevated / Aerial Structure	SWF/LF	LF - Facility is an active large volume transfer/processing site for industrial and mixed municipal waste. Permit issued for the site in 2006.	Med	
E1C-158	26	393	1011961420	SUPERIOR THREAD ROLLING COMPANY	12801 WENTWORTH ST	5169 ft (0.98 mi) SW	At-grade	CERCLIS-NFRAP	Facility is listed to have been evaluated and not qualify for the NPL based on existing information provided.	Low	
E1C-159	29	444	S114697881, 1000288928	SWELLDOM COMPANY, SWELLDOM HOME CARE SERVICE INC	8531 LANKERSHIM BLVD	2300 ft (0.44 mi) SW	At-grade	HIST CORTESE, LUST, RGA LUST	HIST CORTESE/LUST (1000288928) - Facility is listed to have impacted soil with aviaional fuel. Site status is reported to be "Completed - Case Closed" as of 7/22/1996.	Low	
E1C-160	27-29	402	U001567825	TAM CERAMICS INC	11078 FLEETWOOD ST	2505 ft (0.47 mi) NE	Retained Cut / Trench	ENVIROSTOR	Facility is reported to have a Tiered Permit, however, land use restrictions and NPL subjectivity were not reported.	Low	
E1C-161	26-27	355	1000310559	TEKTOPLATE INC	12280 MONTAGUE ST	896 ft (0.17 mi) ENE	Tunnel	SLIC, ENVIROSTOR	Facility was evaluated by the LARWQCB in 2001 in relation to a chromium VI and VOC impact to an aquifer used for drinking water source assessment for the area. The facility was determined to need "No Further	Low	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
									Requirements" in relation to the investigation in 2003 as is listed as "Completed - Case Closed."		
E1C-162	29	443	S109117739, S114703961, U001567767	TEXACO - KEEBLE, ROBERT, TIMM FUEL & TIRE SERVICE INC	8579 SAN FERNANDO RD	154 ft (0.03 mi) SW	Retained Cut / Trench	LUST, RGA LUST	LUST (S109117739/U001567767) - Facility is listed to have impacted soil with gasoline. Site status is reported to be "Completed - Case Closed" as of 4/26/2010.	Med	
E1C-163	27	372	1000195400	TIME AVIATION SERVICES INC	9255 SAN FERNANDO RD	172 ft (0.03 mi) SW	At-grade	SLIC	Facility was evaluated by a consultant in 2005 in relation to a chromium VI and VOC impact to an aquifer used for drinking water source assessment for the area. Arsenic was detected in soil concentrations above PRG levels but were determined to be within typical background concentrations for the southern California area. The facility was determined to need "No Further Requirements" in relation to the investigation in 2005 and is listed as "Completed - Case Closed" as of 12/23/2014.	Low	
E1C-164	27	372	9999040782, 90080790, 91070272, 94020232, 94021240, 94031220, 94031475, 94040501, 9998051231, 9999020521, 9999020902, 999030882, 9999050952, 9999081691, 9998081224, 91020479, 91040501, 91080928, 94071368, 95050633, 95051264, 95101164, 96010156, 990001390	TINY BUT MIGHTY PRODUCTIONS INC BHC 2	9175 SAN FERNANDO RD, 9175 SAN FERNANDO BLVD	166 ft (0.03 mi) SW	At-grade	HMIRS, CHMIRS	Various spill incidents were reported in relation to transportation of chemicals. Upon review, a majority of the spills occurred while in off-site transit, were contained, and appeared to be minor.	Low	
E1C-165	27-29	424	S114706151, S109117745	TRANSIT MIXED CONCRETE (FMR SOUTHDOWN CONCRETE)	8960 N BRADLEY AVE	1579 ft (0.3 mi) NE	At-grade	LUST, RGA LUST	LUST (S109117745) - Facility is reported to have impacted soil with diesel fuel. Site status is listed as "Completed - Case Closed" as of 1/13/2015.	Low	
E1C-166	27	372	1000102029	TRUESDALE ESM EAST VALLEY	11781 TRUESDALE ST	3503 ft (0.66 mi) NE	At-grade	RCRA-TSDF	Facility is listed to treat, store, or dispose of numerous types of hazardous waste. Groundwater monitoring and evaluation is reported to have occurred between 1984 and 1985.	Low	
E1C-167	29	443	S109821493, S103441383	TUJUNGA PIT	8250 TUJUNGA AVE	1597 ft (0.3 mi) SW	Retained Cut / Trench	SWF/LF,WMUDS /SWAT	Very limited information provided for facility. Site assessed for SWAT program. Impact to media not reported.	Med	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
E1C-168	29	444	S113482310	TUXFORD PIT LANDFILL	11590 TUXFORD ST (TUXFORD ST AND GOLDEN STATE FWY)	1532 ft (0.29 mi) SW	Elevated / Aerial Structure	LDS	Facility is listed as a closed solid waste disposal site with a current regulation status as "unpermitted."	Med	
E1C-169	26-27	355	1000353463	ULTRAMET	12173 MONTAGUE ST	1816 ft (0.34 mi) ENE	Tunnel	US BROWNFIELDS, ENVIROSTOR	Brownfields - Facility is listed to have had a Phase I ESA performed in relation to assessment of the site. The Phase I ESA was performed under an US-EPA Brownfields Assessment Cooperative Agreement. The property use is reported to consist of light manufacturing. Results of the Phase I ESA were not reported and no COCs were identified for the site. ENVIROSTOR - Facility is reported to have had a site screening performed in 2007 to determine potential impacts to the site due to past use as metal plating. Hydrochloric acid was confirmed as a COC to have impacted soils. Current site status is listed as "Inactive - Action Required" as of 6/30/2007.	Med	
E1C-170	24	240	U001567595, S114709810	UPS SAN FERNANDO CASFR, UNITED PARCEL SERVICE	12745 ARROYO ST	825 ft (0.16 mi) WNW	Tunnel	LUST, RGA LUST	Facility is listed to have impacted an unknown media with an unknown COC. Site status is listed as "Completed - Case Closed" as of 5/10/2011.	Low	
E1C-171	26	327	S101618430	VALLEY CIRCUITS INC	11031 GLENOAKS BLVD	196 ft (0.04 mi) WSW	Tunnel	ENVIROSTOR	Facility is reported to have a Tiered Permit, however, land use restrictions and NPL subjectivity were not reported. Current status is listed as "Refer: Other Agency" as of an unspecified date.	Low	
E1C-172	27	388	1004676152	VALLEY GENERATING STATION	11801 SHELDON ST	1217 ft (0.23 mi) NE	At-grade	SLIC, VCP, ENVIROSTOR	VCP - Facility is listed to be in DTSC Site Cleanup Program with status of active as of 6/28/2000. Numerous COCs are confirmed to have impacted soil at the site and remedial actions are reported to have taken place. SLIC - Facility is reported to have been investigated in relation to the San Fernando Valley Superfund Site due to previous site usage. Soil investigation at the site was performed in 2005 to 2006 in relation to a LARWQCB Order. The assessment concluded that no chromium and or other VOCs were used at the Site. A notice of "No Further Requirements" was issued in 2006. The site status is listed as "Completed - Case Closed" as of 12/19/2014. ENVIROSTOR - facility is listed to be involved with a voluntary cleanup due to past use as and electrical generation/substation. Confirmed COCs consist of arsenic, total chromium, lead, PCBs, PAHs, copper and compounds, nickel, and vanadium and compounds to soil. Site status is listed as "Active" as of 6/28/2000.	Med	
E1C-173	27	392	S101618546, U001567848, S104156390	VALLEY GENERATING STATION - DWP/VALLEY GENERATING STATION DISP	9430 SAN FERNANDO RD	81 ft (0.02 mi) SW	At-grade	LDS, ENVIROSTOR, W MUDS/SWAT	LDS (S101618546) - Facility is listed to be an "Open-Inactive" land disposal site with a status date of 8/20/2013. ENVIROSTOR (U001567848) - Facility is listed to have been evaluated for impacts due to historical usage. A Non-Emergency Hazardous Material Substance Release Report for the site (July 8, 1994) stated the facility is impacted with oil fly ash containing metals, including chromium, copper, lead, nickel, and vanadium. During assessment of the site, no COCs are reported to have been confirmed and the facility is listed to not be applicable to NPL or have land use restrictions. Site status is listed as "Inactive - Needs Evaluation" as of 9/14/1995.	High	
E1C-174	27	391	S116282732	VALLEY RECLAMATION COMPANY - PIT NO. 3	11311 PEORIA ST	3933 ft (0.74 mi) NE	At-grade	LDS	Facility is listed as a land disposal site with a status of "Open - Inactive" as of 2013. Reports for the facility have indicated PCE impacts to groundwater.	Low	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
E1C-175	24-25	248	S114718054, S108935371, 1003878394, 1000200422	VALLEYCREST LANDSCAPE, FIREBALL INDUSTRIES INC	12087 N LOPEZ CANYON RD	1908 ft (0.36 mi) ESE	Tunnel	CERCLIS-NFRAP, LUST, ENVIROSTOR, RGA LUST	LUST (S108935371) - Facility is listed to have impacted an aquifer used for drinking water supply with diesel, xylenes, MTBE, TBA, and other fuel oxygenates. Site status is listed as "Completed - Case Closed" as of 9/9/2008. CERCLIS-NFRAP (1003878394) - Site was assessed for contamination in 2013 and is listed as NFRAP due to not qualifying for the NPL based on existing information. ENVIROSTOR (1000200422) - Facility listed to have had site screening performed due to historical usage. No confirmed COCs and/or impacted media are reported. Site status is listed as "Refer: Other Agency" with a status date of 8/31/1995.	Low	
E1C-176	26	315	S109422396	VAUGHN ELEMENTARY LANGUAGE ACADEMY	11176, 11180, 11182, 11188 HERRICK AVE	2531 ft (0.48 mi) WSW	Tunnel	ENVIROSTOR	Facility was evaluated for the NPL in relation to a school evaluation and determined not to be eligible as of 6/22/2009. Site restrictions are not reported for the facility. The site is currently listed as "No Further Action."	Low	
E1C-177	29	443	S106484837	VINTEN EQUIPMENT INC	8115 N CLYBORN	406 ft (0.08 mi) NE	Tunnel	SLIC	The site is listed as Completed - Case Closed as of 12/22/2014 for VOC contamination that has impacted an aquifer used for drinking water supply.	High	
E1C-178	27	372	S111076161	VULCAN MATERIALS (SUN VALLEY)	11520 SHELDON ST	4330 ft (0.82 mi) NE	At-grade	SWF/LF	Facility is listed to be an active landfilling operation that accepts inert waste as an inert debris engineered fill operation.	Low	
E1C-179	29	402	1014677847, S106399137, 2003642460	VULCAN MATERIALS CO SUN VALLEY	11447 WEST TUXFORD ST	246 ft (0.05 mi) NE	Elevated / Aerial Structure	ERNS, TRIS, CHMIRS	TRIS (1000128768) - Facility is listed to have notified the EPA under SARA Title III, Section 313. The site is listed to release up to eight pounds of naphthalene and PAHs to the atmosphere due to operations. CHMIRS/ERNS (S106399137/2003642460) - Facility is reported to have released 4,000 gallons of asphalt materials due to a plugged operation line in 2003. A waterway (storm drain) is reported to have been involved. Spill containment is not reported and cleanup was listed to have been completed.	Med	
E1C-180	27	414	1005775701	WASTE MANAGEMENT	9081 TUJUNGA AVE	1954 ft (0.37 mi) NE	Elevated / Aerial Structure	SWF/LF	Facility is listed as an active waste hauler. Limited additional information is provided.	Low	
E1C-181	27	402	S103697090	WEST COAST WINERY	11115 PENDLETON ST	3804 ft (0.72 mi) NE	At-grade	SLIC	Facility is listed to be a cleanup program site with a status of "Completed - Case Closed" as of 9/27/1995. The impacted media and COCs for the site are not reported.	Low	
E1C-182	26	355	1011812566	WILLIES AUTO REPAIR	9954 SAN FERNANDO RD	1158 ft (0.22 mi) WSW	Retained Cut / Trench	US BROWNFIELDS	Facility is listed to have had a Phase I ESA performed in relation to assessment of the site. The Phase I ESA was performed under an US-EPA Brownfields Assessment Cooperative Agreement. Results of the Phase I ESA were not reported.	Low	
E1C-183	29	443	S105026815, S114723172, U003904755, S114723381	WORLD OIL STATION NO. 19	8181 SUNLAND BLVD	175 ft (0.03 mi) SW	Tunnel	HIST CORTESE, LUST, RGA LUST	A LUST was reported to have impacted soil with gasoline. Case closed as of 1996.	Med	
E1C-184	6	142	91240533		1040 E RAE ST	22 ft (0 mi) WSW	At-grade	ERNS	Facility is reported to have impacted water with diesel fuel due to a tank valve malfunction in 1991. A contractor is reported to have been retained to clean up the spill.	Low	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
E1C-185	24	206	S110417564		1/5 MILES EAST OF 12100 HARDING ST	27 ft (0.01 mi) WNW	Tunnel	CHMIRS	Vandalism to a pole top transformer caused a spill of approximately 10 gallons of mineral oil (unknown if containing PCBs) in 2008. Waterway not reported to have been involved.	Low	
E1C-186	26	299	S110977421, S110417948		12600 VAN NUYS BLVD, SHADOW HILLS MOBILE HOME PARK	122 ft (0.02 mi) ESE	Tunnel	CHMIRS	CHMIRS (S110977421) - A caller reported that the cap to a sewage clean out valve was removed resulting in 100 gallons of sewage being released to the surrounding area. The spill occurred in 2010 and is not reported to have been contained and/or cleaned up. CHMIRS (S110417948) - A caller reported that approximately 1,000-gallons of sewage was released due to a clog in the sewer main. A contractor is reported to have cleaned up the spill.	Low	
E1C-187	26	327	S110981113		11000 GLEN OAKS BLVD, CROSS STREET IS PIERCE ST	107 ft (0.02 mi) ENE	Tunnel	CHMIRS	In 2010, a caller reported that approximately 1,500-gallons of sewage was released into a catch basin due to a semi carrying the sewage overturning due to a vehicle accident. The release was contained by placement of sandbags and booms before it could reach a waterway. Clean up was performed by United Pumping using a vacuum truck.	Low	
E1C-188	26-27	355	874580, 93328129		12243 BRANFORD ST	126 ft (0.02 mi) ENE	Retained Cut / Trench	ERNS	A sight glass was reported to have broken on an AST containing trichlorofluoromethane in 1993. The spill released 25,000 pounds of the material within a concrete containment. Most of the material evaporated and the remaining amount was cleaned up. The media affected is reported to have been land and air.	Med	
E1C-189	26-27	355	8865637		12318 BRANFORD ST 818-899-7924; ROB MEHAN(FOREMAN)/JOE E	249 ft (0.05 mi) WSW	Retained Cut / Trench	ERNS	Facility is reported to have had an emergency release tot the soil. In 1988, a caller stated that a green liquid material was eating through drums it was contained in. The material was reported to have been smoking and business employees were hosing down the spill resulting in intense fumes in the area. Containment and cleanup are not reported.	Med	
E1C-190	27	372	90178746		CONSTRUCTION SITE 9175 SAN FERNANDO RD	408 ft (0.08 mi) SW	At-grade	ERNS	Facility is reported to have spilled approximately 45 gallons of lacquer thinner/paint thinner in 1990. An agency was reported to be retained to handle and dispose of the product moving forward.	Med	
E1C-191	27-29	422	2014083694, S116779407		9027 SAN FERNANDO RD	164 ft (0.03 mi) SW	At-grade	ERNS, CHMIRS	ERNS (2014083694) - Facility is reported to have a release to soil. In 2014, dumping of an unknown material was reported to an alley way/asphalt. The material was reported to have been cleaned up by an employee of the company. CHMIRS (S116779407) - A caller reported a discharge of motor oil into an alley behind the facility. The caller stated that the business is pumping the product into the alley on a regular basis. Containment and cleanup are not reported.	High	
E1C-192	29	443	S109035661, 2007306845		11275 PENROSE ST	71 ft (0.01 mi) NE	Retained Cut / Trench	ERNS, CHMIRS	CHMIRS (S109035661) - A spill of approximately 20 pounds of ammonia was discovered during a pump down. The spill occurred in 2007 and is reported to have been contained. Cleanup is not reported. ERNS (2007306845) - A caller reported a release of approximate 20 pounds of anhydrous ammonia during a pump down of a refrigeration unit. The spill is reported to the atmosphere. The spill occurred in 2007 and is reported to have been contained. Cleanup is not reported.	Low	
E1C-193	29	491	S105651191		7975 CLYBOURN AVE, SUN VALLEY TB 533 A2	264 ft (0.05 mi) SW	Tunnel	CHMIRS	A tanker truck is reported to have had a leaking valve, resulting in asphalt emulsion being spread over the street into the gutter and storm drain and	Low	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
									ending up in the flood control channel in 1997. The street was closed and sand was spread over the surface. A contractor was retained to clean up the spill.		
E1C-194	29	513	S101298216, S105032930	U-HAUL CENTER OF SUN VALLEY	7721 HOLLYWOOD WAY	1752 ft (0.33 mi) ENE	Cut and Cover	HIST CORTESE,LUST	Facility was evaluated by the LARWQCB in relation to hydrocarbon impacts to soil. The facility is listed as "Completed - Case Closed" as of 3/31/92.	Low	
E1C-195	29	503	S110275514	SUPERIOR PLATING	4001 GLENOAKS BLVD	2150 ft (0.41 mi) NE	Tunnel	ENVIROSTOR	Facility was evaluated by the DTSC and is listed as "Inactive - Needs Evaluation" as of 5/24/12.	Med	
E1C-196	26-27	355	S112283606	CALDERON RECYCLING	12231 BRANFORD ST	424 ft (0.08 mi) ENE	Retained Cut / Trench	SWRCY	Facility is listed to be a recycling center that accepts aluminum/glass/plastic/bimetal products. Operation begin date listed to be 7/5/2015.	Med	
E1C-197	27	404	S103441474	BRADLEY AVENUE DUMP NO. 2		2464 ft (0.47 mi) NE	At-grade	WMUDS/SWAT	Facility is listed to be is Solid Waste Assessment Test Program. Little additional information is provided.	Med	
E1C-198	26-28	421	S103441429	BRIGHT REALITY	LAUREL CANYON & JEROME	4260 ft (0.81 mi) SW	At-grade	WMUDS/SWAT	Facility is listed to be is Solid Waste Assessment Test Program. Little additional information is provided.	Low	
E1C-199	29	443	S103441729	PENROSE LANDFILL	8221 TUJUNGA AVE	1689 ft (0.32 mi) SW	Retained Cut / Trench	WMUDS/SWAT	Facility is listed as Category B – Any facility having a physical, chemical, or biological waste treatment system (except for septic systems with subsurface disposal), or any Class II or II disposal site, or facilities without treatment systems that are complex, such as marinas with petroleum products, solid wastes, and sewage pump out facilities. The facility is listed to “not fall into the category of Municipal/Domestic, Industrial, Agricultural or Solid Waste (Class I, II or III) and to be a minor threat to water quality.	Med	
E1C-200	29	493	S103441730	TUJUNGA AVE/SITE 8-PENROSE PIT	8145 N. TUJUNGA AVE.	2836 ft (0.54 mi) SW	Cut and Cover	WMUDS/SWAT	Facility is listed as Category B – Any facility having a physical, chemical, or biological waste treatment system (except for septic systems with subsurface disposal), or any Class II or II disposal site, or facilities without treatment systems that are complex, such as marinas with petroleum products, solid wastes, and sewage pump out facilities. The facility is listed to “not fall into the category of Municipal/Domestic, Industrial, Agricultural or Solid Waste (Class I, II or III) and to be a minor threat to water quality.	Low	
E1C-201	29	500	S107137870	LEOS RECYCLING INC	7636 SAN FERNANDO RD	62 ft (0.01 mi) SW	Tunnel	SWRCY	Facility is listed to be a recycling center that accepts aluminum/glass/plastic/bimetal products. Operation begin date listed to be 1/2/2016.	Med	
E1C-202	26	327	S101584960	SEUNG HO KIM/MAL NAM KIM	11045 GLENOAKS BLVD	235 ft (0.04 mi) WSW	Tunnel	SWRCY	Facility is listed to be a recycling center that accepts aluminum/glass/plastic/bimetal products. Operation begin date listed to be 9/28/1998.	Med	

¹The site is included in a group of industrial facilities that are documented to be included as "Responsible Parties" in relation to the San Fernando Valley Superfund Site for VOC/solvent/metal/chlorinated hydrocarbon impacts to groundwater used for drinking water. Listed sites with the same designation have the Case Background description associated with the listing presented in BOLD font and contain an "X" in the "Associated with the Superfund Site (Area #1)" column. While the San Fernando Superfund Site currently has a status of "Open - Remediation" or similar, some of the associated sites may have since been closed or have a status of "Completed - Case Closed". The remaining sites continue to be open and undergoing remediation for the associated contamination.

Table 3.10-B-7: E1A Central Subsection PEC Sites

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
E1C-1	27	355	1011812498	12127 MONTAGUE ST	12127 MONTAGUE ST	2255 ft (0.43 mi) ENE	Tunnel	US BROWNFIELDS	Site is listed to be part of a TBA Cooperative Agreement for potentially impacted properties. A Phase I ESA indicated cleanup is not required for the property.	Low	
E1C-2	26-27	355	1011812499	12237 MONTAGUE ST	12237 MONTAGUE ST	1263 ft (0.24 mi) ENE	Tunnel	US BROWNFIELDS	Site is listed to be part of a TBA Cooperative Agreement for potentially impacted properties. A Phase I ESA indicated cleanup is not required for the property.	Low	
E1C-3	26-27	355	1011812500	12269 MONTAGUE ST	12269 MONTAGUE ST	982 ft (0.19 mi) ENE	Tunnel	US BROWNFIELDS	Site is listed to be part of a TBA Cooperative Agreement for potentially impacted properties. A Phase I ESA indicated cleanup is not required for the property.	Low	
E1C-4	26	355	1011812501	12333 BRANFORD ST	12333 BRANFORD ST	417 ft (0.08 mi) WSW	Retained Cut / Trench	US BROWNFIELDS	Site is listed to be part of a TBA Cooperative Agreement for potentially impacted properties. A Phase I ESA indicated cleanup is not required for the property.	Low	
E1C-5	26	355	2008439502, 2004041369, 2004090543, 2004090552, 2007432171, 9900016774, 9900017582, S118188860, S101618411, S112829940, 2008426052, 2004061278, 9999010984	12466 MONTAGUE, ABF FREIGHT SYSTEM INC	12466 MONTAGUE ST (CON-WAY FREIGHT TERMINAL UFV)	251 ft (0.05 mi) WSW	Retained Cut / Trench	HMIRS, CHMIRS	Various spill incidents were reported in relation to transportation of chemicals. Upon review, a majority of the spills occurred while in off-site transit, were contained, and appeared to be minor.	Low	
E1C-6	27	372	2008442399, 2000018444, 2005702069, 2005705141, 9900015353, 2000018445, 2000023111, 2000023112, 2000026381, 2000026382, 2000027914, 2000027915, 2000081231, 2000100313, 2000100954, 2000101199, 2001010286, 2001010613, 2002079730,	9210 SAN FERANND RD	9210 SAN FERNANDO RD, 9210 SAN FERNANDO RD	8 ft (0 mi) SW	At-grade	HMIRS	Various spill incidents were reported in relation to transportation of chemicals. Upon review, a majority of the spills occurred while in off-site transit, were contained, and appeared to be minor.	Low	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
			2005702976, 2005703130, 20								
E1C-7	29	443	S113001921	ABBOTT TECHNOLOGIES INC	8203 VINELAND	260 ft (0.05 mi) SW	Cut and Cover	CHMIRS	In 2013, a caller reported an illegal dumping of sewage from motor homes. Approximately 100 gallons were reported and the material was contained with the sewage system.	Low	
E1C-8	29	429	1000426895, 1012010283	ACCURATE ENGINEERING INC	8710 TELFAIR AVE	1509 ft (0.29 mi) SW	At-grade	TRIS, ENVIROSTOR	ENVIROSTOR (1000426895) - Facility is reported to have been assessed via a Phase I ESA for potential COCs. No COCs were confirmed for the site and the facility was determined to not be subject to the NPL and/or land use restrictions. TRIS (1012010283) - Facility is listed to have notified the EPA under SARA Title II, Section 313. Copper and lead compounds are reported to be transferred from the facility for further waste management.	Low	
E1C-9	12	180	S106103358	ACTION CLAY QUARRIES	FOREST SERVICE RD 4N32	3475 ft (0.66 mi) SE	Tunnel	LDS	Facility is listed to be an active land disposal site in relation to mining operation byproducts that are being produced. Site status is listed to be "Open - Operating" as of 5/31/2016.	Low	
E1C-10	27	372	1007739312, S110275515, S106484865	ACTIVE MAGNETIC INSPECTION INC EAGLE TECH	9356 1/2 SAN FERNANDO ROAD, UNIT B	24 ft (0 mi) NE	At-grade	TRIS, ENVIROSTOR, SLIC	ENVIROSTOR (S110275515) - Facility was evaluated for the NPL and determined not to be eligible as of 9/8/2011. The site was referred to the EPA. SLIC (S106484865) - Facility was evaluated by the LARWQCB in 1997 in relation to a chromium VI source assessment for the area. The facility was determined to need "No Further Requirements" in relation to the investigation in 1997 and is listed as "Completed - Case Closed" as of 11/14/2014. TRIS (1007739312) - Facility is listed to have notified the EPA under SARA Title II, Section 313 in related to chromium, nickel, and nitric acid waste transferred for metal recovery from the site operations.	Med	
E1C-11	18	182	S117660933	ACTON CLAY QUARRIES	31375 N. ALISO CANYON RD	3279 ft (0.62 mi) SE	Tunnel	CA MINES	Facility is listed active clay open pit, plant or mill mine as of 2014.	Low	
E1C-12	29	443	S100229464, S114568808	ADVANCED PACKAGING TECHNIQUES	11340 PENROSE ST	714 ft (0.14 mi) SW	Retained Cut / Trench	HIST CORTESE, LUST, GA LUST	Facility is listed to have impacted soils with alcohols due to a LUST. The site status is reported as "Completed - Case Closed" as of 7/22/1996.	Low	
E1C-13	27	372	1000905404, 1014202314	ALERT PLATING COMPANY	9939 GLENOAKS BLVD	3355 ft (0.64 mi) ENE	At-grade	CERCLIS-NFRAP, SLIC	CERCLIS-NFRAP (1014202314) - Site assessed for contamination in 2010 and is listed as NFRAP due to not qualifying for the NPL based on existing information. SLIC (1000905404) - Facility was evaluated by the LARWQCB in 2001 in relation to a chromium VI source assessment for the area. The facility was determined to need "No Further Requirements" in relation to the investigation in 2003 and is listed as "Completed - Case Closed" as of 12/22/2012.	Low	
E1C-14	27	372	1018119623	ALLEGHENY SITE	11933-11941 W ALLEGHENY ST	541 ft (0.1 mi) SW	At-grade	US BROWNFIELDS	Site is listed to be part of a TBA Cooperative Agreement for potentially impacted properties. A Phase I ESA indicated cleanup is not required for the property. Unknown media was indicated to have been affected at the site.	Low	
E1C-15	26-27	355	1011812514	ANGELUS OXYGEN	12173-79 BRANFORD ST	977 ft (0.19 mi) ENE	Retained Cut / Trench	US BROWNFIELDS	Site is listed to be part of a TBA Cooperative Agreement for potentially impacted properties. A Phase I ESA indicated cleanup is not required for the property.	Low	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
E1C-16	24	239	S105088508	ANTHONY INC	12364 GLADSTONE AVE	1330 ft (0.25 mi) WNW	Tunnel	ENVIROSTOR	Facility is listed to be part of a tiered permit. Site is not subject to the NPL or land use restrictions. Current site status is listed as "Inactive - Needs Evaluation."	Low	
E1C-17	24	239	1000477327, S114572144	ANTHONY MANUFACTURING CO INC	12812 ARROYO AVE	1299 ft (0.25 mi) WNW	Tunnel	HIST CORTESE, LUST, SLIC, ENVIROSTOR, RGA LUST	Facility is listed as "Completed - Case Closed" as of 1997 for an aquifer used for drinking water supply impacted by gasoline and VOCs. A conditional closure was issued pursuant to report of proper sealing of well.	Low	
E1C-18	26	299	S114574855, S104891039	ARCO #9630	12579 VAN NUYS BLVD	170 ft (0.03 mi) ESE	Tunnel	LUST, RGA LUST	Facility is listed as "Leak Being Confirmed" for a gasoline leak to soil as of 2001.	High	
E1C-19	26	324	S114574856, S114702758, S102438981, S114575341, S114703282, S103066084	ARCO #9630, THRIFTY #230	12957 VAN NUYS BLVD	2266 ft (0.43 mi) WSW	Tunnel	HIST CORTESE, LUST, RGA LUST	LUST - Facility is listed to have impacted soil due to a LUST containing gasoline. Site status is listed to be "Case Closed" as of 1/9/1991. LUST/HIST CORTESE (S103066084) - Facility is listed to have impacted other groundwater (used other than drinking water) with gasoline due to a LUST at the site. Site status is listed to be "Completed - Case Closed" as of 3/28/2013.	Low	
E1C-20	27-29	424	1017400940	ASSOCIATED READY MIXED CONCRETE INC	8946 BRADLEY AVE	1570 ft (0.3 mi) NE	At-grade	TRIS	Facility is listed as a hazardous waste/enforcement and compliance history site for lead compounds with a status date of 2014. The lead compounds are reported to be transferred offsite for further waste management.	Low	
E1C-21	29	444	S113145672	ASTRO CHROME & POLISHING	8136 LANKERSHIM BLVD	3951 ft (0.75 mi) SW	At-grade	SLIC	Facility listed as "Open - Site Assessment" as of 2014 for chlorinated hydrocarbons for impacting an unspecified media.	Low	
E1C-22	27	402	S103587984	ATHENS SUN VALLEY MAT REC & T.S.	11121 PENDLETON ST	3801 ft (0.72 mi) NE	At-grade	SWF/LF	Facility is listed as an active large volume transfer and processing facility that accepts green materials, household trash, and inert metals. Monthly inspections are reported for the site and a daily capacity is listed to be 1,500 tons.	Low	
E1C-23	27	402	S103441295	BENTZ DUMP	11251 PENDLETON ST	3368 ft (0.64 mi) NE	At-grade	LDS,WMUDS/S WAT	Facility is listed as a land disposal site with a status of "Completed - Case Closed" as of 5/25/2016. Accepted materials are listed to be clean dirt, broken concrete, asphalt, brick, block and rock.	Low	
E1C-24	27	372	S112205497	BINS BINS BINS INC	11835 SHELDON ST	859 ft (0.16 mi) NE	Elevated / Aerial Structure	SWF/LF	Facility is listed as an active waste hauler. Limited additional information is provided.	Low	
E1C-25	29	402	S113724443	BIOMEDICAL WASTE DISPOSAL	11152 FLEETWOOD ST, #9	1846 ft (0.35 mi) NE	Retained Cut / Trench	MWMP	Facility is listed to be a transfer only medical waste facility. No additional information is provided.	Low	
E1C-26	29	464	S114583652, 1000590036	BLACKTOP MATERIALS COMPANY, BLACTOP MATERIALS CO #2	11462 PENROSE ST	1621 ft (0.31 mi) SW	Retained Cut / Trench	HIST CORTESE, LUST, RGA LUST	Facility is reported to have impacted soil with diesel fuel due to a LUST. Site status is listed as "Completed - Case Closed" as of 9/7/1995.	Low	
E1C-27	26	399	S117661157	BOULEVARD	9108 LAUREL CANYON BLVD	2550 ft (0.48 mi) SW	At-grade	CA MINES	Facility is listed as an idle sand and gravel open pit, plant, or mill operation. Reclamation is reported to be in progress and the facility is listed to be 124 acres in size. Information for the site was updated in 2014.	Med	
E1C-28	27	402	U003060793	BRADLEY AVE DUMP	9050 BRADLEY AVE	1603 ft (0.3 mi) NE	At-grade	LDS,WMUDS/S WAT	Facility is listed as a land disposal site with a status of "Open-Inactive" as of 11/29/2012. Groundwater monitoring was conducted at the site and elevated VOC and PCE/TCE concentrations were identified.	Med	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
E1C-29	27	404	S113887321	BRADLEY EAST LANDFILL	9229 TUJUNGA AVE	2430 ft (0.46 mi) NE	At-grade	LDS	Facility is a former sand and gravel pit that was subsequently used as an unlined non-hazardous solid waste landfill that is listed as "Open - Closed/With Monitoring" as of 5/22/2016. Groundwater and soil/soil vapor are listed to have been impacted with VOCs, metals, and landfill related gases. The facility is reported to have "leaking waste constituents in excess of DHS/MCLs and may be affecting groundwater in the vicinity of the landfill.	Med	
E1C-30	27	400	S100931059, S109286318, S111075797, S103341425	BRADLEY EAST LANDFILL, BRADLEY LANDFILL & RECYCLING CENTER	9227 TUJUNGA AVE	2005 ft (0.38 mi) NE	At-grade	SWF/LF,LDS,W MUDS/SWAT	Facility is listed to be a closed solid waste landfill that accepts construction/demolition, industrial, mixed municipal, and other designated wastes. The closure date is listed as 6/1/2007 and the facility is reported to be 126 acres in size. Facility is also listed to be a solid waste landfill with quarterly inspections with a closure date of 12/31/1980. Facility is also listed to be a closed large volume transfer/processing facility with a closure date of 3/10/1988. Currently, the facility is listed to be an active large volume transfer/processing facility accepting agricultural, green materials, and manure with monthly inspections.	Med	
E1C-31	26-27	355	1000200264, S103441737, 1003880073, S103441393	BRANFORD LANDFILL, BRANFORD EXPERIMENT SITE, LOS ANGELES DWP-BRANFORD STREE	9701 SAN FERNANDO	675 ft (0.13 mi) WSW	At-grade	CERCLIS-NFRAP, HIST CORTESE, LDS, ENVIROSTOR,W MUDS/SWAT	LDS ENVIROSTOR (S103441737) - Facility is listed to be a closed land disposal site with a status of "Open - Closed/With Monitoring" as of 2/25/2016. A landfill gas collection system is reported to be operated continuously to mitigate methane gas migration from the facility. ENVIROSTOR (S103441737) - Facility is listed to have impacted groundwater, soil, and soil vapor with methane due to landfill operations. Site status is reported to be "No Further Action" as of 9/30/1998. CERCLIS-NFRAP (1003880073) - Site assessed for contamination in 1997 and is listed as NFRAP due to not qualifying for the National Priority List (NPL) based on existing information provided in October 2013.	High	
E1C-32	26	355	S102360935	BRANFORD LF	12456 BRANFORD ST	1682 ft (0.32 mi) WSW	At-grade	SWF/LF	Facility is listed to be a closed solid waste landfill. Detail of the material accepted is not provided, however, quarterly inspections are reported. The closure date is not reported for the site.	Med	
E1C-33	27	402	U001567850	BROWNING FERRIS INDUSTRIES INC	9200 GLENOAKS BLVD	3777 ft (0.72 mi) NE	At-grade	SWF/LF	Facility is listed to be an active waste hauler. Limited additional information was provided in relation to site operations. ¹	Low	X
E1C-34	29	443	S103621795	BURBANK AIRCRAFT SUPPLY INC	10671 LANARK	414 ft (0.08 mi) NE	Tunnel	SLIC	Facility is listed to have impacted an aquifer used for drinking water supply with VOCs and chromium. Current status is listed as "Open-Inactive" as of 10/29/2014. Groundwater gradient information was not reported but is anticipated to be toward the southeast per typical flow within the San Fernando Valley area.	High	
E1C-35	29	503	S111828968	BURBANK AIRPORT AUTHORITY	2627 HOLLYWOOD WAY	2159 ft (0.41 mi) NE	Tunnel	SLIC	Facility was evaluated by the LARWQCB in 2004 in relation to a chromium VI source assessment for the area. The facility was determined to need "No Further Requirements" in relation to the investigation in 2004 as is listed as "Completed - Case Closed" as of 12/22/2014.	Low	
E1C-36	24	246	S116497301	C&M TOPSOIL INC	12087-40 LOPEZ CANYON RD.	740 ft (0.14 mi) ESE	Tunnel	SWF/LF	Site is listed as an active facility accepting green waste for composting operations as of 2014.	Low	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
E1C-37	24	239	S101298230, S114588823, S114588822	C. E. MACMILLAN INC	12355 GLADSTONE AVE	1307 ft (0.25 mi) WNW	Tunnel	HIST CORTESE, LUST, RGA LUST	Facility is reported to have impacted soil with other solvents or non-petroleum hydrocarbons due to a LUST. Site status is listed as "Completed - Case Closed" as of 9/4/1996.	Low	
E1C-38	29	500	2004100406, 1000252200	CALIFORNIA BIONUCLEAR CORP	7649 SAN FERNANDO RD	249 ft (0.05 mi) SW	Tunnel	CERCLIS-NFRAP, HMIRS, PRP	Facility was evaluated in relation to the San Fernando NPL case for potentially impacting groundwater with VOCs and/or chromium. The site was determined to require removal only, no site assessment work needed as of 1987.	Med	
E1C-39	26	396	1011961457	CALIFORNIA CHEMICAL MANUFACTURING LLC (AMR)	12734 BRANFORD ST, SUITE 20	3517 ft (0.67 mi) SW	At-grade	CERCLIS-NFRAP	Site assessed for contamination in 2009 and is listed as No Further Remedial Action Planned (NFRAP) due to not qualifying for the National Priority List (NPL) based on existing information.	Low	
E1C-40	29	444	S112274179	CALIFORNIA PROPELLER	8101 LANKERSHIM BLVD	4127 ft (0.78 mi) SW	Retained Cut / Trench	SLIC	Facility was investigated in relation to chromic acid, and 1,1,1-TCA use at the site. Soil samples were collected adjacent to an abandoned clarifier that indicated elevated concentrations of chromium. A soil gas survey was subsequently performed that indicated elevated 1,1-DCE and 1,1,1-TCA concentrations in soils adjacent to the clarifier. The site received a letter of "No Further Action" in regard to soil and soil vapor impacts from the LARWQCB in 1994. The site received a notice of "No Further Action" subsequently in 1996 for the USEPA. Due to concerns regarding emerging chemicals detection in the groundwater of the North Hollywood Operable Unit, the LARWQCB issued a notice for further investigation for potential groundwater impact. In response, a technical report was prepared in 2012 by a consultant. A notice of "No Further Action" in relation to potential groundwater impacts was issued in 2015 by the LARWQCB. The site status is listed as "Completed - Case Closed" as of 5/21/2015.	Low	
E1C-41	29	402	1016467998	CALMAT CO		439 ft (0.08 mi) NE	At-grade	US MINES	Facility is listed as "Non-Coal Mining" as of 1973. Limited additional information was provided.	High	
E1C-42	27-29	402	1006816059	CALPORTLAND CO SUN VALLEY PLANT	8981 BRADLEY AVE	1556 ft (0.29 mi) NE	At-grade	TRIS	Facility is listed to produce lead compounds with off-site transfer for disposal of approximately 13 pounds of the compounds per year.	Low	
E1C-43	24	257	S114726531, S106079129	CITY OF SAN FERNANDO CORP YARD	535 GLENOAKS BLVD	5265 ft (1 mi) WNW	Tunnel	SWF/LF, RGA LF	Facility is listed to be an active limited volume transfer operation accepting construction/demolition, green material, inert, and metal wastes. The site is reported to be inspected quarterly and the permit date for the facility is 9/15/2003.	Low	
E1C-44	29	402	1000591490	COAST LIQUID GAS	11370 PENDLETON ST	583 ft (0.11 mi) NE	Elevated / Aerial Structure	LUST	SWF/LF -Very limited information provided for facility but site is listed in SWF/LF database. LUST - During steam cleaning of a sump, contaminated soil was excavated and disposed of for an unknown contaminant in 1988.	Med	
E1C-45	24	239	1003878859, S104573531	COMMODORE PRODUCTS, P & G PRODUCTS	12800 FOOTHILL BLVD	2307 ft (0.44 mi) WNW	Tunnel	CERCLIS-NFRAP, ENVIROSTOR	CERCLIS - NFRAP (1003878859) - Site assessed for contamination in 2010 and is listed as NFRAP due to not qualifying for the NPL based on existing information. ENVIROSTOR (S104573531) - Facility was investigated in relation to multiple potential COCs at the site under a site characterization and assessment grant. No COCs were confirmed for the facility and the case was referred to another agency as of 8/21/1995.	Low	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
E1C-46	27	402	1000155657, S103340305, 1000409068	COMMUNITY RECYCLING / RES RECOVERY, INC, SOUTHERN CALIFORNIA WASTE REDUCTION	9147 DE GARMO AVEE	3142 ft (0.6 mi) NE	At-grade	CERCLIS-NFRAP, CORRACTS, SWF/LF	SWF/LF (1000155657) - Facility is listed to be an active (permit date of 1997) limited volume transfer operation that accepts construction/demolition and other designated wastes with quarterly inspections. SWF/LF (S103340305) - Facility is listed as an active (permit date of 1998) large volume transfer/processing facility that accepts construction/demolition, industrial, mixed municipal waste. Inspections are reported to be performed on a monthly basis. CERCLIS-NFRAP/CORRACTS - Facility is listed to not qualify for NPL based on information updated in October 2013.	Low	
E1C-47	26	355	1011812530, S104809415	CONDORA CONSTRUCTION SERVICES	12506 MONTAGUE ST	570 ft (0.11 mi) WSW	Retained Cut / Trench	US BROWNFIELDS, SWF/LF	LF- Site is listed as a transfer and processing facility for construction/demolition, green waste, and household hazardous waste with a capacity of 21,000 cubic yards per day. Brownfields - Site was investigated under a Phase I ESA as part of a Brownfields Assessment Cooperative Agreement, impacted media was not reported.	Med	
E1C-48	29	402	S105024700, S114605987, S114605986	CONROCK COMPANY	11401 TUXFORD ST	583 ft (0.11 mi) NE	Elevated / Aerial Structure	HIST CORTESE, LUST, RGA LUST	HIST CORTESE/LUST (S105024700) - Facility is listed to have impacted soil with an unspecified COC. Site status is listed as "Completed - Case Closed" as of 10/7/1994.	Low	
E1C-49	24	239	S114606987, S105026143, S102428394	COSMIC PLASTICS	12314 GLADSTONE AVE	1087 ft (0.21 mi) WNW	Tunnel	HIST CORTESE, LUST, RGA LUST	HIST CORTESE/LUST (S105026143) - Facility is listed to have impacted soil with an aviational fuel due to a LUST. Site status is listed as "Completed - Case Closed" as of 4/22/1988.	Low	
E1C-50	26	355	S101584556	COUNTY OF LA-FIRE DEPARTMENT	12605 OSBORNE ST	979 ft (0.19 mi) WSW	Tunnel	LUST	Site is listed as "Open - Site Assessment" as of 2014. Soil and soil vapor at the facility is listed to have been impacted with petroleum hydrocarbons and VOCs.	Med	
E1C-51	27	402	S104567759, S112891096	CROWN DISPOSAL COMPANY IN, RECOLOGY LOS ANGELES	9189 DE GARMO AVE	3142 ft (0.6 mi) NE	At-grade	SWF/LF	SWF/LF (S104567759) - Facility is listed to be a closed waste hauling site. The type of waste accepted is not reported. LUST (S104567759) - The facility is reported to have impacted soil due to a LUST containing other solvents or non-petroleum hydrocarbons. The site status is listed as "Completed - Case Closed" as of 9/2/1997. A note in the LUST file (1000437523) notes that landfill gas has migrated beneath the site. SWF/LF (S112891096) - Facility is listed to be an active waste hauler/transfer and processing facility that accepts construction/demolition, green materials, trash, and non-hazardous industrial waste.¹	Low	X
E1C-52	26	327	S114608777, S109117602	D & K MILK PALACE (BEACON)	11045 N GLENOAKS BLVD	235 ft (0.04 mi) WSW	Tunnel	LUST, RGA LUST	Facility is listed to have impacted soil with gasoline. Site is listed as "Case Closed" as of 1992.	Med	
E1C-53	27	402	S116282717, S103441524	DE GARMO LANDFILL/DEGARMO	9135 DE GARMO AVE	3101 ft (0.59 mi) NE	At-grade	LDS,WMUDS/S WAT	Site is an "Open - Inactive" land disposal site. Specifics on methane mitigation in relation to the site were not provided.	Low	
E1C-54	27	402	S103441512	DE GARMO PIT LANDFILL	11201 RANDALL STREET	2936 ft (0.56 mi) NE	At-grade	SWF/LF,WMUDS /SWAT	Site is listed as "Closed" for landfill operations and presently is used for commercial purposes. The facility is reported to have been part of the Solid Waste Assessment Test Program.	Low	
E1C-55	29	429	1006816060	DIXON HARD CHROME INC	11645 PENDLETON ST	969 ft (0.18 mi) SW	At-grade	ENVIROSTOR	Facility is listed to have a site assessment screening in relation to potential impacts as a results of past use. NPL and restricted use is not reported. The case was referred to the USEPA with a status date of 9/8/2011.	Med	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
E1C-56	26-27	394	1018119626	EL DORADO SITE	9444 N EL DORADO AVE	1040 ft (0.2 mi) SW	At-grade	US BROWNFIELDS	Site is listed to be part of a TBA Cooperative Agreement for potentially impacted properties. A Phase I ESA indicated cleanup is not required for the property. Unknown media was indicated to have been affected at the site.	Low	
E1C-57	26-27	355	1011812534, S106102747	EXPRESS METAL RECYCLING	12207 BRANFORD ST	453 ft (0.09 mi) ENE	Retained Cut / Trench	US BROWNFIELDS, ENVIROSTOR	Site is listed to be part of a TBA Cooperative Agreement for potentially impacted properties. A Phase I ESA indicated cleanup is not required for the property.	Low	
E1C-58	29	443	1000857356, 1014202338	EXPRESS PLATING DIV MASTERWORK, MONITOR POLISHING AND PLATING	8050 SAN FERNANDO RD	45 ft (0.01 mi) NE	Tunnel	CERCLIS-NFRAP, ENVIROSTOR	ENVIROSTOR (1000857356) - Site listed to be "Inactive - Needs Evaluation" for potential impacts from unspecified COCs to an unspecified media. The site status date is listed to be 9/4/2014. CERCLIS-NFRAP (1014202338) - Facility is listed to not qualify for NPL based on information updated in October 2013.	High	
E1C-59	26	309	S102429425, S114616106, S114616439	EXXON #7-3332	12786 VAN NUYS BLVD	1022 ft (0.19 mi) WSW	Tunnel	HIST CORTESE, LUST, RGA LUST	Facility is listed to have impacted soil with gasoline. Site is listed as "Case Closed" as of 1994.	Low	
E1C-60	26-27	355	S102796761	FOOTHILL AUTO ELECTRIC	12326 MONTAGUE ST	506 ft (0.1 mi) ENE	Tunnel	ENVIROSTOR	Site is listed to have been evaluated for NPL in 2013 for historic impacts and is reported to have been referred to the EPA. No COCs were specified for the facility.	High	
E1C-61	24-25	243	S114727864, S114727868	FOOTHILL WASTE RECLAMINATION INC	12221 LOPEZ CANYON RD	1936 ft (0.37 mi) ESE	Tunnel	RGA LF	Facility is listed to be a landfill related site in 2005 through 2009. No additional information was provided.	Med	
E1C-62	26-27	355	S111120541	FORMER TURBO PRODUCTS	12177 MONTAGUE ST	1781 ft (0.34 mi) ENE	Tunnel	ENVIROSTOR	Site is listed to have been evaluated for NPL in 2013 and is reported to have been referred to the EPA. No COCs were specified for the facility.	Med	
E1C-63	26	355	1000726516, S114623560, S114623570, S114623574	FORTIN INDUSTRIES INC FORTIN INDUSTRIES #610	9880 SAN FERNANDO RD	959 ft (0.18 mi) WSW	Retained Cut / Trench	HIST CORTESE, LUST, SLIC, RGA LUST	Facility is listed to have impacted groundwater (uses other than drinking water) with copper. Case is listed as "Completed - Case Closed" as of 1996.	Med	
E1C-64	27	355	1011812539	GLENOAKS MOBILE MANOR	10471 GLENOAKS BLVD	2365 ft (0.45 mi) ENE	Tunnel	US BROWNFIELDS	Site is listed to be part of a TBA Cooperative Agreement for potentially impacted properties.	Low	
E1C-65	26	335	S110493872	GOLDEN STATE MAGNETIC & PENETRANT LAB	12770 PIERCE ST, #7	1082 ft (0.2 mi) WSW	Tunnel	ENVIROSTOR	Site is listed to have been part of a tiered permit and is reported to have been referred to another agency. No COCs were specified for the facility.	Low	
E1C-66	27-29	402	S105911516	GOODWIN CHEMICAL	9007 NORRIS	2145 ft (0.41 mi) NE	At-grade	SLIC	The facility is listed to have impacted soil with PCE due to storage at the site. Various phases of site assessment were completed from 1990 through 2001. The LARWQCB issued a notice of "No Further Action" on 12/14/2001.	Low	
E1C-67	27	402	S109821484	GREGG PIT (PICK YOUR PART)	11370 PENDLETON ST	2137 ft (0.4 mi) NE	At-grade	SWF/LF	SWF/LF - Very limited information provided for facility but site is listed in SWF/LF database. LUST - During steam cleaning of a sump, contaminated soil was excavated and disposed of for an unknown contaminant in 1988.	Med	
E1C-68	24-25	272	S107736420	HANSEN FLOOD CON BAS/D		2116 ft (0.4 mi) ESE	Tunnel	ENVIROSTOR	Facility is listed as "Inactive - Needs Evaluation" as of 7/1/2005 as a military evaluation. No COCs were identified for the site.	Med	
E1C-69	26	355	S108199262	HAULING SOLUTIONS INC	9871 SAN FERNANDO RD	1120 ft (0.21 mi) WSW	Retained Cut / Trench	SWF/LF	Facility is listed as active waste hauling business. Additional information not provided.	Low	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
E1C-70	29	525	S101586790	HENSLER GENERAL CONSTRUCTION	7550 WHEATLAND AVE	2003 ft (0.38 mi) SW	Tunnel	SLIC	Facility was evaluated by the LARWQCB in 2001 in relation to a chromium VI source assessment for the area. The facility was determined to need "No Further Requirements" in relation to the investigation in 2003 as is listed as "Completed - Case Closed" as of 12/22/2014.	Low	
E1C-71	29	443	1017816849	HOLLIDAY ROCK CO	11420 PENROSE ST	1182 ft (0.22 mi) SW	Retained Cut / Trench	TRIS	Facility is listed to have notified the EPA under SARA Title III, Section 313. Lead compounds (three pounds per year) are reported to be produced at the site. In addition, the facility is listed in the EPA's index system in relation to release of toxic chemicals to air, water, land, or are transported off-site.	Low	
E1C-72	27	355	S105628352	HR TEXTRON	12137 MONTAGUE ST	2167 ft (0.41 mi) ENE	Tunnel	ENVIROSTOR	Facility is listed to have been evaluated for impacts in relation to historical usage. No confirmed COCs are reported for the site. A status of "Inactive - Needs Evaluation" is reported as of 1/30/2001. ¹	Med	X
E1C-73	26-27	360	S103985140, S114633701, S114633704, S102628856, 1000404171, S114633700, 1015732716, S105025438	HR TEXTRON INC	10445 GLENOAKS BLVD	1996 ft (0.38 mi) ENE	Tunnel	CERCLIS-NFRAP, HIST CORTESE, LUST, SLIC, RGA LUST	HIST CORTESE/LUST (S103985140/S102628856) - Solvents reported to have impacted soil at the site. Significant interim remedial action was reported to have been taken. Case closed in 1996. SLIC (S103985140) - A work plan was submitted in 2004 for the facility in relation to a LQRWQCB request for information. The site was reported to receive a notice of "No Further Requirements" in relation to the San Fernando Valley Chromium VI investigation. Site status listed as "Completed - Case Closed" as of 12/22/2014. LUST (1000404171) - Facility listed to have impacted soil with waste/motor/hydraulic/lubricating oil. Site status listed as "Completed - Case Closed" as of 3/22/2016. CERCLIS-NFRAP (1015732716) - Facility was evaluated for the NPL in relation to a historical evaluation and determined to not qualify based on information provided in October 2013. ¹	Low	X
E1C-74	27	402	1000428465	INDUSTRIAL BATTERY ENGINEERING	9121 DE GARMO AVE	3092 ft (0.59 mi) NE	At-grade	SLIC	Facility was evaluated by the LARWQCB in 2001 in relation to a chromium VI source assessment for the area. The facility was determined to need "No Further Requirements" in relation to the investigation in 2003 as is listed as "Completed - Case Closed" as of 12/22/2014.	Low	
E1C-75	27	355	1011812541	INDUSTRIAL-BUSINESS PARK	12085 BRANFORD ST	1773 ft (0.34 mi) ENE	Retained Cut / Trench	US BROWNFIELDS	Site is listed to be part of a TBA Cooperative Agreement for potentially impacted properties. A Phase I ESA indicated cleanup in not required for the property.	Low	
E1C-76	24	253	1008371158	J L SHEPHERD AND ASSOC	1010 ARROYO AVE	4067 ft (0.77 mi) WNW	Tunnel	MLTS	Facility was evaluated for the NPL in relation to a historical evaluation and determined not to be eligible as of 1/30/2001. Site restrictions are not reported for the facility. The site is currently listed as "Inactive - Needs Evaluation."	Low	
E1C-77	8-9	152	S114636951, S106915912, S114636952	JASONS AUTO PARTS	415 SIERRA HWY, 415 W SIERRA HWY	998 ft (0.19 mi) NW	Tunnel	LUST, RGA LUST	LUST (S106915912) Facility is listed to have impacted soils with tetrachloroethylene, waste oil/ motor oil/ hydraulic oil/ and lubricating oil due to a LUST. Low levels of TRPH and PCE remain in subsurface soils. Groundwater is estimated at greater than 500 feet bgs and not anticipated to have been impacted from the release. The site status is reported as "Completed - Case Closed" as of 9/21/2010.	Med	
E1C-78	26-27	35je5	S118504792, S108749114	JESSE'S PLATING (FORMER HVC)	12229 MONTAGUE ST	1332 ft (0.25 mi) ENE	Tunnel	SLIC, ENVIROSTOR	SLIC (S118504792) - Facility is listed to impacted soil, soil vapor, and an aquifer used for drinking water supply with PCE, TCE, and chromium VI.	Med	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
									Site status is listed to be "Open - Site Assessment" as of 2/11/2016. ENVIROSTOR (S108749114) - Facility is listed as "Inactive - Needs Evaluation" as of 9/8/2011. Past use of metal finishing/metal plating/metal plating - chrome is indicated for the facility and no COCs are specified for the site.		
E1C-79	6	140	S114637448, S102431920	JILL R RATCLIFFE	36200 SIERRA HWY N, SIERRA HWY	513 ft (0.1 mi) W	At-grade	HIST CORTESE, LUST, RGA LUST	Facility is listed to have impacted soil with gasoline due to a LUST. The site status is reported as "Completed - Case Closed" as of 11/21/1991.	Med	
E1C-80	27	402	S106102586	KC NISSAN AUTO DISMANTLING	10967 TUXFORD ST	4334 ft (0.82 mi) NE	At-grade	SLIC	Facility was evaluated by the LARWQCB in 2001 in relation to a chromium VI source assessment for the area. The facility was determined to need "No Further Requirements" in relation to the investigation in 2003 and is listed as "Completed - Case Closed" as of 11/29/2012.	Low	
E1C-81	29	402	S103674790	KENWALT DIE CASTING CO	8719 BRADLEY AVE	1357 ft (0.26 mi) NE	Retained Cut / Trench	SLIC	Facility was evaluated by the LARWQCB in 2001 in relation to a chromium VI source assessment for the area. The facility was determined to need "No Further Requirements" in relation to the investigation in 2003 and is listed as "Completed - Case Closed" as of 12/22/2014.	Low	
E1C-82	27	398	S112186489	LA CITY DWP PENDLETON (PENDLETON STREET LANDFILL)	11000 PENDLETON ST	5115 ft (0.97 mi) NE	At-grade	LDS	Facility is listed as a land disposal site with status of "Completed - Case Closed" as of 2012. However, VOC and solvent concentrations were reported during groundwater monitoring at the facility with flow migration toward the south.	Low	
E1C-83	27	372	S101588330, 1001491848	LA DEPARTMENT OF WATER/POWER, TRUESDALE CENTER	11791 TRUESDALE CENTER	3491 ft (0.66 mi) NE	At-grade	CERCLIS-NFRAP, VCP	VCP/ENVIROSTOR - Facility is reported to have entered a voluntary cleanup agreement in 2000 due to PCB, TPH-d, and TPH-g impacts to soil as a result of use as an electrical generation/substation. Current site status is listed as "Active."	Low	
E1C-84	29	443	S106484855	LADO MFG CO	11400 LUDDINGTON ST, #A	448 ft (0.08 mi) SW	Retained Cut / Trench	SLIC	Facility was evaluated by the LARWQCB in 2001 in relation to a chromium VI source assessment for the area. The facility was determined to need "No Further Requirements" in relation to the investigation in 2014 as is listed as "Completed - Case Closed."	Low	
E1C-85	27	355	U001567439, S114728243, S109821476, S111075979	LEDGER LANDFILL, GLENOAKS DUMP, LEDGER #2	10403 GLENOAKS BLVD	2486 ft (0.47 mi) ENE	Tunnel	SWF/LF, ENVIROSTOR, RGA LF	ENVIROSTOR (U001567439) - Facility was evaluated for the NPL and determined not to be eligible as of 1/22/2001. Site status is listed to be "Inactive - Needs Evaluation." SWF/LF (S111075979) - Facility is listed to be a closed landfill that accepted commercial, inert, liquid, and residential waste. Current use is reported to be commercial properties and a parking lot.	Med	
E1C-86	27	355	S116282712, S103441358	LEDGER NO. 2	GLENOAKS BLVD & MONTAGUE ST	2534 ft (0.48 mi) ENE	Tunnel	LDS,WMUDS/S WAT	Facility is listed to be a land disposal site with a status of "Open - Inactive" as of 12/24/2013. Limited additional information was provided.	Med	
E1C-87	26	355	S109821545	LEWIS VISCO - VALLEY IRON & METAL CO	9050 AND 9116 BRADLEY AVE	261 ft (0.05 mi) WSW	Tunnel	SWF/LF	Facility is listed to be a SWF/LF site with limited additional information reported.	High	
E1C-88	27	372	1017817032	LEX PRODUCTS WEST	11847 SHELDON ST	767 ft (0.15 mi) NE	Elevated / Aerial Structure	TRIS	Facility is listed to have notified the EPA under SARA Title III, Section 313. Copper (up to 7,552 pounds per year) are reported to be produced at the site and subject to waste broker disposal. In addition, the facility is listed in the EPA's index system in relation to release of toxic chemicals to air, water, land, or off-site transport.	Med	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
E1C-89	29	402	S116282735	LIVINGSTON - GRAHAM SUN VALLEY SANITARY LANDFILL	ADJACENT TO BRADLEY WEST	82 ft (0.02 mi) SW	At-grade	LDS	Facility is listed as a land disposal site with status of "Open - Inactive" as of 2013. The landfill is comingled with the Bradley West landfill and is reported to have continual groundwater and methane monitoring performed in relation to operations.	High	
E1C-90	27	406	S114644511, S114644510, S114644509, 1000591737	LIVINGSTON GRAHAM BLUE DIAMOND	11720 WICKES ST, 11720 WICKS ST	450 ft (0.09 mi) NE	At-grade	HIST CORTESE, LUST, RGA LUST	HIST CORTESE/LUST (1000591737) - Facility is listed to have impacted soil with aviation fuel due to a LUST. Site status is reported to be "Completed - Case Closed" as of 11/13/1997.	Med	
E1C-91	27	372	1014202344	LNL ANODIZING	9900 GLENOAKS BLVD, #3	3478 ft (0.66 mi) NE	At-grade	CERCLIS-NFRAP	Facility is reported to have been investigated in relation to the San Fernando Valley Superfund Site. The site was determined to not qualify for the NPL based on information provided as of 2010.	Low	
E1C-92	29	429	S106484456	LOCKHEED A-1, B85, LOTS 16, 16A	3220 W THORTON	648 ft (0.12 mi) SW	At-grade	SLIC	Site is listed as "Open - Site Assessment" as of 1990. An aquifer used for drinking water supply beneath the facility is listed to have been impacted by chromium and VOCs. ¹	Med	X
E1C-93	29	500	S114644699, S102432702	LOCKHEED PLANT B-6-F	7575 SAN FERNANDO RD N	257 ft (0.05 mi) SW	Tunnel	LUST, RGA LUST	Facility is listed to have impacted an aquifer used for drinking water supply with diesel fuel. Current site status is listed as "Completed - Case Closed" as of 1/1/1996.	High	
E1C-94	27	372	S109442393, S106528956	LOONEY BINS/EAST VALLEY DIVERSION	11616 SHELDON ST	3115 ft (0.59 mi) NE	At-grade	SWF/LF	SWF/LF (S109442393) - Facility is listed to be an active transfer/processing facility accepting construction/demolition and non-hazardous industrial debris. SWF/LF (S106528956) - Facility is listed to be an active large volume construction/demolition processing facility with monthly inspections.	Low	
E1C-95	27	372	S111075989	LOONEY BINS/SPACCARELLI HAULING	11616 1/2 SHELDON ST	3114 ft (0.59 mi) NE	At-grade	SWF/LF	Facility is listed as an active waste hauler. Limited additional information is provided.	Low	
E1C-96	24	229	S107736633	LOPEZ FLOOD CONTROL BASIN		893 ft (0.17 mi) WNW	Tunnel	ENVIROSTOR	Facility was evaluated for the NPL in relation to a military evaluation and determined not to be eligible as of 7/1/2005. Site restrictions are not reported for the facility. The site is currently listed as "Inactive - Needs Evaluation."	Med	
E1C-97	29	525	S113003727	LYN-TRON, INC	3150 N. DAMON WAY	2502 ft (0.47 mi) SW	Tunnel	SLIC	Facility is reported to have been investigated in relation to the San Fernando Valley Superfund Site due to manufacturing of metal and non-metal fasteners used in relation to the aerospace industry. Environmental assessment of the site was performed in 2013 in relation to a LARWQCB Order. The assessment concluded that no chromium and or other VOCs were used at the Site. A notice of "No Further Requirements" was issued in respect to soils only in 2013. The site status is listed as "Completed - Case Closed" as of 12/16/2013.	Low	
E1C-98	26	323	S107736650	MACLAY ES ADDITION, SITE 1 5640040	11071 BORDEN AVE	1327 ft (0.25 mi) ENE	Tunnel	ENVIROSTOR	Facility was evaluated for the NPL in relation to a school evaluation and determined not to be eligible as of 10/2/2006. Site restrictions are not reported for the facility. The site is currently listed as "No Further Action."	Low	
E1C-99	26	323	S105754243	MACLAY NEW PRIMARY CENTER	11035, 11063 & 11051 BORDEN AVE	1409 ft (0.27 mi) ENE	Tunnel	ENVIROSTOR	Facility was evaluated for the NPL in relation to a school evaluation and determined not to be eligible as of 10/6/2003. Site restrictions and confirmed COCs are not reported for the facility. The site is currently listed as "No Further Action."	Low	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
E1C-100	29	443	S105026814, S114647195, U001567798, S104160057	MANNING FUEL INC CEE JAY MACHINE	8407 TUJUNGA AVE, 8407 TUJUNGA	1062 ft (0.2 mi) SW	Retained Cut / Trench	HIST CORTESE, LUST, RGA LUST	LUST (U001567798) - Facility is listed to have impacted soil with aviation fuel as a result of a LUST. Site status is listed as "Completed - Case Closed" as of 2/27/1996. LUST (S104160057) - Facility is listed to have impacted soils with an unspecified COC. Site status is listed as "Case Closed" as of 2/27/1996.	Low	
E1C-101	27	355	S118504711	MAYONI ENTERPRISES INC	10340 GLENOAKS BLVD	2538 ft (0.48 mi) ENE	Tunnel	SLIC	Facility is listed to have impacted an aquifer used for drinking water, soil, and soil vapor with 1,1,1-TCA, 1,4-dioxane, and PCE. Site status is currently listed as "Open - Site Assessment" as of 12/16/2015.	Med	
E1C-102	26	393	1011961419, S106484866	MILES CHEMICAL COMPANY INC	12801 RANGOON ST	4631 ft (0.88 mi) SW	At-grade	CERCLIS-NFRAP, SLIC	SLIC (S106484866) - Facility was evaluated by the LARWQCB in 2004 in relation to a chromium VI source assessment for potential impacts to an aquifer used for drinking water in the area. The facility was determined to need "No Further Requirements" in relation to the investigation in 2004 as is listed as "Completed - Case Closed" as of 7/15/2004. ENVIROSTOR (S106484866) - Facility is listed to be evaluated for impacted due to historic use of the site as a transfer station or transportation - warehouse. Soil and soil vapor are listed as potential impacted media. Site status is listed as "No Further Action" as of 6/15/2011. CERCLIS-NFRAP (1011961419) - Facility is listed to not qualify for the NPL based on existing information.	Low	
E1C-103	24	279	S109548322	MILLER STEPHENSON CHEMICAL COMPANY	12261 FOOTHILL BLVD	1294 ft (0.25 mi) ESE	Tunnel	ENVIROSTOR	Facility is listed to have been evaluated for impacts in relation to potential soil and soil vapor. No confirmed COCs are reported for the site. A status of "No Further Action" is reported as of 9/8/2011.	Low	
E1C-104	24-25	256	S113096047, S102360706, S107144883, S106528955, S109286180, S103866717	MM LOPEZ ENERGY LLC, LA CITY, BUREAU OF SANITATION, LOPEZ CANYON LANDFILL, LOPEZ CANYON ENVIRONMENTAL CENTER	11950 LOPEZ CANYON RD	1862 ft (0.35 mi) ESE	Tunnel	SWF/LF, LDS,WMUDS/S WAT	SWF/LF (S113096047) - Facility is reported to be an active chipping and grinding operation for green materials. SWF/LF (S102360706) - Facility is reported to be a closed (closure date 6/30/1996) solid waste landfill that accepted mixed municipal waste. Quarterly inspections are reported. SWF/LF (S107144883) - Facility is listed to be a closed Class III landfill (closed 7/1/1996) consisting of approximately 166 acres. The landfill is listed to still be producing methane as a result of prior use, however, the facility is a landfill gas to energy project that utilized the methane for energy production for residences in the area. Methane extraction in relation to energy production continues to be performed at the site today and an active SWF/LF composting operation (S106528955) for green waste is also present. LDS (S109286180) - Facility is listed to be "Open - Verification Monitoring" in relation to groundwater, soil, and soil vapor impacts from previous use of the property as a land disposal site.	Med	
E1C-105	26-27	355	S111120538	MOC PRODUCTS	12306-12308 MONTAGUE ST	651 ft (0.12 mi) ENE	Tunnel	ENVIROSTOR	Facility is listed to have been evaluated for impacts. No confirmed COCs are reported for the site. A status of "Refer: EPA" is reported as of 6/27/2013.	Med	
E1C-106	26-27	355	S114655820, 1000128768, S114655821	MOC PRODUCTS COMPANY INC	12306 MONTAGUE ST	651 ft (0.12 mi) ENE	Tunnel	TRIS, HIST CORTESE, LUST, RGA LUST	TRIS (1000128768) - Facility has multiple listings under that database. A LUST is reported to have impacted soil with aviation fuel. Site status is reported to be "Completed - Case Closed" as of 4/28/1997. Facility is listed to have notified EPA under SARA Title II, Section 313. N-methyl-2-pyrrolidone is reported to be used/produced on the site. Toluene, C.I. food red 15, methanol, ethylbenzene, certain glycol ethers, zinc compounds, PAHs, xylene (mixed isomers) and ethylene glycol are also reported to be	Med	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
									used/produced at the facility. The site is also reported to be in multiple other databases.		
E1C-107	26-27	355	1011812545	MOC THE PROFESSIONAL CHOICE	12307 MONTAGUE ST	618 ft (0.12 mi) ENE	Tunnel	US BROWNFIELDS	Site is listed to be part of a TBA Cooperative Agreement for potentially impacted properties. A Phase I ESA indicated cleanup is reported for the property.	Med	
E1C-108	26-27	390	S114656201, U001567802, S104160058, S114656202	MONARCH RECORD MFG CORP INC	9545 SAN FERNANDO RD	418 ft (0.08 mi) SW	At-grade	HIST CORTESE, LUST, RGA LUST	HIST CORTESE/LUST (U001567802) - Facility is listed to have impacted soil with gasoline due to a LUST. Site status is listed as "Completed - Case Closed" as of 4/30/1987. LUST (S104160058) - Same information as provided above.	Med	
E1C-109	24	194	S103978520	MOUNTAIN VIEW GATED VILLAS	12831 HUBBARD ST	4065 ft (0.77 mi) WNW	Tunnel	VCP	Facility is reported to be part of the VCP program with a status of "No Further Action" as of 4/19/2000 due to illegal dumping and medical related incineration. Soil was confirmed to be impacted with copper and compounds, furans, and arsenic dioxin.	Low	
E1C-110	27-29	402	1008381793	NATIONAL READY MIX CONCRETE CO	9010 NORRIS AVE	2193 ft (0.42 mi) NE	At-grade	TRIS	Facility is listed to have notified the EPA under SARA Title III, Section 313. Lead compounds (up to 7.1 pounds per year) are reported to be produced at the site.	Low	
E1C-111	5-6	128	S114660362, S114690985, S102437520, S114690913, S114690983	NETAL INC, SIERRA HWY & AVE S	37205 SIERRA HWY, 37205 SIERRA HWY N	61 ft (0.01 mi) ENE	At-grade	HIST CORTESE, LUST, RGA LUST	A LUST containing waste/motor/hydraulic oil was present at the site. Soil and an aquifer used for drinking water supply was reported to have been impacted. Assessment/remediation performed and case closed in 2014.	High	
E1C-112	27	355	1011812546	NEWHALL JUNK & SALVAGE RECYCLERS	12011 BRANFORD ST	2422 ft (0.46 mi) ENE	Retained Cut / Trench	US BROWNFIELDS	Facility is listed to have had a Phase I ESA performed in relation to assessment of the site. The Phase I ESA was performed under an US-EPA Brownfields Assessment Cooperative Agreement. Results of the Phase I ESA were not reported.	Low	
E1C-113	12	177	1011130614	NORTH STAR MINERALS INC		2387 ft (0.45 mi) NW	At-grade	US MINES	Site is listed as an active non-coal mining company. Numerous citations are reported for unspecified reasons.	Med	
E1C-114	27	355	1011812547	NUMBER 1 ELECTRIC	12051 BRANFORD ST	2093 ft (0.4 mi) ENE	Retained Cut / Trench	US BROWNFIELDS	Facility is listed to have had a Phase I ESA performed in relation to assessment of the site. The Phase I ESA was performed under an US-EPA Brownfields Assessment Cooperative Agreement. Results of the Phase I ESA were not reported.	Low	
E1C-115	29	464	S106484857	OCCUPANT-AUTO SHOP	8431 TELFAIR AVE	1685 ft (0.32 mi) SW	Retained Cut / Trench	SLIC	Facility was evaluated by the LARWQCB in 2001 in relation to a chromium VI source assessment for the area. The facility was determined to need "No Further Requirements" in relation to the investigation in 2014 as is listed as "Completed - Case Closed."	Low	
E1C-116	26	303	1018119710	ORNELAS SITE	11340 N GLENOAKS BLVD	2010 ft (0.38 mi) WNW	Tunnel	US BROWNFIELDS	Facility is listed to have had a Phase I ESA performed in relation to assessment of the site. The Phase I ESA was performed under an US-EPA Brownfields Assessment Cooperative Agreement. Results of the Phase I ESA were not reported.	Low	
E1C-117	29	443	S114666067, S110060769, S106517286, S114666066	PACIFIC ENERGY	8309 TUJUNGA AVE	1232 ft (0.23 mi) SW	Retained Cut / Trench	HIST CORTESE, LUST, RGA LUST	HIST CORTESE/LUST (S110060769) - Facility is listed to have impacted soil with aviation fuel due to a LUST. Site status is listed as "Completed - Case Closed" as of 10/6/1997.	Low	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
E1C-118	27	355	1016170548, 1000252793	PACIFIC PLATING	12113 BRANFORD ST	1444 ft (0.27 mi) ENE	Retained Cut / Trench	CERCLIS-NFRAP, ENVIROSTOR	CERCLIS-NFRAP (1016170548) - Site was assessed for contamination in 2013 and is listed as NFRAP due to not qualifying for the NPL based on existing information. ENVIROSTOR (1000252793) - Facility is listed to be part of a Tiered Permit with a status of "Refer: Other Agency." Furthermore, the site is listed as "Inactive - Action Required" with a status date of 9/8/2011.	Med	
E1C-119	26-27	355	1000229142, 1012043061	PB FIBERGLASS PRODUCTS INC	12177 BRANFORD ST	856 ft (0.16 mi) ENE	Retained Cut / Trench	CERCLIS-NFRAP, ENVIROSTOR	ENVIROSTOR (1000229142) - Facility was evaluated for the NPL and determined not to be eligible as of 9/5/2014. Site status is listed to be "Inactive - Needs Evaluation." Numerous PAH compounds are listed as confirmed COCs for the site to soil. CERCLIS-NFRAP (1012043061) - Site was assessed for contamination in 2013 and is listed as NFRAP due to not qualifying for the NPL based on existing information.	Med	
E1C-120	27	402	1006932050	PDQ AUTO SALVAGE	10975 TUXFORD ST	4250 ft (0.8 mi) NE	At-grade	CERCLIS-NFRAP, LEAD SMELTERS	Site assessed for contamination in 1979 through 1982 and is listed as NFRAP due to not qualifying for the NPL based on existing information.	Low	
E1C-121	27	402	S109821518, S108432318	PENDLETON STREET DUMP	11050 PENDLETON ST	3673 ft (0.7 mi) NE	At-grade	SWF/LF	SWF/LF (S108432318) - Facility is listed to be a closed solid waste landfill facility. Limited additional information was provided for site. SWF/LF (S109821518) - Facility is listed to be an active limited volume transfer/processing operation for metal, mixed municipal, tire, passenger, and wood waste.	Low	
E1C-122	29	402	S109117694	PENHALL COMPANY	11182 W PENROSE AVE	959 ft (0.18 mi) NE	Retained Cut / Trench	LUST	Soil is reported to have been impacted from a LUST of diesel fuel at the facility. Current status listed as "Completed - Case Closed" as of 2012.	Low	
E1C-123	29	443	1001115478, S109287258	PENROSE LANDFILL GAS CONVERSION LLC, PENROSE SANITARY LANDFILL	8301 TUJUNGA AVE	1367 ft (0.26 mi) SW	Retained Cut / Trench	CERCLIS-NFRAP, SLIC, LDS, ENVIROSTOR	An aquifer used for drinking water supply is reported to have been impacted from a LUST of diesel fuel at the facility. Current status listed as "Completed - Case Closed" as of 2012.	Low	
E1C-124	29	443	S102360907	PENROSE PIT	8251 - 8301 TUJUNGA AVE	1354 ft (0.26 mi) SW	Retained Cut / Trench	SWF/LF	Site is listed as a closed solid waste disposal facility for residential/industrial/commercial waste. Facility was closed in 1987.	Med	
E1C-125	29	500	1000415250	PHOTO CHEM ETCH CORP	7710 SAN FERNANDO RD	30 ft (0.01 mi) SW	Tunnel	SLIC, ENVIROSTOR	The site is listed as "Completed - Case Closed" as of 12/22/2014 for VOC contamination that has impacted an aquifer used for drinking water supply.	Low	
E1C-126	26-27	355	1011812550, 874580	PMC	12243 BRANFORD ST	126 ft (0.02 mi) ENE	Retained Cut / Trench	US BROWNFIELDS, ERNS	ERNS (874580) - Facility is reported to have a release to soil. In 1987, a truck had a fuel tank plug knocked out when it ran over a steel plate in the road resulting in 100 gallons of diesel fuel being spilled. The fire department responded to the scene and cleanup is not planned in relation to the spill. ERNS (93328129) - Facility is reported to have an emergency release to the soil. In 1993, a sight glass on a storage tank broke resulting in 25,000 pounds of trichlorofluoromethane being spilled to surrounding soil and the atmosphere. BROWNFIELD (1011812550) - Facility is listed to have had a Phase I ESA performed in relation to assessment of the site. The Phase I ESA was performed under an US-EPA Brownfields Assessment Cooperative Agreement. Results of the Phase I ESA were not reported.	High	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
E1C-127	27	355	1011812551	PRE-FAB GRANITE COUNTERTOPS	12065 BRANFORD ST	1962 ft (0.37 mi) ENE	Retained Cut / Trench	US BROWNFIELDS	Facility is listed to have had a Phase I ESA performed in relation to assessment of the site. The Phase I ESA was performed under an US-EPA Brownfields Assessment Cooperative Agreement. Results of the Phase I ESA were not reported.	Low	
E1C-128	29	443	1017428034, 1000297142	PRIME PLATING INC	11321 GOSS ST	797 ft (0.15 mi) SW	Retained Cut / Trench	TRIS, SLIC	SLIC - An aquifer used for drinking water supply is reported to have been impacted from chromium and VOCs. Current status listed as "Completed - Case Closed" as of 1997. TRIS - The facility is listed to use toxic chemicals (cyanide/lead/nitrate compounds) which are reported to be transported offsite for disposal.	Med	
E1C-129	27	372	1016112148	QEP INC	11912 SHELDON ST	289 ft (0.05 mi) NE	Elevated / Aerial Structure	TRIS	Facility is listed to have notified the EPA under SARA Title III, Section 313. Styrene is reported to be released to the air.	Low	
E1C-130	27	355	S110494226	QUALITY FINISHING INC	12109 BRANFORD ST, SUITE D2 & D4-D6	1543 ft (0.29 mi) ENE	Retained Cut / Trench	ENVIROSTOR	Facility is listed to be part of a tiered permit and referred to another agency. Site is not subject to the NPL or land use restrictions.	Low	
E1C-131	27	355	1011812553	QUALITY USED AUTO PARTS	12055 A BRANFORD ST	1922 ft (0.36 mi) ENE	Retained Cut / Trench	US BROWNFIELDS	Facility is listed to have had a Phase I ESA performed in relation to assessment of the site. The Phase I ESA was performed under an US-EPA Brownfields Assessment Cooperative Agreement. Results of the Phase I ESA were not reported.	Low	
E1C-132	29	443	1001217364	R L ANODIZING	11331 PENROSE ST	542 ft (0.1 mi) SW	Retained Cut / Trench	ENVIROSTOR	Facility was evaluated in 2012. Site is listed to not be NPL eligible and not have land restrictions. A status of "No Further Action" was issued on 7/9/2013.	Low	
E1C-133	27-29	402	1014202571	RECYCLED BASE MATERIALS INC		2320 ft (0.44 mi) NE	At-grade	US MINES	Facility is listed as an abandoned non-coal mining operation as of 2010.	Med	
E1C-134	26-27	355	S111076059, 1006932051, S117038718	REDUCE PRICE DISPOSAL, BRANFORD AUTO WRECKING	12276 BRANFORD ST	29 ft (0.01 mi) ENE	Retained Cut / Trench	CERCLIS-NFRAP, LEAD SMELTERS, SWF/LF, ENVIROSTOR	SWF/LF (S111076059) - Facility is listed as an active waste hauler. CERCLIS-NFRAP (1006932051) - Site was assessed for contamination in 2013 and is listed as NFRAP due to not qualifying for the NPL based on existing information. LEAD SMELTER (1006932051) - Facility is listed to not be on the NPL with a primary site function of recycling. ENVIROSTOR (S117038718) Facility is listed to be evaluated for impacts. Site status is listed as "Inactive - Needs Evaluation" as of 8/31/2014.	High	
E1C-135	26	355	S118504837, 1011812525	REYNOLDS PRINTASIGN (FORMER), CADILLAC KING AUTO DISMANTLING	9830 SAN FERNANDO RD	837 ft (0.16 mi) WSW	Retained Cut / Trench	US BROWNFIELDS, SLIC	SLIC (S118504837) - Facility is listed to have operated from 1955 through 1989, manufacturing equipment for making signs. The operations involved the use and storage of VOCs, including TCE and 1,1,1-TCA. Site usage and storage is reported to have impacted the subsurface. Site status is listed as "Open - Site Assessment" as of 3/23/2016. BROWNFIELDS (1011812525) - Facility is listed to have had a Phase I ESA performed in relation to assessment of the site. The Phase I ESA was performed under an US-EPA Brownfields Assessment Cooperative Agreement. Results of the Phase I ESA were not reported.	Med	
E1C-136	27	411	S102808013	RICHARD E BYRD HIGH SCHOOL	9171 TELFAIR AVE	1589 ft (0.3 mi) SW	At-grade	ENVIROSTOR	Facility was evaluated for the NPL in relation to a school evaluation and determined not to be eligible as of 11/4/2011. Site restrictions are not reported for the facility. The site is currently listed as "No Further Action."	Low	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
E1C-137	26	355	S114677632, S104572887, S104160034, 2002033528, S114677633	ROADWAY EXPRESS INC	12355 MONTAGUE ST	142 ft (0.03 mi) ENE	Tunnel	HMIRS, HIST CORTESE, LUST, RGA LUST	HIST CORTESE/LUST (S104572887/S104160034) - Facility is listed to have impacted an aquifer used for drinking water supply with gasoline due to a LUST. Site status is reported to be "Completed - Case Closed" as of 9/4/1996. HMIRS (2002033528) - Release of approximately 5.5-gallons of nitric oxide compressed gas is reported as a result of a damaged cylinder in 2002. The fire department is reported to have responded and emptied the remaining product from the cylinder.	High	
E1C-138	27	402	1003879001	ROIC/SUN VALLEY	9068 DE GARMO AVE	3114 ft (0.59 mi) NE	At-grade	CERCLIS-NFRAP, LIENS 2, PRP	CERCLIS-NFRAP - Site is listed as "removal only site (no site assessment work needed)." A lien was recorded against the property on 9/30/1987.	Low	
E1C-139	27	355	1011812556	ROSS BAKER TOWING INC	12025 BRANFORD ST	2307 ft (0.44 mi) ENE	Retained Cut / Trench	US BROWNFIELDS	Facility is listed to have had a Phase I ESA performed in relation to assessment of the site. The Phase I ESA was performed under an US-EPA Brownfields Assessment Cooperative Agreement. Results of the Phase I ESA were not reported.	Low	
E1C-140	24-25	248	1003878824	RUSSELL MOE DUMP	12021 N LOPEZ CANYON RD	1777 ft (0.34 mi) ESE	Tunnel	CERCLIS-NFRAP	Facility is listed to have been evaluated and not qualify for the NPL based on existing information provided on 12/1/1987.	Low	
E1C-141	24-25	248	S101612993	RUSSELL MOE LANDFILL	12089 LOPEZ CANYON RD	1913 ft (0.36 mi) ESE	Tunnel	SWF/LF, LDS,WMUDS/S WAT	Facility is listed to be an unpermitted solid waste disposal site with quarterly inspections. Site is listed to have been closed on 12/31/1964.	Med	
E1C-142	29	473	S116497300	SA RECYCLING LLC	8270 TUJUNGA AVE	1077 ft (0.2 mi) SW	Retained Cut / Trench	SWF/LF	Facility is listed to be a medium volume transfer/processing facility for mixed municipal waste with a permit date of 2014.	Low	
E1C-143	27	372	1018119624	SAN FERNANDO SITE	9319-9325 N SAN FERNANDO RD	164 ft (0.03 mi) SW	At-grade	US BROWNFIELDS	Facility is listed to have had a Phase I ESA performed in relation to assessment of the site. The Phase I ESA was performed under an US-EPA Brownfields Assessment Cooperative Agreement. A petroleum related industry is reported to be located within close proximity of the property and potentially contributed to contamination at the site. Results of the Phase I ESA were not reported.	Med	
E1C-144	26	355	1000119933	SDS INDUSTRIES INC	10241 NORRIS AVE	506 ft (0.1 mi) ENE	Tunnel	SLIC	Facility is listed to have been re-evaluated by the LARWQCB in 1997 in relation to impacts to the San Fernando Valley NPL site. A notice of "No Further Requirements" was issued on 1/30/1997 and site status is listed as "Completed Case Closed."	Low	
E1C-145	26-27	355	S116497299	SEGOVIA ROLL-OFF	12215 BRANFORD ST	307 ft (0.06 mi) ENE	Retained Cut / Trench	SWF/LF	Facility is listed to be an active limited volume transfer operation for construction/demolition, green materials, and mixed municipal wastes with quarterly inspections. The permit status is listed to have been updated on 3/6/2014.	Med	
E1C-146	27	374	S117662604	SHELDON	11401 W TUXFORD STREET	5087 ft (0.96 mi) NE	At-grade	CA MINES	Facility is listed as an active open pit sand and gravel mining operation as of 2014. Reclamation is reported to be in progress.	Low	
E1C-147	5-6	135	S114690986, S109348411	SIERRA HWY ANTELOPE VALLEY S CONVIENCE PLAZA	37167 N SIERRA HWY	180 ft (0.03 mi) WSW	At-grade	LUST, RGA LUST	A LUST with unspecified contents was present at the site. The impacted media was not reported. Case closed in 2007.	Med	
E1C-148	27	402	S116497298	SINGH DISPOSAL	11401 PENDLETON ST	1882 ft (0.36 mi) NE	At-grade	SWF/LF	Facility is listed to be an active limited volume transfer operation for construction/demolition and inert materials with quarterly inspections. The permit status is listed to have been updated on 2/12/2014.	Low	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
E1C-149	27-29	423	1009629960	SOUTHERN CALIFORNIA GAS CO	10632 PENROSE ST	4721 ft (0.89 mi) NE	Cut and Cover	DOT OPS	Facility is listed to be a natural gas distribution line that was damaged by outside forces (outside/third party) in 1987.	Low	
E1C-150	29	443	S114694413, S103988817, U001567823, S114694414	SOUTHLAND TRANSMISSIONS	8283 SAN FERNANDO RD	140 ft (0.03 mi) SW	Cut and Cover	HIST CORTESE, LUST, RGA LUST	An aquifer used for drinking water supply is reported to have been impacted from a LUST containing aviation fuel at the facility. Current status listed as "Completed - Case Closed" as of 1996.	High	
E1C-151	26-27	355	S114694690, S101586554, S114694689	SPARTAN TRUCK EQUIPMENT, SPARTAN TRUCK COMPANY	12266 BRANFORD ST	87 ft (0.02 mi) ENE	Retained Cut / Trench	HIST CORTESE, LUST, RGA LUST	HIST CORTESE/LUST (S101586554) - Facility is listed to have impacted soil with waste/motor/hydraulic/lubricating oil due to a LUST. The site status is reported as "Completed - Case Closed" as of 6/6/1986.	Med	
E1C-152	29	428	S106484844	SPECTRA AMERICAN	11037 PENROSE ST	2269 ft (0.43 mi) NE	Retained Cut / Trench	SLIC, ENVIROSTOR	Facility was evaluated by the LARWQCB in 2001 in relation to a chromium VI and VOC impact to an aquifer used for drinking water source assessment for the area. The facility was determined to need "No Further Requirements" in relation to the investigation in 2014 as is listed as "Completed - Case Closed."	Low	
E1C-153	24	239	1000181713	SPECTROLAB INC	12500 GLADSTONE AVE	1973 ft (0.37 mi) WNW	Tunnel	TRIS, ENVIROSTOR	TRIS - Facility is listed to generate hazardous waste, have notified EPA under EPA SARA Title III, Section 313, and is in the EPA's index system due to semiconductor and related device manufacturing. ENVIROSTOR - Facility is listed to have a tiered permit. Site is reported to not be subject to the NPL or have restricted land use as a result of facility operations.	Low	
E1C-154	29	496	S102360919, S109286992	STRATHERN INERT LANDFILL	11201 STRATHERN ST	2154 ft (0.41 mi) SW	Cut and Cover	SWF/LF, LDS	Facility is listed as a land disposal site with a status of "Open - Verification Monitoring."	Med	
E1C-155	29	443	S111076116	STRATHERN SANITARY LANDFILL	8230 TUJUNGA AVE	1635 ft (0.31 mi) SW	Retained Cut / Trench	SWF/LF	The facility is listed as a closed landfilling operation that accepted inert waste. Currently, the site is listed to be an inert debris engineered fill operation over an area of 34 acres.	Med	
E1C-156	27	391	S103426966, S109287408, S102266815	SUN VALLEY LANDFILL - THERMAL TREATMENT UNIT/SUN VALLEY INERT LANDFILL	9436 GLENOAKS BLVD	3773 ft (0.71 mi) NE	At-grade	SWF/LF, LDS,WMUDS/S WAT	SWF/LF (S103426966)- Facility is listed to be an active inert debris engineered fill operation at a closed landfill. The site is reported to be 125 acres in size. LDS (S109287408) - Facility is listed to be a land disposal site with a status of "Completed - Case Closed" as of 5/30/2016.	Low	
E1C-157	29	402	S106528959, S117711954	SUN VALLEY PAPER STOCK MRF AND TS	8701 NORTH SAN FERNANDO RD	160 ft (0.03 mi) SW	Elevated / Aerial Structure	SWF/LF	LF - Facility is an active large volume transfer/processing site for industrial and mixed municipal waste. Permit issued for the site in 2006.	Med	
E1C-158	26	393	1011961420	SUPERIOR THREAD ROLLING COMPANY	12801 WENTWORTH ST	5169 ft (0.98 mi) SW	At-grade	CERCLIS-NFRAP	Facility is listed to have been evaluated and not qualify for the NPL based on existing information provided.	Low	
E1C-159	29	444	S114697881, 1000288928	SWELLDOM COMPANY, SWELLDOM HOME CARE SERVICE INC	8531 LANKERSHIM BLVD	2300 ft (0.44 mi) SW	At-grade	HIST CORTESE, LUST, RGA LUST	HIST CORTESE/LUST (1000288928) - Facility is listed to have impacted soil with aviaional fuel. Site status is reported to be "Completed - Case Closed" as of 7/22/1996.	Low	
E1C-160	27-29	402	U001567825	TAM CERAMICS INC	11078 FLEETWOOD ST	2505 ft (0.47 mi) NE	Retained Cut / Trench	ENVIROSTOR	Facility is reported to have a Tiered Permit, however, land use restrictions and NPL subjectivity were not reported.	Low	
E1C-161	26-27	355	1000310559	TEKTOPLATE INC	12280 MONTAGUE ST	896 ft (0.17 mi) ENE	Tunnel	SLIC, ENVIROSTOR	Facility was evaluated by the LARWQCB in 2001 in relation to a chromium VI and VOC impact to an aquifer used for drinking water source assessment for the area. The facility was determined to need "No Further	Low	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
									Requirements" in relation to the investigation in 2003 as is listed as "Completed - Case Closed."		
E1C-162	29	443	S109117739, S114703961, U001567767	TEXACO - KEEBLE, ROBERT, TIMM FUEL & TIRE SERVICE INC	8579 SAN FERNANDO RD	154 ft (0.03 mi) SW	Retained Cut / Trench	LUST, RGA LUST	LUST (S109117739/U001567767) - Facility is listed to have impacted soil with gasoline. Site status is reported to be "Completed - Case Closed" as of 4/26/2010.	Med	
E1C-163	27	372	1000195400	TIME AVIATION SERVICES INC	9255 SAN FERNANDO RD	172 ft (0.03 mi) SW	At-grade	SLIC	Facility was evaluated by a consultant in 2005 in relation to a chromium VI and VOC impact to an aquifer used for drinking water source assessment for the area. Arsenic was detected in soil concentrations above PRG levels but were determined to be within typical background concentrations for the southern California area. The facility was determined to need "No Further Requirements" in relation to the investigation in 2005 and is listed as "Completed - Case Closed" as of 12/23/2014.	Low	
E1C-164	27	372	9999040782, 90080790, 91070272, 94020232, 94021240, 94031220, 94031475, 94040501, 9998051231, 9999020521, 9999020902, 999030882, 9999050952, 9999081691, 9998081224, 91020479, 91040501, 91080928, 94071368, 95050633, 95051264, 95101164, 96010156, 990001390	TINY BUT MIGHTY PRODUCTIONS INC BHC 2	9175 SAN FERNANDO RD, 9175 SAN FERNANDO BLVD	166 ft (0.03 mi) SW	At-grade	HMIRS, CHMIRS	Various spill incidents were reported in relation to transportation of chemicals. Upon review, a majority of the spills occurred while in off-site transit, were contained, and appeared to be minor.	Low	
E1C-165	27-29	424	S114706151, S109117745	TRANSIT MIXED CONCRETE (FMR SOUTHDOWN CONCRETE)	8960 N BRADLEY AVE	1579 ft (0.3 mi) NE	At-grade	LUST, RGA LUST	LUST (S109117745) - Facility is reported to have impacted soil with diesel fuel. Site status is listed as "Completed - Case Closed" as of 1/13/2015.	Low	
E1C-166	27	372	1000102029	TRUESDALE ESM EAST VALLEY	11781 TRUESDALE ST	3503 ft (0.66 mi) NE	At-grade	RCRA-TSDF	Facility is listed to treat, store, or dispose of numerous types of hazardous waste. Groundwater monitoring and evaluation is reported to have occurred between 1984 and 1985.	Low	
E1C-167	29	443	S109821493, S103441383	TUJUNGA PIT	8250 TUJUNGA AVE	1597 ft (0.3 mi) SW	Retained Cut / Trench	SWF/LF,WMUDS /SWAT	Very limited information provided for facility. Site assessed for SWAT program. Impact to media not reported.	Med	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
E1C-168	29	444	S113482310	TUXFORD PIT LANDFILL	11590 TUXFORD ST (TUXFORD ST AND GOLDEN STATE FWY)	1532 ft (0.29 mi) SW	Elevated / Aerial Structure	LDS	Facility is listed as a closed solid waste disposal site with a current regulation status as "unpermitted."	Med	
E1C-169	26-27	355	1000353463	ULTRAMET	12173 MONTAGUE ST	1816 ft (0.34 mi) ENE	Tunnel	US BROWNFIELDS, ENVIROSTOR	Brownfields - Facility is listed to have had a Phase I ESA performed in relation to assessment of the site. The Phase I ESA was performed under an US-EPA Brownfields Assessment Cooperative Agreement. The property use is reported to consist of light manufacturing. Results of the Phase I ESA were not reported and no COCs were identified for the site. ENVIROSTOR - Facility is reported to have had a site screening performed in 2007 to determine potential impacts to the site due to past use as metal plating. Hydrochloric acid was confirmed as a COC to have impacted soils. Current site status is listed as "Inactive - Action Required" as of 6/30/2007.	Med	
E1C-170	24	240	U001567595, S114709810	UPS SAN FERNANDO CASFR, UNITED PARCEL SERVICE	12745 ARROYO ST	825 ft (0.16 mi) WNW	Tunnel	LUST, RGA LUST	Facility is listed to have impacted an unknown media with an unknown COC. Site status is listed as "Completed - Case Closed" as of 5/10/2011.	Low	
E1C-171	26	327	S101618430	VALLEY CIRCUITS INC	11031 GLENOAKS BLVD	196 ft (0.04 mi) WSW	Tunnel	ENVIROSTOR	Facility is reported to have a Tiered Permit, however, land use restrictions and NPL subjectivity were not reported. Current status is listed as "Refer: Other Agency" as of an unspecified date.	Low	
E1C-172	27	388	1004676152	VALLEY GENERATING STATION	11801 SHELDON ST	1217 ft (0.23 mi) NE	At-grade	SLIC, VCP, ENVIROSTOR	VCP - Facility is listed to be in DTSC Site Cleanup Program with status of active as of 6/28/2000. Numerous COCs are confirmed to have impacted soil at the site and remedial actions are reported to have taken place. SLIC - Facility is reported to have been investigated in relation to the San Fernando Valley Superfund Site due to previous site usage. Soil investigation at the site was performed in 2005 to 2006 in relation to a LARWQCB Order. The assessment concluded that no chromium and or other VOCs were used at the Site. A notice of "No Further Requirements" was issued in 2006. The site status is listed as "Completed - Case Closed" as of 12/19/2014. ENVIROSTOR - facility is listed to be involved with a voluntary cleanup due to past use as and electrical generation/substation. Confirmed COCs consist of arsenic, total chromium, lead, PCBs, PAHs, copper and compounds, nickel, and vanadium and compounds to soil. Site status is listed as "Active" as of 6/28/2000.	Med	
E1C-173	27	392	S101618546, U001567848, S104156390	VALLEY GENERATING STATION - DWP/VALLEY GENERATING STATION DISP	9430 SAN FERNANDO RD	81 ft (0.02 mi) SW	At-grade	LDS, ENVIROSTOR, W MUDS/SWAT	LDS (S101618546) - Facility is listed to be an "Open-Inactive" land disposal site with a status date of 8/20/2013. ENVIROSTOR (U001567848) - Facility is listed to have been evaluated for impacts due to historical usage. A Non-Emergency Hazardous Material Substance Release Report for the site (July 8, 1994) stated the facility is impacted with oil fly ash containing metals, including chromium, copper, lead, nickel, and vanadium. During assessment of the site, no COCs are reported to have been confirmed and the facility is listed to not be applicable to NPL or have land use restrictions. Site status is listed as "Inactive - Needs Evaluation" as of 9/14/1995.	High	
E1C-174	27	391	S116282732	VALLEY RECLAMATION COMPANY - PIT NO. 3	11311 PEORIA ST	3933 ft (0.74 mi) NE	At-grade	LDS	Facility is listed as a land disposal site with a status of "Open - Inactive" as of 2013. Reports for the facility have indicated PCE impacts to groundwater.	Low	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
E1C-175	24-25	248	S114718054, S108935371, 1003878394, 1000200422	VALLEYCREST LANDSCAPE, FIREBALL INDUSTRIES INC	12087 N LOPEZ CANYON RD	1908 ft (0.36 mi) ESE	Tunnel	CERCLIS-NFRAP, LUST, ENVIROSTOR, RGA LUST	LUST (S108935371) - Facility is listed to have impacted an aquifer used for drinking water supply with diesel, xylenes, MTBE, TBA, and other fuel oxygenates. Site status is listed as "Completed - Case Closed" as of 9/9/2008. CERCLIS-NFRAP (1003878394) - Site was assessed for contamination in 2013 and is listed as NFRAP due to not qualifying for the NPL based on existing information. ENVIROSTOR (1000200422) - Facility listed to have had site screening performed due to historical usage. No confirmed COCs and/or impacted media are reported. Site status is listed as "Refer: Other Agency" with a status date of 8/31/1995.	Low	
E1C-176	26	315	S109422396	VAUGHN ELEMENTARY LANGUAGE ACADEMY	11176, 11180, 11182, 11188 HERRICK AVE	2531 ft (0.48 mi) WSW	Tunnel	ENVIROSTOR	Facility was evaluated for the NPL in relation to a school evaluation and determined not to be eligible as of 6/22/2009. Site restrictions are not reported for the facility. The site is currently listed as "No Further Action."	Low	
E1C-177	29	443	S106484837	VINTEN EQUIPMENT INC	8115 N CLYBORN	406 ft (0.08 mi) NE	Tunnel	SLIC	The site is listed as Completed - Case Closed as of 12/22/2014 for VOC contamination that has impacted an aquifer used for drinking water supply.	High	
E1C-178	27	372	S111076161	VULCAN MATERIALS (SUN VALLEY)	11520 SHELDON ST	4330 ft (0.82 mi) NE	At-grade	SWF/LF	Facility is listed to be an active landfilling operation that accepts inert waste as an inert debris engineered fill operation.	Low	
E1C-179	29	402	1014677847, S106399137, 2003642460	VULCAN MATERIALS CO SUN VALLEY	11447 WEST TUXFORD ST	246 ft (0.05 mi) NE	Elevated / Aerial Structure	ERNS, TRIS, CHMIRS	TRIS (1000128768) - Facility is listed to have notified the EPA under SARA Title III, Section 313. The site is listed to release up to eight pounds of naphthalene and PAHs to the atmosphere due to operations. CHMIRS/ERNS (S106399137/2003642460) - Facility is reported to have released 4,000 gallons of asphalt materials due to a plugged operation line in 2003. A waterway (storm drain) is reported to have been involved. Spill containment is not reported and cleanup was listed to have been completed.	Med	
E1C-180	27	414	1005775701	WASTE MANAGEMENT	9081 TUJUNGA AVE	1954 ft (0.37 mi) NE	Elevated / Aerial Structure	SWF/LF	Facility is listed as an active waste hauler. Limited additional information is provided.	Low	
E1C-181	27	402	S103697090	WEST COAST WINERY	11115 PENDLETON ST	3804 ft (0.72 mi) NE	At-grade	SLIC	Facility is listed to be a cleanup program site with a status of "Completed - Case Closed" as of 9/27/1995. The impacted media and COCs for the site are not reported.	Low	
E1C-182	26	355	1011812566	WILLIES AUTO REPAIR	9954 SAN FERNANDO RD	1158 ft (0.22 mi) WSW	Retained Cut / Trench	US BROWNFIELDS	Facility is listed to have had a Phase I ESA performed in relation to assessment of the site. The Phase I ESA was performed under an US-EPA Brownfields Assessment Cooperative Agreement. Results of the Phase I ESA were not reported.	Low	
E1C-183	29	443	S105026815, S114723172, U003904755, S114723381	WORLD OIL STATION NO. 19	8181 SUNLAND BLVD	175 ft (0.03 mi) SW	Tunnel	HIST CORTESE, LUST, RGA LUST	A LUST was reported to have impacted soil with gasoline. Case closed as of 1996.	Med	
E1C-184	6	142	91240533		1040 E RAE ST	22 ft (0 mi) WSW	At-grade	ERNS	Facility is reported to have impacted water with diesel fuel due to a tank valve malfunction in 1991. A contractor is reported to have been retained to clean up the spill.	Low	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
E1C-185	24	206	S110417564		1/5 MILES EAST OF 12100 HARDING ST	27 ft (0.01 mi) WNW	Tunnel	CHMIRS	Vandalism to a pole top transformer caused a spill of approximately 10 gallons of mineral oil (unknown if containing PCBs) in 2008. Waterway not reported to have been involved.	Low	
E1C-186	26	299	S110977421, S110417948		12600 VAN NUYS BLVD, SHADOW HILLS MOBILE HOME PARK	122 ft (0.02 mi) ESE	Tunnel	CHMIRS	CHMIRS (S110977421) - A caller reported that the cap to a sewage clean out valve was removed resulting in 100 gallons of sewage being released to the surrounding area. The spill occurred in 2010 and is not reported to have been contained and/or cleaned up. CHMIRS (S110417948) - A caller reported that approximately 1,000-gallons of sewage was released due to a clog in the sewer main. A contractor is reported to have cleaned up the spill.	Low	
E1C-187	26	327	S110981113		11000 GLEN OAKS BLVD, CROSS STREET IS PIERCE ST	107 ft (0.02 mi) ENE	Tunnel	CHMIRS	In 2010, a caller reported that approximately 1,500-gallons of sewage was released into a catch basin due to a semi carrying the sewage overturning due to a vehicle accident. The release was contained by placement of sand bags and booms before it could reach a waterway. Clean up was performed by United Pumping using a vacuum truck.	Low	
E1C-188	26-27	355	874580, 93328129		12243 BRANFORD ST	126 ft (0.02 mi) ENE	Retained Cut / Trench	ERNS	A sight glass was reported to have broken on an AST containing trichlorofluoromethane in 1993. The spill released 25,000 pounds of the material within a concrete containment. Most of the material evaporated and the remaining amount was cleaned up. The media affected is reported to have been land and air.	Med	
E1C-189	26-27	355	8865637		12318 BRANFORD ST 818-899-7924; ROB MEHAN(FOREMAN)/JOE E	249 ft (0.05 mi) WSW	Retained Cut / Trench	ERNS	Facility is reported to have had an emergency release tot the soil. In 1988, a caller stated that a green liquid material was eating through drums it was contained in. The material was reported to have been smoking and business employees were hosing down the spill resulting in intense fumes in the area. Containment and cleanup are not reported.	Med	
E1C-190	27	372	90178746		CONSTRUCTION SITE 9175 SAN FERNANDO RD	408 ft (0.08 mi) SW	At-grade	ERNS	Facility is reported to have spilled approximately 45 gallons of lacquer thinner/paint thinner in 1990. An agency was reported to be retained to handle and dispose of the product moving forward.	Med	
E1C-191	27-29	422	2014083694, S116779407		9027 SAN FERNANDO RD	164 ft (0.03 mi) SW	At-grade	ERNS, CHMIRS	ERNS (2014083694) - Facility is reported to have a release to soil. In 2014, dumping of an unknown material was reported to an alley way/asphalt. The material was reported to have been cleaned up by an employee of the company. CHMIRS (S116779407) - A caller reported a discharge of motor oil into an alley behind the facility. The caller stated that the business is pumping the product into the alley on a regular basis. Containment and cleanup are not reported.	High	
E1C-192	29	443	S109035661, 2007306845		11275 PENROSE ST	71 ft (0.01 mi) NE	Retained Cut / Trench	ERNS, CHMIRS	CHMIRS (S109035661) - A spill of approximately 20 pounds of ammonia was discovered during a pump down. The spill occurred in 2007 and is reported to have been contained. Cleanup is not reported. ERNS (2007306845) - A caller reported a release of approximate 20 pounds of anhydrous ammonia during a pump down of a refrigeration unit. The spill is reported to the atmosphere. The spill occurred in 2007 and is reported to have been contained. Cleanup is not reported.	Low	
E1C-193	29	491	S105651191		7975 CLYBOURN AVE, SUN VALLEY TB 533 A2	264 ft (0.05 mi) SW	Tunnel	CHMIRS	A tanker truck is reported to have had a leaking valve, resulting in asphalt emulsion being spread over the street into the gutter and storm drain and	Low	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
									ending up in the flood control channel in 1997. The street was closed and sand was spread over the surface. A contractor was retained to clean up the spill.		
E1C-194	29	513	S101298216, S105032930	U-HAUL CENTER OF SUN VALLEY	7721 HOLLYWOOD WAY	1752 ft (0.33 mi) ENE	Cut and Cover	HIST CORTESE,LUST	Facility was evaluated by the LARWQCB in relation to hydrocarbon impacts to soil. The facility is listed as "Completed - Case Closed" as of 3/31/92.	Low	
E1C-195	29	503	S110275514	SUPERIOR PLATING	4001 GLENOAKS BLVD	2150 ft (0.41 mi) NE	Tunnel	ENVIROSTOR	Facility was evaluated by the DTSC and is listed as "Inactive - Needs Evaluation" as of 5/24/12.	Med	
E1C-196	26-27	355	S112283606	CALDERON RECYCLING	12231 BRANFORD ST	424 ft (0.08 mi) ENE	Retained Cut / Trench	SWRCY	Facility is listed to be a recycling center that accepts aluminum/glass/plastic/bimetal products. Operation begin date listed to be 7/5/2015.	Med	
E1C-197	27	404	S103441474	BRADLEY AVENUE DUMP NO. 2		2464 ft (0.47 mi) NE	At-grade	WMUDS/SWAT	Facility is listed to be is Solid Waste Assessment Test Program. Little additional information is provided.	Med	
E1C-198	26-28	421	S103441429	BRIGHT REALITY	LAUREL CANYON & JEROME	4260 ft (0.81 mi) SW	At-grade	WMUDS/SWAT	Facility is listed to be is Solid Waste Assessment Test Program. Little additional information is provided.	Low	
E1C-199	29	443	S103441729	PENROSE LANDFILL	8221 TUJUNGA AVE	1689 ft (0.32 mi) SW	Retained Cut / Trench	WMUDS/SWAT	Facility is listed as Category B – Any facility having a physical, chemical, or biological waste treatment system (except for septic systems with subsurface disposal), or any Class II or II disposal site, or facilities without treatment systems that are complex, such as marinas with petroleum products, solid wastes, and sewage pump out facilities. The facility is listed to “not fall into the category of Municipal/Domestic, Industrial, Agricultural or Solid Waste (Class I, II or III) and to be a minor threat to water quality.	Med	
E1C-200	29	493	S103441730	TUJUNGA AVE/SITE 8-PENROSE PIT	8145 N. TUJUNGA AVE.	2836 ft (0.54 mi) SW	Cut and Cover	WMUDS/SWAT	Facility is listed as Category B – Any facility having a physical, chemical, or biological waste treatment system (except for septic systems with subsurface disposal), or any Class II or II disposal site, or facilities without treatment systems that are complex, such as marinas with petroleum products, solid wastes, and sewage pump out facilities. The facility is listed to “not fall into the category of Municipal/Domestic, Industrial, Agricultural or Solid Waste (Class I, II or III) and to be a minor threat to water quality.	Low	
E1C-201	29	500	S107137870	LEOS RECYCLING INC	7636 SAN FERNANDO RD	62 ft (0.01 mi) SW	Tunnel	SWRCY	Facility is listed to be a recycling center that accepts aluminum/glass/plastic/bimetal products. Operation begin date listed to be 1/2/2016.	Med	
E1C-202	26	327	S101584960	SEUNG HO KIM/MAL NAM KIM	11045 GLENOAKS BLVD	235 ft (0.04 mi) WSW	Tunnel	SWRCY	Facility is listed to be a recycling center that accepts aluminum/glass/plastic/bimetal products. Operation begin date listed to be 9/28/1998.	Med	
E1AC-203	7	S99	S113138690	ALL VALLEY RV CENTER	1525 SIERRA HWY	4474 ft (0.85 mi) NW	Elevated / Aerial Structure	CERS, CERS HAZ WASTE	Facility is listed as a hazardous waste generator in 2005 and 2006. This facility has received numerous administrative and facility compliance violations in issued by the Los Angeles County Fire Department.	Low	
E1AC-204	4	G37	S106826011	ANTELOPE VALLEY - N SIERRA HIGHWAY	36007 N. SIERRA HWY	152 ft (0.03 mi) E	At-grade	CERS, CERS HAZ WASTE	Facility is listed as a chemical storage facility. This facility received numerous administrative and facility compliance violations issued by the Los Angeles County Fire Department.	Med	
E1AC-205	1	H41	S103950319, 1000205297	ANTELOPE VALLEY PRESS	37404 SIERRA HWY	236 ft (0.04 mi) E	At-grade	CERS, CERS HAZ WASTE,	Facility is listed as a chemical storage facility. No violations have been reported.	Low	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
								LOS ANGELES CO. HMS			
E1AC-206	1	B14	U003060220	ARCO PRODUCTS CO (DEST)	37207 SIERRA HWY	59 ft (0.01 mi) W	At-grade	LOS ANGELES CO. HMS	Facility is listed as a hazardous material handler. The facility status is listed at "open".	Low	
E1AC-207	4	121	S118756508	DESERT WILLOW SCHOOL	62ND STREET EAST/S-8 AVENUE	1029 ft (0.19 mi) NE	At-grade	ENVIROSTOR. CERS	Facility is reported to have been assessed via a Phase I ESA for potential COCs. No COCs were confirmed for the site and the facility was determined to not be subject to the NPL and/or land use restrictions. Current site status is listed as "No Action Required."	Low	
E1AC-208	1	AB140	S123501389	PALMDALE WATER DISTRICT-TRMT PLNT	700 E AVENUE S	1273 ft (0.24 mi) W	At-grade	CERS, CERS HAZ WASTE	Facility is listed as a hazardous waste generator and chemical storage facility.	Low	
E1AC-209	9	D25	S104734900	SCOTTY'S NURSERY	352 SIERRA HWY	890 ft (0.17 mi) NW	Tunnel	LOS ANGELES CO. HMS	Facility is listed as a hazardous material handler. The facility status is listed at "open".	Low	
E1AC-210	10	C23	1025569695, 1025689899	SHEBA FERTILIZER DEPOSIT		418 ft (0.08 mi) W	Tunnel	MINES MRDS	Facility is listed as a prospect producer of sand, gravel, calcium and gypsum-anhydrite.	Med	
E1AC-211	1	B11	S109689978	SIERRA HWY & AVE S INC	37321 SIERRA HWY	20 ft (0 mi) W	At-grade	LOS ANGELES CO. HMS	Facility is listed as a hazardous material handler. The facility status is listed at "removed".	Low	
E1AC-212	1	B12	S102064705	SIERRA HWY & AVE S INC	37305 SIERRA HWY	25 ft (0 mi) W	At-grade	LOS ANGELES CO. HMS	Facility is listed as a hazardous material handler. The facility status is listed at "open".	Low	

¹The site is included in a group of industrial facilities that are documented to be included as "Responsible Parties" in relation to the San Fernando Valley Superfund Site for VOC/solvent/metal/chlorinated hydrocarbon impacts to groundwater used for drinking water. Listed sites with the same designation have the Case Background description associated with the listing presented in BOLD font and contain an "X" in the "Associated with the Superfund Site (Area #1)" column. While the San Fernando Superfund Site currently has a status of "Open - Remediation" or similar, some of the associated sites may have since been closed or have a status of "Completed - Case Closed". The remaining sites continue to be open and undergoing remediation for the associated contamination.

Table 3.10-B-8: E1 and E1A Burbank Subsection PEC Sites

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associated with the Superfund Site (Area #1)
E1B-2	29-30	500	S102414757	KAHR BEARING, A DOVER SARGENT	3010 N SAN FERNANDO BLVD	2613 ft (0.49 mi) ENE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to volatile organic compound impacts to an aquifer used for drinking water. The facility is listed as "Open - Inactive" as of 10/29/14. ¹	Med	X
E1B-3	29	500	S114644703, S114644702, S114644704, S101295680, S103649152	LOCKHEED PLANT B-6, BURBANK PLANT B-6	2801 HOLLYWOOD WAY N	322 ft (0.06 mi) ENE	Cut and Cover	HIST CORTESE,LUS T,SLIC,RGA LUST	Facility was evaluated by the LARWQCB in relation to metals and volatile organic compound impacts to soil and an aquifer used for drinking water. The facility is listed as "Open - Remediation" as of 10/31/96. ¹	High	X
E1B-4	29	500	S117624723	PACIFIC AIRMOTIVE CORPORATION	2940/2840 NORTH HOLLYWOOD WAY	1043 ft (0.2 mi) ENE	Cut and Cover	SLIC	See below.	High	
E1B-5	29	500	S104915023, S114665215, S114665214, S114665216, 1000725966, 1015732718	PACIFIC AIRMOTIVE CORPORATION	2940 NORTH HOLLYWOOD WAY	1043 ft (0.2 mi) ENE	Cut and Cover	CERCLIS-NFRAP,HIST CORTESE,LUS T,ENVIROSTOR,RGA LUST	Facility was evaluated by the LARWQCB in relation to volatile organic compound impacts to soil and an aquifer used for drinking water. The facility is listed as "Open - Remediation" as of 5/31/99.	High	
E1B-6	29-30	500	1000209850, S114720502, 1000209849, S114720504	PH BURBANK, WEBER AIRCRAFT INC	2820 N ONTARIO ST, 2820 ONTARIO ST	2343 ft (0.44 mi) ENE	Cut and Cover	HIST CORTESE,LUS T,SLIC,RGA LUST	Facility was evaluated by the LARWQCB in relation to metals and volatile organic compound impacts to soil and an aquifer used for drinking water. The facility is listed as "Open - Remediation" as of 1/10/94. ¹	Med	X
E1B-7	29-30	500	S105670833, S108214030, 90185855, S106484452, S113472852	STAINLESS STEEL PRODUCTS, INC	2980 NORTH SAN FERNANDO BLVD	2863 ft (0.54 mi) ENE	Cut and Cover	ERNS,SLIC,CH MIRS	Facility was evaluated by the LARWQCB in relation to metals and volatile organic compound impacts to soil and an aquifer used for drinking water. The facility is listed as "Open - Site Assessment" as of 9/21/12. ¹	Low	X
E1B-8	29	500	1000431948, S106392146	STEVE'S PLATING CORPORATION	3111 NORTH SAN FERNANDO BLVD	1969 ft (0.37 mi) ENE	Cut and Cover	SLIC,CHMIRS, ENVIROSTOR	Facility was evaluated by the LARWQCB in relation to chromium and volatile organic compound impacts to an aquifer used for drinking water. The facility is listed as "Open - Inactive" as of 1/28/16. ¹	Med	X
E1B-12	29	586	S106484454	ABBY RENTS	2333 N VALLEY ST	3162 ft (0.6 mi) SW	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to chromium VI impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements" in relation to a soil investigation and is listed as "Completed - Case Closed" as of 12/23/14.	Low	
E1B-13	29	500	S106764394	ADB INDUSTRIES	2523 N ONTARIO ST	2013 ft (0.38 mi) ESE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to metal impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements for soil only" and is listed as "Completed - Case Closed" as of 8/26/14.	Low	
E1B-14	29-30	500	S114568902, S114568903, S103587492	AEROQUIP CORP, AEROQUIP FACILITY (FORMER)	3015 WINONA AVE	2413 ft (0.46 mi) ESE	Cut and Cover	HIST CORTESE,LUS T,RGA LUST	Facility was evaluated by the LARWQCB in relation to volatile organic compound impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements" based on investigations performed prior to 1997 and is listed as "Completed - Case Closed" as of 8/30/96. ¹	Low	X

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associate d with the Superfund Site (Area #1)
E1B-15	29	500	1000300331	ALUMINUM DIP BRAZE CO	2537 N ONTARIO ST	2013 ft (0.38 mi) ESE	Cut and Cover	CERCLIS-NFRAP	Facility was evaluated by the LARWQCB in relation to chromium VI impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements for soils only" and is listed as "Completed - Case Closed" as of 8/26/14.	Low	
E1B-16	29-30	500	1000857227, 1000818182	ALUMTREAT INC	2905 WINONA AVE	2784 ft (0.53 mi) ESE	Cut and Cover	CERCLIS-NFRAP,CORR ACTS,RCRA-TSDF,DEED,E NVIROSTOR	Facility was evaluated by the DTSC in relation to historic manufacturing activities. The facility is listed as "Land Use Restrictions Only" as of 9/19/97.	Low	
E1B-17	29-30	500	S104567212	AMER. FINE ARTS FOUNDRY	2520 N ONTARIO ST	2312 ft (0.44 mi) ESE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to chromium VI and volatile organic compound impacts to an aquifer used for drinking water. The facility was determined to need "No Further Requirements" and is listed as "Completed - Case Closed" as of 12/22/14.	Low	
E1B-18	29	572	S114578215, S103282106, 1000180804	ASII TANK FARM (SITE #1), AIRCRAFT SERVICE INTERNATIONAL	2761 HOLLYWOOD WAY	994 ft (0.19 mi) SE	Cut and Cover	HIST CORTESE,LUS T,RGA LUST	Facility was evaluated by the LARWQCB in relation to a leaking underground storage tank case where soil was impacted. The facility is listed as "Completed - Case Closed" as of 11/5/01.	Low	
E1B-19	29	500	S106484438	BONDED SERVICES	3205 BURTON AVE	2388 ft (0.45 mi) SE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to metal and volatile organic compound impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements" and is listed as "Completed - Case Closed" as of 10/29/14. ¹	Low	X
E1B-20	29	500	S102860870, 1015732646	BRASS PRODUCTION COMPANY	3059-3063 N CALIFORNIA ST	2143 ft (0.41 mi) ENE	Cut and Cover	CERCLIS-NFRAP,ENVIR OSTOR	Facility was evaluated by the DTSC and is listed as "No Further Action" as of 10/25/94.	Low	
E1B-21	29	607	U001568394	BUDGET RENT-A-CAR	2220 N HOLLYWOOD WAY	4165 ft (0.79 mi) SSE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to chromium VI impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements" and is listed as "Completed - Case Closed" as of 12/22/14.	Low	
E1B-22	29	500	S104827552	BUILDIT ENGINEERING	3074 N LIMA ST	1913 ft (0.36 mi) ENE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to metals and volatile organic compound impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements" and is listed as "Completed - Case Closed" as of 9/9/05.	Low	
E1B-23	29	500	S106484432	BURBANK FOUNDRY INC	3083 N CALIFORNIA ST	2185 ft (0.41 mi) ENE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to volatile organic compound impacts to an aquifer used for drinking water. The facility is listed as "Completed - Case Closed" as of 8/25/95.	Low	
E1B-24	29	500	S114591373, U002286741, S114591375	CAMELOT PRESS	2815 LIMA STREET N	1501 ft (0.28 mi) ENE	Cut and Cover	HIST CORTESE,LUS T,RGA LUST	Facility was evaluated by the LARWQCB in relation to a leaking underground storage tank case where fuel may have impacted an aquifer used for drinking water. The facility was determined to need "No Further Requirements" and is listed as "Completed - Case Closed" as of 12/27/96.	Low	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associate d with the Superfund Site (Area #1)
E1B-25	29	572	S103647859, S114595810, S114599402, S114595813, S114595811, S101295678	CHEVRON STATION #9-0839	2650 HOLLYWOOD WAY, 2650 HOLLYWOOD WAY N	1539 ft (0.29 mi) SE	Cut and Cover	HIST CORTESE,LUS T,RGA LUST	Facility was evaluated by the LARWQCB in relation to a leaking underground storage tank case where gasoline impacted the soil. The facility is listed as "Completed - Case Closed" as of 11/5/01.	Low	
E1B-26	29	500	1006825838	CONNELL PROCESSING INC	3094 N AVON ST	1602 ft (0.3 mi) ENE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to metals and volatile organic compound impacts to soil and an aquifer used for drinking water. The facility is listed as "Completed - Case Closed" as of 3/27/87.	Low	
E1B-27	29-30	500	S114607665, 1017428036, S102628781, S114607667	CRANE CO, HYDRO-AIRE DIV	3000 WINONA AVE	2856 ft (0.54 mi) ESE	Cut and Cover	TRIS,HIST CORTESE,LUS T,SLIC,RGA LUST	Facility was evaluated by the LARWQCB in relation to metals and volatile organic compound impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements" and is listed as "Completed - Case Closed" as of 3/30/05. ¹	Low	X
E1B-28	29	586	1000818183	DUNLAP ABBOTT CHALCO CORP	2323 VALLEY ST	3185 ft (0.6 mi) SW	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to chromium VI impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements with respect to soils only" and is listed as "Completed - Case Closed" as of 8/28/14.	Low	
E1B-29	29	500	1003878774	DUNRITE METAL PLATING	3055 CALIFORNIA ST	2136 ft (0.4 mi) ENE	Cut and Cover	CERCLIS-NFRAP	Site is not listed on the NPL.	Low	
E1B-30	29	607	1000473071	EI DUPONT DENEMOURS & CO	3300 PACIFIC AVE	4522 ft (0.86 mi) SSE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to metal and volatile organic compound impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements" and is listed as "Completed - Case Closed" as of 12/23/14. ¹	Low	X
E1B-31	29	500	S112274185	FORMER B-G DETECTION SERVICE FACILITY	3071 N LIMA STREET	1863 ft (0.35 mi) ENE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to metals impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements for soils only" and is listed as "Completed - Case Closed" as of 3/25/13.	Low	
E1B-32	29	586	S100222505	FORMER LOCKHEED PLANT B-5	4207 EMPIRE AVENUE	2818 ft (0.53 mi) SW	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to metal and volatile organic compound impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements for soils only" based on investigations in 2001 and is listed as "Completed - Case Closed" as of 6/29/04.	Low	
E1B-33	29	500	S102860886	HUGHEY & PHILLIPS INC	3050 CALIFORNIA ST	2168 ft (0.41 mi) ENE	Cut and Cover	ENVIROSTOR	Facility was evaluated by the DTSC and is listed as "No Further Action" as of 2/2/95.	Low	
E1B-34	29	500	1000175608	JANCO CORPORATION	3111 WINONA AVE	2060 ft (0.39 mi) ESE	Cut and Cover	SLIC,ENVIROSTOR	Facility was evaluated by the LARWQCB in relation to metals and volatile organic compound impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements" and is listed as "Completed - Case Closed" as of 3/2/15. ¹	Low	X

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associate d with the Superfund Site (Area #1)
E1B-35	29-30	500	S106484422	JAY DEE AIRCRAFT SUPPLY	2917 THORNTON AVE	3125 ft (0.59 mi) SE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to chromium VI impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements" and is listed as "Completed - Case Closed" as of 12/19/14.	Low	
E1B-36	29-30	500	S106484423	JAY-DEE AIRCRAFT SUPPLY CO INC	2921 THORNTON AVE	3117 ft (0.59 mi) SE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to chromium VI impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements" and is listed as "Completed - Case Closed" as of 12/19/14.	Low	
E1B-37	29-30	500	S101584875	K M RECORDS INC	2980 N ONTARIO ST	2488 ft (0.47 mi) ENE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to chromium VI impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements" based on an investigation in 2005 and is listed as "Completed - Case Closed" as of 12/23/14.	Low	
E1B-38	29	607	S106484419	LEE FILTERS (FORMER ZIPCO)	2237 HOLLYWOOD	4052 ft (0.77 mi) SSE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to chromium VI impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements" and is listed as "Completed - Case Closed" as of 12/19/14.	Low	
E1B-39	29-30	500	U001568367	MEL BERNIE CO	3000 W EMPIRE AVE	3863 ft (0.73 mi) SE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to chromium VI impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements" and is listed as "Completed - Case Closed" as of 12/23/14.	Low	
E1B-40	29	500	S102812673	MID VALLEY ANODIZING	3075 N CALIFORNIA ST	2182 ft (0.41 mi) ENE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to metals and volatile organic compound impacts to soil and an aquifer used for drinking water. The facility is listed as "Completed - Case Closed" as of 11/3/15.	Low	
E1B-41	30	536	1000150828, S114662968, S114662970	OCEAN TECHNOLOGY INC	2835 NAOMI ST N	3675 ft (0.7 mi) ENE	Cut and Cover	HIST CORTESE,LUS T,RGA LUST	Facility was evaluated by the LARWQCB in relation to acetone impacts to soil and an aquifer used for drinking water. The facility is listed as "Completed - Case Closed" as of 2/11/97.¹	Low	X
E1B-42	29	572	S106483563	PREMIER CLEANERS (FORMER)	2708 N HOLLYWOOD WAY	1300 ft (0.25 mi) SE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to volatile organic compound impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements for soils only" and is listed as "Completed - Case Closed" as of 12/23/14.	Low	
E1B-43	29-30	500	S106484436	PROCESS CONTROL LABS	2520 N ONTARIO ST, #D	2312 ft (0.44 mi) ESE	Cut and Cover	SLIC,ENVIROSTOR	Facility was evaluated by the LARWQCB in relation to volatile organic compound impacts to an aquifer used for drinking water. The facility was determined to need "No Further Requirements" and is listed as "Completed - Case Closed" as of 12/23/14.	Low	
E1B-44	29-30	500	1014352264	SENIOR AEROSPACE INC SSP DIV	2980 SAN FERNANDO BLVD	2905 ft (0.55 mi) ENE	Cut and Cover	TRIS	No releases to soil or groundwater were reported.	Low	
E1B-45	29-30	500	S113026331	SPACE-LOK INC	2526 N ONTARIO ST	2302 ft (0.44 mi) ESE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to chromium VI impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements for soils only" following a soil assessment and is listed as "Completed - Case Closed" as of 10/21/15.¹	Low	X

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associate d with the Superfund Site (Area #1)
E1B-46	29	500	S114696972, U002285096, S114696974	SUN BANK	3110 WINONA AVE	2049 ft (0.39 mi) ESE	Cut and Cover	HIST CORTESE,LUST,RGA LUST	Facility was evaluated by the LARWQCB in relation to hydrocarbon impacts to soil. The facility is listed as "Completed - Case Closed" as of 11/5/01.	Low	
E1B-48	29-30	500	S106484437	THE PATRICK TATOPOULOS DESIGNS	1951 ONTARIO ST	4303 ft (0.81 mi) SSE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to chromium VI and volatile organic compound impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Action" and is listed as "Completed - Case Closed" as of 8/25/1995.	Low	
E1B-49	29	500	S106484427	U.S. LABEL CORP	3100 W VANOWEN ST	3825 ft (0.72 mi) SE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to metal impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements" and is listed as "Open - Inactive" as of 12/19/14.	Low	
E1B-50	29	500	1000283248	VALLEY ENAMELING CORP	2509 N ONTARIO ST	2267 ft (0.43 mi) ESE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to chromium VI impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements" and is listed as "Completed - Case Closed" as of 12/23/14. ¹	Low	X
E1B-53	29-30	500	S107473150	FORMER TWISS HEATING & TREATING	2503 N ONTARIO BLVD.	2275 ft (0.43 mi) ESE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to volatile organic compound impacts to soil. The facility was determined to need "No Further Requirements" as of 12/17/97. ¹	Low	X
E1B-54	29-30	500	S112186558	ALIGN-RITE INTERNATIONAL / PHOTRONICS INC	2422-2428 N ONTARIO ST	2535 ft (0.48 mi) SE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to metal impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements For Soils Only" and is listed as "Completed - Case Closed" as of 11/27/13. ¹	Low	X
E1B-55	30	500	S104538157	AUTO MATTERS	2812 N SAN FERNANDO BLVD	3650 ft (0.69 mi) ESE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to metals and volatile organic compound impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements" and is listed as "Completed - Case Closed" as of 6/16/06.	Low	
E1B-56	29	500	S114579267, 1000149067, S114579269, 1001023008	AVIALL INCORPORATED, HERTZ ENTERTAINMENT SERVICES (9684-00)	3111 KENWOOD ST, 3111 N KENWOOD ST	183 ft (0.03 mi) ENE	Cut and Cover	HIST CORTESE,LUST,SLIC,RGA LUST	Facility was evaluated by the LARWQCB in relation to metal, TPH, and VOC impacts to soil and an aquifer used for drinking water. The facility is listed as "Open - Remediation" as of 3/25/96. ¹	High	X
E1B-57	29	500	S104827433	CAL-AIR PROCESSING	3014 N. HOLLYWOOD WAY	1129 ft (0.21 mi) ENE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to chromium VI impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements" and is listed as "Completed - Case Closed" as of 12/23/14.	Low	
E1B-59	30	500	S113804585	COMCO INC	2151 N LINCOLN ST	5055 ft (0.96 mi) ESE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to a chromium VI and volatile organic compound impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Action" and is listed as "Completed - Case Closed" as of 9/22/2015.	Low	
E1B-60	29	500	S100859292	CONNELL PROCESSING INC,CONNELL PROC CORP	3080 N AVON ST	1590 ft (0.3 mi) ENE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to metals and volatile organic compound impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements" and is listed as "Completed - Case Closed" as of 3/27/87.	Low	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associate d with the Superfund Site (Area #1)
E1B-61	30	500	1000686643	GRAPHIC ART SYSTEMS INC	2150 N LINCOLN ST	5149 ft (0.98 mi) ESE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in 2001 in relation to chromium VI and volatile organic compound impacts to soil and an aquifer used for drinking. The facility was determined to need "No Further Requirements" and is listed as "Completed - Case Closed" as of 12/22/14.	Low	
E1B-62	29	500	U001568408	IMAGE TRANSFORM LAB	3611 N SAN FERNANDO BLVD	809 ft (0.15 mi) ENE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to metal impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Investigation" and is listed as "Completed - Case Closed" as of 12/31/96.	Low	
E1B-63	29	500	1000115930	L. A. GAUGE CO INC.	7440 SAN FERNANDO RD	646 ft (0.12 mi) ENE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to VOC impacts to soil. The facility was determined to need "No Further Requirements" and is listed as "Completed - Case Closed" as of 12/1/98. ¹	Low	X
E1B-64	29	588	S106484476	LOCKHEED A-1 EAST	3401 W EMPIRE AVE	3061 ft (0.58 mi) SSE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to hydrocarbon and volatile organic compound impacts to soil and an aquifer used for drinking water. The facility is listed as "Open - Site Assessment" as of 7/17/96. ¹	Low	X
E1B-65	29	500	S106484475	LOCKHEED A-1 EAST, BLDG 90	3110 W THORNTON AVE	2447 ft (0.46 mi) SE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to volatile organic compound impacts to an aquifer used for drinking water. The facility is listed as "Open - Remediation as of 10/30/98. ¹	Med	X
E1B-67	29	588	1015732629, S103646938	LOCKHEED CAL. COMPANY PLANT A1, LOCKHEED AIRCRAFT CORPORATION	2555 N HOLLYWOOD WAY	2154 ft (0.41 mi) SSE	Cut and Cover	CERCLIS-NFRAP,SLIC	Facility was evaluated by the LARWQCB in relation to metal and volatile organic compound impacts to soil and an aquifer used for drinking water. The facility is listed as "Open - Remediation" as of 9/24/01. ¹	Med	X
E1B-68	29	607	S101587292	LOCKHEED PLANT A-1 SOUTH	2311 N HOLLYWOOD WAY	3616 ft (0.68 mi) SSE	Cut and Cover	SLIC	Facility is listed as "Open - Remediation" as of 5/24/1995 due to semi-volatile organic compounds and volatile organic compound impacts to an aquifer used for drinking water. ¹	Low	X
E1B-69	29	500	S104915019	LOCKHEED-B6-371	2960 HOLLYWOOD WAY	1067 ft (0.2 mi) ENE	Cut and Cover	HIST CORTESE,SLIC	Facility was evaluated by the LARWQCB in relation to volatile organic compound impacts to soil and an aquifer used for drinking water. The facility is listed as "Open - Site Assessment" as of 1/27/15. ¹	High	X
E1B-70	29	500	1000306879	MAGNA PLATING COMPANY	3063 N CALIFORNIA ST	2149 ft (0.41 mi) ENE	Cut and Cover	SLIC,ENVIROSTOR	Facility was evaluated by the LARWQCB in relation to metals and volatile organic compound impacts to soil and an aquifer used for drinking water. The facility is listed as "Open - Site Assessment" as of 9/29/05.	Med	
E1B-71	29	500	S106661719	PREMIER DRY CLEANING	3238 N SAN FERNANDO BLVD	1934 ft (0.37 mi) ENE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to volatile organic compound impacts to soil and an aquifer used for drinking water. The facility is listed as "Completed - Case Closed" as of 4/15/88.	Low	
E1B-72	29-30	500	S114673145, S114673144, S100228023, S114673143	QUEEN CITY SHELL INC	2801 SAN FERNANDO BLVD N	3074 ft (0.58 mi) ENE	Cut and Cover	HIST CORTESE,LUST, RGA LUST	Facility was evaluated by the LARWQCB in relation to a leaking underground storage tank case where gasoline impacted soil and an aquifer used for drinking water. The facility is listed as "Completed - Case Closed" as of 11/5/01.	Low	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associate d with the Superfund Site (Area #1)
E1B-73	29-30	500	1006834661	SIERRACIN-HARRISON	3020 EMPIRE AVE	3776 ft (0.72 mi) SE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to metals and volatile organic compound impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements" and is listed as "Open - Inactive" as of 10/29/14. ¹	Low	X
E1B-74	30	500	1000278339, S114723183, S114723182	WORLD OIL #25	2417 SAN FERNANDO BLVD N	4459 ft (0.84 mi) ESE	Cut and Cover	HIST CORTESE,LUS T,RGA LUST	Facility was evaluated by the LARWQCB in relation to chromium VI impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements following soil vapor extraction remediation" and is listed as "Completed - Case Closed" as of 6/26/06.	Low	
E1B-76	29	500	S100274773, S100274876		LOCKHEED BUILDING #199, LOCKHEED, PLANT B-1, 199	97 ft (0.02 mi) WSW	Cut and Cover	CHMIRS	Two incidents were reported in 1989. No further information was included.	Med	
E1B-77	29	500	S100278782		LOCKHEED PLANT B-1, BLDG 166	97 ft (0.02 mi) WSW	Cut and Cover	CHMIRS	An incident was reported in 1988. No further information was included.	Med	
E1B-78	29	500	S100275423		LOCKHEED PLANT B-1, BLDG #161	97 ft (0.02 mi) WSW	Cut and Cover	CHMIRS	An incident was reported in 1989. No further information was included.	Med	
E1B-79	23	389	S100833478	LOCKHEED-BURBANK PLANTS A-1, B-1, B-6 & C-1	2555 N. HOLLYWOOD WAY	2154 ft (0.41 mi) SSE	Cut and Cover	CA BOND EXP. PLN	Facility is listed to be one of the responsible parties for the impacts to the San Fernando Valley groundwater basin resulting in the current Superfund site. Historical usage at the facility related to aircraft manufacturing and research resulted in PCE, TCE, and VOC impacts. Monitoring and remediation is reported to be in progress. ¹	High	X
E1B-80	29	557	S100356219	LOCKHEED PLANT C-1	10720 SHERMAN WAY	3589 ft (0.68 mi) WSW	Cut and Cover	SLIC	LUST (S100356219) - Facility is listed to have impacted an aquifer used for drinking water supply with solvents. Site status is listed as "Completed - Case Closed" as of 12/7/1994. SLIC (S100356219) - Facility is listed to have impacted soil and an aquifer used for drinking water supply with metals (Chromium) and VOCs. Approximately 110,000 tons of impacted soil were removed from the site. A notice of "No Further Remediation" for soil was issued in 1990 and 1994. Continued remediation for the impacted aquifer is reported and site status is listed as "Open - Remediation" as of 7/28/1992. ¹	Low	X
E1B-81	29	557	1003878490, U001568412	PAC AIRCRAFT ENGINEERING CTR, MEDIA AVIATION	3000 N CLYBOURN AVE, 3000 N CLYBOURN AVE.	3023 ft (0.57 mi) WSW	Cut and Cover	CERCLIS-NFRAP, SLIC	CERCLIS-NFRAP (1003878490) - Site is listed to "not qualify for the NPL based on existing information" as of 1981. SLIC (U001568412) - Facility was evaluated by the LARWQCB in 2005 in relation to a chromium VI source assessment for the area. The facility was determined to need "No Further Requirements" in relation to the investigation in 2005 and is listed as "Completed - Case Closed" as of 12/23/2014.	Low	
E1B-82	N/A	49	S122356468	FORMER ADEL PRECISION PRODUCTS - ADEL PRECISION PRODUCTS	10635-10703, 10725 VANOWEN	4330 ft (0.82 mi) WSW	Cut and Cover	CPS-SLIC	The facility is listed to have impacted an aquifer used for drinking water supply, soil, and soil vapor with chromium VI, PCE, and TCE due to historic aerospace industry operations. Current site status is listed to be "Open- Site Assessment."	Low	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associate d with the Superfund Site (Area #1)
E1B-83	N/A	52	1000168300	PRICE CLUB	10950 SHERMAN WY	5019 ft (0.95 mi) WSW	Cut and Cover	ENVIROSTOR, HIST Cortese, LA Co. Site Mitigation	Facility was evaluated for impacts due to usage (fuel station, etc.) in 2011. Abatement for an unspecified compound was listed to have occurred and been performed.	Low	
E1B-84	N/A	222	S108196068	LOCKHEED AIR TERMINAL	2627 NORTH HOLLYWOOD WAY	1637 ft (0.31 mi) SSE	Cut and Cover	ENVIROSTOR, CHMIRS	ENVIROSTOR - Facility was evaluated by the LARWQCB for potential impacts by halogenated solvents with "historical" listed for the site type with the last status date of 5/12/95. CHMIRS – An incident was reported in September 2013 stated that a blockage on private property created an overflow of raw sewage to a storm drain.	Med	
E1B-85	N/A	AF191	1000685953	AMERIFLIGHT	4700 EMPIRE AVE HANGER ONE	3089 ft (0.59 mi) SW	Cut and Cover	LUST, CA FID UST	The facility is listed to have contained a LUST that impacted an unknown media. The cased is listed as "Completed – Case Closed" with a status date of 12/15/92.	Low	
E1B-86	N/A	AF197	S104406389	MERCURY AIR SERVICES	4331 EMPIRE AVE W	3015 ft (0.57 mi) SW	Cut and Cover	HIST CORTESE, LUST	The facility is listed to have impacted soil with aviation fuel. The status is listed to be "Completed – Cased Closed" as of 11/16/2011.	Low	
E1B-87	N/A	AN214, AN215	S101586348, S100948720	R J MYERS & SONS, INCORPORATED	7333 CLYBOURN AVE	3060 ft (0.58 mi) WSW	Cut and Cover	HIST CORTESE, LUST	The facility is listed to have impacted soil with aviation fuel. The status is listed to be "Completed – Cased Closed" as of 6/5/1984.	Low	
E1B-88	N/A	B31, B32, B34	S114683121, S114672991, S104406393	QUALITY AUTO REPAIR, SARKIS KRIKORIAN LEONS CO	10740 VANOWEN ST	4675 ft (0.89 mi) WSW	Cut and Cover	RGA LUST, LUST, HIST CORTESE	The facility is listed to have impacted soil with diesel and gasoline. The status is listed to be "Completed – Cased Closed" as of 4/20/2015.	Low	
E1B-89	N/A	B8, B9	S122356477, S122354302	SUB-AREA OF FORMER ADEL PRECISION PRODUCTS	10717 VANOWEN	4589 ft (0.87 mi) WSW	Cut and Cover	CPS_SLIC	The facility is listed to have impacted soil and soil vapor with VOCs (PCE/TCE). The case is listed with a status of "Completed – Case Closed" as of 5/30/2018.	Low	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction and Groundwater Gradient (if applicable)	Grade	Databases	Case Background	Priority	Associate d with the Superfund Site (Area #1)
E1B-90	N/A	0	1000709322	SAN FERNANDO VALLEY (AREA 1)	NORTH HOLLYWOOD WELLFIELD AREA	0 ft	Cut and Cover	NPL, PRP, RODS, SEMS, CORTESE, ENVIROSTOR, CONSENT, ENG CONTROLS, HIST CALSITES, INST CONTROL	The case is in relation to the impacted groundwater of the San Fernando Valley Basin by TCE, PCE, and carbon tetrachloride and chloroform to a lesser extent. The impact is basically valley wide and has impacted groundwater used for drinking water. Remediation of the water is ongoing and has been divided into different areas for characterization, status, and remediation purposes.¹	High	X
E1B-91	23	378	S108196068	BURBANK AIRPORT AUTHORITY	2627 HOLLYWOOD	1422 ft (0.27 mi) SSW	Cut and Cover	ENVIROSTOR	Facility was evaluated by the LARWQCB in relation to metals and volatile organic compound impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements" and is listed as "Completed - Case Closed" as of 12/22/14.	Low	
E1B-92	23	387	S108974267	THE HERTZ CORP.	4521 EMPIRE AVE.	3401 ft (0.64 mi) SW	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to metal impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements" and is listed as "Completed - Case Closed" as of 12/22/14.	Low	
E1B-93	23	392	S107737541	VEGA AIRCRAFT		2576 ft (0.49 mi) SSE	Cut and Cover	ENVIROSTOR	Facility was evaluated by the DTSC in relation to a Formerly Used Defense Site. The facility is listed as "Inactive - Needs Evaluation" as of 7/1/05.	Med	
E1B-94	23	316	S100280525		2428 NORTH ONTARIO ST.	2498 ft (0.47 mi) ESE	Cut and Cover	CHMIRS	An incident was reported in 1988. No further information was provided.	Low	

¹The site is included in a group of industrial facilities that are documented to be included as "Responsible Parties" in relation to the San Fernando Valley Superfund Site for VOC/solvent/metal/chlorinated hydrocarbon impacts to groundwater used for drinking water. Listed sites with the same designation have the Case Background description associated with the listing presented in BOLD font and contain an "X" in the "Associated with the Superfund Site (Area #1)" column. While the San Fernando Superfund Site currently has a status of "Open - Remediation" or similar, some of the associated sites may have since been closed or have a status of "Completed - Case Closed". The remaining sites continue to be open and undergoing remediation for the associated contamination.

Table 3.10-B-9: E2 Central Subsection PEC Sites

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	DATABASES	Case Background	Priority	Associated with the Superfund Site (Area #1)
E2C-1	21	210	S117660926	A.C. ALBA LANDSCAPE BOULDERS - CLOSED		2225 ft (0.42 mi) ESE	Elevated / Aerial Structure	CA MINES	Facility is listed as "Closed, No Intent to Resume" as of 1996 for an open pit stone mining operation. Reclamation is reported to not have been started.	Low	
E2C-2	21	247	S114567917	AAA FOREIGN AUTO PARTS AND SALVAGE INC	9101 N GLENOAKS BLVD	67 ft (0.01 mi) ENE	Tunnel	RGA LUST	Facility is listed to have contained a LUST with unspecified contents and affected media as of 2012.	High	
E2C-3	11	180	S106103358	ACTION CLAY QUARRIES	FOREST SERVICE RD 4N32	3475 ft (0.66 mi) SE	Tunnel	LDS	Facility is listed to be an active land disposal site in relation to mining operation byproducts that are being produced. Site status is listed to be "Open - Operating" as of 5/31/2016.	Low	
E2C-4	14	182	S117660933	ACTON CLAY QUARRIES	31375 N. ALISO CANYON RD	3279 ft (0.62 mi) SE	Tunnel	CA MINES	Facility is listed active clay open pit, plant or mill mine as of 2014.	Low	
E2C-5	21	247	S102424167, S104575733, S114573362	ARCO #1298	9055 SUNLAND BLVD	1289 ft (0.24 mi) ENE	Tunnel	LUST, RGA LUST	Facility is listed to have contained a LUST that impacted soil with aviation fuel. Site status is listed as "Completed - Case Closed" as of 10/17/1994.	Low	
E2C-6	21-23	247	S114575363	ARCO FACILITY NO. 9581	9009 GLENOAKS	456 ft (0.09 mi) ENE	Tunnel	RGA LUST	Facility is listed to have contained a LUST with unspecified contents and affected media as of 2007.	High	
E2C-7	21-23	267	1017400940	ASSOCIATED READY MIX CONCRETE INC	8946 BRADLEY AVE	2064 ft (0.39 mi) WSW	Tunnel	TRIS	Facility is listed as a hazardous waste/enforcement and compliance history site for lead compounds with a status date of 2014. The lead compounds are reported to be transferred offsite for further waste management.	Low	
E2C-8	21	247	S103587984	ATHENS SUN VALLEY MAT REC & T.S.	11121 PENDLETON ST	621 ft (0.12 mi) WSW	Tunnel	SWF/LF	Facility is listed as an active large volume transfer and processing facility that accepts green materials, household trash, and inert metals. Monthly inspections are reported for the site and a daily capacity is listed to be 1,500 tons.	Low	
E2C-9	21	247	S103441295	BENTZ DUMP	11251 PENDLETON ST	976 ft (0.18 mi) WSW	Tunnel	LDS, WMUDS/SWAT	Facility is listed as a land disposal site with a status of "Completed - Case Closed" as of 5/25/2016. Accepted materials are listed to be clean dirt, broken concrete, asphalt, brick, block and rock.	Med	
E2C-10	20-21	247	U003060793	BRADLEY AVE DUMP	9050 BRADLEY AVE	2580 ft (0.49 mi) WSW, groundwater gradient to the south	Tunnel	LDS, WMUDS/SWAT	Facility is listed as a land disposal site with a status of "Open-Inactive" as of 11/29/2012. Groundwater monitoring was conducted at the site and elevated VOC and PCE/TCE concentrations were identified.	Med	
E2C-11	20-21	251	S113887321	BRADLEY EAST LANDFILL	9229 TUJUNGA AVE	2427 ft (0.46 mi) WSW, groundwater flow to the southeast	Tunnel	LDS	Facility is a former sand and gravel pit that was subsequently used as an unlined non-hazardous solid waste landfill that is listed as "Open - Closed/With Monitoring" as of 5/22/2016. Groundwater and soil/soil vapor are listed to have been impacted with VOCs, metals, and landfill related gases. The facility is reported to have "leaking waste constituents in excess of DHS/MCLs and may be affecting groundwater in the vicinity of the landfill.	Med	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	DATABASES	Case Background	Priority	Associated with the Superfund Site (Area #1)
E2C-12	20	249	S100931059, S109286318, S111075797, S103341425	BRADLEY EAST LANDFILL, BRADLEY LANDFILL & RECYCLING CENTER	9227 TUJUNGA AVE	3543 ft (0.67 mi) WSW	Tunnel	SWF/LF, LDS, WMUDS/SWAT	Facility is listed to be a closed solid waste landfill that accepts construction/demolition, industrial, mixed municipal, and other designated wastes. The closure date is listed as 6/1/2007 and the facility is reported to be 126 acres in size. Facility is also listed to be a solid waste landfill with quarterly inspections with a closure date of 12/31/1980. Facility is also listed to be a closed large volume transfer/processing facility with a closure date of 3/10/1988. Currently, the facility is listed to be an active large volume transfer/processing facility accepting agricultural, green materials, and manure with monthly inspections.	Low	
E2C-13	21	247	U001567850, S114587252	BROWNING FERRIS INDUSTRIES INC	9200 GLENOAKS BLVD	210 ft (0.04 mi) WSW	Tunnel	LUST, RGA LUST, SWF/LF	Facility is listed to be an active waste hauler. Limited additional information was provided in relation to site operations. ¹	High	X
E2C-14	23	277	S103621795	BURBANK AIRCRAFT SUPPLY INC	10671 LANARK	686 ft (0.13 mi) SW	Tunnel	SLIC	Facility is listed to have impacted an aquifer used for drinking water supply with VOCs and chromium. Current status is listed as "Open-Inactive" as of 10/29/2014. Groundwater gradient information was not reported but is anticipated to be toward the southeast per typical flow within the San Fernando Valley area.	Med	
E2C-15	23	319	S111828968	BURBANK AIRPORT AUTHORITY	2627 HOLLYWOOD WAY	2341 ft (0.44 mi) NE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in 2004 in relation to a chromium VI source assessment for the area. The facility was determined to need "No Further Requirements" in relation to the investigation in 2004 as is listed as "Completed - Case Closed" as of 12/22/2014.	Low	
E2C-16	23	316	1000252200	CALIFORNIA BIONUCLEAR CORP	7654 SAN FERNANDO RD	24 ft (0 mi) NE	Cut and Cover	CERCLIS-NFRAP, PRP	Facility was evaluated in relation to the San Fernando NPL case for potentially impacting groundwater with VOCs and/or chromium. The site was determined to require removal only, no site assessment work needed as of 1987.	Med	
E2C-17	21	238	S117661231, S102266815	CALMAT - SUN VALLEY/SUN VALLEY INERT LANDFILL	9436 GLENOAKS BLVD	1255 ft (0.24 mi) WNW	Cut and Cover	CA MINES, WMUDS/SWAT	Facility is listed as "Closed - No Intent to Resume, Reclamation in Progress" as of 2014. Facility is listed to have produced sand and gravel.	High	
E2C-18	23	247	1016467998	CALMAT CO		2769 ft (0.52 mi) WSW	Tunnel	US MINES	Facility is listed as "Non-Coal Mining" as of 1973.	Low	
E2C-19	21-23	247	1006816059	CALPORTLAND CO SUN VALLEY PLANT	8981 BRADLEY AVE	2510 ft (0.48 mi) WSW	Tunnel	TRIS	Facility is listed to produce lead compounds with off-site transfer for disposal of approximately 13 pounds of the compound per year.	Low	
E2C-20	21	247	1000819733, S114595729, S114597757, S114599587	CHEVRON STATION 90589	9110 GLENOAKS BLVD	39 ft (0.01 mi) ENE	Tunnel	LUST, RGA LUST, HIST CORTESE	The facility is listed to have impacted soil with waste/motor/hydraulic/lubricating oil due to a LUST at the site. The facility is listed to be "Completed - Case Closed" as of 7/5/1994.	High	
E2C-21	21	247	1000155657, S103340305, 1000409068	COMMUNITY RECYCLING / RES RECOVERY INC SOUTHERN CALIFORNIA WASTE REDUCTION	9147 DE GARMO AVE	1081 ft (0.2 mi) WSW	Tunnel	CERCLIS-NFRAP, CORRACTS, SWF/LF	SWF/LF (1000155657) - Facility is listed to be an active (permit date of 1997) limited volume transfer operation that accepts construction/demolition and other designated wastes with quarterly inspections. SWF/LF (S103340305) - Facility is listed as an active (permit date of 1998) large volume transfer/processing facility that accepts construction/demolition, industrial, mixed municipal waste. Inspections are reported to be performed on a monthly basis. CERCLIS-NFRAP/CORRACTS - Facility is listed to not qualify for NPL based on information updated in October 2013.	Low	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	DATABASES	Case Background	Priority	Associated with the Superfund Site (Area #1)
E2C-22	21	247	S104567759, 1000437523, S112891096, S114608028, S114608029	CROWN DIPOSAL COMPANY INC, RECOLOGY LOS ANGELES	9189 DE GARMO AVE	1081 ft (0.2 mi) WSW	Tunnel	LUST, RGA LUST, SWF/LF	SWF/LF (S104567759) - Facility is listed to be a closed waste hauling site. The type of waste accepted is not reported. LUST (S104567759) - The facility is reported to have impacted soil due to a LUST containing other solvents or non-petroleum hydrocarbons. The site status is listed as "Completed - Case Closed" as of 9/2/1997. A note in the LUST file (1000437523) notes that landfill gas has migrated beneath the site. SWF/LF (S112891096) - Facility is listed to be an active waste hauler/transfer and processing facility that accepts construction/demolition, green materials, trash, and non-hazardous industrial waste. ¹	Low	X
E2C-23	21	247	S116282717, S103441524	DE GARMO LANDFILL/DEGARMO	9135 DE GARMO AVE	830 ft (0.16 mi) WSW	Tunnel	LDS, WMUDS/SWAT	Site is an "Open - Inactive" land disposal site. Specifics on methane mitigation in relation to the site were not provided.	High	
E2C-24	21	247	S103441512	DE GARMO PIT LANDFILL	11201 RANDALL ST	935 ft (0.18 mi) WSW	Tunnel	SWF/LF, WMUDS/SWAT	Site is listed as "Closed" for landfill operations and presently is used for commercial purposes. The facility is reported to have been part of the Solid Waste Assessment Test Program.	High	
E2C-25	23	277	1000857356, 1014202338	EXPRESS PLATING V MASTERWORK, MONITOR POLISHING AND PLATING	8050 SAN FERNANDO RD	1168 ft (0.22 mi) SW	Tunnel	CERCLIS-NFRAP, ENVIROSTOR	Site listed to be inactive - Needs Evaluation for potential contamination from electroplating operation.	Med	
E2C-26	21	247	S105092651	FORMER JESSE'S PLATING	11103 RANDALL ST	786 ft (0.15 mi) WSW	Tunnel	ENVIROSTOR	Site previously used for metal finishing and metal plating. Is under investigation for unspecified COCs in soil and soil vapor. Currently "Inactive- Needs Evaluation" as of 2011.	Med	
E2C-27	21	247	U001567827, S114627260	GINO C BATTAGLIA	9077 DE GARMO AVE	636 ft (0.12 mi) WSW	Tunnel	LUST, RGA LUST	LUST (U001567827) - Facility is listed to have impacted soils with diesel fuel. Site status is listed as "Completed - Case Closed" as of 4/3/2008.	Low	
E2C-28	21-23	247	S105911516	GOODWIN CHEMICAL	9007 NORRIS	1459 ft (0.28 mi) WSW	Tunnel	SLIC	The facility is listed to have impacted soil with PCE due to storage at the site. Various phases of site assessment were completed from 1990 through 2001. The LARWQCB issued a notice of "No Further Action" on 12/14/2001.	Low	
E2C-29	21	247	1000591490, S109821484	GREGG PIT (PICK YOUR PART)	11370 PENDLETON ST	1999 ft (0.38 mi) WSW	Tunnel	SWF/LF, LUST	SWF/LF - Very limited information provided for facility but site is listed in SWF/LF database. LUST - During steam cleaning of a sump, contaminated soil was excavated and disposed of for an unknown contaminant in 1988.	Med	
E2C-30	23	339	S101586790	HENSLER GENERAL CONSTRUCTION	7550 WHEATLAND AVE	2071 ft (0.39 mi) WSW	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in 2004 in relation to a chromium VI source assessment for the area. The facility was determined to need "No Further Requirements" in relation to the investigation in 2004 as is listed as "Completed - Case Closed" as of 12/22/2014.	Low	
E2C-31	21	247	1001404429	HONEYWELL AVIONICS REPAIR CTR	9450 CHIVERS AVE	1052 ft (0.2 mi) ESE	Tunnel	SLIC	Facility was evaluated by the LARWQCB in relation to metal impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements" based on a soil investigation completed in 2004 and is listed as "Completed - Case Closed" as of 12/22/14.	Low	
E2C-32	21	247	1000428465	INDUSTRIAL BATTERY ENGINEERING	9121 DE GARMO AVE	748 ft (0.14 mi) WSW	Tunnel	SLIC	Facility was evaluated by the LARWQCB in 2001 in relation to a chromium VI source assessment for the area. The facility was determined to need "No Further Requirements" in relation to the investigation in 2003 as is listed as "Completed - Case Closed" as of 12/22/2014.	Low	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	DATABASES	Case Background	Priority	Associated with the Superfund Site (Area #1)
E2C-33	21	247	U001567785, S102441475, S114724214	ISSA N KHOURY, ZAUNER'S AUTOMOTIVE	9089 GLENOAKS BLVD	139 ft (0.03 mi) ENE	Tunnel	LUST, RGA LUST, CHMIRS	CHMIRS (U001567785) - A release of an unspecified amount of petroleum product was reported to have occurred beneath two of the fuel dispensers in 1996. A waterway is reported to have been involved and cleanup was performed by Shell Oil. LUST (S102441475) - A leak at the facility is reported to have been discovered on 5/21/1996. The leaked material is not reported and is listed to have impacted soil. Current site status is listed to be "Leak Being Confirmed" as of 5/24/1996.	High	
E2C-34	7	152	S114636951, S106915912, S114636952	JASONS AUTO PARTS	415 SIERRA HWY	894 ft (0.17 mi) WNW	Retained Cut / Trench	LUST, RGA LUST	LUSTs containing PCE, waste/motor/hydraulic/lubricating oil were reported to impact an unknown media. Case closed in 2010.	Med	
E2C-35	21-23	247	U001567797, U003781064, S114637415	JIFFY LUBE	10867 PENROSE ST	1123 ft (0.21 mi) ENE	Tunnel	LUST, RGA LUST	LUST (U001567797) - Facility is reported to have impacted soil with waste/motor/hydraulic/lubricating oil. Site status is listed as "Completed - Case Closed" as of 8/2/2000.	Low	
E2C-36	4	140	S114637448, S102431920	JILL R RATCLIFFE	36200 SIERRA HWY, N	734 ft (0.14 mi) ENE	At-grade	LUST, RGA LUST	A LUST containing gasoline is reported to have impacted surrounding soil. Case closed in 1991.	Low	
E2C-37	21	247	S106102586	KC NISSAN AUTO SMANTLING	10967 TUXFORD ST	627 ft (0.12 mi) ENE	Tunnel	SLIC	Facility was evaluated by the LARWQCB in 2001 in relation to a chromium VI source assessment for the area. The facility was determined to need "No Further Requirements" in relation to the investigation in 2003 and is listed as "Completed - Case Closed" as of 11/29/2012.	Low	
E2C-38	23	247	S103674790	KENWALT E CASTING CO	8719 BRADLEY AVE	1395 ft (0.26 mi) WSW	Tunnel	SLIC	Facility was evaluated by the LARWQCB in 2001 in relation to a chromium VI source assessment for the area. The facility was determined to need "No Further Requirements" in relation to the investigation in 2003 and is listed as "Completed - Case Closed" as of 12/22/2014.	Low	
E2C-39	21	246	S112186489	LA CITY DWP PENDLETON (PENDLETON STREET LANDFILL)	11000 PENDLETON ST	379 ft (0.07 mi) ENE	Tunnel	LDS	Facility is listed as a land disposal site with status of "Completed - Case Closed" as of 2012. However, VOC and solvent concentrations were reported during groundwater monitoring at the facility with flow migration toward the south.	High	
E2C-40	20	228	S101588330, 1001491848	LA DEPARTMENT OF WATER/POWER, TRUESDALE CENTER	11791 TRUESDALE CENTER	4778 ft (0.9 mi) WNW	Tunnel	CERCLIS-NFRAP, VCP, ENVIROSTOR	VCP/ENVIROSTOR - Facility is reported to have entered a voluntary cleanup agreement in 2000 due to PCB, TPH-d, and TPH-g impacts to soil as a result of use as an electrical generation/substation. Current site status is listed as "Active."	Low	
E2C-41	23	277	S106484855	LADO MFG CO	11400 LUD NGTON ST, #A	3230 ft (0.61 mi) WSW	Tunnel	SLIC	Facility was evaluated by the LARWQCB in 2001 in relation to a chromium VI source assessment for the area. The facility was determined to need "No Further Requirements" in relation to the investigation in 2014 as is listed as "Completed - Case Closed."	Low	
E2C-42	22-23	247	S116282735	LIVINGSTON - GRAHAM SUN VALLEY SANITARY LANDFILL	ADJACENT TO BRADLEY WEST	3398 ft (0.64 mi) WSW	Tunnel	LDS	Facility is listed as a land disposal site with status of "Open - Inactive" as of 2013. The landfill is comingled with the Bradley West landfill and is reported to have continual groundwater and methane monitoring performed in relation to operations.	Low	
E2C-43	20	228	1014202344	LNL ANODIZING	9900 GLENOAKS BLVD, #3	4985 ft (0.94 mi) WNW	Tunnel	CERCLIS-NFRAP	Facility is reported to have been investigated in relation to the San Fernando Valley Superfund Site. The site was determined to not qualify for the NPL based on provided information as of 2010.	Low	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	DATABASES	Case Background	Priority	Associated with the Superfund Site (Area #1)
E2C-44	22	271	S106484456	LOCKHEED A-1, B85, LOTS 16, 16A	3220 W. THORTON	4553 ft (0.86 mi) WSW	Tunnel	SLIC	Site is listed as "Open - Site Assessment" as of 1990. An aquifer used for drinking water supply beneath the facility is listed to have been impacted by chromium and VOCs. ¹	Low	X
E2C-45	23	316	S102432702, S114644699	LOCKHEED PLANT B-6-F	7575 SAN FERNANDO RD N	175 ft (0.03 mi) SW	Cut and Cover	LUST, RGA LUST	Facility is listed to have impacted an aquifer used for drinking water supply with diesel fuel. Current site status is listed as "Completed - Case Closed" as of 1/1/1996.	Low	
E2C-46	20	228	S109442393, S106528956	LOONEY BINS/EAST VALLEY VERSION	11616 SHELDON ST	3975 ft (0.75 mi) WNW	Tunnel	SWF/LF	SWF/LF (S109442393) - Facility is listed to be an active transfer/processing facility accepting construction/demolition and non-hazardous industrial debris. SWF/LF (S106528956) - Facility is listed to be an active large volume construction/demolition processing facility with monthly inspections.	Low	
E2C-47	20	228	S111075989	LOONEY BINS/SPACCARELLI HAULING	11616 1/2 SHELDON ST	3976 ft (0.75 mi) WNW	Tunnel	SWF/LF	Facility is listed as an active waste hauler. Limited additional information is provided.	Low	
E2C-48	23	339	S113003727	LYN-TRON INC	3150 N. DAMON WAY	2320 ft (0.44 mi) SW	Cut and Cover	SLIC	Facility is reported to have been investigated in relation to the San Fernando Valley Superfund Site due to manufacturing of metal and non-metal fasteners used in relation to the aerospace industry. Environmental assessment of the site was performed in 2013 in relation to a LARWQCB Order. The assessment concluded that no chromium and or other VOCs were used at the Site. A notice of "No Further Requirements" was issued in respect to soils only in 2013. The site status is listed as "Completed - Case Closed" as of 12/16/2013.	Low	
E2C-49	16	183	1007372595, S109548277	MENDENHALL PEAK CAMP SITE		2323 ft (0.44 mi) NW	Tunnel	FUDS, ENVIROSTOR	FUDS (1007372595) - Site is reported to have been acquired by the Army from the USFS for use with mountain maneuver training from 1942 to 1944. The site consisted of 320 acres of land. ENVIROSTOR (S109548277) - Facility is listed to be a 640 acres parcel of land requiring military evaluation. Site status is listed as "Inactive - Needs Evaluation" as of 7/1/2005.	Med	
E2C-50	21-23	247	1008381793	NATIONAL READY MIX CONCRETE CO	9010 NORRIS AVE	1496 ft (0.28 mi) WSW	Tunnel	TRIS	The facility is listed to use toxic chemicals (lead compounds) which are reported to be transported offsite for disposal.	Low	
E2C-51	10	177	1011130614	NORTH STAR MINERALS INC		2387 ft (0.45 mi) NW	At-grade	US MINES	Site is listed as an active non-coal mining company. Numerous citations are reported for unspecified reasons.	Med	
E2C-52	22-23	292	S106484857	OCCUPANT-AUTO SHOP	8431 TELFAIR AVE	4442 ft (0.84 mi) WSW	Tunnel	SLIC	Facility was evaluated by the LARWQCB in 2001 in relation to a chromium VI source assessment for the area. The facility was determined to need "No Further Requirements" in relation to the investigation in 2014 as is listed as "Completed - Case Closed."	Low	
E2C-53	21	247	1000105226	P BRAZE INC	9131 DE GARMO AVE	774 ft (0.15 mi) WSW	Tunnel	ENVIROSTOR	Facility is reported to have an active Tiered Permit. Confirmed COCs were not reported and the site is listed to not be included on any NPL or have restricted use.	Low	
E2C-54	21	247	1006932050	PDQ AUTO SALVAGE	10975 TUXFORD ST	551 ft (0.1 mi) ENE	Tunnel	CERCLIS-NFRAP, LEAD SMELTERS, ENVIROSTOR	Site assessed for contamination in 1979 through 1982 and is listed as NFRAP due to not qualifying for the NPL based on existing information.	Med	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	DATABASES	Case Background	Priority	Associated with the Superfund Site (Area #1)
E2C-55	21	247	2006812066, S109821518, S108432318	PENDLETON STREET DUMP	11050 PENDLETON ST	455 ft (0.09 mi) WSW	Tunnel	ERNS, SWF/LF	SWF/LF (S108432318) - Facility is listed to be a closed solid waste landfill facility. Limited additional information was provided for site. ERNS (2006812066) - A caller stated that during the filling of a UST with hydraulic oil, approximately 220 gallons of the material spilled to the soil. The spill occurred in 2006 and was reported to have been contained and cleaned up. SWF/LF (S109821518) - Facility is listed to be an active limited volume transfer/processing operation for metal, mixed municipal, tire, passenger, and wood waste.	High	
E2C-56	23	247	S109117694	PENHALL COMPANY	11182 W PENROSE AVE	1717 ft (0.33 mi) WSW	Tunnel	LUST	Soil is reported to have been impacted from a LUST of diesel fuel at the facility. Current status listed as "Completed - Case Closed" as of 2012.	Low	
E2C-57	23	277	S102360907	PENROSE PIT	8251 - 8301 TUJUNGA AVE	3789 ft (0.72 mi) WSW	Tunnel	SWF/LF	Site is listed as a closed solid waste disposal facility for residential/industrial/commercial waste. Facility was closed in 1987.	Low	
E2C-58	23	277	S109287258, 1001115478	PENROSE SANITARY LANDFILL, PENROSE LANDFILL GAS CONVERSION LLC	8301 TUJUNGA AVE	3806 ft (0.72 mi) WSW	Tunnel	CERCLIS-NFRAP, SLIC, LDS	An aquifer used for drinking water supply is reported to have been impacted from a LUST of diesel fuel at the facility. Current status listed as "Completed - Case Closed" as of 2012.	Low	
E2C-59	23	316	1000415250	PHOTO CHEM ETCH CORP	7710 SAN FERNANDO RD	88 ft (0.02 mi) SW	Tunnel	SLIC, ENVIROSTOR	The site is listed as "Completed - Case Closed" as of 12/22/2014 for VOC contamination that has impacted an aquifer used for drinking water supply.	Low	
E2C-60	23	277	1000297142	PRIME PLATING INC	11321 GOSS ST	3261 ft (0.62 mi) WSW	Tunnel	SLIC	SLIC - An aquifer used for drinking water supply is reported to have been impacted from chromium and VOCs. Current status listed as "Completed - Case Closed" as of 1997. TRIS - The facility is listed to use toxic chemicals (cyanide/lead/nitrate compounds) which are reported to be transported offsite for disposal.	Low	
E2C-61	21-23	247	1014202571	RECYCLED BASE MATERIALS INC		1442 ft (0.27 mi) WSW	Tunnel	US MINES	Facility is listed as an abandoned non-coal mining operation as of 2010.	Med	
E2C-62	21	247	1003879001	ROIC/SUN VALLEY	9068 DE GARMO AVE	581 ft (0.11 mi) WSW	Tunnel	CERCLIS-NFRAP, LIENS2, PRP	CERCLIS-NFRAP - Site is listed as "removal only site (no site assessment work needed)." A lien was recorded against the property on 9/30/1987.	Low	
E2C-63	23	297	S116497300	SA RECYCLING LLC	8270 TUJUNGA AVE	3338 ft (0.63 mi) SW	Tunnel	SWF/LF	Facility is listed to be a medium volume transfer/processing facility for mixed municipal waste with a permit date of 2014.	Low	
E2C-64	20-21	227	S117662604	SHELDON	11401 W TUXFORD ST	3482 ft (0.66 mi) WNW	Tunnel	CA MINES	Facility is listed as an active open pit sand and gravel mining operation as of 2014. Reclamation is reported to be in progress.	Low	
E2C-65	4	128	S102437520, S114660362, S114690985, S114690913, S114690983	SIERRA HWY & AVE S, NETAL INC	37205 SIERRA HWY	61 ft (0.01 mi) ENE	At-grade	LUST, RGA LUST	A LUST containing waste/motor/hydraulic oil was present at the site. Soil and an aquifer used for drinking water supply were reported to have been impacted. Assessment/remediation performed and case closed in 2014.	High	
E2C-66	4	135	S109348411, S114690986	SIERRA HWY ANTELOPE VALLEY S CONVIENCE PLAZA	37167 N SIERRA HWY	180 ft (0.03 mi) WSW	At-grade	LUST, RGA LUST	A LUST with unspecified contents was present at the site. The impacted media was not reported. Case closed in 2007.	High	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	DATABASES	Case Background	Priority	Associated with the Superfund Site (Area #1)
E2C-67	21	247	S116497298	SINGH SPOSAL	11401 PENDLETON ST	2339 ft (0.44 mi) WSW	Tunnel	SWF/LF	Facility is listed as a limited volume transfer/processing site that accepts construction/demolition and inert waste with a permit date of 2014.	Low	
E2C-68	23	277	S103988817, U001567823, S114694413, S114694414	SOUTHLAND TRANSMISSIONS	8283 SAN FERNANDO RD	1974 ft (0.37 mi) SW	Tunnel	LUST, RGA LUST	An aquifer used for drinking water supply is reported to have been impacted from a LUST containing aviation fuel at the facility. Current status listed as "Completed - Case Closed" as of 1996.	Low	
E2C-69	23	270	S106484844	SPECTRA AMERICAN	11037 PENROSE ST	462 ft (0.09 mi) WSW	Tunnel	SLIC, ENVIROSTOR	Facility was evaluated by the LARWQCB in 2001 in relation to a chromium VI and VOC impact to an aquifer used for drinking water source assessment for the area. The facility was determined to need "No Further Requirements" in relation to the investigation in 2014 as is listed as "Completed - Case Closed."	Low	
E2C-70	23	315	S109286992, S102360919	STRATHERN INERT LANDFILL	11201 STRATHERN ST	3947 ft (0.75 mi) SW	Tunnel	SWF/LF, LDS	Facility is listed as a land disposal site with a status of "Open - Verification Monitoring."	Low	
E2C-71	23	277	S111076116	STRATHERN SANITARY LANDFILL	8230 TUJUNGA AVE	3970 ft (0.75 mi) SW	Tunnel	SWF/LF	The facility is listed as a closed landfilling operation that accepted inert waste. Currently, the site is listed to be an inert debris engineered fill operation over an area of 34 acres.	Low	
E2C-72	21	243	S109287408, S103426966	SUN VALLEY LANDFILL - THERMAL TREATMENT UNIT	9436 GLENOAKS BLVD	1604 ft (0.3 mi) WNW	Tunnel	SWF/LF, LDS	SWF/LF (S103426966)- Facility is listed to be an active inert debris engineered fill operation at a closed landfill. The site is reported to be 125 acres in size. LDS (S109287408) - Facility is listed to be a land disposal site with a status of "Completed - Case Closed" as of 5/30/2016.	Med	
E2C-73	22-23	247	S106528959, S117711954	SUN VALLEY PAPER STOCK MRF AND TS	8701 N SAN FERNANDO RD	3406 ft (0.65 mi) WSW	Tunnel	SWF/LF	LF - Facility is an active large volume transfer/processing site for industrial and mixed municipal waste. Permit issued for the site in 2006.	Low	
E2C-74	23	319	S110275514	SUPERIOR PLATING	4001 GLENOAKS BLVD	2347 ft (0.44 mi) NE	Cut and Cover	ENVIROSTOR	Facility is listed to have a status of "Inactive - Needs Evaluation" as of 5/24/2012. Impacted media and COCs were not reported for the site.	Med	
E2C-75	21-23	247	U001567826	TAM CERAMICS INC	11025 FLEETWOOD ST	86 ft (0.02 mi) WSW	Tunnel	ENVIROSTOR	Facility is listed as "Refer: Other Agency" as of an unspecified date. The potential COCs and impacted media are not reported.	High	
E2C-76	21-23	247	U001567825	TAM CERAMICS INC	11078 FLEETWOOD ST	556 ft (0.11 mi) WSW	Tunnel	ENVIROSTOR	Facility is reported to have a Tiered Permit, however, land use restrictions and NPL subjectivity were not reported.	Low	
E2C-77	21	247	S103675889, S114702674, S101298215, S114702676, S114703573	THRIFTY #127	9090 GLENOAKS BLVD	168 ft (0.03 mi) ENE	Tunnel	LUST, RGA LUST	Facility is listed to have impacted soil due to a LUST containing gasoline. The site status is reported to be "Completed - Case Closed" as of 1/7/1998.	Med	
E2C-78	21-23	267	S109117745, S114706151	TRANSIT MIXED CONCRETE (FMR SOUTHDOWN CONCRETE)	8960 N BRADLEY AVE	2130 ft (0.4 mi) WSW	Tunnel	LUST, RGA LUST	Facility is listed to have impacted soil due to a LUST containing diesel fuel. The site status is reported to be "Completed - Case Closed" as of 1/13/2015.	Low	
E2C-79	20	228	1000102029	TRUESDALE ESM EAST VALLEY	11781 TRUESDALE ST	4771 ft (0.9 mi) WNW	Tunnel	CERCLIS-NFRAP	Facility is listed to treat, store, or dispose of numerous types of hazardous waste. Groundwater monitoring and evaluation is reported to have occurred between 1984 and 1985.	Low	
E2C-80	23	277	S109821493, S103441383	TUJUNGA PIT	8250 TUJUNGA AVE	3955 ft (0.75 mi) SW	Tunnel	SWF/LF, WMUD S/SWAT	Very limited information provided for facility. Site assessed for SWAT program. Impact to media not reported.	Low	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	DATABASES	Case Background	Priority	Associated with the Superfund Site (Area #1)
E2C-81	21	247	S102360910	TUXFORD PIT LANDFILL	TUXFORD & GOLDEN STATE	1426 ft (0.27 mi) ENE	Tunnel	SWF/LF, WMUD S/SWAT	Facility is listed as a closed solid waste disposal site with a current regulation status as "unpermitted."	Med	
E2C-82	22	278	S113482310	TUXFORD PIT LANDFILL	11590 TUXFORD ST (TUXFORD ST AND GOLDEN STATE FWY)	4642 ft (0.88 mi) WSW	Tunnel	LDS	Facility is listed as an "Open - Inactive" land disposal site with a status date of 6/3/2013. Records for the facility from 1992 to 1993 identify TCE and PCE impacts to an underlying aquifer.	Low	
E2C-83	23	329	S101298216, S105032930	U-HAUL CENTER OF SUN VALLEY	7721 HOLLYWOOD WAY	1910 ft (0.36 mi) NE	Cut and Cover	LUST	Facility is listed to have impacted soil with waste/motor/hydraulic/lubricating oil due from a LUST. Site status is reported to be "Completed - Case Closed" as of 3/31/1992.	Low	
E2C-84	21	243	S116282732	VALLEY RECLAMATION COMPANY - PIT NO. 3	11311 PEORIA ST	1425 ft (0.27 mi) WNW	Tunnel	LDS	Facility is listed as a land disposal site with a status of "Open - Inactive" as of 2013. Reports for the facility have indicated PCE impacts to groundwater.	Med	
E2C-85	23	277	S106484837	VINTEN EQUIPMENT INC	8115 N CLYBORN	785 ft (0.15 mi) SW	Tunnel	SLIC	The site is listed as "Completed - Case Closed" as of 12/22/2014 for VOC contamination that has impacted an aquifer used for drinking water supply.	Med	
E2C-86	20-21	228	S111076161	VULCAN MATERIALS (SUN VALLEY)	11520 SHELDON ST	3204 ft (0.61 mi) WNW	Cut and Cover	SWF/LF	Facility is listed to be an active landfilling operation that accepts inert waste as an inert debris engineered fill operation.	Low	
E2C-87	20-21	259	1005775701	WASTE MANAGEMENT	9081 TUJUNGA AVE	2531 ft (0.48 mi) WSW	Tunnel	SWF/LF	Facility is listed as an active waste hauler. Limited additional information is provided.	Low	
E2C-88	21	247	S103697090	WEST COAST WINERY	11115 PENDLETON ST	619 ft (0.12 mi) WSW	Tunnel	SLIC	Facility is listed to be a cleanup program site with a status of "Completed - Case Closed" as of 9/27/1995. The impacted media and COCs for the site are not reported.	Med	
E2C-89	23	277	S105026815, U003904755, S114723172, S114723381	WORLD OIL #19	8181 SUNLAND BLVD	1749 ft (0.33 mi) SW	Tunnel	LUST, RGA LUST	A LUST was reported to have impacted soil with gasoline. Case closed as of 1996.	Low	
E2C-90	21	243	S108935380, S114723800	YELLOW TRANSPORTATION INC	11300 PEORIA ST W	1334 ft (0.25 mi) WNW	Tunnel	LUST, RGA LUST	Facility is listed to have impacted soil due to a LUST containing diesel fuel. The site status is reported to be "Completed - Case Closed" as of 6/20/2007.	Low	
E2C-91	4	142	91240533		1040 E RAE ST	22 ft (0 mi) WSW	At-grade	ERNS	Facility is reported to have impacted water with diesel fuel due to a tank valve malfunction in 1991. A contractor is reported to have been retained to clean up the spill.	Med	
E2C-92	21-23	247	90183854		1078 FLEETWOOD ST	98 ft (0.02 mi) ENE	Tunnel	ERNS	Facility is reported to have impacted soil with wastewater containing lead due to a breakdown in integrity of a sump in 1990. The system was shut down and repaired and soil was tested for impacts.	Low	
E2C-93	23	270	S106394805, 2001579988		11019 PENROSE AVE., IN THE PARKING LOT, BEHIND THE BUILDING	314 ft (0.06 mi) WSW	Tunnel	CHMIRS, ERNS	The site is reported to have discharged cleaning solvents to a storm drain due to preparation of sushi on trays and then applying a cleanser on a tarp that leads to a storm drain. The discharge is reported to have occurred in 2001. Cleanup and containment are not reported.	Low	
E2C-94	23	294	2000547976		8300 SUNLAND BLVD	265 ft (0.05 mi) SW	Tunnel	ERNS	A caller stated that an employee of the facility was washing transmissions with fluids running directly into the storm drain in 2000. The local fire department was notified of the claim.	Low	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	DATABASES	Case Background	Priority	Associated with the Superfund Site (Area #1)
E2C-95	23	316	S100278782		LOCKHEED PLANT B-1 BLDG 166	28 ft (0.01 mi) SSE	Cut and Cover	CHMIRS	An incident is reported in 1988. The media impacted and COCs involved are not reported.	Med	
E2C-96	23	316	S100275423		LOCKHEED PLANT B-1 BLDG #161	28 ft (0.01 mi) SSE	Cut and Cover	CHMIRS	An incident is reported in 1989. The media impacted and COCs involved are not reported.	Med	
E2C-97	23	316	S100274876		LOCKHEED, PLANT B-1, 199	28 ft (0.01 mi) SSE	Cut and Cover	CHMIRS	An incident is reported in 1989. The media impacted and COCs involved are not reported.	Med	
E2C-98	23	316	2004100406		7649 SAN FERNANDO ROAD	208 ft (0.04 mi) SW	Cut and Cover	HMIRS	A spill of five gallons of TCE was reported in 2004 to an unspecified media. A certified hazardous materials team responded to contain and clean up the spill.	Low	
E2C-99	21	241	S103441494	SAN FERNANDO VALLEY DISPOSAL C	11100 PEORIA STREET	141 ft (0.03 mi) WNW	Tunnel	WMUDS/SWAT	Facility is listed to be in Solid Waste Assessment Test Program. Little additional information is provided.	High	
E2C-100	21-23	247	U001567789	T M SCRAP METALS INC	11092 TUXFORD ST	361 ft (0.07 mi) WSW	Tunnel	SWRCY	Facility is listed to be a recycling center that accepts aluminum/glass/plastic/bimetal products. Operation begin date listed to be 3/25/2011.	Med	
E2C-101	20-21	251	S103441474	BRADLEY AVENUE DUMP NO. 2		2402 ft (0.45 mi) WSW	Tunnel	WMUDS/SWAT	Facility is listed to be in Solid Waste Assessment Test Program. Little additional information is provided.	Med	
E2C-102	23	277	S103441729	PENROSE LANDFILL	8221 TUJUNGA AVE	4023 ft (0.76 mi) SW	Tunnel	WMUDS/SWAT	Facility is listed as Category B – Any facility having a physical, chemical, or biological waste treatment system (except for septic systems with subsurface disposal), or any Class II or II disposal site, or facilities without treatment systems that are complex, such as marinas with petroleum products, solid wastes, and sewage pump out facilities. The facility is listed to “not fall into the category of Municipal/Domestic, Industrial, Agricultural or Solid Waste (Class I, II or III) and to be a minor threat to water quality.	Low	
E2C-103	23	312	S103441730	TUJUNGA AVE/SITE 8- PENROSE PIT	8145 N. TUJUNGA AVE.	4815 ft (0.91 mi) SW	Tunnel	WMUDS/SWAT	Facility is listed as Category B – Any facility having a physical, chemical, or biological waste treatment system (except for septic systems with subsurface disposal), or any Class II or II disposal site, or facilities without treatment systems that are complex, such as marinas with petroleum products, solid wastes, and sewage pump out facilities. The facility is listed to “not fall into the category of Municipal/Domestic, Industrial, Agricultural or Solid Waste (Class I, II or III) and to be a minor threat to water quality.	Low	
E2C-104	23	316	S107137870	LEOS RECYCLING INC	7636 SAN FERNANDO RD	70 ft (0.01 mi) NE	Cut and Cover	SWRCY	Facility is listed to be a recycling center that accepts aluminum/glass/plastic/bimetal products. Operation begin date listed to be 1/2/2016.	Med	
E2C-105	N/A	N/A	S101586348, S100948720	R J MYERS & SONS, INCORPORATED	7333 CLYBOURN AVE	3002 ft (0.57 mi) SW	TBD	LUST, HIST CORTESE	The facility is listed to have contained a LUST (S101586348) that impacted soil only. The tank had a capacity of 150-gallons and contained aviation fuel and is noted to have been closed in June 1984.	Low	

¹The site is included in a group of industrial facilities that are documented to be included as "Responsible Parties" in relation to the San Fernando Valley Superfund Site for VOC/solvent/metal/chlorinated hydrocarbon impacts to groundwater used for drinking water. Listed sites with the same designation have the Case Background description associated with the listing presented in BOLD font and contain an "X" in the "Associated with the Superfund Site (Area #1)" column. While the San Fernando Superfund Site currently has a status of "Open - Remediation" or similar, some of the associated sites may have since been closed or have a status of "Completed - Case Closed". The remaining sites continue to be open and undergoing remediation for the associated contamination.

Table 3.10-B-10: E2A Central Subsection PEC Sites

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	DATABASES	Case Background	Priority	Associated with the Superfund Site (Area #1)
E2C-1	21	210	S117660926	A.C. ALBA LANDSCAPE BOULDERS - CLOSED		2225 ft (0.42 mi) ESE	Elevated / Aerial Structure	CA MINES	Facility is listed as "Closed, No Intent to Resume" as of 1996 for an open pit stone mining operation. Reclamation is reported to not have been started.	Low	
E2C-2	21	247	S114567917	AAA FOREIGN AUTO PARTS AND SALVAGE INC	9101 N GLENOAKS BLVD	67 ft (0.01 mi) ENE	Tunnel	RGA LUST	Facility is listed to have contained a LUST with unspecified contents and affected media as of 2012.	High	
E2C-3	11	180	S106103358	ACTION CLAY QUARRIES	FOREST SERVICE RD 4N32	3475 ft (0.66 mi) SE	Tunnel	LDS	Facility is listed to be an active land disposal site in relation to mining operation byproducts that are being produced. Site status is listed to be "Open - Operating" as of 5/31/2016.	Low	
E2C-4	14	182	S117660933	ACTON CLAY QUARRIES	31375 N. ALISO CANYON RD	3279 ft (0.62 mi) SE	Tunnel	CA MINES	Facility is listed active clay open pit, plant or mill mine as of 2014.	Low	
E2C-5	21	247	S102424167, S104575733, S114573362	ARCO #1298	9055 SUNLAND BLVD	1289 ft (0.24 mi) ENE	Tunnel	LUST, RGA LUST	Facility is listed to have contained a LUST that impacted soil with aviation fuel. Site status is listed as "Completed - Case Closed" as of 10/17/1994.	Low	
E2C-6	21-23	247	S114575363	ARCO FACILITY NO. 9581	9009 GLENOAKS	456 ft (0.09 mi) ENE	Tunnel	RGA LUST	Facility is listed to have contained a LUST with unspecified contents and affected media as of 2007.	High	
E2C-7	21-23	267	1017400940	ASSOCIATED READY MIX CONCRETE INC	8946 BRADLEY AVE	2064 ft (0.39 mi) WSW	Tunnel	TRIS	Facility is listed as a hazardous waste/enforcement and compliance history site for lead compounds with a status date of 2014. The lead compounds are reported to be transferred offsite for further waste management.	Low	
E2C-8	21	247	S103587984	ATHENS SUN VALLEY MAT REC & T.S.	11121 PENDLETON ST	621 ft (0.12 mi) WSW	Tunnel	SWF/LF	Facility is listed as an active large volume transfer and processing facility that accepts green materials, household trash, and inert metals. Monthly inspections are reported for the site and a daily capacity is listed to be 1,500 tons.	Low	
E2C-9	21	247	S103441295	BENTZ DUMP	11251 PENDLETON ST	976 ft (0.18 mi) WSW	Tunnel	LDS, WMUDS/SWAT	Facility is listed as a land disposal site with a status of "Completed - Case Closed" as of 5/25/2016. Accepted materials are listed to be clean dirt, broken concrete, asphalt, brick, block and rock.	Med	
E2C-10	20-21	247	U003060793	BRADLEY AVE DUMP	9050 BRADLEY AVE	2580 ft (0.49 mi) WSW, groundwater gradient to the south	Tunnel	LDS, WMUDS/SWAT	Facility is listed as a land disposal site with a status of "Open-Inactive" as of 11/29/2012. Groundwater monitoring was conducted at the site and elevated VOC and PCE/TCE concentrations were identified.	Med	
E2C-11	20-21	251	S113887321	BRADLEY EAST LANDFILL	9229 TUJUNGA AVE	2427 ft (0.46 mi) WSW, groundwater flow to the southeast	Tunnel	LDS	Facility is a former sand and gravel pit that was subsequently used as an unlined non-hazardous solid waste landfill that is listed as "Open - Closed/With Monitoring" as of 5/22/2016. Groundwater and soil/soil vapor are listed to have been impacted with VOCs, metals, and landfill related gases. The facility is reported to have "leaking waste constituents in excess of DHS/MCLs and may be affecting groundwater in the vicinity of the landfill.	Med	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	DATABASES	Case Background	Priority	Associated with the Superfund Site (Area #1)
E2C-12	20	249	S100931059, S109286318, S111075797, S103341425	BRADLEY EAST LANDFILL, BRADLEY LANDFILL & RECYCLING CENTER	9227 TUJUNGA AVE	3543 ft (0.67 mi) WSW	Tunnel	SWF/LF, LDS, WMUDS/SWAT	Facility is listed to be a closed solid waste landfill that accepts construction/demolition, industrial, mixed municipal, and other designated wastes. The closure date is listed as 6/1/2007 and the facility is reported to be 126 acres in size. Facility is also listed to be a solid waste landfill with quarterly inspections with a closure date of 12/31/1980. Facility is also listed to be a closed large volume transfer/processing facility with a closure date of 3/10/1988. Currently, the facility is listed to be an active large volume transfer/processing facility accepting agricultural, green materials, and manure with monthly inspections.	Low	
E2C-13	21	247	U001567850, S114587252	BROWNING FERRIS INDUSTRIES INC	9200 GLENOAKS BLVD	210 ft (0.04 mi) WSW	Tunnel	LUST, RGA LUST, SWF/LF	Facility is listed to be an active waste hauler. Limited additional information was provided in relation to site operations. ¹	High	X
E2C-14	23	277	S103621795	BURBANK AIRCRAFT SUPPLY INC	10671 LANARK	686 ft (0.13 mi) SW	Tunnel	SLIC	Facility is listed to have impacted an aquifer used for drinking water supply with VOCs and chromium. Current status is listed as "Open-Inactive" as of 10/29/2014. Groundwater gradient information was not reported but is anticipated to be toward the southeast per typical flow within the San Fernando Valley area.	Med	
E2C-15	23	319	S111828968	BURBANK AIRPORT AUTHORITY	2627 HOLLYWOOD WAY	2341 ft (0.44 mi) NE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in 2004 in relation to a chromium VI source assessment for the area. The facility was determined to need "No Further Requirements" in relation to the investigation in 2004 as is listed as "Completed - Case Closed" as of 12/22/2014.	Low	
E2C-16	23	316	1000252200	CALIFORNIA BIONUCLEAR CORP	7654 SAN FERNANDO RD	24 ft (0 mi) NE	Cut and Cover	CERCLIS-NFRAP, PRP	Facility was evaluated in relation to the San Fernando NPL case for potentially impacting groundwater with VOCs and/or chromium. The site was determined to require removal only, no site assessment work needed as of 1987.	Med	
E2C-17	21	238	S117661231, S102266815	CALMAT - SUN VALLEY/SUN VALLEY INERT LANDFILL	9436 GLENOAKS BLVD	1255 ft (0.24 mi) WNW	Cut and Cover	CA MINES, WMUDS/SWAT	Facility is listed as "Closed - No Intent to Resume, Reclamation in Progress" as of 2014. Facility is listed to have produced sand and gravel.	High	
E2C-18	23	247	1016467998	CALMAT CO		2769 ft (0.52 mi) WSW	Tunnel	US MINES	Facility is listed as "Non-Coal Mining" as of 1973.	Low	
E2C-19	21-23	247	1006816059	CALPORTLAND CO SUN VALLEY PLANT	8981 BRADLEY AVE	2510 ft (0.48 mi) WSW	Tunnel	TRIS	Facility is listed to produce lead compounds with off-site transfer for disposal of approximately 13 pounds of the compound per year.	Low	
E2C-20	21	247	1000819733, S114595729, S114597757, S114599587	CHEVRON STATION 90589	9110 GLENOAKS BLVD	39 ft (0.01 mi) ENE	Tunnel	LUST, RGA LUST, HIST CORTESE	The facility is listed to have impacted soil with waste/motor/hydraulic/lubricating oil due to a LUST at the site. The facility is listed to be "Completed - Case Closed" as of 7/5/1994.	High	
E2C-21	21	247	1000155657, S103340305, 1000409068	COMMUNITY RECYCLING / RES RECOVERY INC SOUTHERN CALIFORNIA WASTE REDUCTION	9147 DE GARMO AVE	1081 ft (0.2 mi) WSW	Tunnel	CERCLIS-NFRAP, CORRACTS, SWF/LF	SWF/LF (1000155657) - Facility is listed to be an active (permit date of 1997) limited volume transfer operation that accepts construction/demolition and other designated wastes with quarterly inspections. SWF/LF (S103340305) - Facility is listed as an active (permit date of 1998) large volume transfer/processing facility that accepts construction/demolition, industrial, mixed municipal waste. Inspections are reported to be performed on a monthly basis. CERCLIS-NFRAP/CORRACTS - Facility is listed to not qualify for NPL based on information updated in October 2013.	Low	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	DATABASES	Case Background	Priority	Associated with the Superfund Site (Area #1)
E2C-22	21	247	S104567759, 1000437523, S112891096, S114608028, S114608029	CROWN SPOSAL COMPANY INC, RECOLOGY LOS ANGELES	9189 DE GARMO AVE	1081 ft (0.2 mi) WSW	Tunnel	LUST, RGA LUST, SWF/LF	SWF/LF (S104567759) - Facility is listed to be a closed waste hauling site. The type of waste accepted is not reported. LUST (S104567759) - The facility is reported to have impacted soil due to a LUST containing other solvents or non-petroleum hydrocarbons. The site status is listed as "Completed - Case Closed" as of 9/2/1997. A note in the LUST file (1000437523) notes that landfill gas has migrated beneath the site. SWF/LF (S112891096) - Facility is listed to be an active waste hauler/transfer and processing facility that accepts construction/demolition, green materials, trash, and non-hazardous industrial waste.¹	Low	X
E2C-23	21	247	S116282717, S103441524	DE GARMO LANDFILL/DEGARMO	9135 DE GARMO AVE	830 ft (0.16 mi) WSW	Tunnel	LDS, WMUDS/SWAT	Site is an "Open - Inactive" land disposal site. Specifics on methane mitigation in relation to the site were not provided.	High	
E2C-24	21	247	S103441512	DE GARMO PIT LANDFILL	11201 RANDALL ST	935 ft (0.18 mi) WSW	Tunnel	SWF/LF, WMUDS/SWAT	Site is listed as "Closed" for landfill operations and presently is used for commercial purposes. The facility is reported to have been part of the Solid Waste Assessment Test Program.	High	
E2C-25	23	277	1000857356, 1014202338	EXPRESS PLATING V MASTERWORK, MONITOR POLISHING AND PLATING	8050 SAN FERNANDO RD	1168 ft (0.22 mi) SW	Tunnel	CERCLIS-NFRAP, ENVIROSTOR	Site listed to be inactive - Needs Evaluation for potential contamination from electroplating operation.	Med	
E2C-26	21	247	S105092651	FORMER JESSE'S PLATING	11103 RANDALL ST	786 ft (0.15 mi) WSW	Tunnel	ENVIROSTOR	Site previously used for metal finishing and metal plating. Is under investigation for unspecified COCs in soil and soil vapor. Currently "Inactive- Needs Evaluation" as of 2011.	Med	
E2C-27	21	247	U001567827, S114627260	GINO C BATTAGLIA	9077 DE GARMO AVE	636 ft (0.12 mi) WSW	Tunnel	LUST, RGA LUST	LUST (U001567827) - Facility is listed to have impacted soils with diesel fuel. Site status is listed as "Completed - Case Closed" as of 4/3/2008.	Low	
E2C-28	21-23	247	S105911516	GOODWIN CHEMICAL	9007 NORRIS	1459 ft (0.28 mi) WSW	Tunnel	SLIC	The facility is listed to have impacted soil with PCE due to storage at the site. Various phases of site assessment were completed from 1990 through 2001. The LARWQCB issued a notice of "No Further Action" on 12/14/2001.	Low	
E2C-29	21	247	1000591490, S109821484	GREGG PIT (PICK YOUR PART)	11370 PENDLETON ST	1999 ft (0.38 mi) WSW	Tunnel	SWF/LF, LUST	SWF/LF - Very limited information provided for facility but site is listed in SWF/LF database. LUST - During steam cleaning of a sump, contaminated soil was excavated and disposed of for an unknown contaminant in 1988.	Med	
E2C-30	23	339	S101586790	HENSLER GENERAL CONSTRUCTION	7550 WHEATLAND AVE	2071 ft (0.39 mi) WSW	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in 2004 in relation to a chromium VI source assessment for the area. The facility was determined to need "No Further Requirements" in relation to the investigation in 2004 as is listed as "Completed - Case Closed" as of 12/22/2014.	Low	
E2C-31	21	247	1001404429	HONEYWELL AVIONICS REPAIR CTR	9450 CHIVERS AVE	1052 ft (0.2 mi) ESE	Tunnel	SLIC	Facility was evaluated by the LARWQCB in relation to metal impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements" based on a soil investigation completed in 2004 and is listed as "Completed - Case Closed" as of 12/22/14.	Low	
E2C-32	21	247	1000428465	INDUSTRIAL BATTERY ENGINEERING	9121 DE GARMO AVE	748 ft (0.14 mi) WSW	Tunnel	SLIC	Facility was evaluated by the LARWQCB in 2001 in relation to a chromium VI source assessment for the area. The facility was determined to need "No Further Requirements" in relation to the investigation in 2003 as is listed as "Completed - Case Closed" as of 12/22/2014.	Low	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	DATABASES	Case Background	Priority	Associated with the Superfund Site (Area #1)
E2C-33	21	247	U001567785, S102441475, S114724214	ISSA N KHOURY, ZAUNER'S AUTOMOTIVE	9089 GLENOAKS BLVD	139 ft (0.03 mi) ENE	Tunnel	LUST, RGA LUST, CHMIRS	CHMIRS (U001567785) - A release of an unspecified amount of petroleum product was reported to have occurred beneath two of the fuel dispensers in 1996. A waterway is reported to have been involved and cleanup was performed by Shell Oil. LUST (S102441475) - A leak at the facility is reported to have been discovered on 5/21/1996. The leaked material is not reported and is listed to have impacted soil. Current site status is listed to be "Leak Being Confirmed" as of 5/24/1996.	High	
E2C-34	7	152	S114636951, S106915912, S114636952	JASONS AUTO PARTS	415 SIERRA HWY	998 ft (0.19 mi) NW	Tunnel	LUST, RGA LUST	LUST (S106915912) Facility is listed to have impacted soils with tetrachloroethylene, waste oil/ motor oil/ hydraulic oil/ and lubricating oil due to a LUST. Low levels of TRPH and PCE remain in subsurface soils. Groundwater is estimated at greater than 500 feet bgs and not anticipated to have been impacted from the release. The site status is reported as "Completed - Case Closed" as of 9/21/2010.	Med	
E2C-35	21-23	247	U001567797, U003781064, S114637415	JIFFY LUBE	10867 PENROSE ST	1123 ft (0.21 mi) ENE	Tunnel	LUST, RGA LUST	LUST (U001567797) - Facility is reported to have impacted soil with waste/motor/hydraulic/lubricating oil. Site status is listed as "Completed - Case Closed" as of 8/2/2000.	Low	
E2C-36	4	140	S114637448, S102431920	JILL R RATCLIFFE	36200 SIERRA HWY, N	513 ft (0.1 mi) W	At-grade	LUST, RGA LUST	Facility is listed to have impacted soil with gasoline due to a LUST. The site status is reported as "Completed - Case Closed" as of 11/21/1991.	Med	
E2C-37	21	247	S106102586	KC NISSAN AUTO SMANTLING	10967 TUXFORD ST	627 ft (0.12 mi) ENE	Tunnel	SLIC	Facility was evaluated by the LARWQCB in 2001 in relation to a chromium VI source assessment for the area. The facility was determined to need "No Further Requirements" in relation to the investigation in 2003 and is listed as "Completed - Case Closed" as of 11/29/2012.	Low	
E2C-38	23	247	S103674790	KENWALT E CASTING CO	8719 BRADLEY AVE	1395 ft (0.26 mi) WSW	Tunnel	SLIC	Facility was evaluated by the LARWQCB in 2001 in relation to a chromium VI source assessment for the area. The facility was determined to need "No Further Requirements" in relation to the investigation in 2003 and is listed as "Completed - Case Closed" as of 12/22/2014.	Low	
E2C-39	21	246	S112186489	LA CITY DWP PENDLETON (PENDLETON STREET LANDFILL)	11000 PENDLETON ST	379 ft (0.07 mi) ENE	Tunnel	LDS	Facility is listed as a land disposal site with status of "Completed - Case Closed" as of 2012. However, VOC and solvent concentrations were reported during groundwater monitoring at the facility with flow migration toward the south.	High	
E2C-40	20	228	S101588330, 1001491848	LA DEPARTMENT OF WATER/POWER, TRUESDALE CENTER	11791 TRUESDALE CENTER	4778 ft (0.9 mi) WNW	Tunnel	CERCLIS- NFRAP, VCP, ENVIROSTOR	VCP/ENVIROSTOR - Facility is reported to have entered a voluntary cleanup agreement in 2000 due to PCB, TPH-d, and TPH-g impacts to soil as a result of use as an electrical generation/substation. Current site status is listed as "Active."	Low	
E2C-41	23	277	S106484855	LADO MFG CO	11400 LUD NGTON ST, #A	3230 ft (0.61 mi) WSW	Tunnel	SLIC	Facility was evaluated by the LARWQCB in 2001 in relation to a chromium VI source assessment for the area. The facility was determined to need "No Further Requirements" in relation to the investigation in 2014 as is listed as "Completed - Case Closed."	Low	
E2C-42	22-23	247	S116282735	LIVINGSTON - GRAHAM SUN VALLEY SANITARY LANDFILL	ADJACENT TO BRADLEY WEST	3398 ft (0.64 mi) WSW	Tunnel	LDS	Facility is listed as a land disposal site with status of "Open - Inactive" as of 2013. The landfill is comingled with the Bradley West landfill and is reported to have continual groundwater and methane monitoring performed in relation to operations.	Low	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	DATABASES	Case Background	Priority	Associated with the Superfund Site (Area #1)
E2C-43	20	228	1014202344	LNL ANODIZING	9900 GLENOAKS BLVD, #3	4985 ft (0.94 mi) WNW	Tunnel	CERCLIS-NFRAP	Facility is reported to have been investigated in relation to the San Fernando Valley Superfund Site. The site was determined to not qualify for the NPL based on provided information as of 2010.	Low	
E2C-44	22	271	S106484456	LOCKHEED A-1, B85, LOTS 16, 16A	3220 W. THORTON	4553 ft (0.86 mi) WSW	Tunnel	SLIC	Site is listed as "Open - Site Assessment" as of 1990. An aquifer used for drinking water supply beneath the facility is listed to have been impacted by chromium and VOCs. ¹	Low	X
E2C-45	23	316	S102432702, S114644699	LOCKHEED PLANT B-6-F	7575 SAN FERNANDO RD N	175 ft (0.03 mi) SW	Cut and Cover	LUST, RGA LUST	Facility is listed to have impacted an aquifer used for drinking water supply with diesel fuel. Current site status is listed as "Completed - Case Closed" as of 1/1/1996.	Low	
E2C-46	20	228	S109442393, S106528956	LOONEY BINS/EAST VALLEY VERSION	11616 SHELDON ST	3975 ft (0.75 mi) WNW	Tunnel	SWF/LF	SWF/LF (S109442393) - Facility is listed to be an active transfer/processing facility accepting construction/demolition and non-hazardous industrial debris. SWF/LF (S106528956) - Facility is listed to be an active large volume construction/demolition processing facility with monthly inspections.	Low	
E2C-47	20	228	S111075989	LOONEY BINS/SPACCARELLI HAULING	11616 1/2 SHELDON ST	3976 ft (0.75 mi) WNW	Tunnel	SWF/LF	Facility is listed as an active waste hauler. Limited additional information is provided.	Low	
E2C-48	23	339	S113003727	LYN-TRON INC	3150 N. DAMON WAY	2320 ft (0.44 mi) SW	Cut and Cover	SLIC	Facility is reported to have been investigated in relation to the San Fernando Valley Superfund Site due to manufacturing of metal and non-metal fasteners used in relation to the aerospace industry. Environmental assessment of the site was performed in 2013 in relation to a LARWQCB Order. The assessment concluded that no chromium and or other VOCs were used at the Site. A notice of "No Further Requirements" was issued in respect to soils only in 2013. The site status is listed as "Completed - Case Closed" as of 12/16/2013.	Low	
E2C-49	16	183	1007372595, S109548277	MENDENHALL PEAK CAMP SITE		2323 ft (0.44 mi) NW	Tunnel	FUDS, ENVIROSTOR	FUDS (1007372595) - Site is reported to have been acquired by the Army from the USFS for use with mountain maneuver training from 1942 to 1944. The site consisted of 320 acres of land. ENVIROSTOR (S109548277) - Facility is listed to be a 640 acres parcel of land requiring military evaluation. Site status is listed as "Inactive - Needs Evaluation" as of 7/1/2005.	Med	
E2C-50	21-23	247	1008381793	NATIONAL READY MIX CONCRETE CO	9010 NORRIS AVE	1496 ft (0.28 mi) WSW	Tunnel	TRIS	The facility is listed to use toxic chemicals (lead compounds) which are reported to be transported offsite for disposal.	Low	
E2C-51	10	177	1011130614	NORTH STAR MINERALS INC		2387 ft (0.45 mi) NW	At-grade	US MINES	Site is listed as an active non-coal mining company. Numerous citations are reported for unspecified reasons.	Med	
E2C-52	22-23	292	S106484857	OCCUPANT-AUTO SHOP	8431 TELFAIR AVE	4442 ft (0.84 mi) WSW	Tunnel	SLIC	Facility was evaluated by the LARWQCB in 2001 in relation to a chromium VI source assessment for the area. The facility was determined to need "No Further Requirements" in relation to the investigation in 2014 as is listed as "Completed - Case Closed."	Low	
E2C-53	21	247	1000105226	P BRAZE INC	9131 DE GARMO AVE	774 ft (0.15 mi) WSW	Tunnel	ENVIROSTOR	Facility is reported to have an active Tiered Permit. Confirmed COCs were not reported and the site is listed to not be included on any NPL or have restricted use.	Low	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	DATABASES	Case Background	Priority	Associated with the Superfund Site (Area #1)
E2C-54	21	247	1006932050	PDQ AUTO SALVAGE	10975 TUXFORD ST	551 ft (0.1 mi) ENE	Tunnel	CERCLIS-NFRAP, LEAD SMELTERS, ENVIROSTOR	Site assessed for contamination in 1979 through 1982 and is listed as NFRAP due to not qualifying for the NPL based on existing information.	Med	
E2C-55	21	247	2006812066, S109821518, S108432318	PENDLETON STREET DUMP	11050 PENDLETON ST	455 ft (0.09 mi) WSW	Tunnel	ERNS, SWF/LF	SWF/LF (S108432318) - Facility is listed to be a closed solid waste landfill facility. Limited additional information was provided for site. ERNS (2006812066) - A caller stated that during the filling of a UST with hydraulic oil, approximately 220 gallons of the material spilled to the soil. The spill occurred in 2006 and was reported to have been contained and cleaned up. SWF/LF (S109821518) - Facility is listed to be an active limited volume transfer/processing operation for metal, mixed municipal, tire, passenger, and wood waste.	High	
E2C-56	23	247	S109117694	PENHALL COMPANY	11182 W PENROSE AVE	1717 ft (0.33 mi) WSW	Tunnel	LUST	Soil is reported to have been impacted from a LUST of diesel fuel at the facility. Current status listed as "Completed - Case Closed" as of 2012.	Low	
E2C-57	23	277	S102360907	PENROSE PIT	8251 - 8301 TUJUNGA AVE	3789 ft (0.72 mi) WSW	Tunnel	SWF/LF	Site is listed as a closed solid waste disposal facility for residential/industrial/commercial waste. Facility was closed in 1987.	Low	
E2C-58	23	277	S109287258, 1001115478	PENROSE SANITARY LANDFILL, PENROSE LANDFILL GAS CONVERSION LLC	8301 TUJUNGA AVE	3806 ft (0.72 mi) WSW	Tunnel	CERCLIS-NFRAP, SLIC, LDS	An aquifer used for drinking water supply is reported to have been impacted from a LUST of diesel fuel at the facility. Current status listed as "Completed - Case Closed" as of 2012.	Low	
E2C-59	23	316	1000415250	PHOTO CHEM ETCH CORP	7710 SAN FERNANDO RD	88 ft (0.02 mi) SW	Tunnel	SLIC, ENVIROSTOR	The site is listed as "Completed - Case Closed" as of 12/22/2014 for VOC contamination that has impacted an aquifer used for drinking water supply.	Low	
E2C-60	23	277	1000297142	PRIME PLATING INC	11321 GOSS ST	3261 ft (0.62 mi) WSW	Tunnel	SLIC	SLIC - An aquifer used for drinking water supply is reported to have been impacted from chromium and VOCs. Current status listed as "Completed - Case Closed" as of 1997. TRIS - The facility is listed to use toxic chemicals (cyanide/lead/nitrate compounds) which are reported to be transported offsite for disposal.	Low	
E2C-61	21-23	247	1014202571	RECYCLED BASE MATERIALS INC		1442 ft (0.27 mi) WSW	Tunnel	US MINES	Facility is listed as an abandoned non-coal mining operation as of 2010.	Med	
E2C-62	21	247	1003879001	ROIC/SUN VALLEY	9068 DE GARMO AVE	581 ft (0.11 mi) WSW	Tunnel	CERCLIS-NFRAP, LIENS2, PRP	CERCLIS-NFRAP - Site is listed as "removal only site (no site assessment work needed)." A lien was recorded against the property on 9/30/1987.	Low	
E2C-63	23	297	S116497300	SA RECYCLING LLC	8270 TUJUNGA AVE	3338 ft (0.63 mi) SW	Tunnel	SWF/LF	Facility is listed to be a medium volume transfer/processing facility for mixed municipal waste with a permit date of 2014.	Low	
E2C-64	20-21	227	S117662604	SHELDON	11401 W TUXFORD ST	3482 ft (0.66 mi) WNW	Tunnel	CA MINES	Facility is listed as an active open pit sand and gravel mining operation as of 2014. Reclamation is reported to be in progress.	Low	
E2C-65	4	128	S102437520, S114660362, S114690985, S114690913, S114690983	SIERRA HWY & AVE S, NETAL INC	37205 SIERRA HWY	61 ft (0.01 mi) ENE	At-grade	LUST, RGA LUST	A LUST containing waste/motor/hydraulic oil was present at the site. Soil and an aquifer used for drinking water supply were reported to have been impacted. Assessment/remediation performed and case closed in 2014.	High	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	DATABASES	Case Background	Priority	Associated with the Superfund Site (Area #1)
E2C-66	4	135	S109348411, S114690986	SIERRA HWY ANTELOPE VALLEY S CONVIENCE PLAZA	37167 N SIERRA HWY	180 ft (0.03 mi) WSW	At-grade	LUST, RGA LUST	A LUST with unspecified contents was present at the site. The impacted media was not reported. Case closed in 2007.	High	
E2C-67	21	247	S116497298	SINGH SPOSAL	11401 PENDLETON ST	2339 ft (0.44 mi) WSW	Tunnel	SWF/LF	Facility is listed as a limited volume transfer/processing site that accepts construction/demolition and inert waste with a permit date of 2014.	Low	
E2C-68	23	277	S103988817, U001567823, S114694413, S114694414	SOUTHLAND TRANSMISSIONS	8283 SAN FERNANDO RD	1974 ft (0.37 mi) SW	Tunnel	LUST, RGA LUST	An aquifer used for drinking water supply is reported to have been impacted from a LUST containing aviation fuel at the facility. Current status listed as "Completed - Case Closed" as of 1996.	Low	
E2C-69	23	270	S106484844	SPECTRA AMERICAN	11037 PENROSE ST	462 ft (0.09 mi) WSW	Tunnel	SLIC, ENVIROSTOR	Facility was evaluated by the LARWQCB in 2001 in relation to a chromium VI and VOC impact to an aquifer used for drinking water source assessment for the area. The facility was determined to need "No Further Requirements" in relation to the investigation in 2014 as is listed as "Completed - Case Closed."	Low	
E2C-70	23	315	S109286992, S102360919	STRATHERN INERT LANDFILL	11201 STRATHERN ST	3947 ft (0.75 mi) SW	Tunnel	SWF/LF, LDS	Facility is listed as a land disposal site with a status of "Open - Verification Monitoring."	Low	
E2C-71	23	277	S111076116	STRATHERN SANITARY LANDFILL	8230 TUJUNGA AVE	3970 ft (0.75 mi) SW	Tunnel	SWF/LF	The facility is listed as a closed landfilling operation that accepted inert waste. Currently, the site is listed to be an inert debris engineered fill operation over an area of 34 acres.	Low	
E2C-72	21	243	S109287408, S103426966	SUN VALLEY LANDFILL - THERMAL TREATMENT UNIT	9436 GLENOAKS BLVD	1604 ft (0.3 mi) WNW	Tunnel	SWF/LF, LDS	SWF/LF (S103426966)- Facility is listed to be an active inert debris engineered fill operation at a closed landfill. The site is reported to be 125 acres in size. LDS (S109287408) - Facility is listed to be a land disposal site with a status of "Completed - Case Closed" as of 5/30/2016.	Med	
E2C-73	22-23	247	S106528959, S117711954	SUN VALLEY PAPER STOCK MRF AND TS	8701 N SAN FERNANDO RD	3406 ft (0.65 mi) WSW	Tunnel	SWF/LF	LF - Facility is an active large volume transfer/processing site for industrial and mixed municipal waste. Permit issued for the site in 2006.	Low	
E2C-74	23	319	S110275514	SUPERIOR PLATING	4001 GLENOAKS BLVD	2347 ft (0.44 mi) NE	Cut and Cover	ENVIROSTOR	Facility is listed to have a status of "Inactive - Needs Evaluation" as of 5/24/2012. Impacted media and COCs were not reported for the site.	Med	
E2C-75	21-23	247	U001567826	TAM CERAMICS INC	11025 FLEETWOOD ST	86 ft (0.02 mi) WSW	Tunnel	ENVIROSTOR	Facility is listed as "Refer: Other Agency" as of an unspecified date. The potential COCs and impacted media are not reported.	High	
E2C-76	21-23	247	U001567825	TAM CERAMICS INC	11078 FLEETWOOD ST	556 ft (0.11 mi) WSW	Tunnel	ENVIROSTOR	Facility is reported to have a Tiered Permit, however, land use restrictions and NPL subjectivity were not reported.	Low	
E2C-77	21	247	S103675889, S114702674, S101298215, S114702676, S114703573	THRIFTY #127	9090 GLENOAKS BLVD	168 ft (0.03 mi) ENE	Tunnel	LUST, RGA LUST	Facility is listed to have impacted soil due to a LUST containing gasoline. The site status is reported to be "Completed - Case Closed" as of 1/7/1998.	Med	
E2C-78	21-23	267	S109117745, S114706151	TRANSIT MIXED CONCRETE (FMR SOUTHDOWN CONCRETE)	8960 N BRADLEY AVE	2130 ft (0.4 mi) WSW	Tunnel	LUST, RGA LUST	Facility is listed to have impacted soil due to a LUST containing diesel fuel. The site status is reported to be "Completed - Case Closed" as of 1/13/2015.	Low	
E2C-79	20	228	1000102029	TRUESDALE ESM EAST VALLEY	11781 TRUESDALE ST	4771 ft (0.9 mi) WNW	Tunnel	CERCLIS-NFRAP	Facility is listed to treat, store, or dispose of numerous types of hazardous waste. Groundwater monitoring and evaluation is reported to have occurred between 1984 and 1985.	Low	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	DATABASES	Case Background	Priority	Associated with the Superfund Site (Area #1)
E2C-80	23	277	S109821493, S103441383	TUJUNGA PIT	8250 TUJUNGA AVE	3955 ft (0.75 mi) SW	Tunnel	SWF/LF,WMUDS /SWAT	Very limited information provided for facility. Site assessed for SWAT program. Impact to media not reported.	Low	
E2C-81	21	247	S102360910	TUXFORD PIT LANDFILL	TUXFORD & GOLDEN STATE	1426 ft (0.27 mi) ENE	Tunnel	SWF/LF,WMUDS /SWAT	Facility is listed as a closed solid waste disposal site with a current regulation status as "unpermitted."	Med	
E2C-82	22	278	S113482310	TUXFORD PIT LANDFILL	11590 TUXFORD ST (TUXFORD ST AND GOLDEN STATE FWY)	4642 ft (0.88 mi) WSW	Tunnel	LDS	Facility is listed as an "Open - Inactive" land disposal site with a status date of 6/3/2013. Records for the facility from 1992 to 1993 identify TCE and PCE impacts to an underlying aquifer.	Low	
E2C-83	23	329	S101298216, S105032930	U-HAUL CENTER OF SUN VALLEY	7721 HOLLYWOOD WAY	1910 ft (0.36 mi) NE	Cut and Cover	LUST	Facility is listed to have impacted soil with waste/motor/hydraulic/lubricating oil due from a LUST. Site status is reported to be "Completed - Case Closed" as of 3/31/1992.	Low	
E2C-84	21	243	S116282732	VALLEY RECLAMATION COMPANY - PIT NO. 3	11311 PEORIA ST	1425 ft (0.27 mi) WNW	Tunnel	LDS	Facility is listed as a land disposal site with a status of "Open - Inactive" as of 2013. Reports for the facility have indicated PCE impacts to groundwater.	Med	
E2C-85	23	277	S106484837	VINTEN EQUIPMENT INC	8115 N CLYBORN	785 ft (0.15 mi) SW	Tunnel	SLIC	The site is listed as "Completed - Case Closed" as of 12/22/2014 for VOC contamination that has impacted an aquifer used for drinking water supply.	Med	
E2C-86	20-21	228	S111076161	VULCAN MATERIALS (SUN VALLEY)	11520 SHELDON ST	3204 ft (0.61 mi) WNW	Cut and Cover	SWF/LF	Facility is listed to be an active landfilling operation that accepts inert waste as an inert debris engineered fill operation.	Low	
E2C-87	20-21	259	1005775701	WASTE MANAGEMENT	9081 TUJUNGA AVE	2531 ft (0.48 mi) WSW	Tunnel	SWF/LF	Facility is listed as an active waste hauler. Limited additional information is provided.	Low	
E2C-88	21	247	S103697090	WEST COAST WINERY	11115 PENDLETON ST	619 ft (0.12 mi) WSW	Tunnel	SLIC	Facility is listed to be a cleanup program site with a status of "Completed - Case Closed" as of 9/27/1995. The impacted media and COCs for the site are not reported.	Med	
E2C-89	23	277	S105026815, U003904755, S114723172, S114723381	WORLD OIL #19	8181 SUNLAND BLVD	1749 ft (0.33 mi) SW	Tunnel	LUST, RGA LUST	A LUST was reported to have impacted soil with gasoline. Case closed as of 1996.	Low	
E2C-90	21	243	S108935380, S114723800	YELLOW TRANSPORTATION INC	11300 PEORIA ST W	1334 ft (0.25 mi) WNW	Tunnel	LUST, RGA LUST	Facility is listed to have impacted soil due to a LUST containing diesel fuel. The site status is reported to be "Completed - Case Closed" as of 6/20/2007.	Low	
E2C-91	4	142	91240533		1040 E RAE ST	22 ft (0 mi) WSW	At-grade	ERNS	Facility is reported to have impacted water with diesel fuel due to a tank valve malfunction in 1991. A contractor is reported to have been retained to clean up the spill.	Med	
E2C-92	21-23	247	90183854		1078 FLEETWOOD ST	98 ft (0.02 mi) ENE	Tunnel	ERNS	Facility is reported to have impacted soil with wastewater containing lead due to a breakdown in integrity of a sump in 1990. The system was shut down and repaired and soil was tested for impacts.	Low	
E2C-93	23	270	S106394805, 2001579988		11019 PENROSE AVE., IN THE PARKING LOT, BEHIND THE BUILDING	314 ft (0.06 mi) WSW	Tunnel	CHMIRS, ERNS	The site is reported to have discharged cleaning solvents to a storm drain due to preparation of sushi on trays and then applying a cleanser on a tarp that leads to a storm drain. The discharge is reported to have occurred in 2001. Cleanup and containment are not reported.	Low	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	DATABASES	Case Background	Priority	Associated with the Superfund Site (Area #1)
E2C-94	23	294	2000547976		8300 SUNLAND BLVD	265 ft (0.05 mi) SW	Tunnel	ERNS	A caller stated that an employee of the facility was washing transmissions with fluids running directly into the storm drain in 2000. The local fire department was notified of the claim.	Low	
E2C-95	23	316	S100278782		LOCKHEED PLANT B-1 BLDG 166	28 ft (0.01 mi) SSE	Cut and Cover	CHMIRS	An incident is reported in 1988. The media impacted and COCs involved are not reported.	Med	
E2C-96	23	316	S100275423		LOCKHEED PLANT B-1 BLDG #161	28 ft (0.01 mi) SSE	Cut and Cover	CHMIRS	An incident is reported in 1989. The media impacted and COCs involved are not reported.	Med	
E2C-97	23	316	S100274876		LOCKHEED, PLANT B-1, 199	28 ft (0.01 mi) SSE	Cut and Cover	CHMIRS	An incident is reported in 1989. The media impacted and COCs involved are not reported.	Med	
E2C-98	23	316	2004100406		7649 SAN FERNANDO ROAD	208 ft (0.04 mi) SW	Cut and Cover	HMIRS	A spill of five gallons of TCE was reported in 2004 to an unspecified media. A certified hazardous materials team responded to contain and clean up the spill.	Low	
E2C-99	21	241	S103441494	SAN FERNANDO VALLEY DISPOSAL C	11100 PEORIA STREET	141 ft (0.03 mi) WNW	Tunnel	WMUDS/SWAT	Facility is listed to be in Solid Waste Assessment Test Program. Little additional information is provided.	High	
E2C-100	21-23	247	U001567789	T M SCRAP METALS INC	11092 TUXFORD ST	361 ft (0.07 mi) WSW	Tunnel	SWRCY	Facility is listed to be a recycling center that accepts aluminum/glass/plastic/bimetal products. Operation begin date listed to be 3/25/2011.	Med	
E2C-101	20-21	251	S103441474	BRADLEY AVENUE DUMP NO. 2		2402 ft (0.45 mi) WSW	Tunnel	WMUDS/SWAT	Facility is listed to be in Solid Waste Assessment Test Program. Little additional information is provided.	Med	
E2C-102	23	277	S103441729	PENROSE LANDFILL	8221 TUJUNGA AVE	4023 ft (0.76 mi) SW	Tunnel	WMUDS/SWAT	Facility is listed as Category B – Any facility having a physical, chemical, or biological waste treatment system (except for septic systems with subsurface disposal), or any Class II or III disposal site, or facilities without treatment systems that are complex, such as marinas with petroleum products, solid wastes, and sewage pump out facilities. The facility is listed to “not fall into the category of Municipal/Domestic, Industrial, Agricultural or Solid Waste (Class I, II or III) and to be a minor threat to water quality.	Low	
E2C-103	23	312	S103441730	TUJUNGA AVE/SITE 8-PENROSE PIT	8145 N. TUJUNGA AVE.	4815 ft (0.91 mi) SW	Tunnel	WMUDS/SWAT	Facility is listed as Category B – Any facility having a physical, chemical, or biological waste treatment system (except for septic systems with subsurface disposal), or any Class II or III disposal site, or facilities without treatment systems that are complex, such as marinas with petroleum products, solid wastes, and sewage pump out facilities. The facility is listed to “not fall into the category of Municipal/Domestic, Industrial, Agricultural or Solid Waste (Class I, II or III) and to be a minor threat to water quality.	Low	
E2C-104	23	316	S107137870	LEOS RECYCLING INC	7636 SAN FERNANDO RD	70 ft (0.01 mi) NE	Cut and Cover	SWRCY	Facility is listed to be a recycling center that accepts aluminum/glass/plastic/bimetal products. Operation begin date listed to be 1/2/2016.	Med	
E2C-105	N/A	N/A	S101586348, S100948720	R J MYERS & SONS, INCORPORATED	7333 CLYBOURN AVE	3002 ft (0.57 mi) SW	TBD	LUST, HIST CORTESE	The facility is listed to have contained a LUST (S101586348) that impacted soil only. The tank had a capacity of 150-gallons and contained aviation fuel and is noted to have been closed in June 1984.	Low	
E2AC-106	7	S99	S113138690	ALL VALLEY RV CENTER	1525 SIERRA HWY	4474 ft (0.85 mi) NW	Elevated / Aerial Structure	CERS, CERS HAZ WASTE	Facility is listed as a hazardous waste generator in 2005 and 2006. This facility has received numerous administrative and facility compliance violations in issued by the Los Angeles County Fire Department.	Low	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	DATABASES	Case Background	Priority	Associated with the Superfund Site (Area #1)
E2AC-107	4	G37	S106826011	ANTELOPE VALLEY - N SIERRA HIGHWAY	36007 N. SIERRA HWY	152 ft (0.03 mi) E	At-grade	CERS, CERS HAZ WASTE	Facility is listed as a chemical storage facility. This facility received numerous administrative and facility compliance violations issued by the Los Angeles County Fire Department.	Med	
E2AC-108	1	H41	S103950319, 1000205297	ANTELOPE VALLEY PRESS	37404 SIERRA HWY	236 ft (0.04 mi) E	At-grade	CERS, CERS HAZ WASTE, LOS ANGELES CO. HMS	Facility is listed as a chemical storage facility. No violations have been reported.	Low	
E2AC-109	1	B14	U003060220	ARCO PRODUCTS CO (DEST)	37207 SIERRA HWY	59 ft (0.01 mi) W	At-grade	LOS ANGELES CO. HMS	Facility is listed as a hazardous material handler. The facility status is listed at "open".	Low	
E2AC-110	4	121	S118756508	DESERT WILLOW SCHOOL	62ND STREET EAST/S-8 AVENUE	1029 ft (0.19 mi) NE	At-grade	ENVIROSTOR. CERS	Facility is reported to have been assessed via a Phase I ESA for potential COCs. No COCs were confirmed for the site and the facility was determined to not be subject to the NPL and/or land use restrictions. Current site status is listed as "No Action Required."	Low	
E2AC-111	1	AB140	S123501389	PALMDALE WATER DISTRICT-TRMT PLNT	700 E AVENUE S	1273 ft (0.24 mi) W	At-grade	CERS, CERS HAZ WASTE	Facility is listed as a hazardous waste generator and chemical storage facility.	Low	
E2AC-112	9	D25	S104734900	SCOTTY'S NURSERY	352 SIERRA HWY	890 ft (0.17 mi) NW	Tunnel	LOS ANGELES CO. HMS	Facility is listed as a hazardous material handler. The facility status is listed at "open".	Low	
E2AC-113	10	C23	1025569695, 1025689899	SHEBA FERTILIZER DEPOSIT		418 ft (0.08 mi) W	Tunnel	MINES MRDS	Facility is listed as a prospect producer of sand, gravel, calcium, and gypsum-anhydrite.	Med	
E2AC-114	1	B11	S109689978	SIERRA HWY & AVE S INC	37321 SIERRA HWY	20 ft (0 mi) W	At-grade	LOS ANGELES CO. HMS	Facility is listed as a hazardous material handler. The facility status is listed at "removed".	Low	
E2AC-115	1	B12	S102064705	SIERRA HWY & AVE S INC	37305 SIERRA HWY	25 ft (0 mi) W	At-grade	LOS ANGELES CO. HMS	Facility is listed as a hazardous material handler. The facility status is listed at "open".	Low	

¹ The site is included in a group of industrial facilities that are documented to be included as "Responsible Parties" in relation to the San Fernando Valley Superfund Site for VOC/solvent/metal/chlorinated hydrocarbon impacts to groundwater used for drinking water. Listed sites with the same designation have the Case Background description associated with the listing presented in BOLD font and contain an "X" in the "Associated with the Superfund Site (Area #1)" column. While the San Fernando Superfund Site currently has a status of "Open - Remediation" or similar, some of the associated sites may have since been closed or have a status of "Completed - Case Closed". The remaining sites continue to be open and undergoing remediation for the associated contamination.

Table 3.10-B-11: E2 and E2A Burbank Subsection PEC Sites

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	DATABASES	Case Background	Priority	Associated with the Superfund Site (Area #1)
E2B-1	23	316	S106764394	ADB INDUSTRIES	2523 NORTH ONTARIO STREET	1991 ft (0.38 mi) ESE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to metal impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements for soil only" and is listed as "Completed - Case Closed" as of 8/26/14.	Low	
E2B-2	23	316	S103587492, S114568902, S114568903	AEROQUIP FACILITY (FORMER)	3015 WINONA AVE	2388 ft (0.45 mi) ESE	Cut and Cover	LUST,RGA LUST	Facility was evaluated by the LARWQCB in relation to volatile organic compound impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements" based on investigations performed prior to 1997 and is listed as "Completed - Case Closed" as of 8/30/96.¹	Low	X
E2B-4	23	316	S112186558	ALIGN-RITE INTERNATIONAL / PHOTRONICS INC.	2422-2428 NORTH ONTARIO STREET	2516 ft (0.48 mi) SE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to chromium VI impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements with respect to soils only" and is listed as "Completed - Case Closed" as of 11/27/13.¹	Low	X
E2B-6	23	316	1000300331	ALUMINUM DIP BRAZE CO	2537 N ONTARIO ST	1991 ft (0.38 mi) ESE	Cut and Cover	CERCLIS-NFRAP	Facility was evaluated by the LARWQCB in relation to chromium VI impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements for soils only" and is listed as "Completed - Case Closed" as of 8/26/14.	Low	
E2B-7	23	316	1000857227, 1000818182	ALUMTREAT INC	2905 WINONA AVE	2760 ft (0.52 mi) ESE	Cut and Cover	CERCLIS-NFRAP,CORRACTS,RCRA-TSDF,ENVIROSTOR	Facility was evaluated by the DTSC in relation to historic manufacturing activities. The facility is listed as "Land Use Restrictions Only" as of 9/19/97.	Low	
E2B-8	23	316	S104567212	AMER. FINE ARTS FOUNDRY	2520 N. ONTARIO ST.	2290 ft (0.43 mi) ESE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to chromium VI and volatile organic compound impacts to an aquifer used for drinking water. The facility was determined to need "No Further Requirements" and is listed as "Completed - Case Closed" as of 12/22/14.	Low	
E2B-9	23	372	S103282106, 1000180804, S114578215	ASII TANK FARM (SITE #1), AIRCRAFT SERVICE INTERNATIONAL	2761 HOLLYWOOD WAY	976 ft (0.18 mi) SE	Cut and Cover	LUST,RGA LUST	Facility was evaluated by the LARWQCB in relation to a leaking underground storage tank case where soil was impacted. The facility is listed as "Completed - Case Closed" as of 11/5/01.	Low	
E2B-10	23	316	S104538157	AUTO MATTERS	2812 N SAN FERNANDO BLVD	3625 ft (0.69 mi) ESE	Cut and Cover	SLIC	07=-	Low	
E2B-11	23	316	S114579267, 1000149067, S114579269, 1001023008	AVIALL INCORPORATED, HERTZ ENTERTAINMENT SERVICES (9684-00)	3111 KENWOOD ST	134 ft (0.03 mi) ENE	Cut and Cover	HIST CORTESE,LUST ,RGA LUST,SLIC	Facility was evaluated by the LARWQCB in relation to metal, TPH, and VOC impacts to soil and an aquifer used for drinking water. The facility is listed as "Open - Remediation" as of 3/25/96.¹	High	X
E2B-13	23	316	S106484438	BONDED SERVICES	3205 BURTON AVE.	2369 ft (0.45 mi) SE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to metal and volatile organic compound impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements" and is listed as "Completed - Case Closed" as of 10/29/14.¹	Low	X

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	DATABASES	Case Background	Priority	Associated with the Superfund Site (Area #1)
E2B-14	23	316	S102860870, 1015732646	BRASS PRODUCTION COMPANY	3059-3063 NORTH CALIFORNIA STREET	2100 ft (0.4 mi) ENE	Cut and Cover	CERCLIS-NFRAP, ENVIROSTOR	Facility was evaluated by the DTSC and is listed as "No Further Action" as of 10/25/94.	Low	
E2B-15	23	408	U001568394	BUDGET RENT-A-CAR	2220 N. HOLLYWOOD WAY.	4164 ft (0.79 mi) SSE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to chromium VI impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements" and is listed as "Completed - Case Closed" as of 12/22/14.	Low	
E2B-16	23	316	S104827552	BUILT ENGINEERING	3074 N. LIMA ST.	1865 ft (0.35 mi) ENE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to metals and volatile organic compound impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements" and is listed as "Completed - Case Closed" as of 9/9/05.	Low	
E2B-17	23	378	S108196068	BURBANK AIRPORT AUTHORITY	2627 HOLLYWOOD	1415 ft (0.27 mi) SSW	Cut and Cover	ENVIROSTOR	Facility was evaluated by the LARWQCB in relation to metals and volatile organic compound impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements" and is listed as "Completed - Case Closed" as of 12/22/14.	Low	
E2B-18	23	316	S106484432	BURBANK FOUNDRY INC.	3083 N. CALIFORNIA ST.	2137 ft (0.4 mi) ENE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to volatile organic compound impacts to an aquifer used for drinking water. The facility is listed as "Completed - Case Closed" as of 8/25/95.	Low	
E2B-19	23	387	S106484454	ABBY RENTS	2333 N. VALLEY ST.	3145 ft (0.6 mi) SW	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to chromium VI impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements" in relation to a soil investigation and is listed as "Completed - Case Closed" as of 12/23/14.	Low	
E2B-20	23	316	S104827433	CAL-AIR PROCESSING	3014 N. HOLLYWOOD WAY.	1104 ft (0.21 mi) ENE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to chromium VI impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements" and is listed as "Completed - Case Closed" as of 12/23/14.	Low	
E2B-21	23	316	U002286741, S114591373, S114591375	CAMELOT PRESS	2815 LIMA ST N	1476 ft (0.28 mi) ESE	Cut and Cover	LUST, RGA LUST	Facility was evaluated by the LARWQCB in relation to a leaking underground storage tank case where fuel may have impacted an aquifer used for drinking water. The facility was determined to need "No Further Requirements" and is listed as "Completed - Case Closed" as of 12/27/96.	Low	
E2B-23	23	372	S114595810, S114599402, S114595813, S101295678, S114595811	CHEVRON STATION #9-0839	2650 HOLLYWOOD WAY	1529 ft (0.29 mi) SE	Cut and Cover	LUST, RGA LUST	Facility was evaluated by the LARWQCB in relation to a leaking underground storage tank case where gasoline impacted the soil. The facility is listed as "Completed - Case Closed" as of 11/5/01.	Low	
E2B-24	23	316	S113804585	COMCO, INC	2151 NORTH LINCOLN STREET	5033 ft (0.95 mi) ESE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to a chromium VI and volatile organic compound impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Action" and is listed as "Completed - Case Closed" as of 9/22/2015.	Low	
E2B-25	23	316	1006825838	CONNELL PROCESSING INC	3094 N AVON ST	1560 ft (0.3 mi) ENE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to metals and volatile organic compound impacts to soil and an aquifer used for drinking water. The facility is listed as "Completed - Case Closed" as of 3/27/87.	Low	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	DATABASES	Case Background	Priority	Associated with the Superfund Site (Area #1)
E2B-26	23	316	S100859292	CONNELL PROCESSING INC,CONNELL PROC CORP	3080 N AVON ST	1542 ft (0.29 mi) ENE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to metals and volatile organic compound impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements" and is listed as "Completed - Case Closed" as of 3/27/87.	Low	
E2B-27	23	316	S102628781, S114607665, 1017428036, S114607667	CRANE CO, HYDRO-AIRE V	3000 WINONA AVE	2832 ft (0.54 mi) ESE	Cut and Cover	TRIS,LUST,RGA LUST,SLIC	Facility was evaluated by the LARWQCB in relation to metals and volatile organic compound impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements" and is listed as "Completed - Case Closed" as of 3/30/05. ¹	Low	X
E2B-28	23	387	1000818183	DUNLAP BOTT CHALCO CORP	2323 VALLEY ST	3168 ft (0.6 mi) SW	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to chromium VI impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements with respect to soils only" and is listed as "Completed - Case Closed" as of 8/28/14.	Low	
E2B-29	23	408	1000473071	EI DUPONT DENEMOURS & CO	3300 PACIFIC AVE	4517 ft (0.86 mi) SSE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to metal and volatile organic compound impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements" and is listed as "Completed - Case Closed" as of 12/23/14. ¹	Low	X
E2B-30	23	316	S112274185	FORMER B-G DETECTION SERVICE FACILITY	3071 N. LIMA STREET	1815 ft (0.34 mi) ENE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to metals impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements for soils only" and is listed as "Completed - Case Closed" as of 3/25/13.	Low	
E2B-31	23	387	S100222505	FORMER LOCKHEED PLANT B-5	4207 EMPIRE AVENUE	2799 ft (0.53 mi) SW	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to metal and volatile organic compound impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements for soils only" based on investigations in 2001 and is listed as "Completed - Case Closed" as of 6/29/04.	Low	
E2B-32	23	316	S107473150	FORMER TWISS HEATING & TREATING	2503 NORTH ONTARIO BLVD.	2253 ft (0.43 mi) ESE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to volatile organic compound impacts to soil. The facility was determined to need "No Further Requirements" as of 12/17/97. ¹	Low	X
E2B-33	23	316	1000686643	GRAPHIC ART SYSTEMS INC	2150 N LINCOLN ST	5127 ft (0.97 mi) ESE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in 2001 in relation to chromium VI and volatile organic compound impacts to soil and an aquifer used for drinking. The facility was determined to need "No Further Requirements" and is listed as "Completed - Case Closed" as of 12/22/14.	Low	
E2B-34	23	316	S102860886	HUGHEY & PHILLIPS INC	3050 CALIFORNIA STREET	2132 ft (0.4 mi) ENE	Cut and Cover	ENVIROSTOR	Facility was evaluated by the DTSC and is listed as "No Further Action" as of 2/2/95.	Low	
E2B-35	23	316	U001568408	IMAGE TRANSFORM L	3611 N SAN FERNANDO BLVD	770 ft (0.15 mi) ENE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to metal impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Investigation" and is listed as "Completed - Case Closed" as of 12/31/96.	Med	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	DATABASES	Case Background	Priority	Associated with the Superfund Site (Area #1)
E2B-36	23	316	1000175608	JANCO CORPORATION	3111 WINONA AVE	2036 ft (0.39 mi) ESE	Cut and Cover	SLIC,ENVIROSTOR	Facility was evaluated by the LARWQCB in relation to metals and volatile organic compound impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements" and is listed as "Completed - Case Closed" as of 3/2/15. ¹	Low	X
E2B-37	23	316	S106484422	JAY DEE AIRCRAFT SUPPLY	2917 THORNTON AVE	3106 ft (0.59 mi) SE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to chromium VI impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements" and is listed as "Completed - Case Closed" as of 12/19/14.	Low	
E2B-38	23	316	S106484423	JAY-DEE AIRCRAFT SUPPLY CO.INC	2921 THORNTON AVE.	3098 ft (0.59 mi) SE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to chromium VI impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements" and is listed as "Completed - Case Closed" as of 12/19/14.	Low	
E2B-39	23	316	S101584875	K M RECORDS INC	2980 N ONTARIO ST	2463 ft (0.47 mi) ENE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to chromium VI impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements" based on an investigation in 2005 and is listed as "Completed - Case Closed" as of 12/23/14.	Low	
E2B-40	23	316	S102414757	KAHR BEARING, A DOVER SARGENT	3010 N SAN FERNANDO BL	2588 ft (0.49 mi) ENE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to volatile organic compound impacts to an aquifer used for drinking water. The facility is listed as "Open - Inactive" as of 10/29/14. ¹	Med	X
E2B-41	23	408	S106484419	LEE FILTERS (FORMER ZIPCO)	2237 HOLLYWOOD	4051 ft (0.77 mi) SSE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to chromium VI impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements" and is listed as "Completed - Case Closed" as of 12/19/14.	Low	
E2B-42	23	389	S106484476	LOCKHEED A-1 EAST	3401 W EMPIRE AVE	3055 ft (0.58 mi) SSE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to hydrocarbon and volatile organic compound impacts to soil and an aquifer used for drinking water. The facility is listed as "Open - Site Assessment" as of 7/17/96. ¹	Low	X
E2B-43	23	316	S106484475	LOCKHEED A-1 EAST, BLDG 90	3110 W THORNTON AVE	2431 ft (0.46 mi) SE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to volatile organic compound impacts to an aquifer used for drinking water. The facility is listed as "Open - Remediation as of 10/30/98. ¹	Med	X
E2B-45	23	389	S110494012	LOCKHEED CORP./ENV SYSTEMS & TECH	2550 N. HOLLYWOOD WAY #305	2149 ft (0.41 mi) SSE	Cut and Cover	ENVIROSTOR	Facility is listed as having a tiered permit. No spills have been reported.	Low	
E2B-46	23	408	S101587292	LOCKHEED PLANE A-1 SOUTH	2311 N HOLLYWOOD WAY	3615 ft (0.68 mi) SSE	Cut and Cover	SLIC	Facility is listed as "Open - Remediation" as of 5/24/1995 due to semi-volatile organic compounds and volatile organic compound impacts to an aquifer used for drinking water. ¹	Low	X
E2B-47	23	389	S114644692, S114644691, S103945706, S114644687, S114644693, S101582663, 1015732629, S103646938	LOCKHEED PLANT A-1, LOCKHEED PLANT A-1-F, LOCKHEED AIRCRAFT CORPORATION	2555 HOLLYWOOD WAY N	2149 ft (0.41 mi) SSE	Cut and Cover	CERCLIS-NFRAP,LUST,RGA LUST,SLIC,ENVIROSTOR	Facility was evaluated by the LARWQCB in relation to metal and volatile organic compound impacts to soil and an aquifer used for drinking water. The facility is listed as "Open - Remediation" as of 9/24/01. ¹	Med	X

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	DATABASES	Case Background	Priority	Associated with the Superfund Site (Area #1)
E2B-48	23	389	S114644686	LOCKHEED PLANT A-1-F	255 HOLLYWOOD WY	2149 ft (0.41 mi) SSE	Cut and Cover	RGA LUST	Facility was evaluated by the LARWQCB in relation to metals and volatile organic compound impacts to soil and an aquifer used for drinking water. The facility is listed as "Open - Remediation" as of 10/31/96. ¹	Med	X
E2B-49	23	316	S114644703, S114644702, S101295680, S114644704, S103649152	LOCKHEED PLANT B-6	2801 HOLLYWOOD WAY N	277 ft (0.05 mi) ENE	Cut and Cover	LUST,RGA LUST,SLIC	Facility was evaluated by the LARWQCB in relation to metals and volatile organic compound impacts to soil and an aquifer used for drinking water. The facility is listed as "Open - Remediation" as of 10/31/96. ¹	High	X
E2B-50	23	316	S104915019	LOCKHEED-B6-371	2960 HOLLYWOOD WAY	1042 ft (0.2 mi) ENE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to volatile organic compound impacts to soil and an aquifer used for drinking water. The facility is listed as "Open - Site Assessment" as of 1/27/15. ¹	High	X
E2B-51	23	316	1000306879	MAGNA PLATING COMPANY	3063 NORTH CALIFORNIA STREET	2105 ft (0.4 mi) ENE	Cut and Cover	SLIC,ENVIROST OR	Facility was evaluated by the LARWQCB in relation to metals and volatile organic compound impacts to soil and an aquifer used for drinking water. The facility is listed as "Open - Site Assessment" as of 9/29/05.	Med	
E2B-52	23	316	S103650761, U001568367	MEL BERNIE & CO., INC.	3000 EMPIRE AVENUE	3850 ft (0.73 mi) SE	Cut and Cover	SLIC,ENVIROST OR	Facility was evaluated by the LARWQCB in relation to chromium VI impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements" and is listed as "Completed - Case Closed" as of 12/23/14. ¹	Low	X
E2B-53	23	316	S102812673	MID VALLEY ANODIZING	3075 N CALIFORNIA ST	2134 ft (0.4 mi) ENE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to metals and volatile organic compound impacts to soil and an aquifer used for drinking water. The facility is listed as "Completed - Case Closed" as of 11/3/15.	Low	
E2B-54	23	316	S117624723	PACIFIC AIRMOTIVE CORPORATION	2940/2840 NORTH HOLLYWOOD WY	1018 ft (0.19 mi) ENE	Cut and Cover	SLIC	See below.	High	
E2B-55	23	316	S104915023, 0170188, S114665215, S114665214, S114665216, 1000725966, 1015732718	PACIFIC AIRMOTIVE CORPORATION	2940 HOLLYWOOD WAY N	1018 ft (0.19 mi) ENE	Cut and Cover	CERCLIS-NFRAP,ERNS,L UST,RGA LUST,ENVIROST OR	Facility was evaluated by the LARWQCB in relation to volatile organic compound impacts to soil and an aquifer used for drinking water. The facility is listed as "Open - Remediation" as of 5/31/99.	High	
E2B-56	23	316	1000209850, 1000209849, S114720502, S114720504	PH BURBANK, WEBER AIRCRAFT INC	2820 N ONTARIO ST	2318 ft (0.44 mi) ENE	Cut and Cover	LUST,RGA LUST,SLIC	Facility was evaluated by the LARWQCB in relation to metals and volatile organic compound impacts to soil and an aquifer used for drinking water. The facility is listed as "Open - Remediation" as of 1/10/94. ¹	Med	X
E2B-57	23	372	S106483563	PREMIER CLEANERS (FORMER)	2708 NORTH HOLLYWOOD WAY	1287 ft (0.24 mi) SE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to volatile organic compound impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements for soils only" and is listed as "Completed - Case Closed" as of 12/23/14.	Low	
E2B-58	23	316	S106661719	PREMIER DRY CLEANING	3238 N SAN FERNANDO BLVD	1909 ft (0.36 mi) ENE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to volatile organic compound impacts to soil and an aquifer used for drinking water. The facility is listed as "Completed - Case Closed" as of 4/15/88.	Low	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	DATABASES	Case Background	Priority	Associated with the Superfund Site (Area #1)
E2B-59	23	316	S106484436	PROCESS CONTROL L S	2520 N. ONTARIO ST. #D	2290 ft (0.43 mi) ESE	Cut and Cover	SLIC,ENVIROSTOR	Facility was evaluated by the LARWQCB in relation to volatile organic compound impacts to an aquifer used for drinking water. The facility was determined to need "No Further Requirements" and is listed as "Completed - Case Closed" as of 12/23/14.	Low	
E2B-60	23	316	S114673145, S100228023, S114673144, S114673143	QUEEN CITY SHELL INC.	2801 SAN FERNANDO BLVD N	3049 ft (0.58 mi) ENE	Cut and Cover	LUST,RGA LUST	Facility was evaluated by the LARWQCB in relation to a leaking underground storage tank case where gasoline impacted soil and an aquifer used for drinking water. The facility is listed as "Completed - Case Closed" as of 11/5/01.	Low	
E2B-62	23	316	1006834661	SIERRACIN-HARRISON	3020 EMPIRE AVE.	3764 ft (0.71 mi) SE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to metals and volatile organic compound impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements" and is listed as "Open - Inactive" as of 10/29/14. ¹	Low	X
E2B-63	23	316	S113026331	SPACE-LOK INC	2526 NORTH ONTARIO STREET	2280 ft (0.43 mi) ESE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to chromium VI impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements for soils only" following a soil assessment and is listed as "Completed - Case Closed" as of 10/21/15. ¹	Low	X
E2B-64	23	316	1014352264	SENIOR AEROSPACE INC SSP V	2980 N. SAN FERNANDO BLVD.	2838 ft (0.54 mi) ENE	Cut and Cover	TRIS	No releases to soil or groundwater were reported.	Low	
E2B-65	23	316	1000431948	STEVE'S PLATING CORPORATION	3111 NORTH SAN FERNANDO BLVD.	1944 ft (0.37 mi) ENE	Cut and Cover	SLIC,ENVIROSTOR	Facility was evaluated by the LARWQCB in relation to chromium and volatile organic compound impacts to an aquifer used for drinking water. The facility is listed as "Open - Inactive" as of 1/28/16. ¹	Med	X
E2B-66	23	316	U002285096, S114696972, S114696974	SUN BANK	3110 WINONA AVE	2025 ft (0.38 mi) ESE	Cut and Cover	LUST,RGA LUST	Facility was evaluated by the LARWQCB in relation to hydrocarbon impacts to soil. The facility is listed as "Completed - Case Closed" as of 11/5/01.	Low	
E2B-67	23	387	S108974267	THE HERTZ CORP.	4521 EMPIRE AVE.	3379 ft (0.64 mi) SW	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to metal impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements" and is listed as "Completed - Case Closed" as of 12/22/14.	Low	
E2B-68	23	316	S106484437	THE PATRICK TATOPOULOS DESIGNS	1951 ONTARIO ST	4294 ft (0.81 mi) SSE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to chromium VI and volatile organic compound impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Action" and was is listed as "Completed - Case Closed" as of 8/25/1995.	Low	
E2B-69	23	316	S106484427	U.S. L EL CORP.	3100 W. VANOWEN ST	3816 ft (0.72 mi) SE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to metal impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements" and is listed as "Open - Inactive" as of 12/19/14.	Low	
E2B-70	23	316	1000283248	VALLEY ENAMELING CORP	2509 NORTH ONTARIO STREET	2246 ft (0.43 mi) ESE	Cut and Cover	SLIC	Facility was evaluated by the LARWQCB in relation to chromium VI impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements" and is listed as "Completed - Case Closed" as of 12/23/14. ¹	Low	X
E2B-71	23	392	S107737541	VEGA AIRCRAFT		2575 ft (0.49 mi) SSE	Cut and Cover	ENVIROSTOR	Facility was evaluated by the DTSC in relation to a Formerly Used Defense Site. The facility is listed as "Inactive - Needs Evaluation" as of 7/1/05.	Med	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	DATABASES	Case Background	Priority	Associated with the Superfund Site (Area #1)
E2B-73	23	316	1000278339, S114723183, S114723182	WORLD OIL #25	2417 SAN FERNANDO BLVD N	4436 ft (0.84 mi) ESE	Cut and Cover	LUST,RGA LUST	Facility was evaluated by the LARWQCB in relation to chromium VI impacts to soil and an aquifer used for drinking water. The facility was determined to need "No Further Requirements following soil vapor extraction remediation" and is listed as "Completed - Case Closed" as of 6/26/06.	Low	
E2B-74	23	316	S100280525		2428 NORTH ONTARIO ST.	2479 ft (0.47 mi) ESE	Cut and Cover	CHMIRS	An incident was reported in 1988. No further information was provided.	Low	
E2B-75	23	389	S100833478	LOCKHEED-BURBANK PLANTS A-1, B-1, B-6 & C-1	2555 N. HOLLYWOOD WAY	2149 ft (0.41 mi) SSE	Cut and Cover	CA BOND EXP. PLN	Facility is listed to be one of the responsible parties for the impacts to the San Fernando Valley groundwater basin resulting in the current Superfund site. Historical usage at the facility related to aircraft manufacturing and research resulted in PCE, TCE, and VOC impacts. Monitoring and remediation is reported to be in progress.¹	High	X
E2B-76	23	316	1000115930	L. A. GAUGE CO INC	7440 SAN FERNANDO RD	702 ft (0.13 mi) ENE	Cut and Cover	SLIC	The facility is reported to have performed SVE in relation to VOC impacts to soil at the site. SVE wells were reported to have been screened at depths ranging from 10 to 135 feet bgs. A soil gas rebound test was performed in 1998 and the LARWQCB subsequently issued a notice of "No Further Requirements" in February 1997. The site status is listed as "Completed - Case Closed" as of 12/1/1998.¹	Low	X
E2B-77	23	358	S114644706, S100356219, S114644707	LOCKHEED PLANT C-1	10720 SHERMAN WAY	3564 ft (0.68 mi) WSW	Cut and Cover	SLIC, RGA LUST, HIST CORTESE, LUST	LUST (S100356219) - Facility is listed to have impacted an aquifer used for drinking water supply with solvents. Site status is listed as "Completed - Case Closed" as of 12/7/1994. SLIC (S100356219) - Facility is listed to have impacted soil and an aquifer used for drinking water supply with metals (Chromium) and VOCs. Approximately 110,000 tons of impacted soil were removed from the site. A notice of "No Further Remediation" for soil was issued in 1990 and 1994. Continued remediation for the impacted aquifer is reported and site status is listed as "Open - Remediation" as of 7/28/1992.¹	Low	X
E2B-78	23	358	1003878490, U001568412	PAC AIRCRAFT ENGINEERING CTR, ME A AVIATION	3000 N CLYBOURN AVE	2998 ft (0.57 mi) WSW	Cut and Cover	CERCLIS-NFRAP, SLIC	CERCLIS-NFRAP (1003878490) - Site is listed to "not qualify for the NPL based on existing information" as of 1981. SLIC (U001568412) - Facility was evaluated by the LARWQCB in 2005 in relation to a chromium VI source assessment for the area. The facility was determined to need "No Further Requirements" in relation to the investigation in 2005 and is listed as "Completed - Case Closed" as of 12/23/2014.	Low	
E2B-79	23	316	S100274773		LOCKHEED BLDG #199	7 ft (0 mi) WSW	Cut and Cover	CHMIRS	An incident is reported in 1990. The media impacted and COCs involved are not reported.	Med	
E2B-80	N/A	49	S122356468	FORMER ADEL PRECISION PRODUCTS - ADEL PRECISION PRODUCTS	10635-10703, 10725 VANOWEN	4307 ft (0.82 mi) WSW	Cut and Cover	CPS-SLIC	The facility is listed to have impacted an aquifer used for drinking water supply, soil, and soil vapor with chromium VI, PCE, and TCE due to historic aerospace industry operations. Current site status is listed to be "Open-Site Assessment."	Low	
E2B-81	N/A	52	1000168300	PRICE CLUB	10950 SHERMAN WY	4994 ft (0.95 mi) WSW	Cut and Cover	ENVIROSTOR, HIST Cortese, LA Co. Site Mitigation	Facility was evaluated for impacts due to usage (fuel station, etc.) in 2011. Abatement for an unspecified compound was listed to have occurred and been performed.	Low	

HSR Site No.	EDR FOCUS_MAP	EDR MAP_ID	ENVID	NAME	ADDRESS	Distance and Direction of Site and Groundwater Gradient (if applicable)	Grade	DATABASES	Case Background	Priority	Associated with the Superfund Site (Area #1)
E2B-82	N/A	222	S108196068	LOCKHEED AIR TERMINAL	2627 NORTH HOLLYWOOD WAY	1629 ft (0.31 mi) SSE	Cut and Cover	ENVIROSTOR, CHMIRS	ENVIROSTOR - Facility was evaluated by the LARWQCB for potential impacts by halogenated solvents with "historical" listed for the site type with the last status date of 5/12/95. CHMIRS - An incident was reported in September 2013 stated that a blockage on private property created an overflow of raw sewage to a storm drain.	Med	
E2B-83	N/A	AF191	1000685953	AMERIFLIGHT	4700 EMPIRE AVE HANGER ONE	3068 ft (0.58 mi) SW	Cut and Cover	LUST, CA FID UST	The facility is listed to have contained a LUST that impacted an unknown media. The case is listed as "Completed - Case Closed" with a status date of 12/15/92.	Low	
E2B-84	N/A	AF197	S104406389	MERCURY AIR SERVICES	4331 EMPIRE AVE W	2994 ft (0.57 mi) SW	Cut and Cover	HIST CORTESE, LUST	The facility is listed to have impacted soil with aviation fuel. The status is listed to be "Completed - Cased Closed" as of 11/16/2011.	Low	
E2B-85	N/A	AN214, AN215	S101586348, S100948720	R J MYERS & SONS, INCORPORATED	7333 CLYBOURN AVE	3002 ft (0.57 mi) SW	Cut and Cover	HIST CORTESE, LUST	The facility is listed to have impacted soil with aviation fuel. The status is listed to be "Completed - Cased Closed" as of 6/5/1984.	Low	
E2B-86	N/A	B31, B32, B34	S114683121, S114672991, S104406393	QUALITY AUTO REPAIR, SARKIS KRİKORIAN LEONS CO	10740 VANOWEN ST	4652 ft (0.88 mi) WSW	Cut and Cover	RGA LUST, LUST, HIST CORTESE	The facility is listed to have impacted soil with diesel and gasoline. The status is listed to be "Completed - Cased Closed" as of 4/20/2015.	Low	
E2B-87	N/A	B8, B9	S122356477, S122354302	SUB-AREA OF FORMER ADEL PRECISION PRODUCTS	10717 VANOWEN	4566 ft (0.86 mi) WSW	Cut and Cover	CPS_SLIC	The facility is listed to have impacted soil and soil vapor with VOCs (PCE/TCE). The case is listed with a status of "Completed - Case Closed" as of 5/30/2018.	Low	
E2B-88	N/A	0	1000709322	SAN FERNANDO VALLEY (AREA 1)	NORTH HOLLYWOOD WELLFIELD AREA	0 ft	Cut and Cover	NPL, PRP, RODS, SEMS, CORTESE, ENVIROSTOR, CONSENT, ENG CONTROLS, HIST CALSITES, INST CONTROL	The case is in relation to the impacted groundwater of the San Fernando Valley Basin by TCE, PCE, and carbon tetrachloride and chloroform to a lesser extent. The impact is basically valley wide and has impacted groundwater used for drinking water. Remediation of the water is ongoing and has been divided into different areas for characterization, status, and remediation purposes. ¹	High	X
E2B-89	23	316	S108214030	STAINLESS STEEL PRODUCTS INC.	2980 N. SAN FERNANDO BLVD.	2838 ft (0.54 mi) ENE	Cut and Cover	TRIS	Facility was evaluated by the LARWQCB in relation to metals and volatile organic compound impacts to soil and an aquifer used for drinking water. The facility is listed as "Open - Site Assessment" as of 9/21/12. ¹	Low	X
E2B-90	29	597	S107735858	OCEAN TECHNOLOGY INC	2835 NAOMI ST N	3675 ft (0.7 mi) ENE	Cut and Cover	HIST Cortese, LUST, RGA LUST	Facility was evaluated by the LARWQCB in relation to acetone impacts to soil and an aquifer used for drinking water. The facility is listed as "Completed - Case Closed" as of 2/11/97. ¹	Low	X
E2B-91	29	500	1003878774	DUNRITE METAL PLATING	3055 CALIFORNIA ST	2136 ft (0.4 mi) ENE	Cut and Cover	CERCLIS-NFRAP	Site is not listed on the NPL.	Low	

¹ The site is included in a group of industrial facilities that are documented to be included as "Responsible Parties" in relation to the San Fernando Valley Superfund Site for VOC/solvent/metal/chlorinated hydrocarbon impacts to groundwater used for drinking water. Listed sites with the same designation have the Case Background description associated with the listing presented in BOLD font and contain an "X" in the "Associated with the Superfund Site (Area #1)" column. While the San Fernando Superfund Site currently has a status of "Open - Remediation" or similar, some of the associated sites may have since been closed or have a status of "Completed - Case Closed". The remaining sites continue to be open and undergoing remediation for the associated contamination.