

# Appendix I

---

Preliminary Geotechnical Interpretive Report

January 13, 2021

Fuego Farms LLC  
C/O Willy Ventura  
**Ventura Engineering**  
27393 Ynez Rd., Suite 159  
Temecula, CA 92591

Project No. 203306-10A

**Subject: Preliminary Geotechnical Interpretive Report, Proposed Cannabis Cultivation Facility, APN 933-020-005-6, Located at 22750 Carancho Road, Temecula Area, Riverside County, California**

Earth Strata Geotechnical Services is pleased to present our preliminary geotechnical interpretive report for the proposed development, Assessor's Parcel Number 933-020-005-6, located at 22750 Carancho Road in the Temecula area of Riverside County, California. This work was performed in accordance with the scope of work described in our proposal, dated October 6, 2020. The purpose of this study is to evaluate the nature, distribution, engineering properties, and geologic strata underlying the site with respect to the proposed development.


Earth Strata Geotechnical Services appreciates the opportunity to offer our consultation and advice on this project. In the event that you have any questions, please do not hesitate to contact the undersigned at your earliest convenience.

Respectfully submitted,

EARTH STRATA GEOTECHNICAL SERVICES



Stephen M. Poole, PE, GE  
Principal Engineer

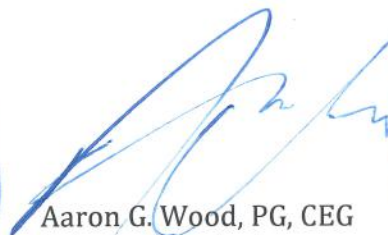

Aaron G. Wood, PG, CEG  
Principal Geologist



SMP/hr

Distribution: (2) Addressee

## TABLE OF CONTENTS

<u>Section</u>	<u>Page</u>
INTRODUCTION .....	1
SITE DESCRIPTION .....	1
<b>PROPOSED DEVELOPMENT AND GRADING</b> .....	1
FIELD EXPLORATION AND LABORATORY TESTING .....	3
Field Exploration.....	3
Laboratory Testing .....	3
FINDINGS.....	3
Regional Geology.....	3
Local Geology .....	4
Faulting .....	6
Landslides.....	6
CONCLUSIONS AND RECOMMENDATIONS .....	6
General .....	6
Earthwork.....	7
Earthwork and Grading .....	7
Clearing and Grubbing .....	7
Excavation Characteristics .....	7
Groundwater .....	7
Ground Preparation for Fill Areas .....	7
Oversize Rock .....	8
Compacted Fill Placement .....	8
Import Earth Materials .....	8
Cut/Fill Transitions .....	9
Cut Areas .....	9
Shrinkage, Bulking and Subsidence .....	10
Geotechnical Observations .....	10
Post Grading Considerations .....	10
Slope Landscaping and Maintenance .....	10
Site Drainage .....	10
Utility Trenches.....	11
SEISMIC DESIGN CONSIDERATIONS.....	11
Ground Motions.....	11
Secondary Seismic Hazards .....	12
Liquefaction and Lateral Spreading .....	13
General .....	13
Allowable Bearing Values.....	13
Settlement.....	13
Lateral Resistance.....	14
Structural Setbacks and Building Clearance .....	14
Foundation Observations .....	15
Expansive Soil Considerations .....	16
Medium Expansion Potential (Expansion Index of 51 to 90).....	16
Footings.....	16
Building Floor Slabs.....	16

<b>Post Tensioned Slab/Foundation Design Recommendations</b> .....	18
<b>Corrosivity</b> .....	19
<b>RETAINING WALLS</b> .....	20
<b>Active and At-Rest Earth Pressures</b> .....	20
<b>Subdrain System</b> .....	21
<b>Temporary Excavations</b> .....	21
<b>Retaining Wall Backfill</b> .....	21
<b>CONCRETE FLATWORK</b> .....	22
<b>Thickness and Joint Spacing</b> .....	22
<b>Subgrade Preparation</b> .....	22
<b>SLOPE STABILITY</b> .....	22
<b>Deep Seated Stability</b> .....	22
<b>Surficial Stability</b> .....	23
<b>Slope Stability Results</b> .....	23
<b>GRADING PLAN REVIEW AND CONSTRUCTION SERVICES</b> .....	23
<b>REPORT LIMITATIONS</b> .....	24

Attachments:

- Figure 1 – Vicinity Map (Page 2)
- Figure 2 – Regional Geologic Map (Page 5)
- APPENDIX A – References (Rear of Text)
- APPENDIX B – Exploratory Logs (Rear of Text)
- APPENDIX C – Laboratory Procedures and Test Results (Rear of Text)
- APPENDIX D – Seismicity (Rear of Text)
- APPENDIX E - Slope Stability Analysis (Rear of Text)
- APPENDIX F – General Earthwork and Grading Specifications (Rear of Text)
- Plate 1 – Geotechnical Map (Rear of Text)
- Plate 2 – Overall Site Map (Rear of Text)
- Plate 3 – Geotechnical Cross Section (Rear of Text)

## **INTRODUCTION**

Earth Strata Geotechnical Services is pleased to present our preliminary geotechnical interpretive report for the proposed development. The purpose of this study was to evaluate the nature, distribution, engineering properties, and geologic strata underlying the site with respect to the proposed development, and then provide preliminary grading and foundation design recommendations based on the plans you provided. The general location of the subject property is indicated on the Vicinity Map, Figure 1. The plans you provided were used as the base map to show geologic conditions within the subject site, see Geotechnical Map, Plate 1.

## **SITE DESCRIPTION**

The subject property is located at 22750 Carancho Road in the Temecula area of Riverside County, California. The approximate location of the site is shown on the Vicinity Map, Figure 1.


The subject property is comprised of approximately 72.15 acres of undeveloped land. The site has not been graded. Topographic relief at the subject property is relatively high with the terrain being generally hilly and sloping. Elevations at the site range from approximately 1650 to 1280 feet above mean sea level (msl), for a difference of about  $370\pm$  feet across the entire site. Drainage within the subject property generally flows to the southeast.

The site is currently bordered by residential development to the east and south, as well as vacant land to the north and west. Most of the vegetation on the site consists of dense amounts of native vegetation along with small to large trees throughout the subject site.

## **PROPOSED DEVELOPMENT AND GRADING**

The proposed commercial development is expected to consist of concrete, wood or steel framed one- and/or two-story structures utilizing slab on grade construction with associated streets, landscape areas, and utilities. The current development plans include sixteen greenhouse structures and a steel structure positioned in the southern corner of the site.

The plans provided by you were utilized in our exploration and form the base for our Geotechnical Map, Plate 1. The plans call for proposed 2:1 cut slopes on the order of 15 feet high and 2:1 fill slopes on the order of 46 feet high. Cuts and fills up to 18 and 28 feet, respectively are proposed to reach design grades. Retaining walls up to 15 feet high are planned to support level backslope conditions.

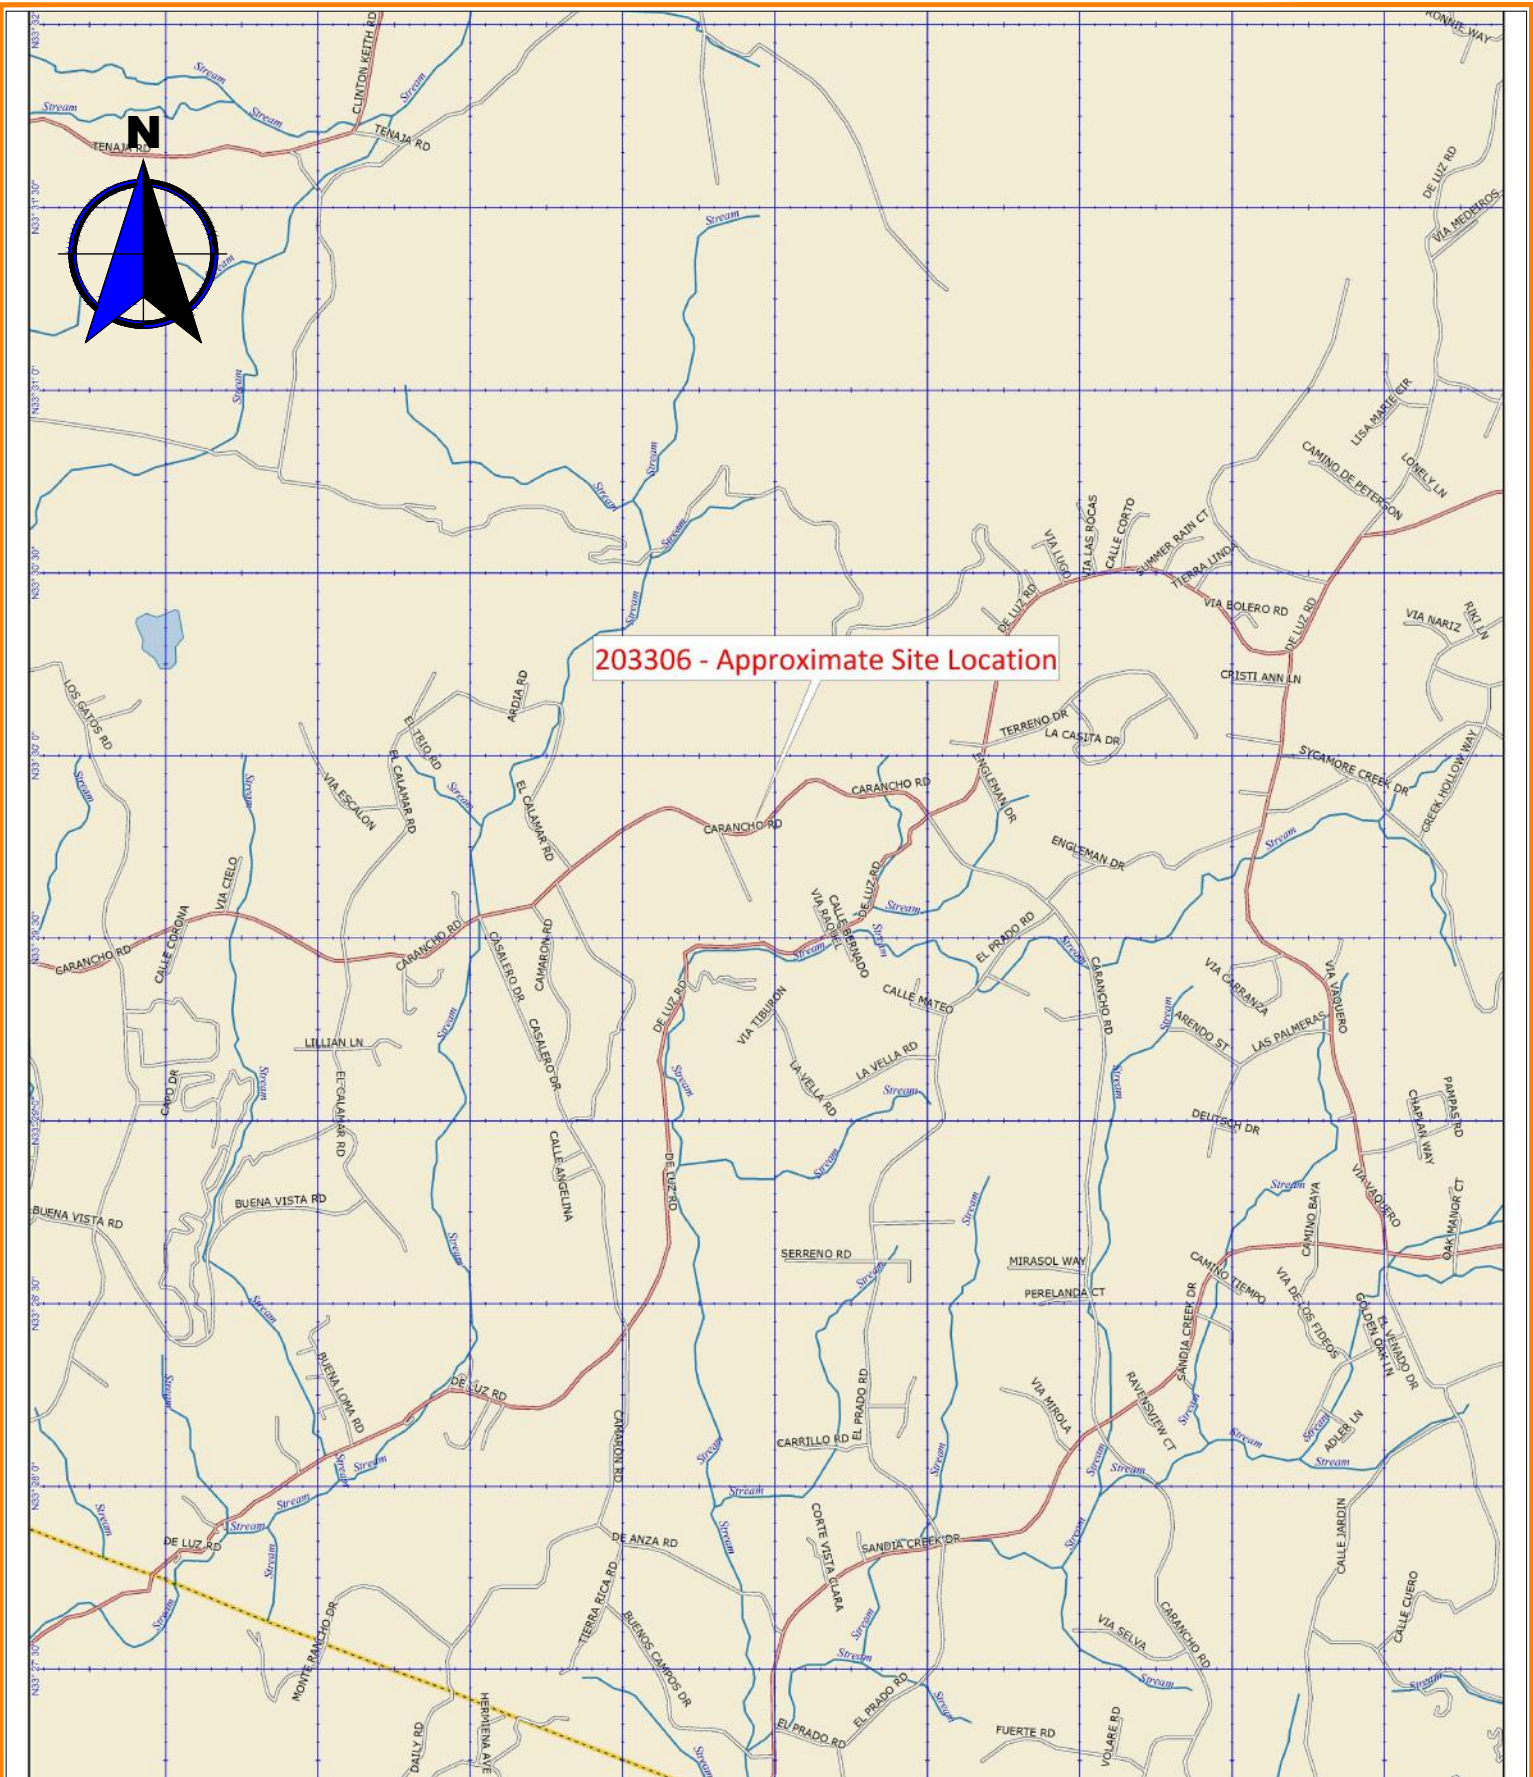

© 2007 DeLorme (www.delorme.com) Topo USA®.

Earth Strata Geotechnical Services, Inc.  
 Geotechnical, Environmental and Materials Testing Consultants  
 www.ESGSINC.com (951) 397-8315

PROPOSED CANNABIS CULTIVATION FACILITY		203306-10A
VICINITY MAP		SCALE 1:40,625
JAN 2021	FIGURE 1	

## **FIELD EXPLORATION AND LABORATORY TESTING**

### **Field Exploration**

Subsurface exploration within the subject site was performed on November 17, 2020 and January 8, 2021 for the exploratory excavations. A mini excavator was utilized to excavate thirteen (13) test pits to a maximum depth of 6 feet. Test Pits TP-1 through TP-7 were excavated in the northern portion of the site out of the development area (See Overall Site Map) and Test Pits TP-8 through TP-13 were excavated in the southern portion of the site within the proposed development area (See Geotechnical Map). An underground utilities clearance was obtained from Underground Service Alert of Southern California, prior to the subsurface exploration.

Earth materials encountered during exploration were classified and logged in general accordance with the Standard Practice for Description and Identification of Soils (Visual-Manual Procedure) of ASTM D 2488. Upon completion of laboratory testing, exploratory logs and sample descriptions may have been reconciled to reflect laboratory test results with regard to ASTM D 2487.

Associated with the subsurface exploration was the collection of bulk (disturbed) samples of earth materials for laboratory testing and analysis. The approximate exploratory locations are shown on the Geotechnical Map, Plate 1 and the Overall Site Map, Plate 2. The descriptive logs are presented in Appendix B.

### **Laboratory Testing**

Maximum dry density/optimum moisture content, expansion potential, pH, resistivity, sulfate content, chloride content, and in-situ density/moisture content were determined for selected undisturbed and bulk samples of earth materials, considered representative of those encountered. An evaluation of the test data is reflected throughout the Conclusions and Recommendations section of this report. A brief description of laboratory test criteria and summaries of test data are presented in Appendix C.

## **FINDINGS**

### **Regional Geology**

Regionally, the site is located in the Peninsular Ranges Geomorphic Province of California. The Peninsular Ranges are characterized by northwest trending steep mountain ranges separated by sediment filled elongated valleys. The dominant structural geologic features reflect the northwest trend of the province. Associated with and subparallel to the San Andreas Fault are the San Jacinto Fault, Newport-Inglewood, and the Whittier-Elsinore Fault. The Santa Ana Mountains abut the west side of the Elsinore Fault while the Perris Block forms the other side of the fault zone to the east. The Perris Block is bounded to the east by the San Jacinto Fault. The northern perimeter of the Los Angeles basin forms part of a northerly dipping blind thrust fault at the boundary between the Peninsular Ranges Province and the Transverse Range Province.

The mountainous regions within the Peninsular Ranges Province are comprised of Pre-Cretaceous, metasedimentary, and metavolcanic rocks along with Cretaceous plutonic rocks of the Southern California Batholith. The low lying areas are primarily comprised of Tertiary and Quaternary non-marine alluvial


sediments consisting of alluvial deposits, sandstones, claystones, siltstones, conglomerates, and occasional volcanic units. A map illustrating the regional geology is presented on the Regional Geologic Map, Figure 2.

### **Local Geology**

The earth materials on the site are primarily comprised of topsoil and bedrock. A general description of the dominant earth materials observed on the site is provided below:

- Topsoil (no map symbol): Residual topsoil, encountered in the upper 1 to 2 feet, blankets the site and underlying bedrock. These materials were noted to be generally light yellowish brown to dark reddish brown, sandy clay to silty sand which were very porous, dry to moist and in a loose state.
- Cretaceous Tonalite (map symbol Kt): The Tonalite was encountered below the topsoil across the site. The Tonalite was generally noted to be yellowish brown to olive brown, slightly moist to moist and was found to be in a moderately hard to very hard state. Typically, the upper 1 to 3 feet of this unit is more weathered and not as hard.



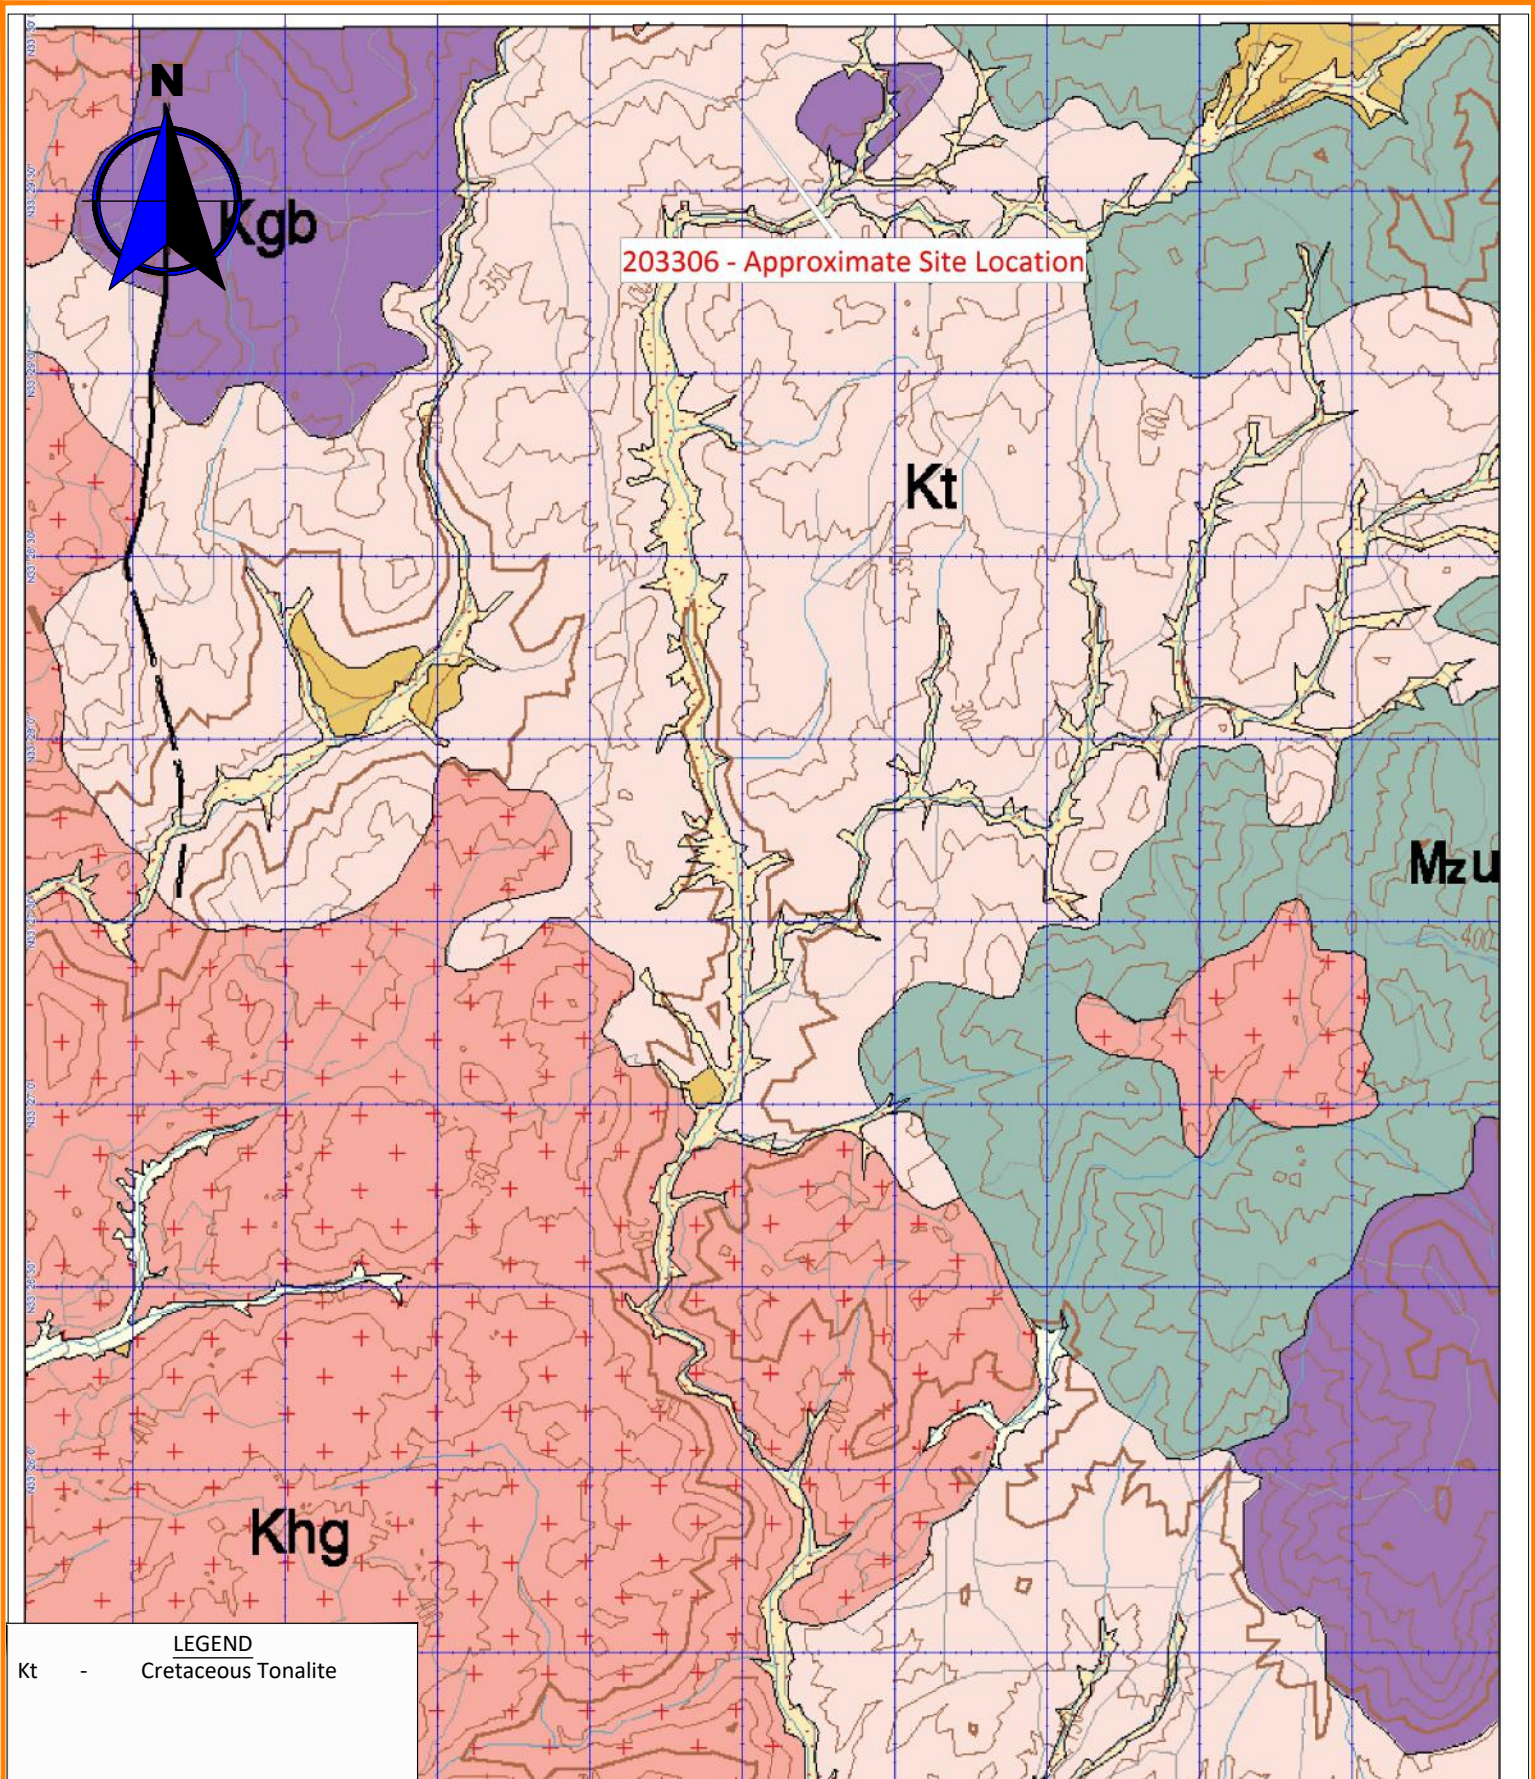

REFERENCES: Morton, D.M., Hauser, Rachel M., and Ruppert, Kelly R., 2004, Preliminary Digital Geologic Map of the Oceanside 30' x 60' Quadrangle, Southern California, Version 2.0: U.S. Geological Survey Open-File Report 99-0172.  
 "© 2007 DeLorme (www.delorme.com) Topo USA®".

Earth Strata Geotechnical Services, Inc. Geotechnical, Environmental and Materials Testing Consultants www.ESGSINC.com (951) 397-8315	PROPOSED CANNABIS CULTIVATION FACILITY		203306-10A
	REGIONAL GEOLOGIC MAP		SCALE 1:40,625
	JAN 2021	FIGURE 2	

## **Faulting**

The project is located in a seismically active region and as a result, significant ground shaking will likely impact the site within the design life of the proposed project. The geologic structure of the entire southern California area is dominated by northwest-trending faults associated with the San Andreas Fault system, which accommodates for most of the right lateral movement associated with the relative motion between the Pacific and North American tectonic plates. Known active faults within this system include the Newport-Inglewood, Whittier-Elsinore, San Jacinto and San Andreas Faults.

No active faults are known to project through the site and the site is not located within an Alquist-Priolo Earthquake Fault Zone, established by the State of California to restrict the construction of new habitable structures across identifiable traces of known active faults. An active fault is defined by the State of California as having surface displacement within the past 11,000 years or during the Holocene geologic time period. Based on our mapping of the subject site, review of current and historical aerial imagery, lack of lineaments indicative of active faulting, and the data compiled during the preparation of this report, it is our interpretation that the potential for surface rupture to adversely impact the proposed structures is very low to remote.

Based on our review of regional geologic maps and applicable computer programs (USGS Seismic Design Maps, Caltrans ARS online, and USGS Earthquake Hazard Programs), the Elsinore Fault with an approximate source to site distance of 7.67 kilometers is the closest known active fault anticipated to produce the highest ground accelerations, with an anticipated maximum modal magnitude of 7.7. A list of faults as well as a list of significant historical seismic events within a 100km radius of the subject site are included in Appendix D.

## **Landslides**

Landslide debris was not observed during our subsurface exploration and no ancient landslides are known to exist on the site. No landslides are known to exist, or have been mapped, in the vicinity of the site. Geologic mapping of the site conducted during our investigation, and review of aerial imagery of the site, reveal no geomorphic expressions indicative of landsliding. The materials encountered in the pad area were found to be very hard and no oversteepened slopes exist on the site or are proposed.

## **CONCLUSIONS AND RECOMMENDATIONS**

### **General**

From geotechnical and engineering geologic points of view, the subject property is considered suitable for the proposed development, provided the following conclusions and recommendations are incorporated into the plans and are implemented during construction.

## **Earthwork**

### **Earthwork and Grading**

The provisions of the 2019 California Building Code (CBC), including the General Earthwork and Grading Specifications in the last Appendix of this report, should be applied to all earthwork and grading operations, as well as in accordance with all applicable grading codes and requirements of the appropriate reviewing agency. Unless specifically revised or amended herein, grading operations should also be performed in accordance with applicable provisions of our General Earthwork and Grading Specifications within the last appendix of this report.

### **Clearing and Grubbing**

Vegetation including trees, grasses, weeds, brush, shrubs, or any other debris should be stripped from the areas to be graded and properly disposed of offsite. In addition, laborers should be utilized to remove any roots, branches, or other deleterious materials during grading operations.

Earth Strata Geotechnical Services should be notified at the appropriate times to provide observation and testing services during Clearing and Grubbing operations. Any buried structures or unanticipated conditions should be brought to our immediate attention.

### **Excavation Characteristics**

Based on the results of our exploration and experience with similar projects in similar settings, the near surface earth materials, will be readily excavated with conventional earth moving equipment. Excavation difficulty is a function of the degree of weathering and amount of fracturing within the bedrock. Bedrock generally becomes harder and more difficult to excavate with increasing depth, but with the appropriate heavy machinery the proposed excavations are considered feasible.

### **Groundwater**

Groundwater was not observed during our subsurface exploration. It should be noted that localized groundwater could be encountered during grading due to the limited number of exploratory locations or other factors.

### **Ground Preparation for Fill Areas**

For each area to receive compacted fill, the removal of low density, compressible earth materials, such as topsoil should continue until firm competent bedrock is encountered. Removal excavations are subject to verification by the project engineer, geologist or their representative. Prior to placing compacted fills, the exposed bottom in each removal area should be scarified to a depth of 6 inches or more, watered or air dried as necessary to achieve near optimum moisture conditions and then compacted to a minimum of 90 percent of the maximum dry density determined by ASTM D 1557.

The intent of remedial grading is to diminish the potential for hydro-consolidation, slope instability, and/or settlement. Remedial grading should extend beyond the perimeter of the proposed structures a horizontal distance equal to the depth of excavation or a minimum of 5 feet, whichever

is greater. For cursory purposes the anticipated removal depths are shown on the enclosed Geotechnical Map, Plate 1. In general, the anticipated removal depths should vary from 2 to 3 feet below existing grade.

### **Wet Removals**

Wet alluvial materials will probably not be encountered within the low lying areas of the site. If removals of wet alluvial materials are required, special grading equipment and procedures can greatly reduce overall costs. Careful planning by an experienced grading contractor can reduce the need for special equipment, such as swamp cats, draglines, excavators, pumps, and top loading earthmovers. Possible solutions may include the placement of imported angular rock and/or geotextile ground reinforcement. More specific recommendations can be provided based on the actual conditions encountered. Drying or mixing of wet materials with dry materials will be needed to bring the wet materials to near optimum moisture prior to placing wet materials into compacted fills.

### **Oversize Rock**

Oversize rock is expected to be encountered during grading. Oversize rock that is encountered (i.e., rock exceeding a maximum dimension of 12 inches) should be disposed of offsite or stockpiled onsite and crushed for future use. The disposal of oversize rock is discussed in greater detail in General Earthwork and Grading Specifications within the last appendix of this report.

### **Compacted Fill Placement**

Compacted fill materials should be placed in 6 to 8 inch maximum (uncompacted) lifts, watered or air dried as necessary to achieve uniform near optimum moisture content and then compacted to a minimum of 90 percent of the maximum dry density determined by ASTM D 1557.

### **Import Earth Materials**

Should import earth materials be needed to achieve final design grades, all potential import materials should be free of deleterious/oversize materials, non-expansive, and approved by the project geotechnical consultant prior to delivery onsite.

### **Fill Slopes**

When properly constructed, fill slopes up to 46 feet high with inclinations of 2:1 (h:v) or flatter are considered to be grossly stable. Keyways are required at the toe of all fill slopes higher than 5 feet and steeper than 5:1 (h:v). Keyways should be a minimum of 10 feet wide and 2 feet into bedrock, as measured on the downhill side. In order to establish keyway removals, backcuts should be cut no steeper than 1:1 or as recommended by the geotechnical engineer or engineering geologist. Compacted fill should be benched into bedrock.

## **Cut Slopes**

When properly constructed, cut slopes into bedrock up to 15 feet high with inclinations of 2:1 (h:v) or flatter are considered grossly stable. Cut slopes should be observed by the engineering geologist or his representative during grading, but are anticipated to be stable.

## **Stabilization Fills**

Currently, stabilization fills will not be required for cut slopes in the bedrock. Our engineering geologist or his representative should be called to evaluate all slopes during grading. In the event that unfavorable geologic conditions are encountered, recommendations for stabilization fills or flatter slopes will be provided.

## **Temporary Backcuts**

It is the responsibility of the grading contractor to follow all Cal-OSHA requirements with regard to excavation safety. Where existing developments are upslope, adequate slope stability to protect those developments must be maintained. Temporary backcuts will be required to accomplish removals of unsuitable materials and possibly, to perform canyon removals, stabilization fills, and/or keyways. Backcuts should be excavated at a gradient of 1:1 (h:v) or flatter. Flatter backcuts may be required where geologic structure or earth materials are unfavorable. It is imperative that grading schedules minimize the exposure time of the unsupported excavations. All excavations should be stabilized within 30 days of initial excavation.

## **Cut/Fill Transitions**

Cut/fill transitions should be eliminated from all building areas where the depth of fill placed within the "fill" portion exceeds proposed footing depths. This is to diminish distress to structures resulting from excessive differential settlement. The entire foundation of each structure should be founded on a uniform bearing material. This should be accomplished by overexcavating the "cut" portion and replacing the excavated materials as properly compacted fill. Refer to the following table for recommended depths of overexcavation.

<b>DEPTH OF FILL ("fill" portion)</b>	<b>DEPTH OF OVEREXCAVATION ("cut" portion)</b>
Up to 5 feet	Equal Depth
5 to 10 feet	5 feet
Greater than 10 feet	One-half the thickness of fill placed on the "fill" portion (10 feet maximum)

Overexcavation of the "cut" portion should extend beyond the building perimeter a horizontal distance equal to the depth of overexcavation or a minimum of 5 feet, whichever is greater.

## **Cut Areas**

In cut areas, an area a minimum of 5 feet beyond the footprint of the proposed structures should overexcavated until; competent bottoms are achieved; to a minimum 3 feet below the proposed

foundations; or per the Overexcavation Table above; (whichever is greater) and replaced with compacted fill. Final determination of areas that require overexcavation should be determined in the field by a representative of Earth Strata Geotechnical Services.

### **Shrinkage, Bulking and Subsidence**

Volumetric changes in earth material quantities will occur when poorly consolidated earth materials are replaced with properly compacted fill. Estimates of the percent shrinkage/bulking factors for the various geologic units observed on the subject property are based on in-place densities and on the estimated average percent of relative compaction achieved during grading.

<b>GEOLOGIC UNIT</b>	<b>SHRINKAGE (%)</b>
Topsoil	10 to 15
Bedrock	0 to 5 (Bulking)

Subsidence from scarification and recompaction of exposed bottom surfaces is expected to be negligible to approximately 0.01 foot.

The estimates of shrinkage/bulking and subsidence are intended as an aid for project engineers in determining earthwork quantities. Since many variables can affect the accuracy of these estimates, they should be used with caution and contingency plans should be in place for balancing the project.

### **Geotechnical Observations**

Clearing operations, removal of unsuitable materials, and general grading procedures should be observed by the project geotechnical consultant or his representative. No compacted fill should be placed without observations by the geotechnical consultant or his representative to verify the adequacy of the removals.

The project geotechnical consultant or his representative should be present to observe grading operations and to check that minimum compaction requirements and proper lift thicknesses are being met, as well as to verify compliance with the other recommendations presented herein.

## **Post Grading Considerations**

### **Slope Landscaping and Maintenance**

Adequate slope and building pad drainage is essential for the long term performance of the subject site. The gross stability of graded slopes should not be adversely affected, provided all drainage provisions are properly constructed and maintained. Engineered slopes should be landscaped with deep rooted, drought tolerant maintenance free plant species, as recommended by the project landscape architect.

### **Site Drainage**

Control of site drainage is important for the performance of the proposed project. Roof gutters are recommended for the proposed structures. Pad and roof drainage should be collected and

transferred to driveways, adjacent streets, storm-drain facilities, or other locations approved by the building official in non-erosive drainage devices. Drainage should not be allowed to pond on the pad or against any foundation or retaining wall. Drainage should not be allowed to flow uncontrolled over any descending slope. Planters located within retaining wall backfill should be sealed to prevent moisture intrusion into the backfill. Planters located next to structures should be sealed to the depth of the footings. Drainage control devices require periodic cleaning, testing and maintenance to remain effective.

At a minimum, pad drainage should be designed at the minimum gradients required by the CBC. To divert water away from foundations, the ground surface adjacent to foundations should also be graded at the minimum gradients required per the CBC.

### **Utility Trenches**

All utility trench backfill should be compacted at near optimum moisture to a minimum of 90 percent of the maximum dry density determined by ASTM D 1557. For utility trench backfill within pavement areas the upper 6 inches of subgrade materials should be compacted to 95 percent of the maximum dry density determined by ASTM D 1557. This includes within the street right-of-ways, utility easements, under footings, sidewalks, driveways and building floor slabs, as well as within or adjacent to any slopes. Backfill should be placed in approximately 6 to 8 inch maximum loose lifts and then mechanically compacted with a hydro-hammer, rolling with a sheepsfoot, pneumatic tampers, or similar equipment. The utility trenches should be tested by the project geotechnical engineer or their representative to verify minimum compaction requirements are obtained.

In order to minimize the penetration of moisture below building slabs, all utility trenches should be backfilled with compacted fill, lean concrete or concrete slurry where they undercut the perimeter foundation. Utility trenches that are proposed parallel to any building footings (interior and/or exterior trenches), should not be located within a 1:1 (h:v) plane projected downward from the outside bottom edge of the footing.

## **SEISMIC DESIGN CONSIDERATIONS**

### **Ground Motions**

Structures are required to be designed and constructed to resist the effects of seismic ground motions as provided in the 2019 California Building Code Section 1613. The design is dependent on the site class, occupancy category I, II, III, or IV, mapped spectral accelerations for short periods ( $S_s$ ), and mapped spectral acceleration for a 1-second period ( $S_1$ ).

In order for structural design to comply with the 2019 CBC, the USGS "US Seismic Design Maps" online tool was used to compile spectral accelerations for the subject property based on data and maps jointly compiled by the United States Geological Survey (USGS) and the California Geological Survey (CGS). The data found in the following table is based on the Maximum Considered Earthquake (MCE) with 5% damped ground motions having a 2% probability of being exceeded in 50 years (2,475 year return period).

The seismic design coefficients were determined by a combination of the site class, mapped spectral accelerations, and occupancy category. The following seismic design coefficients should be implemented during design of the proposed structures. Summaries of the Seismic Hazard Deaggregation graphs and test data are presented in Appendix D.

2019 CBC	FACTOR (ASCE 7-16)
Site Location	Latitude: 33.497975° (North) Longitude: -117.250675°(West)
Site Class	D-default
Mapped Spectral Accelerations for short periods, $S_s$	1.282g
Mapped Spectral Accelerations for 1-Second Period, $S_1$	0.47g
Maximum Considered Earthquake Spectral Response Acceleration for Short Periods, $S_{ms}$	1.538g
Maximum Considered Earthquake Spectral Response Acceleration for 1-Second Period, $S_{m1}$	*Null See Section 11.4.8
Design Spectral Response Acceleration for Short Periods, $S_{Ds}$	1.026g
Design Spectral Response Acceleration for 1-Second Period, $S_{D1}$	*Null See Section 11.4.8
Seismic Design Category	D
Importance Factor Based on Occupancy Category	II

\*2019 CBC

We performed the probabilistic seismic hazard assessment for the site in accordance with the 2019 CBC, Section 1803.5.11 and 1803.5.12. The probabilistic seismic hazard maps and data files were jointly prepared by the United States Geological Survey (USGS) and the California Geological Survey (CGS) and can be found at the CGS Probabilistic Seismic Hazards Mapping Ground Motion Page. Actual ground shaking intensities at the site may be substantially higher or lower based on complex variables such as the near source directivity effects, depth and consistency of earth materials, topography, geologic structure, direction of fault rupture, and seismic wave reflection, refraction, and attenuation rates. The mean peak ground acceleration was calculated to be 0.668g.

### **Secondary Seismic Hazards**

Secondary effects of seismic shaking considered as potential hazards include several types of ground failure as well as induced flooding. Different types of ground failure, which could occur as a consequence of severe ground shaking at the site, include landslides, ground lurching, shallow ground rupture, and liquefaction/lateral spreading. The probability of occurrence of each type of ground failure depends on the severity of the earthquake, distance from faults, topography, the state of subsurface earth materials, groundwater conditions, and other factors. Based on our experience, subsurface exploration, and laboratory testing, all of the above secondary effects of seismic activity are considered unlikely.

Seismically induced flooding is normally a consequence of a tsunami (seismic sea wave), a seiche (i.e., a wave-like oscillation of surface water in an enclosed basin that may be initiated by a strong earthquake) or failure of a major reservoir or retention system up gradient of the site. Since the site is at an elevation of more than 1600 feet above mean sea level and is located more than 15 miles inland from the nearest coastline of the Pacific Ocean, the potential for seismically induced flooding due to a tsunami is considered nonexistent. Since no enclosed bodies of water lie adjacent to or up gradient of the site, the likelihood for



induced flooding due to a dam failure or a seiche overcoming the dam's freeboard is considered nonexistent.

### **Liquefaction and Lateral Spreading**

Liquefaction occurs as a result of a substantial loss of shear strength or shearing resistance in loose, saturated, cohesionless earth materials subjected to earthquake induced ground shaking. Potential impacts from liquefaction include loss of bearing capacity, liquefaction related settlement, lateral movements, and surface manifestation such as sand boils. Seismically induced settlement occurs when loose sandy soils become denser when subjected to shaking during an earthquake. The three factors determining whether a site is likely to be subject to liquefaction include seismic shaking, type and consistency of earth materials, and groundwater level. The proposed structures will be supported by compacted fill and competent bedrock, with no shallow groundwater. As such, the potential for earthquake induced liquefaction and lateral spreading beneath the proposed structures is considered very low to remote due to the recommended compacted fill, relatively low groundwater level, and the dense nature of the deeper onsite earth materials.

## **TENTATIVE FOUNDATION DESIGN RECOMMENDATIONS**

### **General**

Provided grading is performed in accordance with the recommendations of this report, shallow foundations are considered feasible for support of the proposed structures. Tentative foundation recommendations are provided herein and graphic presentations of relevant recommendations may also be included on the enclosed map.

### **Allowable Bearing Values**

An allowable bearing value of 2,000 pounds per square foot (psf) is recommended for design of 24-inch square pad footings and 12-inch-wide continuous footings founded at a minimum depth of 12 inches below the lowest adjacent final grade. This value may be increased by 20 percent for each additional 1-foot of width and/or depth to a maximum value of 2,500 psf. Recommended allowable bearing values include both dead and frequently applied live loads and may be increased by one third when designing for short duration wind or seismic forces.

### **Settlement**

Based on the settlement characteristics of the earth materials that underlie the building sites and the anticipated loading, we estimate that the maximum total settlement of the footings will be less than approximately  $\frac{3}{4}$  inch. Differential settlement is expected to be about  $\frac{1}{2}$  inch over a horizontal distance of approximately 20 feet, for an angular distortion ratio of 1:480. It is anticipated that the majority of the settlement will occur during construction or shortly after the initial application of loading.

The above settlement estimates are based on the assumption that the grading and construction are performed in accordance with the recommendations presented in this report and that the project geotechnical consultant will observe or test the earth material conditions in the footing excavations.

### **Lateral Resistance**

Passive earth pressure of 250 psf per foot of depth to a maximum value of 2,500 psf may be used to establish lateral bearing resistance for footings. For areas covered with hardscape, passive earth pressure may be taken from the surface. For areas without hardscape, the upper 12 inches of the soil profile must be neglected when calculating passive earth pressure. A coefficient of friction of 0.36 times the dead load forces may be used between concrete and the supporting earth materials to determine lateral sliding resistance. The above values may be increased by one-third when designing for short duration wind or seismic forces. When combining passive and friction for lateral resistance, the passive component should be reduced by one third. In no case shall the lateral sliding resistance exceed one-half the dead load for clay, sandy clay, sandy silty clay, silty clay, and clayey silt.


The above lateral resistance values are based on footings for an entire structure being placed directly against either compacted fill or competent bedrock.

### **Structural Setbacks and Building Clearance**

Structural setbacks are required per the 2019 California Building Code (CBC). Additional structural setbacks are not required due to geologic or geotechnical conditions within the site. Improvements constructed in close proximity to natural or properly engineered and compacted slopes can, over time, be affected by natural processes including gravity forces, weathering, and long term secondary settlement. As a result, the CBC requires that buildings and structures be setback or footings deepened to resist the influence of these processes.

For structures that are planned near ascending and descending slopes, the footings should be embedded to satisfy the requirements presented in the CBC, Section 1808.7 as illustrated in the following Foundation Clearances from Slopes diagram.

## FOUNDATION CLEARANCES FROM SLOPES

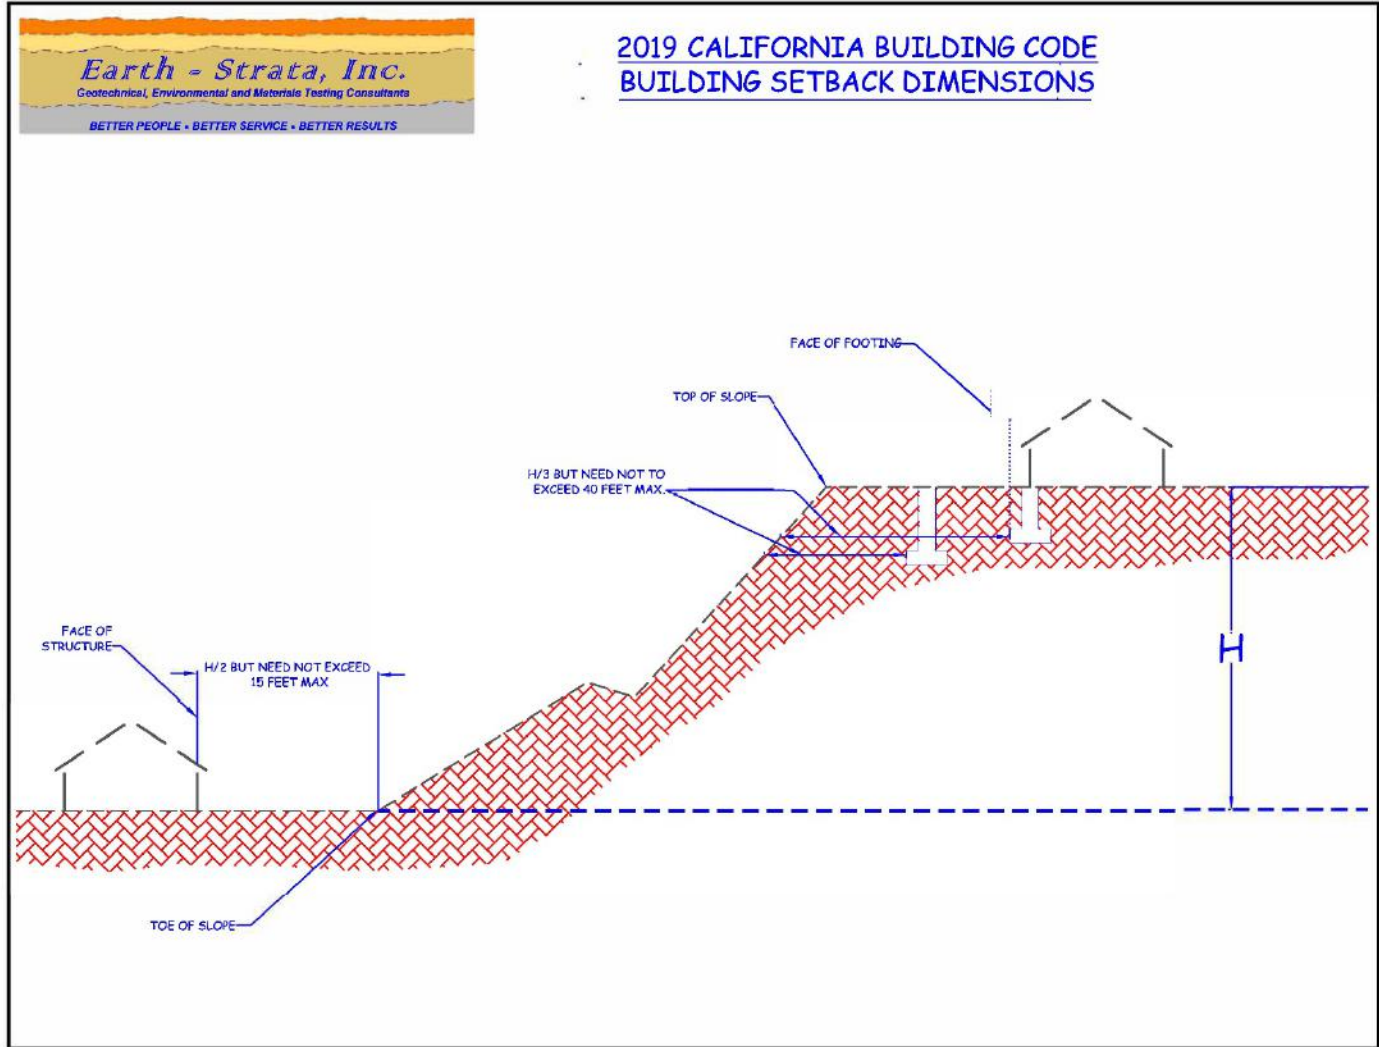

When determining the required clearance from ascending slopes with a retaining wall at the toe, the height of the slope shall be measured from the top of the wall to the top of the slope.

### **Foundation Observations**

In accordance with the 2019 CBC and prior to the placement of forms, concrete, or steel, all foundation excavations should be observed by the geologist, engineer, or his representative to verify that they have been excavated into competent bearing materials. The excavations should be per the approved plans, moistened, cleaned of all loose materials, trimmed neat, level, and square. Any moisture softened earth materials should be removed prior to steel or concrete placement.

Earth materials from foundation excavations should not be placed in slab on grade areas unless the materials are tested for expansion potential and compacted to a minimum of 90 percent of the maximum dry density.

## **Expansive Soil Considerations**

Preliminary laboratory test results indicate onsite earth materials exhibit an expansion potential of **MEDIUM** as classified in accordance with 2019 CBC Section 1803.5.3 and ASTM D 4829. Additional, testing for expansive soil conditions should be conducted upon completion of rough grading. The following recommendations should be considered the very minimum requirements, for the earth materials tested. It is common practice for the project architect or structural engineer to require additional slab thickness, footing sizes, and/or reinforcement.

### **Medium Expansion Potential (Expansion Index of 51 to 90)**

Our laboratory test results indicate that the earth materials onsite exhibit a **MEDIUM** expansion potential as classified in accordance with in 2019 CBC Section 1803.5.3 and ASTM D 4829. Accordingly, the CBC specifies that slab on ground foundations (floor slabs) resting on earth materials with expansion indices greater than 20, require special design considerations in accordance with 2019 CBC Sections 1808.6.1 and 1808.6.2. The design procedures are based on the thickness and plasticity index of the various earth materials within the upper 15 feet of the proposed structure. For preliminary design purposes, we have assumed an effective plasticity index of 16.

#### **Footings**

- Exterior continuous footings for both one- and two-story construction should be founded at a minimum depth of 18 inches below the lowest adjacent final grade. Exterior continuous footings for three-story construction may be founded at a minimum depth of 24 inches below the lowest adjacent final grade. Interior continuous footings for one-, two-, and three-story construction may be founded at a minimum depth of 12 inches below the lowest adjacent final grade. All continuous footings should have a minimum width of 12, 15, and 18 inches, for one-, two-, and three-story structures, respectively, and should be reinforced with a minimum of four (4) No. 4 bars, two (2) top and two (2) bottom.
- Exterior pad footings intended to support roof overhangs, such as second story decks, patio covers and similar construction should be a minimum of 24 inches square and founded at a minimum depth of 18 inches below the lowest adjacent final grade. The pad footings should be reinforced with a minimum of No. 4 bars spaced a maximum of 18 inches on center, each way, and should be placed near the bottom-third of the footings.

#### **Building Floor Slabs**

- The project architect or structural engineer should evaluate minimum floor slab thickness and reinforcement in accordance with 2019 CBC Section 1808.6.2 based on an assumed effective plasticity index of 16. Building floor slabs should be a minimum of 5 inches thick and reinforced with a minimum of No. 4 bars spaced a maximum of 18 inches on center, each way. All floor slab reinforcement should be supported on concrete chairs or bricks to ensure the desired placement at mid-depth.
- Interior floor slabs, within moisture sensitive areas, should be underlain by a minimum 10-mil thick moisture/vapor barrier to help reduce the upward migration of moisture from the

underlying earth materials. The moisture/vapor barrier used should meet the performance standards of an ASTM E 1745 Class A material, and be properly installed in accordance with ACI publication 318. It is the responsibility of the contractor to ensure that the moisture/vapor barriers are free of openings, rips, or punctures prior to placing concrete. As an option for additional moisture reduction, higher strength concrete, such as a minimum 28-day compressive strength of 5,000 pounds per square inch (psi) may be used. Ultimately, the design of the moisture/vapor barrier system and recommendations for concrete placement and curing are the purview of the foundation engineer, taking into consideration the project requirements provided by the architect and owner.

- Garage floor slabs should be a minimum of 5 inches thick and should be reinforced in a similar manner as living area floor slabs. Garage floor slabs should be placed separately from adjacent wall footings with a positive separation maintained with  $\frac{3}{8}$  inch minimum felt expansion joint materials and quartered with weakened plane joints. A 12-inch-wide turn down founded at the same depth as adjacent footings should be provided across garage entrances. The turn down should be reinforced with a minimum of four (4) No. 4 bars, two (2) top and two (2) bottom.
- The subgrade earth materials below all floor slabs should be pre-watered to achieve a moisture content that is at least 2 percent over optimum moisture content, prior to placing concrete. This moisture content should penetrate a minimum depth of 18 inches into the subgrade earth materials. The pre-watering should be verified and tested by Earth Strata Geotechnical Services during construction.

## **Post Tensioned Slab/Foundation Design Recommendations**

In lieu of the proceeding foundation recommendations, post tensioned slabs may be used to support the proposed structures. We recommend that the foundation engineer design the foundation system using the Preliminary Post Tensioned Foundation Slab Design table below. These parameters have been provided in general accordance with Post Tensioned Design. Alternate designs addressing the effects of expansive earth materials are allowed per 2019 CBC Section 1808.6.2. When utilizing these parameters, the foundation engineer should design the foundation system in accordance with the allowable deflection criteria of applicable codes and per the requirements of the structural engineer/architect.

It should be noted that the post tensioned design methodology is partially based on the assumption that soil moisture changes around and underneath post tensioned slabs, are influenced only by climate conditions. Soil moisture change below slabs is the major factor in foundation damages relating to expansive soil. However, the design methodology has no consideration for presaturation, owner irrigation, or other non-climate related influences on the moisture content of subgrade earth materials. In recognition of these factors, we modified the geotechnical parameters determined from this methodology to account for reasonable irrigation practices and proper homeowner maintenance. Additionally, we recommend that prior to excavating footings, slab subgrades be presoaked to a depth of 12 inches and maintained at above optimum moisture until placing concrete. Furthermore, we recommend that the moisture content of the earth materials around the immediate perimeter and below the slab be presaturated to at least 1% above optimum moisture content just prior to placing concrete. The pre-watering should be verified and tested by Earth Strata Geotechnical Services during construction.

The following geotechnical parameters assume that areas adjacent to the foundations, which are planted and irrigated, will be designed with proper drainage to prevent water from ponding. Water ponding near the foundation causes significant moisture change below the foundation. Our recommendations do not account for excessive irrigation and/or incorrect landscape design. Planters placed adjacent to the foundation, should be designed with an effective drainage system or liners, to prevent moisture infiltration below the foundation. Some lifting of the perimeter foundation beam should be expected even with properly constructed planters. Based on our experience monitoring sites with similar earth materials, elevated moisture contents below the foundation perimeter due to incorrect landscaping irrigation or maintenance, can result in uplift at the perimeter foundation relative to the central portion of the slab.

Future owners should be informed and educated of the importance in maintaining a consistent level of moisture within the earth materials around the structures. Future owners should also be informed of the potential negative consequences of either excessive watering, or allowing expansive earth materials to become too dry. Earth materials will shrink as they dry, followed by swelling during the rainy winter season, or when irrigation is resumed. This will cause distress to site improvements and structures.

## Preliminary Post Tensioned Foundation Slab Design

PARAMETER	VALUE
Expansion Index	Medium <sup>1</sup>
Percent Finer than 0.002 mm in the Fraction Passing the No. 200 Sieve	< 30 percent (assumed)
Type of Clay Mineral	Montmorillonite (assumed)
Thornthwaite Moisture Index	+20
Depth to Constant Soil Suction	7 feet
Constant Soil Suction	P.F. 3.6
Moisture Velocity	0.7 inches/month
Center Lift Edge moisture variation distance, $e_m$ Center lift, $y_m$	5.5 feet 2.5 inches
Edge Lift Edge moisture variation distance, $e_m$ Edge lift, $y_m$	3.5 feet 1.0 inches
Soluble Sulfate Content for Design of Concrete Mixtures in Contact with Earth Materials	Negligible
Modulus of Subgrade Reaction, $k$ (assuming presaturation as indicated below)	120 pci
Minimum Perimeter Foundation Embedment	24
Perimeter Foundation Reinforcement	--
Under Slab Moisture/Vapor Barrier and Sand Layer	10-mil thick moisture/vapor barrier meeting the requirements of a ASTM E 1745 Class A material
<ol style="list-style-type: none"> <li>1. Obtained by laboratory testing.</li> <li>2. Recommendations for foundation reinforcement are ultimately the purview of the foundation/structural engineer based upon the geotechnical criteria presented in this report, and structural engineering considerations.</li> </ol>	

### Corrosivity

Corrosion is defined by the National Association of Corrosion Engineers (NACE) as “a deterioration of a substance or its properties because of a reaction with its environment.” From a geotechnical viewpoint, the “substances” are the reinforced concrete foundations or buried metallic elements (not surrounded by concrete) and the “environment” is the prevailing earth materials in contact with them. Many factors can contribute to corrosivity, including the presence of chlorides, sulfates, salts, organic materials, different oxygen levels, poor drainage, different soil types, and moisture content. It is not considered practical or realistic to test for all of the factors which may contribute to corrosivity.

The potential for concrete exposure to chlorides is based upon the recognized Caltrans reference standard “Bridge Design Specifications”, under Subsection 8.22.1 of that document, Caltrans has determined that “Corrosive water or soil contains more than 500 parts per million (ppm) of chlorides”. Based on limited preliminary laboratory testing, the onsite earth materials have chloride contents *less* than 500 ppm. As such, specific requirements resulting from elevated chloride contents are not required.

Specific guidelines for concrete mix design are provided in 2019 CBC Section 1904.1 and ACI 318, Section 4.3 Table 4.3.1 when the soluble sulfate content of earth materials exceeds 0.1 percent by weight. Based on limited preliminary laboratory testing, the onsite earth materials are classified in accordance with Table 4.3.1 as having a *negligible* sulfate exposure condition. Therefore, structural concrete in contact with onsite earth materials should utilize Type I or II.

Based on our laboratory testing of resistivity, the onsite earth materials in contact with buried steel should be considered *corrosive*. Additionally, pH values below 5.6 and above 9.1 are recognized as being corrosive to many common metallic components. The pH values for the earth materials tested were *lower* than 9.1 and *higher* than 5.6.

If building slabs are to be post tensioned, the post tensioning cables should be encased in concrete and/or encapsulated in accordance with the Post Tensioning Institute Guide Specifications. Post tensioning cable end plate anchors and nuts also need to be protected if exposed. If the anchor plates and nuts are in a recess in the edge of the concrete slab, the recess should be filled in with a non-shrink, non-porous, moisture-insensitive epoxy grout so that the anchorage assembly and the end of the cable are completely encased and isolated from the soil. A standard non-shrink, non-metallic cementitious grout may be used only when the post tension anchoring assembly is polyethylene encapsulated similar to that offered by Hayes Industries, LTD or O'Strand, Inc.

The preliminary test results for corrosivity are based on limited samples, and the initiation of grading may blend various earth materials together. This blending or imported material could alter and increase the detrimental properties of the onsite earth materials. Accordingly, additional testing for chlorides and sulfates along with testing for pH and resistivity should be performed upon completion of grading. Laboratory test results are presented in Appendix C.

## RETAINING WALLS

### Active and At-Rest Earth Pressures

Foundations may be designed in accordance with the recommendations provided in the Tentative Foundation Design Recommendation section of this report. The following table provides the minimum recommended equivalent fluid pressures for design of retaining walls a maximum of 15 feet high. The active earth pressure should be used for design of unrestrained retaining walls, which are free to tilt slightly. The at-rest earth pressure should be used for design of retaining walls that are restrained at the top, such as basement walls, curved walls with no joints, or walls restrained at corners. For curved walls, active pressure may be used if tilting is acceptable and construction joints are provided at each angle point and at a minimum of 15 foot intervals along the curved segments.

<b>MINIMUM STATIC EQUIVALENT FLUID PRESSURES (pcf)</b>		
<b>PRESSURE TYPE</b>	<b>BACKSLOPE CONDITION</b>	
	<b>LEVEL</b>	<b>2:1 (h:v)</b>
Active Earth Pressure	45	75
At-Rest Earth Pressure	68	110



The retaining wall parameters provided do not account for hydrostatic pressure behind the retaining walls. Therefore, the subdrain system is a very important part of the design. All retaining walls should be designed to resist surcharge loads imposed by other nearby walls, structures, or vehicles should be added to the above earth pressures, if the additional loads are being applied within a 1.5:1 (h:v) plane projected up from the heel of the retaining wall footing. As a way of minimizing surcharge loads and the settlement potential of nearby buildings, the footings for the building can be deepened below the 1.5:1 (h:v) plane projected up from the heel of the retaining wall footing. For seismic loading, use 40 pcf with an inverted triangle loading diagram.

Upon request and under a separate scope of work, more detailed analyses can be performed to address equivalent fluid pressures with regard to stepped retaining walls, actual retaining wall heights, actual backfill inclinations, specific backfill materials, higher retaining walls requiring earthquake design motions, etc.

### **Subdrain System**

We recommend a perforated pipe and gravel subdrain system be provided behind all proposed retaining walls to prevent the buildup of hydrostatic pressure behind the proposed retaining walls. The perforated pipe should consist of 4-inch minimum diameter Schedule 40 PVC or ABS SDR-35, placed with the perforations facing down. The pipe should be surrounded by 1 cubic foot per foot of  $\frac{3}{4}$ - or  $1\frac{1}{2}$  inch open graded gravel wrapped in filter fabric. The filter fabric should consist of Mirafi 140N or equivalent to prevent infiltration of fines and subsequent clogging of the subdrain system.

In lieu of a perforated pipe and gravel subdrain system, weep holes or open vertical masonry joints may be provided in the lowest row of block exposed to the air to prevent the buildup of hydrostatic pressure behind the proposed retaining walls. Weep holes should be a minimum of 3 inches in diameter and provided at intervals at least every 6 feet along the wall. Open vertical masonry joints should be provided at a minimum of 32 inch intervals. A continuous gravel fill, a minimum of 1 cubic foot per foot, should be placed behind the weep holes or open masonry joints. The gravel should be wrapped in filter fabric consisting of Mirafi 140N or equivalent.

The retaining walls should be adequately coated on the backfilled side of the walls with a proven waterproofing compound by an experienced professional to inhibit infiltration of moisture through the walls.

### **Temporary Excavations**

All excavations should be made in accordance with Cal-OSHA requirements. Earth Strata Geotechnical Services is not responsible for job site safety.

### **Retaining Wall Backfill**

Retaining wall backfill materials should be approved by the geotechnical engineer or his representative prior to placement as compacted fill. Retaining wall backfill should be placed in lifts no greater than 6 to 8 inches, watered or air dried as necessary to achieve near optimum moisture contents. All retaining wall

backfill should be compacted to a minimum of 90 percent of the maximum dry density as determined by ASTM D 1557. Retaining wall backfill should be capped with a paved surface drain.

## **CONCRETE FLATWORK**

### **Thickness and Joint Spacing**

Concrete sidewalks and patio type slabs should be at least 4 inches thick and provided with construction or expansion joints every 6 feet or less, to reduce the potential for excessive cracking. Concrete driveway slabs should be at least 5 inches thick and provided with construction or expansion joints every 10 feet or less, and for earth materials having a **MEDIUM** expansion potential the edges of the driveway slabs should be thickened to a minimum of 6 inches.

### **Subgrade Preparation**

In order to reduce the potential for unsightly cracking, subgrade earth materials underlying concrete flatwork should be compacted at near optimum moisture to a minimum of 90 percent of the maximum dry density determined by ASTM D 1557 and then moistened to optimum or slightly above optimum moisture content. This moisture should extend to a depth of 12 inches below subgrade and be maintained prior to placement of concrete. Pre-watering of the earth materials prior to placing concrete will promote uniform curing of the concrete and minimize the development of shrinkage cracks. The project geotechnical engineer or his representative should verify the density and moisture content of the earth materials and the depth of moisture penetration prior to placing concrete.

Cracking within concrete flatwork is often a result of factors such as the use of too high a water to cement ratio and/or inadequate steps taken to prevent moisture loss during the curing of the concrete. Concrete distress can be reduced by proper concrete mix design and proper placement and curing of the concrete. Minor cracking within concrete flatwork is normal and should be expected.

## **SLOPE STABILITY**

### **Significance of Slope Stability Analyses**

Limit equilibrium analyses of slope stability only provide a general indication of the relative stability of a slope. The applicability is highly dependent on the ability of its simplified analytical methodology and the chosen generalized assumptions of soil properties and slope geometry, to accurately model complex geologic conditions that exist in the field. However, in spite of the limitations, limit equilibrium slope stability analyses can be used to provide insight into the relative need for and benefit of slope stabilization measures.

### **Deep Seated Stability**

Deep seated stability of fill slopes with heights greater than 30 feet or cut slopes steeper than 2:1, were evaluated using Slope/W, a computer application of the Morgenstern Price Method of analysis. Based on our current understanding of the project, slopes on the subject property include a 46 foot high 2:1 (h:v) fill.

The factor of safety of the slopes was evaluated under both static and pseudostatic loading conditions. Per local code requirements, the minimum acceptable factor of safety was taken as 1.5 for static loading and 1.1 for pseudostatic loading. The pseudostatic analysis includes the effects of static loads combined with horizontal inertial force acting out of slope and through the center of gravity of the potential sliding mass. A minimum dynamic horizontal force equal to 0.2 times gravity was applied.

**Surficial Stability**

The surficial stability of near surface earth materials can be calculated using an infinite slope with seepage occurring parallel to the slope face. In the analysis, the vertical depth of saturation is a minimum of 4 feet, and per local code requirements, the minimum acceptable factor of safety for surficial stability is 1.5 for static loading conditions. Our calculations indicate that the proposed compacted fill slopes constructed at a 2:1 (h:v) or flatter are surficially stable with a factor of safety greater than 1.5, see Surficial Stability – Calculation Sheet No. 1, enclosed herein.

For cut slopes into bedrock, the surficial earth materials are removed when the cut slopes are constructed. Therefore, the parallel seepage model for calculating surficial stability is not applicable for cut slopes, as the surficial materials have been removed.

**Slope Stability Results**

The slope stability analyses performed for the sections analyzed on this project indicate that the static factors of safety for potential deep seated slip surfaces are above 1.5 for static and 1.1 for dynamic conditions. The slope stability results are presented in the table below and calculation sheets are presented within the appendices of this report.

**CALCULATED FACTORS OF SAFETY**

<b>SLOPE TYPE</b>	<b>HEIGHT (ft)</b>	<b>STATIC</b>	<b>PSEUDOSTATIC</b>	<b>SURFICIAL</b>
Cross Section A-A' Compacted Fill Slope	46	3.542	2.286	6.23

An Earth Strata Geotechnical Services geologist should evaluate all slopes in the field during grading and construction. If unfavorable geological conditions are observed or encountered, then stabilization fills or flatter slopes may be required. Any stabilization fills should be constructed per the recommendations herein. All fill slope construction should be properly keyed and benched into competent earth materials.

**GRADING PLAN REVIEW AND CONSTRUCTION SERVICES**

This report has been prepared for the exclusive use of **Fuego Farm LLC** and their authorized representative. It likely does not contain sufficient information for other parties or other uses. Earth Strata Geotechnical Services should be engaged to review the final design plans and specifications prior to construction. This is to verify that the recommendations contained in this report have been properly incorporated into the project plans and specifications. Should Earth Strata Geotechnical Services not be accorded the

opportunity to review the project plans and specifications, we are not responsible for misinterpretation of our recommendations.

We recommend that Earth Strata Geotechnical Services be retained to provide geologic and geotechnical engineering services during grading and foundation excavation phases of the work. In order to allow for design changes in the event that the subsurface conditions differ from those anticipated prior to construction.

Earth Strata Geotechnical Services should review any changes in the project and modify and approve in writing the conclusions and recommendations of this report. This report and the drawings contained within are intended for design input purposes only and are not intended to act as construction drawings or specifications. In the event that conditions encountered during grading or construction operations appear to be different than those indicated in this report, this office should be notified immediately, as revisions may be required.

### **REPORT LIMITATIONS**

Our services were performed using the degree of care and skill ordinarily exercised, under similar circumstances, by reputable soils engineers and geologists, practicing at the time and location this report was prepared. No other warranty, expressed or implied, is made as to the conclusions and professional advice included in this report.

Earth materials vary in type, strength, and other geotechnical properties between points of observation and exploration. Groundwater and moisture conditions can also vary due to natural processes or the works of man on this or adjacent properties. As a result, we do not and cannot have complete knowledge of the subsurface conditions beneath the subject property. No practical study can completely eliminate uncertainty with regard to the anticipated geotechnical conditions in connection with a subject property. The conclusions and recommendations within this report are based upon the findings at the points of observation and are subject to confirmation by Earth Strata Geotechnical Services based on the conditions revealed during grading and construction.

This report was prepared with the understanding that it is the responsibility of the owner or their representative, to ensure that the conclusions and recommendations contained herein are brought to the attention of the other project consultants and are incorporated into the plans and specifications. The owners' contractor should properly implement the conclusions and recommendations during grading and construction, and notify the owner if they consider any of the recommendations presented herein to be unsafe or unsuitable.

**APPENDIX A**  
**REFERENCES**

## APPENDIX A

### References

California Building Standards Commission, 2019, *2019 California Building Code, California Code of Regulations Title 24, Part 2, Volume 2 of 2*, Based on 2018 International Building Code.

California Corrosion Guidelines

DeLorme, 2004, (www.delorme.com) *Topo USA*®.

Geo-Slope International, Ltd, 2007, *GeoStudio 2007; Slope/W 2007, Stability Modeling; An Engineering Methodology*.

Hart, Earl W. and Bryant, William A., 1997, *Fault Rupture Hazard Zones in California, CDMG Special Publication 42*, revised 2003.

Jenkins, Olaf P., 1978, *Geologic Map of California, Santa Ana Sheet*; CDMG, Scale 1:250,000.

Kennedy, M.P., et al, 2005, *Geologic Map of the Oceanside 30' x 60' Quadrangle, California*, U.S. Geological Survey, Department of Earth Sciences, University of California, Riverside.

Kennedy, M.P., S.S. Tan, 2005, *Geologic Map of the San Diego 30' x 60' Quadrangle, California*, U.S. Geological Survey, Department of Earth Sciences, University of California, Riverside.

Morton, D.M., Hauser, Rachel M., and Ruppert, Kelly R., 2004, *Preliminary Digital Geologic Map of the Santa Ana 30' x 60' Quadrangle, Southern California, Version 2.0*: U.S. Geological Survey Open-File Report 99-0172.

Morton, D.M. (compiler), and Fred K. Miller (compiler), 2006, *Geologic Map of the San Bernardino and Santa Ana 30' x 60' Quadrangles, California*: U.S. Geological Survey, Version 1, California.

National Association of Corrosion Engineers, 1984, *Corrosion Basics An Introduction*, page 191.

Per A.B. Chance® Recommendations, 2003

Southern California Earthquake Center (SCEC), 1999, *Recommended Procedures for Implementation of DMG Special Publication 117, Guidelines for Analyzing and Mitigating Liquefaction Hazards in California*, March.

**APPENDIX B**  
**EXPLORATORY LOGS**

# Geotechnical Test Pit Log TP-1

Date: November 17, 2020	Project Name: Carancho Road	Page: 1 of 1
Project Number: 203306-10A	Logged By: TJ/HR	
Drilling Company: ESGS	Type of Rig: Mini-ex	
Drive Weight (lbs): -	Drop (in): -	Hole Diameter (in): -
Top of Hole Elevation (ft): See Map	Hole Location: See Geotechnical Map	

Depth (ft)	Blow Count Per Foot	Sample Depth	Dry Density (pcf)	Moisture (%)	Classification Symbol	MATERIAL DESCRIPTION
0						<b>Topsoil:</b>
					SM	Silty SAND; light brown, dry, medium dense, fine to medium sand, trace gravel
						<b>Cretaceous Tonalite (Kt):</b>
						TONALITE; olive, slightly moist, weathered, moderately hard, breaks down into Silty SAND, fine to medium sand
5						Total Depth: 4 feet No Groundwater
10						
15						
20						
25						
30						

42184 Remington Avenue, Temecula, CA 92590

**Earth Strata Geotechnical Services, Inc.**  
 Geotechnical, Environmental and Materials Testing Consultants  
www.ESGSINC.com (951) 397-8315



# Geotechnical Test Pit Log TP-2

Date: November 17, 2020	Project Name: Carancho Road	Page: 1 of 1
Project Number: 203306-10A	Logged By: TJ/HR	
Drilling Company: ESGS	Type of Rig: Mini-ex	
Drive Weight (lbs): -	Drop (in): -	Hole Diameter (in): -
Top of Hole Elevation (ft): See Map	Hole Location: See Geotechnical Map	

Depth (ft)	Blow Count Per Foot	Sample Depth	Dry Density (pcf)	Moisture (%)	Classification Symbol	MATERIAL DESCRIPTION
0						<b>Topsoil:</b>
					SM	Silty SAND; light brown, dry, medium dense, fine to medium sand, trace gravel and organics
						<b>Cretaceous Tonalite (Kt):</b>
5						TONALITE; olive brown, slightly moist, weathered, moderately hard, breaks down into Silty SAND, fine to medium sand
						Total Depth: 4 feet No Groundwater
10						
15						
20						
25						
30						

42184 Remington Avenue, Temecula, CA 92590

**Earth Strata Geotechnical Services, Inc.**  
 Geotechnical, Environmental and Materials Testing Consultants  
www.ESGSINC.com (951) 397-8315



# Geotechnical Test Pit Log TP-4

Date: November 17, 2020	Project Name: Carancho Road	Page: 1 of 1
Project Number: 203306-10A	Logged By: TJ/HR	
Drilling Company: ESGS	Type of Rig: Mini-ex	
Drive Weight (lbs): -	Drop (in): -	Hole Diameter (in): -
Top of Hole Elevation (ft): See Map	Hole Location: See Geotechnical Map	

Depth (ft)	Blow Count Per Foot	Sample Depth	Dry Density (pcf)	Moisture (%)	Classification Symbol	MATERIAL DESCRIPTION
0						<b>Topsoil:</b>
					CL	Sandy CLAY; dark red, moist, loose, fine to medium sand, trace gravel
						<b>Cretaceous Tonalite (Kt):</b>
						TONALITE; olive brown, weathered, moderately hard, breaks down into Silty SAND, fine to medium sand with trace gravel
5						Total Depth: 4 feet No Groundwater
10						
15						
20						
25						
30						

42184 Remington Avenue, Temecula, CA 92590

**Earth Strata Geotechnical Services, Inc.**  
 Geotechnical, Environmental and Materials Testing Consultants  
www.ESGSINC.com (951) 397-8315



# Geotechnical Test Pit Log TP-6

Date: November 17, 2020	Project Name: Carancho Road	Page: 1 of 1
Project Number: 203306-10A	Logged By: TJ/HR	
Drilling Company: ESGS	Type of Rig: Mini-ex	
Drive Weight (lbs): -	Drop (in): -	Hole Diameter (in): -
Top of Hole Elevation (ft): See Map	Hole Location: See Geotechnical Map	

Depth (ft)	Blow Count Per Foot	Sample Depth	Dry Density (pcf)	Moisture (%)	Classification Symbol	MATERIAL DESCRIPTION
0						<b>Topsoil:</b>
					SM	Silty SAND; dark red, moist, loose, fine to medium sand, trace clay and gravel
						<b>Cretaceous Tonalite (Kt):</b>
						TONALITE; olive, dry, weathered, moderately hard, breaks down into
5						Silty SAND, fine to medium sand
						Total Depth: 4 feet
						No Groundwater
10						
15						
20						
25						
30						

42184 Remington Avenue, Temecula, CA 92590

**Earth Strata Geotechnical Services, Inc.**

*Geotechnical, Environmental and Materials Testing Consultants*

www.ESGSINC.com (951) 397-8315

# Geotechnical Test Pit Log TP-7

Date: November 17, 2020	Project Name: Carancho Road	Page: 1 of 1
Project Number: 203306-10A	Logged By: TJ/HR	
Drilling Company: ESGS	Type of Rig: Mini-ex	
Drive Weight (lbs): -	Drop (in): -	Hole Diameter (in): -
Top of Hole Elevation (ft): See Map	Hole Location: See Geotechnical Map	

Depth (ft)	Blow Count Per Foot	Sample Depth	Dry Density (pcf)	Moisture (%)	Classification Symbol	MATERIAL DESCRIPTION
0						<b>Topsoil:</b>
					SM	Silty SAND; brownish red, dry, medium dense, fine to medium sand, gravel
						<b>Cretaceous Tonalite (Kt):</b>
						TONALITE; olive, slightly moist, weathered, moderately hard, breaks down into Silty SAND, fine to medium sand
5						Total Depth: 4 feet No Groundwater
10						
15						
20						
25						
30						

42184 Remington Avenue, Temecula, CA 92590

**Earth Strata Geotechnical Services, Inc.**  
 Geotechnical, Environmental and Materials Testing Consultants  
www.ESGSINC.com (951) 397-8315

# Geotechnical Boring Log TP-8

Date: January 8, 2021	Project Name: Carancho Road	Page: 1 of 1
Project Number: 203306-10A	Logged By: JF	
Drilling Company: Drilling It	Type of Rig: Mini EX	
Drive Weight (lbs): 140	Drop (in): 30	Hole Diameter (in): 8
Top of Hole Elevation (ft): See Map	Hole Location: See Geotechnical Map	

Depth (ft)	Blow Count Per Foot	Sample Depth	Dry Density (pcf)	Moisture (%)	Classification Symbol	MATERIAL DESCRIPTION
0						<b>Topsoil:</b>
					SM	Silty SAND; brownish red to reddish brown, moist, loose, fine to coarse sand with trace clay
						<b>Cretaceous Tonalite (Kt):</b>
5						TONALITE; yellowish brown, slightly moist, weathered, moderately hard, breaks down into Silty SAND, fine to coarse sand
						Hard below 6 feet
						Practical Refusal @ 6 feet
						No Groundwater
10						
15						
20						
25						
30						

42184 Remington Avenue, Temecula, CA 92590

**Earth Strata Geotechnical Services, Inc.**

*Geotechnical, Environmental and Materials Testing Consultants*

www.ESGSINC.com (951) 397-8315

# Geotechnical Boring Log TP-9

Date: January 8, 2021	Project Name: Carancho Road	Page: 1 of 1
Project Number: 203306-10A	Logged By: JF	
Drilling Company: Drilling It	Type of Rig: Mini EX	
Drive Weight (lbs): 140	Drop (in): 30	Hole Diameter (in): 8
Top of Hole Elevation (ft): See Map	Hole Location: See Geotechnical Map	

Depth (ft)	Blow Count Per Foot	Sample Depth	Dry Density (pcf)	Moisture (%)	Classification Symbol	MATERIAL DESCRIPTION
0						<b>Topsoil:</b>
					SM	Silty SAND; reddish brown, brownish red, moist, fine to coarse sand with trace clay
						<b>Cretaceous Tonalite (Kt):</b>
5						TONALITE; light olive brown, dry, weathered, moderately hard, breaks down into Silty SAND, fine to coarse sand
						Hard below 5 feet
						Practical Refusal @ 6 feet
10						No Groundwater
15						
20						
25						
30						

42184 Remington Avenue, Temecula, CA 92590

**Earth Strata Geotechnical Services, Inc.**  
 Geotechnical, Environmental and Materials Testing Consultants  
www.ESGSINC.com (951) 397-8315



# Geotechnical Boring Log TP-10

Date: January 8, 2021	Project Name: Carancho Road	Page: 1 of 1
Project Number: 203306-10A	Logged By: JF	
Drilling Company: Drilling It	Type of Rig: Mini EX	
Drive Weight (lbs): 140	Drop (in): 30	Hole Diameter (in): 8
Top of Hole Elevation (ft): See Map	Hole Location: See Geotechnical Map	

Depth (ft)	Blow Count Per Foot	Sample Depth	Dry Density (pcf)	Moisture (%)	Classification Symbol	MATERIAL DESCRIPTION
0						<b>Topsoil:</b>
					SM	Silty SAND; reddish brown, moist, loose, fine to coarse sand
						<b>Cretaceous Tonalite (Kt):</b>
						TONALITE; light olive brown, dry, weathered, moderately hard, breaks down into Silty SAND, fine to coarse sand
5						Practical Refusal @ 5 feet
						No Groundwater
10						
15						
20						
25						
30						

42184 Remington Avenue, Temecula, CA 92590

**Earth Strata Geotechnical Services, Inc.**  
 Geotechnical, Environmental and Materials Testing Consultants  
www.ESGSINC.com (951) 397-8315

# Geotechnical Boring Log TP-11

Date: January 8, 2021	Project Name: Carancho Road	Page: 1 of 1
Project Number: 203306-10A	Logged By: JF	
Drilling Company: Drilling It	Type of Rig: Mini EX	
Drive Weight (lbs): 140	Drop (in): 30	Hole Diameter (in): 8
Top of Hole Elevation (ft): See Map	Hole Location: See Geotechnical Map	

Depth (ft)	Blow Count Per Foot	Sample Depth	Dry Density (pcf)	Moisture (%)	Classification Symbol	MATERIAL DESCRIPTION
0						<b>Topsoil:</b>
					SM	Silty SAND; reddish brown, moist, loose, fine to coarse sand with trace gravel and clay
						<b>Cretaceous Tonalite (Kt):</b>
5						TONALITE; olive brown, weathered, moderately hard, breaks down into Silty SAND, fine to medium sand with trace gravel
						Practical Refusal @ 6 feet No Groundwater
10						
15						
20						
25						
30						

42184 Remington Avenue, Temecula, CA 92590

**Earth Strata Geotechnical Services, Inc.**  
 Geotechnical, Environmental and Materials Testing Consultants  
www.ESGSINC.com (951) 397-8315

# Geotechnical Boring Log TP-12

Date: January 8, 2021	Project Name: Carancho Road	Page: 1 of 1
Project Number: 203306-10A	Logged By: JF	
Drilling Company: Drilling It	Type of Rig: Mini EX	
Drive Weight (lbs): 140	Drop (in): 30	Hole Diameter (in): 8
Top of Hole Elevation (ft): See Map	Hole Location: See Geotechnical Map	

Depth (ft)	Blow Count Per Foot	Sample Depth	Dry Density (pcf)	Moisture (%)	Classification Symbol	MATERIAL DESCRIPTION
0						<b>Topsoil:</b>
					SM	Silty SAND; reddish brown, moist, loose, fine to coarse sand with trace gravel
						<b>Cretaceous Tonalite (Kt):</b>
						TONALITE; olive, dry, weathered, moderately hard, breaks down into
5						Silty SAND; fine to medium sand with
						Hard below 3 feet
						Practical Refusal @ 5 feet
						No Groundwater
10						
15						
20						
25						
30						

42184 Remington Avenue, Temecula, CA 92590

**Earth Strata Geotechnical Services, Inc.**

*Geotechnical, Environmental and Materials Testing Consultants*

www.ESGSINC.com (951) 397-8315

# Geotechnical Boring Log TP-13

Date: January 8, 2021	Project Name: Carancho Road	Page: 1 of 1
Project Number: 203306-10A	Logged By: JF	
Drilling Company: Drilling It	Type of Rig: Mini EX	
Drive Weight (lbs):	Drop (in):	Hole Diameter (in):
Top of Hole Elevation (ft): See Map	Hole Location: See Geotechnical Map	

Depth (ft)	Blow Count Per Foot	Sample Depth	Dry Density (pcf)	Moisture (%)	Classification Symbol	MATERIAL DESCRIPTION
0						<b>Topsoil:</b>
					SM	Silty SAND; reddish brown, moist, medium dense, fine to coarse sand with trace clay
						<b>Cretaceous Tonalite (Kt):</b>
5						TONALITE; olive, slightly moist, weathered, moderately hard, breaks down into Silty SAND, fine to medium sand
						Hard below 5 feet
						Practical Refusal @ 5 feet
10						No Groundwater
15						
20						
25						
30						

42184 Remington Avenue, Temecula, CA 92590

**Earth Strata Geotechnical Services, Inc.**  
 Geotechnical, Environmental and Materials Testing Consultants  
www.ESGSINC.com (951) 397-8315

## **APPENDIX C**

# **LABORATORY PROCEDURES AND TEST RESULTS**

## APPENDIX C

### Laboratory Procedures and Test Results

Laboratory testing provided quantitative and qualitative data involving the relevant engineering properties of the representative earth materials selected for testing. The representative samples were tested in general accordance with American Society for Testing and Materials (ASTM) procedures and/or California Test Methods (CTM).

**Soil Classification:** Earth materials encountered during exploration were classified and logged in general accordance with the Standard Practice for Description and Identification of Soils (Visual-Manual Procedure) of ASTM D 2488. Upon completion of laboratory testing, exploratory logs and sample descriptions were reconciled to reflect laboratory test results with regard to ASTM D 2487.

**Moisture and Density Tests:** For select samples moisture content was determined using the guidelines of ASTM D 2216 and dry density determinations were made using the guidelines of ASTM D 2937. These tests were performed on relatively undisturbed samples and the test results are presented on the exploratory logs.

**Maximum Density Tests:** The maximum dry density and optimum moisture content of representative samples were determined using the guidelines of ASTM D 1557. The test results are presented in the table below.

SAMPLE LOCATION	MATERIAL DESCRIPTION	MAXIMUM DRY DENSITY (pcf)	OPTIMUM MOISTURE CONTENT (%)
TP-8 @ 0-5 feet	Silty SAND	124.0	10.5

**Expansion Index:** The expansion potential of representative samples was evaluated using the guidelines of ASTM D 4829. The test results are presented in the table below.

SAMPLE LOCATION	MATERIAL DESCRIPTION	EXPANSION INDEX	EXPANSION POTENTIAL
TP-8 @ 0-5 feet	Silty SAND	64	Medium

**Minimum Resistivity and pH Tests:** Minimum resistivity and pH Tests of select samples were performed using the guidelines of CTM 643. The test results are presented in the table below.

SAMPLE LOCATION	MATERIAL DESCRIPTION	pH	MINIMUM RESISTIVITY (ohm-cm)
TP-8 @ 0-5 feet	Silty SAND	7.2	3700

**Soluble Sulfate:** The soluble sulfate content of select samples was determined using the guidelines of CTM 417. The test results are presented in the table below.

SAMPLE LOCATION	MATERIAL DESCRIPTION	SULFATE CONTENT (% by weight)	SULFATE EXPOSURE
TP-8 @ 0-5 feet	Silty SAND	0.001	Negligible

**Chloride Content:** Chloride content of select samples was determined using the guidelines of CTM 422. The test results are presented in the table below.

SAMPLE LOCATION	MATERIAL DESCRIPTION	CHLORIDE CONTENT (ppm)
TP-8 @ 0-5 feet	Silty SAND	40

**APPENDIX D**  
**SEISMICITY**





## ARS Online V3.0.2

**Using the tool:** Specify latitude and longitude in decimal degrees in the input boxes below. Alternatively, **Google Maps** can be used to find the site location. Specify the time-averaged shear-wave velocity in the upper 30m (Vs30) in the input box. After submitting the data, the USGS 2014 hazard data for a 975-year return period will be reported along with adjustment factors required by Caltrans Seismic Design Criteria (SDC) V2.0.

Latitude:  Longitude:  Vs30 (m/s):

### Caltrans Design Spectrum (5% damping)

Period(s)	Sa <sub>2008</sub> (g)	Sa <sub>2014</sub> (g)	Basin <sub>2008</sub>	Basin <sub>2014</sub>	Near Fault Amp	Design Sa <sub>2008</sub> (g)	Design Sa <sub>2014</sub> (g)
PGA	0.49	0.48	1	1	1	0.49	0.48
0.10	0.86	0.85	1	1	1	0.86	0.85
0.20	1.07	1.14	1	1	1	1.07	1.14
0.30	1.06	1.22	1	1	1	1.06	1.22
0.50	0.93	1.1	1	1	1	0.93	1.1
0.75	0.77	0.86	1	1	1	0.77	0.86
1.0	0.63	0.69	1	1	1	0.63	0.69
2.0	0.36	0.35	1	1	1	0.36	0.35
3.0	0.23	0.22	1	1	1	0.23	0.23
4.0	0.17	0.16	1	1	1	0.17	0.16
5.0	0.14	0.12	1	1	1	0.14	0.12

### Deaggregation (based on 2014 hazard)

mean magnitude (for PGA) 6.71

mean site-source distance (km, for Sa at 1s) 24.9

*Option: recalculate Near Fault amplification with user specified distance*

**Site-source distance (km):**

**Search Information**

**Coordinates:** 33.497975, -117.250675  
**Elevation:** 1346 ft  
**Timestamp:** 2021-01-13T19:42:53.610Z  
**Hazard Type:** Seismic  
**Reference Document:** ASCE7-16  
**Risk Category:** II  
**Site Class:** D-default



**Basic Parameters**

Name	Value	Description
$S_S$	1.282	$MCE_R$ ground motion (period=0.2s)
$S_1$	0.47	$MCE_R$ ground motion (period=1.0s)
$S_{MS}$	1.538	Site-modified spectral acceleration value
$S_{M1}$	* null	Site-modified spectral acceleration value
$S_{DS}$	1.026	Numeric seismic design value at 0.2s SA
$S_{D1}$	* null	Numeric seismic design value at 1.0s SA

\* See Section 11.4.8

**Additional Information**

Name	Value	Description
SDC	* null	Seismic design category
$F_a$	1.2	Site amplification factor at 0.2s
$F_v$	* null	Site amplification factor at 1.0s
$CR_S$	0.917	Coefficient of risk (0.2s)
$CR_1$	0.917	Coefficient of risk (1.0s)
PGA	0.557	$MCE_G$ peak ground acceleration
$F_{PGA}$	1.2	Site amplification factor at PGA
$PGA_M$	0.668	Site modified peak ground acceleration
$T_L$	8	Long-period transition period (s)

SsRT	1.282	Probabilistic risk-targeted ground motion (0.2s)
SsUH	1.398	Factored uniform-hazard spectral acceleration (2% probability of exceedance in 50 years)
SsD	1.638	Factored deterministic acceleration value (0.2s)
S1RT	0.47	Probabilistic risk-targeted ground motion (1.0s)
S1UH	0.512	Factored uniform-hazard spectral acceleration (2% probability of exceedance in 50 years)
S1D	0.634	Factored deterministic acceleration value (1.0s)
PGAd	0.694	Factored deterministic acceleration value (PGA)

\* See Section 11.4.8

*The results indicated here DO NOT reflect any state or local amendments to the values or any delineation lines made during the building code adoption process. Users should confirm any output obtained from this tool with the local Authority Having Jurisdiction before proceeding with design.*

## Disclaimer

Hazard loads are provided by the U.S. Geological Survey [Seismic Design Web Services](#).

While the information presented on this website is believed to be correct, ATC and its sponsors and contributors assume no responsibility or liability for its accuracy. The material presented in the report should not be used or relied upon for any specific application without competent examination and verification of its accuracy, suitability and applicability by engineers or other licensed professionals. ATC does not intend that the use of this information replace the sound judgment of such competent professionals, having experience and knowledge in the field of practice, nor to substitute for the standard of care required of such professionals in interpreting and applying the results of the report provided by this website. Users of the information from this website assume all liability arising from such use. Use of the output of this website does not imply approval by the governing building code bodies responsible for building code approval and interpretation for the building site described by latitude/longitude location in the report.

# 2008 National Seismic Hazard Maps - Source Parameters

[New Search](#)

Distance in Kilometers	Name	State	Pref Slip Rate (mm/yr)	Dip (degrees)	Dip Dir	Slip Sense	Rupture Top (km)	Rupture Bottom (km)	Length (km)
7.67	<a href="#">Elsinore;T</a>	CA	5	90	V	strike slip	0	14	52
7.67	<a href="#">Elsinore;W+GI+T+J</a>	CA	n/a	84	NE	strike slip	0	16	199
7.67	<a href="#">Elsinore;W+GI+T</a>	CA	n/a	84	NE	strike slip	0	14	124
7.67	<a href="#">Elsinore;T+J+CM</a>	CA	n/a	85	NE	strike slip	0	16	169
7.67	<a href="#">Elsinore;T+J</a>	CA	n/a	86	NE	strike slip	0	17	127
7.67	<a href="#">Elsinore;GI+T+J+CM</a>	CA	n/a	86	NE	strike slip	0	16	195
7.67	<a href="#">Elsinore;GI+T+J</a>	CA	n/a	86	NE	strike slip	0	17	153
7.67	<a href="#">Elsinore;GI+T</a>	CA	5	90	V	strike slip	0	14	78
7.67	<a href="#">Elsinore;W+GI+T+J+CM</a>	CA	n/a	84	NE	strike slip	0	16	241
14.44	<a href="#">Elsinore;W+GI</a>	CA	n/a	81	NE	strike slip	0	14	83
14.44	<a href="#">Elsinore;GI</a>	CA	5	90	V	strike slip	0	13	37
28.43	<a href="#">Elsinore;J+CM</a>	CA	3	84	NE	strike slip	0	17	118
28.43	<a href="#">Elsinore;J</a>	CA	3	84	NE	strike slip	0	19	75
38.25	<a href="#">Newport Inglewood Connected alt 2</a>	CA	1.3	90	V	strike slip	0	11	208
38.25	<a href="#">Newport-Inglewood (Offshore)</a>	CA	1.5	90	V	strike slip	0	10	66
38.25	<a href="#">Newport Inglewood Connected alt 1</a>	CA	1.3	89		strike slip	0	11	208
39.61	<a href="#">San Jacinto;A+CC+B+SM</a>	CA	n/a	90	V	strike slip	0.1	15	178
39.61	<a href="#">San Jacinto;A+CC+B</a>	CA	n/a	90	V	strike	0.1	15	152

						slip			
39.61	<a href="#">San Jacinto;A</a>	CA	9	90	V	strike slip	0	17	71
39.61	<a href="#">San Jacinto;A+CC</a>	CA	n/a	90	V	strike slip	0	16	118
39.61	<a href="#">San Jacinto;A+C</a>	CA	n/a	90	V	strike slip	0	17	118
40.86	<a href="#">San Jacinto;SJV+A+CC</a>	CA	n/a	90	V	strike slip	0	16	136
40.86	<a href="#">San Jacinto;SBV+SJV+A</a>	CA	n/a	90	V	strike slip	0	16	134
40.86	<a href="#">San Jacinto;SBV+SJV+A+C</a>	CA	n/a	90	V	strike slip	0	17	181
40.86	<a href="#">San Jacinto;SBV+SJV+A+CC</a>	CA	n/a	90	V	strike slip	0	16	181
40.86	<a href="#">San Jacinto;SBV+SJV+A+CC+B</a>	CA	n/a	90	V	strike slip	0.1	15	215
40.86	<a href="#">San Jacinto;SBV+SJV+A+CC+B+SM</a>	CA	n/a	90	V	strike slip	0.1	15	241
40.86	<a href="#">San Jacinto;SJV+A</a>	CA	n/a	90	V	strike slip	0	17	89
40.86	<a href="#">San Jacinto;SJV+A+C</a>	CA	n/a	90	V	strike slip	0	17	136
40.86	<a href="#">San Jacinto;SJV+A+CC+B</a>	CA	n/a	90	V	strike slip	0.1	15	170
40.86	<a href="#">San Jacinto;SJV+A+CC+B+SM</a>	CA	n/a	90	V	strike slip	0.1	15	196
40.90	<a href="#">San Joaquin Hills</a>	CA	0.5	23	SW	thrust	2	13	27
43.04	<a href="#">San Jacinto;SBV+SJV</a>	CA	n/a	90	V	strike slip	0	16	88
43.04	<a href="#">San Jacinto;SJV</a>	CA	18	90	V	strike slip	0	16	43
44.65	<a href="#">Rose Canyon</a>	CA	1.5	90	V	strike slip	0	8	70
46.56	<a href="#">Chino, alt 2</a>	CA	1	65	SW	strike slip	0	14	29
48.41	<a href="#">Elsinore;W</a>	CA	2.5	75	NE	strike slip	0	14	46
50.77	<a href="#">Chino, alt 1</a>	CA	1	50	SW	strike slip	0	9	24
57.59	<a href="#">San Jacinto;SBV</a>	CA	6	90	V	strike slip	0	16	45
63.57	<a href="#">Coronado Bank</a>	CA	3	90	V	strike	0	9	186

						slip			
63.57	<a href="#">Palos Verdes Connected</a>	CA	3	90	V	strike slip	0	10	285
64.79	<a href="#">Newport-Inglewood, alt 1</a>	CA	1	88		strike slip	0	15	65
64.85	<a href="#">S. San Andreas;BB+NM+SM+NSB+SSB+BG+CO</a>	CA	n/a	85		strike slip	0.1	13	390
64.85	<a href="#">S. San Andreas;SM+NSB+SSB</a>	CA	n/a	90	V	strike slip	0	13	176
64.85	<a href="#">S. San Andreas;CH+CC+BB+NM+SM+NSB+SSB+BG+CO</a>	CA	n/a	86		strike slip	0.1	13	512
64.85	<a href="#">S. San Andreas;SSB+BG</a>	CA	n/a	71		strike slip	0	13	101
64.85	<a href="#">S. San Andreas;NSB+SSB+BG+CO</a>	CA	n/a	79		strike slip	0.2	12	206
64.85	<a href="#">S. San Andreas;PK+CH+CC+BB+NM+SM+NSB+SSB</a>	CA	n/a	90	V	strike slip	0.1	13	421
64.85	<a href="#">S. San Andreas;SM+NSB+SSB+BG</a>	CA	n/a	81		strike slip	0	13	234
64.85	<a href="#">S. San Andreas;SM+NSB+SSB+BG+CO</a>	CA	n/a	83		strike slip	0.1	13	303
64.85	<a href="#">S. San Andreas;SSB</a>	CA	16	90	V	strike slip	0	13	43
64.85	<a href="#">S. San Andreas;SSB+BG+CO</a>	CA	n/a	77		strike slip	0.2	12	170
64.85	<a href="#">S. San Andreas;BB+NM+SM+NSB+SSB</a>	CA	n/a	90	V	strike slip	0	14	263
64.85	<a href="#">S. San Andreas;BB+NM+SM+NSB+SSB+BG</a>	CA	n/a	84		strike slip	0	14	321
64.85	<a href="#">S. San Andreas;CC+BB+NM+SM+NSB+SSB</a>	CA	n/a	90	V	strike slip	0	14	322
64.85	<a href="#">S. San Andreas;CC+BB+NM+SM+NSB+SSB+BG</a>	CA	n/a	85		strike slip	0	14	380
64.85	<a href="#">S. San Andreas;CC+BB+NM+SM+NSB+SSB+BG+CO</a>	CA	n/a	86		strike slip	0.1	13	449
64.85	<a href="#">S. San Andreas;CH+CC+BB+NM+SM+NSB+SSB</a>	CA	n/a	90	V	strike slip	0	14	384
64.85	<a href="#">S. San Andreas;CH+CC+BB+NM+SM+NSB+SSB+BG</a>	CA	n/a	86		strike slip	0	14	442
64.85	<a href="#">S. San Andreas;PK+CH+CC+BB+NM+SM+NSB+SSB+BG+CO</a>	CA	n/a	86		strike slip	0.1	13	548
64.85	<a href="#">S. San Andreas;NM+SM+NSB+SSB</a>	CA	n/a	90	V	strike slip	0	13	213

64.85	<a href="#">S. San Andreas;NM+SM+NSB+SSB+BG</a>	CA	n/a	83		strike slip	0	14	271
64.85	<a href="#">S. San Andreas;NM+SM+NSB+SSB+BG+CO</a>	CA	n/a	84		strike slip	0.1	13	340
64.85	<a href="#">S. San Andreas;NSB+SSB</a>	CA	n/a	90	V	strike slip	0	13	79
64.85	<a href="#">S. San Andreas;NSB+SSB+BG</a>	CA	n/a	75		strike slip	0	14	136
64.85	<a href="#">S. San Andreas;PK+CH+CC+BB+NM+SM+NSB+SSB+BG</a>	CA	n/a	86		strike slip	0.1	13	479
65.41	<a href="#">S. San Andreas;BG</a>	CA	n/a	58		strike slip	0	13	56
65.41	<a href="#">S. San Andreas;BG+CO</a>	CA	n/a	72		strike slip	0.3	12	125
65.77	<a href="#">San Jacinto;CC+B</a>	CA	n/a	90	V	strike slip	0.2	14	77
65.77	<a href="#">San Jacinto;CC</a>	CA	4	90	V	strike slip	0	16	43
65.77	<a href="#">San Jacinto;CC+B+SM</a>	CA	n/a	90	V	strike slip	0.2	14	103
66.62	<a href="#">Palos Verdes</a>	CA	3	90	V	strike slip	0	14	99
68.45	<a href="#">San Jacinto;C</a>	CA	14	90	V	strike slip	0	17	47
71.13	<a href="#">Earthquake Valley</a>	CA	2	90	V	strike slip	0	19	20
72.38	<a href="#">S. San Andreas;PK+CH+CC+BB+NM+SM+NSB</a>	CA	n/a	90	V	strike slip	0.1	13	377
72.38	<a href="#">S. San Andreas;BB+NM+SM+NSB</a>	CA	n/a	90	V	strike slip	0	14	220
72.38	<a href="#">S. San Andreas;CC+BB+NM+SM+NSB</a>	CA	n/a	90	V	strike slip	0	14	279
72.38	<a href="#">S. San Andreas;CH+CC+BB+NM+SM+NSB</a>	CA	n/a	90	V	strike slip	0	14	341
72.38	<a href="#">S. San Andreas;NSB</a>	CA	22	90	V	strike slip	0	13	35
72.38	<a href="#">S. San Andreas;NM+SM+NSB</a>	CA	n/a	90	V	strike slip	0	13	170
72.38	<a href="#">S. San Andreas;SM+NSB</a>	CA	n/a	90	V	strike slip	0	13	133
72.41	<a href="#">Puente Hills (Coyote Hills)</a>	CA	0.7	26	N	thrust	2.8	15	17
77.15	<a href="#">Cucamonga</a>	CA	5	45	N	thrust	0	8	28
78.85	<a href="#">San Jose</a>	CA	0.5	74	NW	strike	0	15	20



						slip			
78.87	<a href="#">Pinto Mtn</a>	CA	2.5	90	V	strike slip	0	16	74
82.87	<a href="#">Sierra Madre</a>	CA	2	53	N	reverse	0	14	57
82.87	<a href="#">Sierra Madre Connected</a>	CA	2	51		reverse	0	14	76
85.89	<a href="#">Puente Hills (Santa Fe Springs)</a>	CA	0.7	29	N	thrust	2.8	15	11
86.13	<a href="#">Cleghorn</a>	CA	3	90	V	strike slip	0	16	25
90.87	<a href="#">North Frontal (West)</a>	CA	1	49	S	reverse	0	16	50
93.24	<a href="#">Burnt Mtn</a>	CA	0.6	67	W	strike slip	0	16	21
94.89	<a href="#">S. San Andreas;PK+CH+CC+BB+NM+SM</a>	CA	n/a	90	V	strike slip	0.1	13	342
94.89	<a href="#">S. San Andreas;BB+NM+SM</a>	CA	n/a	90	V	strike slip	0	14	184
94.89	<a href="#">S. San Andreas;NM+SM</a>	CA	n/a	90	V	strike slip	0	14	134
94.89	<a href="#">S. San Andreas;CC+BB+NM+SM</a>	CA	n/a	90	V	strike slip	0	14	243
94.89	<a href="#">S. San Andreas;SM</a>	CA	29	90	V	strike slip	0	13	98
94.89	<a href="#">S. San Andreas;CH+CC+BB+NM+SM</a>	CA	n/a	90	V	strike slip	0	14	306
96.55	<a href="#">Puente Hills (LA)</a>	CA	0.7	27	N	thrust	2.1	15	22
98.51	<a href="#">S. San Andreas;CO</a>	CA	20	90	V	strike slip	0.6	11	69
98.56	<a href="#">Eureka Peak</a>	CA	0.6	90	V	strike slip	0	15	19
99.09	<a href="#">Clamshell-Sawpit</a>	CA	0.5	50	NW	reverse	0	14	16



### Search Results

10 earthquakes.

Only List Earthquakes Shown on Map

Format: Magnitude | Sort: Newest First


- 6.3** 7km SSE of Big Bear City, CA  
1992-06-28 15:05:30 (UTC) 3.6 km
- 6.0** 6km SSW of Morongo Valley, ...  
1986-07-08 09:20:44 (UTC) 9.5 km
- 6.0** 16km WSW of Oasis, CA  
1937-03-25 16:49:02 (UTC) 6.0 km
- 6.4** Long Beach, California Earth...  
1933-03-11 01:54:09 (UTC) 6.0 km
- 6.8** Southern California  
1918-04-21 22:32:25 (UTC) km
- 6.8** Southern California  
1899-12-25 12:25:00 (UTC) km
- 6.4** Southern California  
1899-07-22 20:32:00 (UTC) km
- 6.8** Southern California  
1890-02-09 12:06:00 (UTC) km
- 6.0** Near San Bernardino, Califor...  
1858-12-16 10:00:00 (UTC) km
- 6.5** Gulf of Santa Catalina, Califo...  
1800-11-22 21:30:00 (UTC) km



Scale: 5000 km / 3000 mi | Coordinates: 87.007°N : 60.469°E

**APPENDIX E**  
**SLOPE STABILITY ANALYSIS**

203306-10A  
Carancho Raod SFR  
Cross Section A-A'  
Static Analysis  
Horizontal Acceleration = 0  
Factor of Safety = 3.542

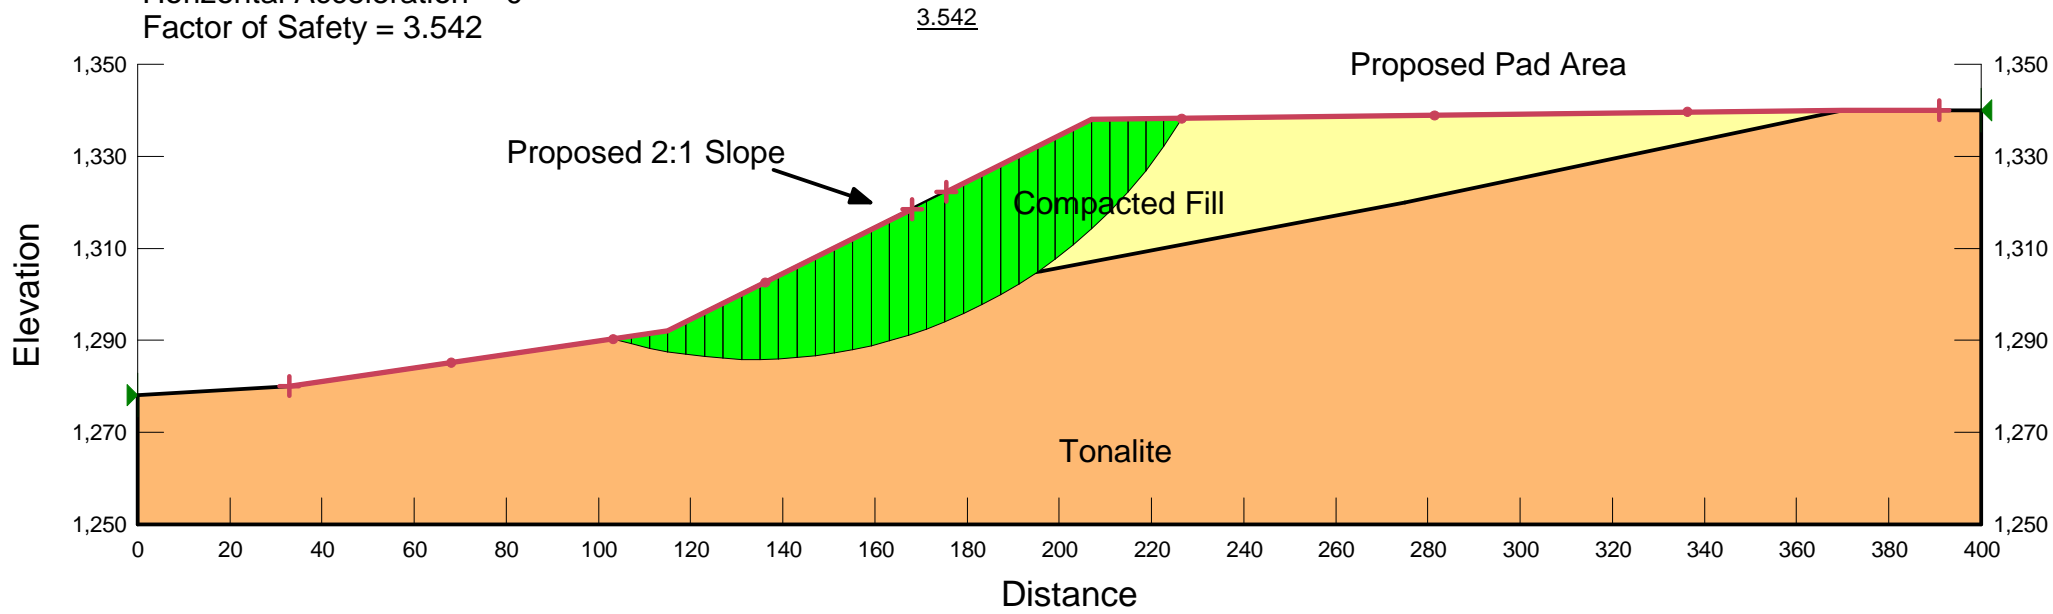

# SLOPE/W Analysis

Report generated using GeoStudio 2012. Copyright © 1991-2012 GEO-SLOPE International Ltd.

## File Information

Created By: [Aaron Wood](#)  
Last Edited By: [Aaron Wood](#)  
Revision Number: 5  
File Version: 8.0  
Tool Version: 8.0.9.6484  
Date: [1/12/2021](#)  
Time: [12:54:52 PM](#)  
File Name: [A-A' Static.gsz](#)  
Directory: [Z:\20 Projects\203306 - Steve Lam, Ventura Engineering, Carancho Road,PRELIM, PERC, Infil, PHASE I\ENGINEERING & GEOLOGY\Slope Stability\](#)  
Last Solved Date: [1/12/2021](#)  
Last Solved Time: [12:54:54 PM](#)

## Project Settings

Length(L) Units: [feet](#)  
Time(t) Units: [Seconds](#)  
Force(F) Units: [lbf](#)  
Pressure(p) Units: [psf](#)  
Strength Units: [psf](#)  
Unit Weight of Water: [62.4 pcf](#)  
View: [2D](#)

## Analysis Settings

### SLOPE/W Analysis

Kind: [SLOPE/W](#)  
Method: [Morgenstern-Price](#)  
Settings  
Side Function  
Interslice force function option: [Half-Sine](#)  
Lambda  
Lambda 1: [-1](#)  
Lambda 2: [-0.8](#)  
Lambda 3: [-0.6](#)  
Lambda 4: [-0.4](#)  
Lambda 5: [-0.2](#)  
Lambda 6: [0](#)  
Lambda 7: [0.2](#)  
Lambda 8: [0.4](#)  
Lambda 9: [0.6](#)  
Lambda 10: [0.8](#)  
Lambda 11: [1](#)  
PWP Conditions Source: [\(none\)](#)  
Slip Surface  
Direction of movement: [Right to Left](#)  
Use Passive Mode: [No](#)  
Slip Surface Option: [Entry and Exit](#)

Critical slip surfaces saved: 1  
Optimize Critical Slip Surface Location: No  
Tension Crack

Tension Crack Option: (none)

F of S Distribution

F of S Calculation Option: Constant

Advanced

Number of Slices: 30

F of S Tolerance: 0.001

Minimum Slip Surface Depth: 0.1 ft

Optimization Maximum Iterations: 2,000

Optimization Convergence Tolerance: 1e-007

Starting Optimization Points: 8

Ending Optimization Points: 16

Complete Passes per Insertion: 1

Driving Side Maximum Convex Angle: 5 °

Resisting Side Maximum Convex Angle: 1 °

## Materials

### Bedrock

Model: Mohr-Coulomb

Unit Weight: 140 pcf

Cohesion': 160 psf

Phi': 48.5 °

Phi-B: 0 °

### Compacted Fill

Model: Mohr-Coulomb

Unit Weight: 135 pcf

Cohesion': 1,160 psf

Phi': 41 °

Phi-B: 0 °

## Slip Surface Entry and Exit

Left Projection: Range

Left-Zone Left Coordinate: (32.82614, 1,279.9895) ft

Left-Zone Right Coordinate: (168, 1,318.5) ft

Left-Zone Increment: 4

Right Projection: Range

Right-Zone Left Coordinate: (175.52021, 1,322.2601) ft

Right-Zone Right Coordinate: (391, 1,340) ft

Right-Zone Increment: 4

Radius Increments: 4

## Slip Surface Limits

Left Coordinate: (0, 1,278) ft

Right Coordinate: (400, 1,340) ft

## Points

	X (ft)	Y (ft)
Point 1	0	1,278

oint 2	33	2 0
oint 3		2 2
oint 4	6	30
oint	27	320
oint 6	370	340
oint 7	400	340
oint	400	2 0
oint	0	2 0
oint 0	207	33

## Regions

	Material	oints	Area (ft <sup>2</sup> )
Region	Bedrock	2 3,4 5,6,7,8	23,075
Region 2	Compacted Fill	3 0 6, ,4	4,02

## Current Slip Surface

Slip Surface:

F of S: 3. 42

Volume: 2 30 .22 <sup>3</sup>

Weight: 3 4 47 .6 lbs

Resisting Moment: 42 6 32 lbs-

Activating Moment: 2 0 3 7 4 lbs-ft

Resisting Force: 34 0 4. 6 lbs

Activating Force: . 4 lbs

F of S Rank:

Exit: ( 03.22 4 2 0.277 )

Entry: (226.604 33 .2406)

Radius: 0 .060

Center: ( 33. 6602 3 3. 74 )


## Slip Slices

	X ( )	Y ( )	PWP (psf)	Base Normal Stress (psf)	Frictional Strength (psf)	Cohesive Strength (psf)
Slice	0 . 24	2 .73 4	0	146.74571	165.86586	160
Slice 2	0 . 474	2 .72 7	0	404. 8 2	457.72234	160
Slice 3	3.03 2	2 7. 7 7	0	646.3 471	730.52588	160
Slice 4	7.006	2 7. 72	0	978.465 8	1,105.9546	160
Slice	2 .0 77	2 6.6 4	0	1,397.9904	1,580.1407	160
Slice 6	2 .032 4	2 6.2027	0	1,787.5224	2,020.4265	160
Slice 7	2 .046 2	2 . 447	0	2, 40.3118	2,419.1824	160
Slice	33.0 3	2 . 364	0	2,450.994	2,770.3447	160
Slice	37.0724	2 . 773	0	2,71 .9604	3,069.8348	160
Slice 0	4 .0 6	2 6.067	0	2, 33.5198	3,315.741	160
Slice	4 .0 3	2 6.407	0	3, 03.851	3,508.2654	160

lice 12	149 11201	1,2		3,228.7814	3,649.4735	160
lice 13	153 12519	1,2 7.5456		3,311.4449	3,742.9076	160
lice 14	157 13836	1,288.3477		3,355.8808	3,793.1333	160
lice 15	161 15154	1,289.3101		3,366.6269	3,805.2795	160
lice 16	165 16472	1,290.437		3,348.3496	3,784.6208	160
lice 17	169 1779	1,291.7339		3,305.5353	3,736.228	160
lice 18	173 19107	1,293.2075		3,242.2513	3,664.6984	160
lice 19	177 20425	1,294.8657		3,161.9746	3,573.9622	160
lice 20	181 21743	1,296.7179		3,067.4765	3,467.1515	160
lice 21	185 23061	1,298.7755		2,960.7478	3,346.5166	160
lice 22	189 24378	1,301.0521		2,842.9472	3,213.3673	160
lice 23	193 25696	1,303.5644		2,714.3547	3,068.0198	160
lice 24	197 21963	1,306.2946		2,547.2934	2,214.3284	1,1
lice 25	201 13178	1,309.26		2,393.0956	2,080.2863	1,1
lice 26	205 04393	1,312.5217		2,221.0666	1,930.7437	1,1
lice 27	208 9605	1,316.1217		1,930.3979	1,678.0693	1,1
lice 28	212 8815	1,320.11		1,514.6747	1,316.6866	1,1
lice 29	216 80249	1,324.55		1,056.9027	918.7514	1,1
lice 30	220 72349	1,329.5362		539.9226	469.34761	1,1
lice 31	224 64449	1,335.2102		-61.060752	-53.079302	1,1



203306-10A  
Carancho Raod SFR  
Cross Section A-A'  
Pseudo Static Analysis  
Horizontal Acceleration = 0.2  
Factor of Safety = 2.286

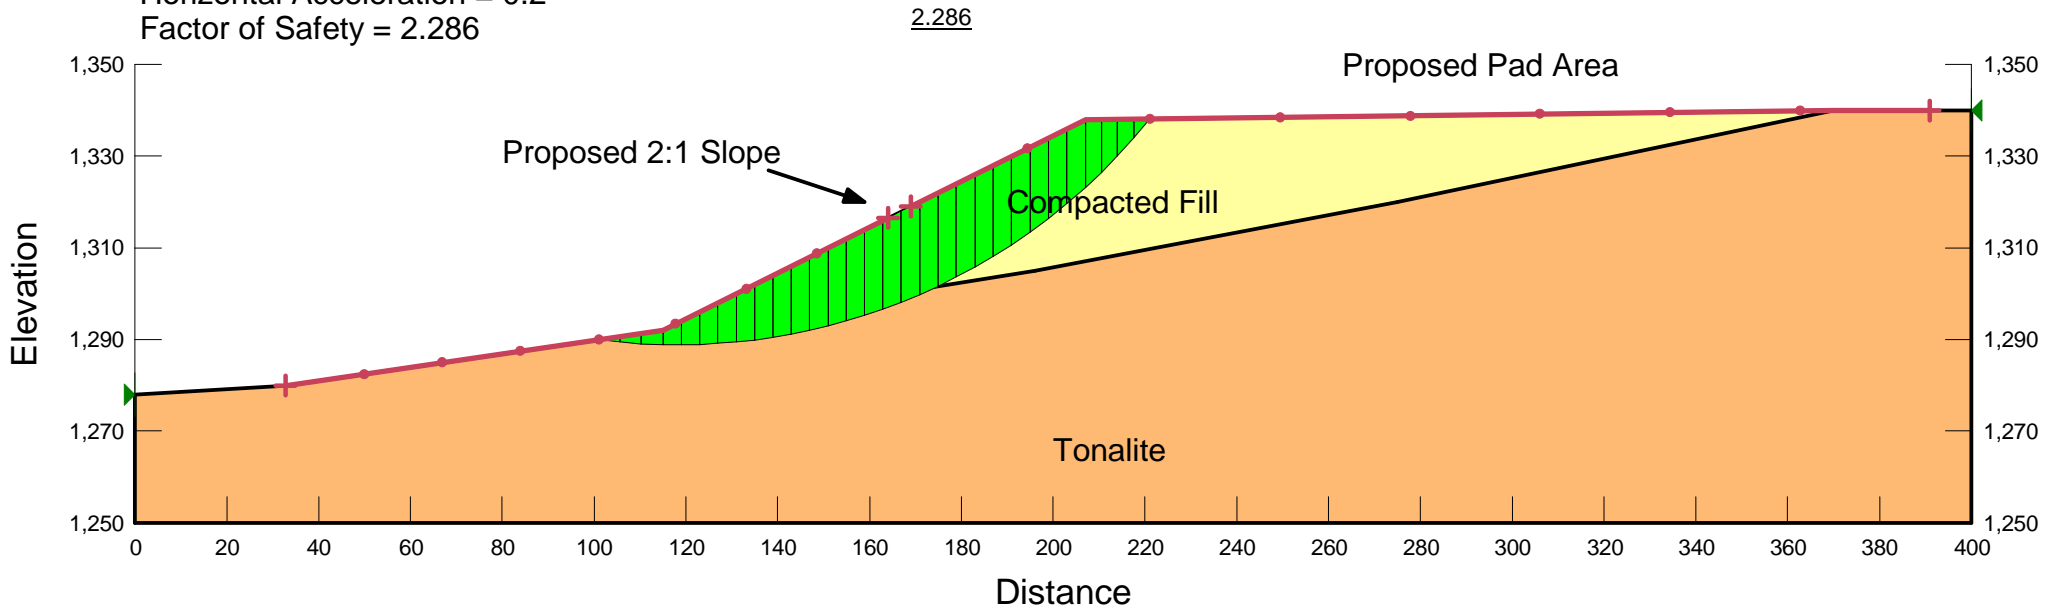

# SLOPE/W Analysis

---

Report generated using GeoStudio 2012. Copyright © 1991-2012 GEO-SLOPE International Ltd.

## File Information

Created By: [Aaron Wood](#)  
Last Edited By: [Aaron Wood](#)  
Revision Number: [12](#)  
File Version: [8.0](#)  
Tool Version: [8.0.9.6484](#)  
Date: [1/13/2021](#)  
Time: [5:19:08 PM](#)  
File Name: [A-A' EQ.gsz](#)  
Directory: [Z:\20 Projects\203306 - Steve Lam, Ventura Engineering, Carancho Road,PRELIM, PERC, Infil, PHASE I\ENGINEERING & GEOLOGY\Slope Stability\](#)  
Last Solved Date: [1/13/2021](#)  
Last Solved Time: [5:19:11 PM](#)

## Project Settings

Length(L) Units: [feet](#)  
Time(t) Units: [Seconds](#)  
Force(F) Units: [lbf](#)  
Pressure(p) Units: [psf](#)  
Strength Units: [psf](#)  
Unit Weight of Water: [62.4 pcf](#)  
View: [2D](#)

## Analysis Settings

### SLOPE/W Analysis

Kind: [SLOPE/W](#)  
Method: [Morgenstern-Price](#)  
Settings  
Side Function  
Interslice force function option: [Half-Sine](#)  
Lambda  
Lambda 1: [-1](#)  
Lambda 2: [-0.8](#)  
Lambda 3: [-0.6](#)  
Lambda 4: [-0.4](#)  
Lambda 5: [-0.2](#)  
Lambda 6: [0](#)  
Lambda 7: [0.2](#)  
Lambda 8: [0.4](#)  
Lambda 9: [0.6](#)  
Lambda 10: [0.8](#)  
Lambda 11: [1](#)  
PWP Conditions Source: [\(none\)](#)  
Slip Surface  
Direction of movement: [Right to Left](#)  
Use Passive Mode: [No](#)  
Slip Surface Option: [Entry and Exit](#)

Critical slip surfaces saved: 1  
Optimize Critical Slip Surface Location: No  
Tension Crack

Tension Crack Option: (none)

F of S Distribution

F of S Calculation Option: Constant

Advanced

Number of Slices: 30

F of S Tolerance: 0.001

Minimum Slip Surface Depth: 0.1 ft

Optimization Maximum Iterations: 2,000

Optimization Convergence Tolerance: 1e-007

Starting Optimization Points: 8

Ending Optimization Points: 16

Complete Passes per Insertion: 1

Driving Side Maximum Convex Angle: 5 °

Resisting Side Maximum Convex Angle: 1 °

## Materials

### Bedrock

Model: Mohr-Coulomb

Unit Weight: 140 pcf

Cohesion': 160 psf

Phi': 48.5 °

Phi-B: 0 °

### Compacted Fill

Model: Mohr-Coulomb

Unit Weight: 135 pcf

Cohesion': 1,160 psf

Phi': 41 °

Phi-B: 0 °

## Slip Surface Entry and Exit

Left Projection: Range

Left-Zone Left Coordinate: (32.82614, 1,279.9895) ft

Left-Zone Right Coordinate: (164, 1,316.5) ft

Left-Zone Increment: 8

Right Projection: Range

Right-Zone Left Coordinate: (169, 1,319) ft

Right-Zone Right Coordinate: (391, 1,340) ft

Right-Zone Increment: 8

Radius Increments: 8

## Slip Surface Limits

Left Coordinate: (0, 1,278) ft

Right Coordinate: (400, 1,340) ft

## Seismic Coefficients

Horz Seismic Coef.: 0.2

Ignore seismic load in strength: No

## oints

	X	Y
int 1	0	1,278
int 2	33	1,280
int 3	115	1,292
int 4	196	1,305
int 5	275	1,320
int 6	370	1,340
int 7	400	1,340
int 8	400	1,250
int 9	0	1,250
int 10	207	1,338

## Regions

	M teri l	ints	Are ft <sup>2</sup>
Regi n 1	Bedr ck	1,2,3,4,5,6,7,8,9	23,075
Regi n 2	C mp cted Fill	3,10,6,5,4	4,021

## Current Slip Surface

Slip Surf ce: 346

F f S: 2.286

V lume: 1,584.2929 <sup>3</sup>

Weight: 215,199.76 lbs

Resisting M ment: 35,968,772 lbs-

Activ ting M ment: 15,732,047 lbs-ft

Resisting F rce: 242,257.34 lbs

Activ ting F rce: 105,966.39 lbs

F f S R nk: 1

Exit: 101.01698, 1,289.9537

Entry: 221.13803, 1,338.1735

R dius: 131.98643


Center: 118.22526, 1,420.8135

## Slip Slices

	X	Y	PWP (psf)	Base Normal Stress (psf)	Frictional Strength (psf)	Cohesive Strength (psf)
Slice 1	103.34748	1,289.6893	0	110.23411	124.597	160
Slice 2	108.00849	1,289.2439	0	308.22742	348.38772	160
Slice 3	112.6695	1,288.9647	0	491.09082	555.0772	160
Slice 4	116.99656	1,288.8479	0	749.0551	846.65278	160
Slice 5	120.98969	1,288.8712	0	1,080.0294	1,220.7511	160
Slice 6	124.98281	1,289.0154	0	1,380.7637	1,560.6694	160
Slice 7	128.97593	1,289.2809	0	1,641.1966	1,855.0353	160
Slice 8	132.96906	1,289.6686	0	1,853.9873	2,095.5515	160
Slice 9	136.96218	1,290.1794	0	2,015.4521	2,278.0541	160

Slice 10	140.95531	1,290.8149	0	2,125.8128	2,402.7943	160
Slice 11	144.94843	1,291.5768	0	2,188.777	2,473.9624	160
Slice 12	148.94156	1,292.4675	0	2,210.6334	2,498.6665	160
Slice 13	152.93468	1,293.4896	0	2,199.1307	2,485.6651	160
Slice 14	156.9278	1,294.6463	0	2,162.3943	2,444.1421	160
Slice 15	160.92093	1,295.9414	0	2,108.057	2,382.725	160
Slice 16	164.91405	1,297.3793	0	2,042.6823	2,308.8324	160
Slice 17	168.90718	1,298.9649	0	1,971.47	2,228.3414	160
Slice 18	172.9003	1,300.7042	0	1,898.1816	2,145.504	160
Slice 19	176.90331	1,302.6091	0	1,863.0896	1,619.5591	1,160
Slice 20	180.9162	1,304.6883	0	1,773.9946	1,542.11	1,160
Slice 21	184.92909	1,306.9469	0	1,682.7636	1,462.8041	1,160
Slice 22	188.94199	1,309.3958	0	1,588.7549	1,381.0836	1,160
Slice 23	192.95488	1,312.0478	0	1,490.3428	1,295.5352	1,160
Slice 24	196.96777	1,314.9184	0	1,384.8934	1,203.8695	1,160
Slice 25	200.98066	1,318.0258	0	1,268.6573	1,102.8269	1,160
Slice 26	204.99355	1,321.3923	0	1,136.5413	987.98028	1,160
Slice 27	208.76725	1,324.8101	0	917.26748	797.36846	1,160
Slice 28	212.30176	1,328.2734	0	599.58741	521.21338	1,160
Slice 29	215.83627	1,332.0126	0	235.15703	204.41889	1,160
Slice 30	219.37078	1,336.0643	0	-192.5789	-167.40628	1,160

203306-10A  
Carancho Raod SFR  
Cross Section A-A'

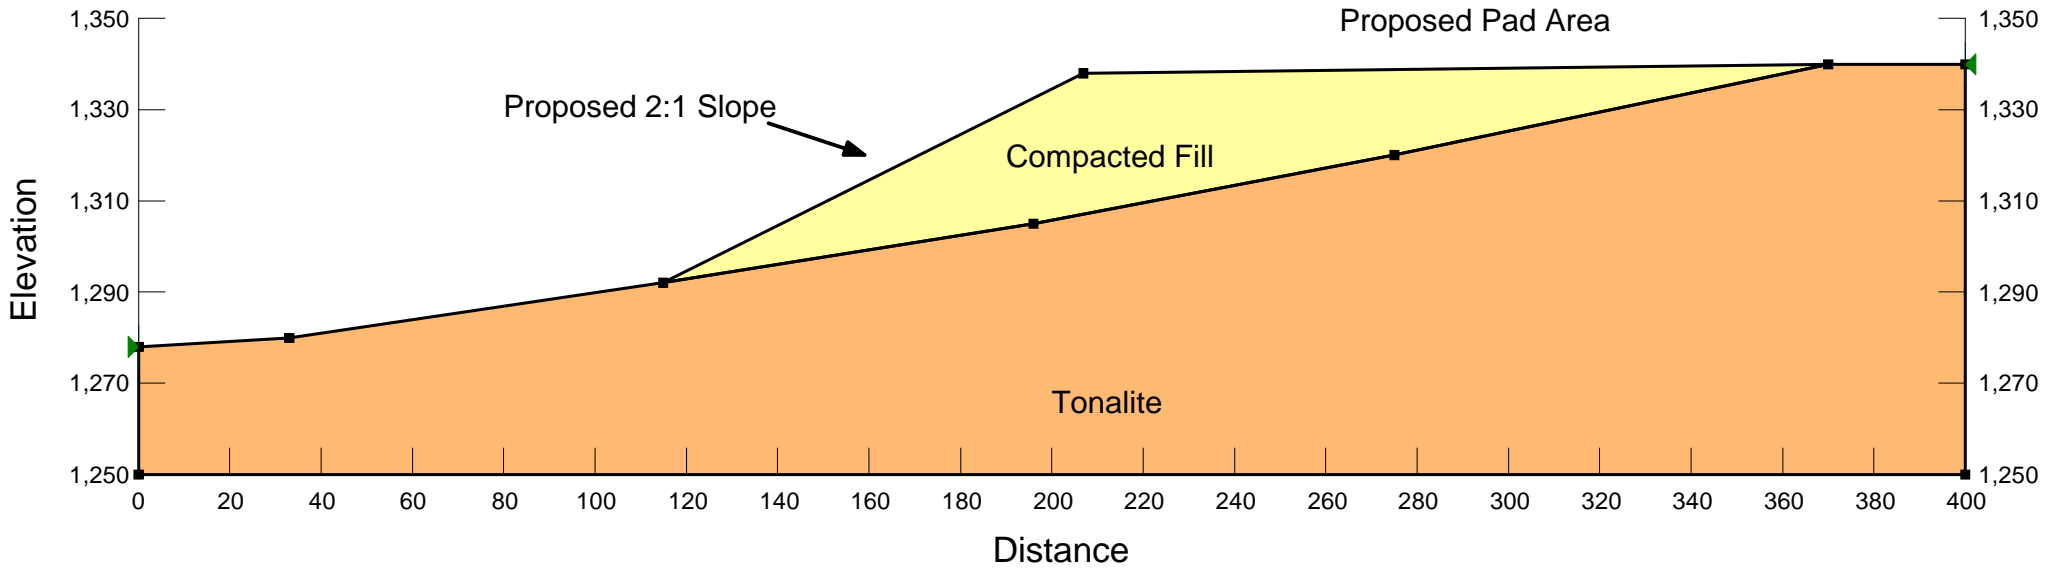

## SURFICIAL STABILITY




JN: 203306-10 CONSULT: AGW  
 PROJECT: Carancho Raod

CALCULATION SHEET # 1

CALCULATE THE SURFICIAL STABILITY OF THE EARTH MATERIAL USING THE INFINITE SLOPE ANALYSIS WITH PARALLEL SEEPAGE. THIS METHOD WAS RECOMMENDED BY THE ASCE AND THE BUILDING AND SAFETY ADVISORY COMMITTEE (8/16/78). MODIFIED FROM SKEMPTON & DeLORY, 1957.

### CALCULATION PARAMETERS

EARTH MATERIAL:	Compacted Fill	SHEAR DIAGRAM:	1
COHESION:	1160 psf	SLOPE ANGLE:	27 degrees
PHI ANGLE:	41 degrees	SATURATION DEPTH (t):	4.0 feet
DENSITY:	135 pcf		

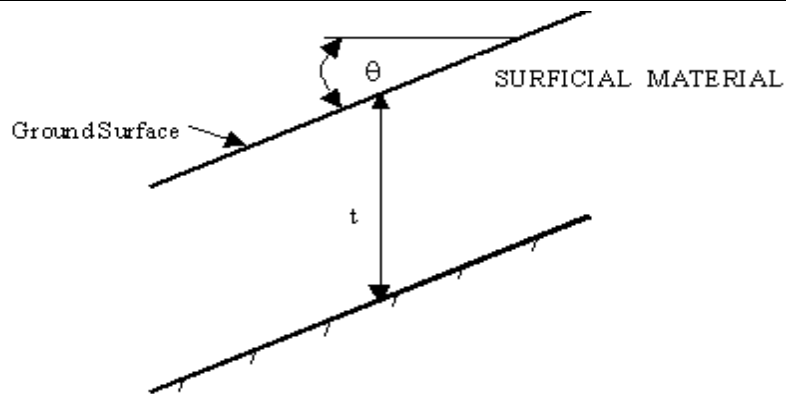

$$FS = \frac{C + (\gamma_{soil} - \gamma_{water}) \cdot t \cdot \cos^2 \theta \tan \Phi}{\gamma_{soil} \cdot t \cdot \cos \Phi \sin \Phi}$$

SAFETY FACTOR = 6.23

### CONCLUSIONS:

THE CALCULATION INDICATES THAT COMPACTED FILL SLOPES ARE SURFICIALLY STABLE.

**APPENDIX F**  
**GENERAL EARTHWORK AND GRADING**  
**SPECIFICATIONS**



## EARTH-STRATA

### **General Earthwork and Grading Specifications**

#### **General**

**Intent:** These General Earthwork and Grading Specifications are intended to be the minimum requirements for the grading and earthwork shown on the approved grading plan(s) and/or indicated in the geotechnical report(s). These General Earthwork and Grading Specifications should be considered a part of the recommendations contained in the geotechnical report(s) and if they are in conflict with the geotechnical report(s), the specific recommendations in the geotechnical report shall supersede these more general specifications. Observations made during earthwork operations by the project Geotechnical Consultant may result in new or revised recommendations that may supersede these specifications and/or the recommendations in the geotechnical report(s).

**The Geotechnical Consultant of Record:** The Owner shall employ a qualified Geotechnical Consultant of Record (Geotechnical Consultant), prior to commencement of grading or construction. The Geotechnical Consultant shall be responsible for reviewing the approved geotechnical report(s) and accepting the adequacy of the preliminary geotechnical findings, conclusions, and recommendations prior to the commencement of the grading or construction.

Prior to commencement of grading or construction, the Owner shall coordinate with the Geotechnical Consultant, and Earthwork Contractor (Contractor) to schedule sufficient personnel for the appropriate level of observation, mapping, and compaction testing.

During earthwork and grading operations, the Geotechnical Consultant shall observe, map, and document the subsurface conditions to confirm assumptions made during the geotechnical design phase of the project. Should the observed conditions differ significantly from the interpretive assumptions made during the design phase, the Geotechnical Consultant shall recommend appropriate changes to accommodate the observed conditions, and notify the reviewing agency where required.

The Geotechnical Consultant shall observe the moisture conditioning and processing of the excavations and fill materials. The Geotechnical Consultant should perform periodic relative density testing of fill materials to verify that the attained level of compaction is being accomplished as specified.

**The Earthwork Contractor:** The Earthwork Contractor (Contractor) shall be qualified, experienced, and knowledgeable in earthwork logistics, preparation and processing of earth materials to receive compacted fill, moisture-conditioning and processing of fill, and compacting fill. The Contractor shall be provided with the approved grading plans and geotechnical report(s) for his review and acceptance of responsibilities, prior to commencement of grading. The Contractor shall be solely responsible for performing the grading in accordance with the approved grading plans and geotechnical report(s). Prior to commencement of grading, the Contractor shall prepare and submit to the Owner and the Geotechnical Consultant a work plan that indicates the sequence of earthwork grading, the number of "equipment" of work and the estimated quantities of daily earthwork contemplated for the site. The Contractor shall inform the Owner and the Geotechnical Consultant of work schedule changes and revisions to the work plan at least 24 hours in advance of such changes so that appropriate personnel will be available for observation and testing. No assumptions shall be made by the Contractor with regard to whether the Geotechnical Consultant is aware of all grading operations.

It is the sole responsibility of the Contractor to provide adequate equipment and methods to accomplish the earthwork operations in accordance with the applicable grading codes and agency ordinances, these specifications, and the recommendations in the approved geotechnical report(s) and grading plan(s). At the sole discretion of the Geotechnical Consultant, any unsatisfactory conditions, such as unsuitable earth materials, improper moisture conditioning, inadequate compaction, insufficient buttress keyway size, adverse weather conditions, etc., resulting in a quality of work less than required in the approved grading plans and geotechnical report(s), the Geotechnical Consultant shall reject the work and may recommend to the Owner that grading be stopped until conditions are corrected.

### **Preparation of Areas for Compacted Fill**

**Clearing and Grubbing:** Vegetation, such as brush, grass, roots, and other deleterious material shall be sufficiently removed and properly disposed in a method acceptable to the Owner, Geotechnical Consultant, and governing agencies.

The Geotechnical Consultant shall evaluate the extent of these removals on a site by site basis. Earth materials to be placed as compacted fill shall not contain more than 1 percent organic materials (by volume). No compacted fill lift shall contain more than 10 percent organic matter.

Should potentially hazardous materials be encountered, the Contractor shall stop work in the affected area, and a hazardous materials specialist shall immediately be consulted to evaluate the potentially hazardous materials, prior to continuing to work in that area.

It is our understanding that the State of California defines most refined petroleum products (gasoline, diesel fuel, motor oil, grease, coolant, etc.) as hazardous waste. As such, indiscriminate dumping or spillage of these fluids may constitute a misdemeanor, punishable by fines and/or imprisonment, and shall be prohibited. The contractor is responsible for all hazardous waste related to his operations. The Geotechnical Consultant does not have expertise in this area. If hazardous waste is a concern, then the Owner should contract the services of a qualified environmental assessor.

**Processing:** Exposed earth materials that have been observed to be satisfactory for support of compacted fill by the Geotechnical Consultant shall be scarified to a minimum depth of 6 inches. Exposed earth materials that are not observed to be satisfactory shall be removed or alternative recommendations may be provided by the Geotechnical Consultant. Scarification shall continue until the exposed earth materials are broken down and free of oversize material and the working surface is reasonably uniform, flat, and free of uneven features that would inhibit uniform compaction. The earth materials should be moistened or air dried to near optimum moisture content, prior to compaction.

**Overexcavation:** The Cut Lot Typical Detail and Cut/Fill Transition Lot Typical Detail, included herein provides a graphic illustration that depicts typical overexcavation recommendations made in the approved geotechnical report(s) and/or grading plan(s).

**Keyways and Benching:** Where fills are to be placed on slopes steeper than 5:1 (horizontal to vertical units), the ground shall be thoroughly benched as compacted fill is placed. Please see the three Keyway and Benching Typical Details with subtitles Cut Over Fill Slope, Fill Over Cut Slope, and Fill Slope for a graphic illustration. The lowest bench or smallest keyway shall be a minimum of 10 feet wide (or ½ the proposed slope height) and at least 2 feet into competent earth materials as advised by the Geotechnical Consultant. Typical benches shall be excavated a minimum height of 4 feet into competent earth materials or as recommended by the Geotechnical Consultant. Fill placed on slopes steeper than 5:1 should be thoroughly benched or otherwise excavated to provide a flat subgrade for the compacted fill.

**Evaluation/Acceptance of Bottom Excavations:** All areas to receive compacted fill (bottom excavations), including removal excavations, processed areas, keyways, and benching, shall be observed, mapped, general elevations recorded, and/or tested prior to being accepted by the Geotechnical Consultant as suitable to receive compacted fill. The Contractor shall obtain a written acceptance from the Geotechnical Consultant prior to placing compacted fill. A licensed surveyor shall provide the survey control for determining elevations of bottom excavations, processed areas, keyways, and

benching. The Geotechnical Consultant is not responsible for erroneously located, fills, subdrain systems, or excavations.

## **Fill Materials**

**General:** Earth material to be used as compacted fill should to a large extent be free of organic matter and other deleterious substances as evaluated and accepted by the Geotechnical Consultant.

**Oversize:** Oversize material is rock that does not break down into smaller pieces and has a maximum diameter greater than 12 inches. Oversize rock shall not be included within compacted fill unless specific methods and guidelines acceptable to the Geotechnical Consultant are followed. For examples of methods and guidelines of oversize rock placement see the enclosed Oversize Rock Disposal Detail. The inclusion of oversize materials in the compacted fill shall only be acceptable if the oversize material is completely surrounded by compacted fill or thoroughly jetted granular materials. No oversize material shall be placed within 10 vertical feet of finish grade or within 2 feet of proposed utilities or underground improvements.

**Import:** Should imported earth materials be required, the proposed import materials shall meet the requirements of the Geotechnical Consultant. Well graded, very low expansion potential earth materials free of organic matter and other deleterious substances are usually sought after as import materials. However, it is generally in the Owners best interest that potential import earth materials are provided to the Geotechnical Consultant to determine their suitability for the intended purpose. At least 48 hours should be allotted for the appropriate laboratory testing to be performed, prior to starting the import operations.

## **Fill Placement and Compaction Procedures**

**Fill Layers:** Fill materials shall be placed in areas prepared to receive fill in nearly horizontal layers not exceeding 8 inches in loose thickness. Thicker layers may be accepted by the Geotechnical Consultant, provided field density testing indicates that the grading procedures can adequately compact the thicker layers. Each layer of fill shall be spread evenly and thoroughly mixed to obtain uniformity within the earth materials and consistent moisture throughout the fill.

**Moisture Conditioning of Fill:** Earth materials to be placed as compacted fill shall be watered, dried, blended, and/or mixed, as needed to obtain relatively uniform moisture contents that are at or slightly above optimum. The maximum density and optimum moisture content tests should be performed in accordance with the American Society of Testing and Materials (ASTM test method D1557-00).

**Compaction of Fill:** After each layer has been moisture-conditioned, mixed, and evenly spread, it should be uniformly compacted to a minimum of 90 percent of maximum dry density as determined by ASTM test method D1557-00. Compaction equipment shall be adequately sized and be either specifically designed for compaction of earth materials or be proven to consistently achieve the required level of compaction.

**Compaction of Fill Slopes:** In addition to normal compaction procedures specified above, additional effort to obtain compaction on slopes is needed. This may be accomplished by backrolling of slopes with sheepsfoot rollers as the fill is being placed, by overbuilding the fill slopes, or by other methods producing results that are satisfactory to the Geotechnical Consultant. Upon completion of grading, relative compaction of the fill and the slope face shall be a minimum of 90 percent of maximum density per ASTM test method D1557-00.

**Compaction Testing of Fill:** Field tests for moisture content and relative density of the compacted fill earth materials shall be periodically performed by the Geotechnical Consultant. The location and frequency of tests shall be at the Geotechnical Consultant's discretion based on field observations. Compaction test locations will not necessarily be random. The test locations may or may not be selected to verify minimum compaction requirements in areas that are typically prone to inadequate compaction, such as close to slope faces and near benching.

**Frequency of Compaction Testing:** Compaction tests shall be taken at minimum intervals of every 2 vertical feet and/or per 1,000 cubic yards of compacted materials placed. Additionally, as a guideline, at least one (1) test shall be taken on slope faces for each 5,000 square feet of slope face and/or for each 10 vertical feet of slope. The Contractor shall assure that fill placement is such that the testing schedule described herein can be accomplished by the Geotechnical Consultant. The Contractor shall stop or slow down the earthwork operations to a safe level so that these minimum standards can be obtained.

**Compaction Test Locations:** The approximate elevation and horizontal coordinates of each test location shall be documented by the Geotechnical Consultant. The Contractor shall coordinate with the Surveyor to assure that sufficient grade stakes are established. This will provide the Geotechnical Consultant with sufficient accuracy to determine the approximate test locations and elevations. The Geotechnical Consultant can not be responsible for staking erroneously located by the Surveyor or Contractor. A minimum of two grade stakes should be provided at a maximum horizontal distance of 100 feet and vertical difference of less than 5 feet.

## **Subdrain System Installation**

Subdrain systems shall be installed in accordance with the approved geotechnical report(s), the approved grading plan, and the typical details provided herein. The Geotechnical Consultant may recommend additional subdrain systems and/or changes to the subdrain systems described herein, with regard to the extent, location, grade, or material depending on conditions encountered during grading or other factors. All subdrain systems shall be surveyed by a licensed land surveyor (except for retaining wall subdrain systems) to verify line and grade after installation and prior to burial. Adequate time should be allowed by the Contractor to complete these surveys.


## **Excavation**

All excavations and over-excavations for remedial purposes shall be evaluated by the Geotechnical Consultant during grading operations. Remedial removal depths indicated on the geotechnical plans are estimates only. The actual removal depths and extent shall be determined by the Geotechnical Consultant based on the field evaluation of exposed conditions during grading operations. Where fill over cut slopes are planned, the cut portion of the slope shall be excavated, evaluated, and accepted by the Geotechnical Consultant prior to placement of the fill portion of the proposed slope, unless specifically addressed by the Geotechnical Consultant. Typical details for cut over fill slopes and fill over cut slopes are provided herein.



## **Trench Backfill**

- 1) The Contractor shall follow all OSHA and Cal/OSHA requirements for trench excavation safety.
- 2) Bedding and backfill of utility trenches shall be done in accordance with the applicable provisions in the Standard Specifications of Public Works Construction. Bedding materials shall have a Sand Equivalency more than 30 (SE>30). The bedding shall be placed to 1 foot over the conduit and thoroughly jetting to provide densification. Backfill should be compacted to a minimum of 90 percent of maximum dry density, from 1 foot above the top of the conduit to the surface.
- 3) Jetting of the bedding materials around the conduits shall be observed by the Geotechnical Consultant.
- 4) The Geotechnical Consultant shall test trench backfill for the minimum compaction requirements recommended herein. At least one test should be conducted for every 300 linear feet of trench and for each 2 vertical feet of backfill.
- 5) For trench backfill the lift thicknesses shall not exceed those allowed in the Standard Specifications of Public Works Construction, unless the Contractor can demonstrate to the Geotechnical Consultant that the fill lift can be compacted to the minimum relative compaction by his alternative equipment or method.

# STABILIZATION FILL TYPICAL DETAIL

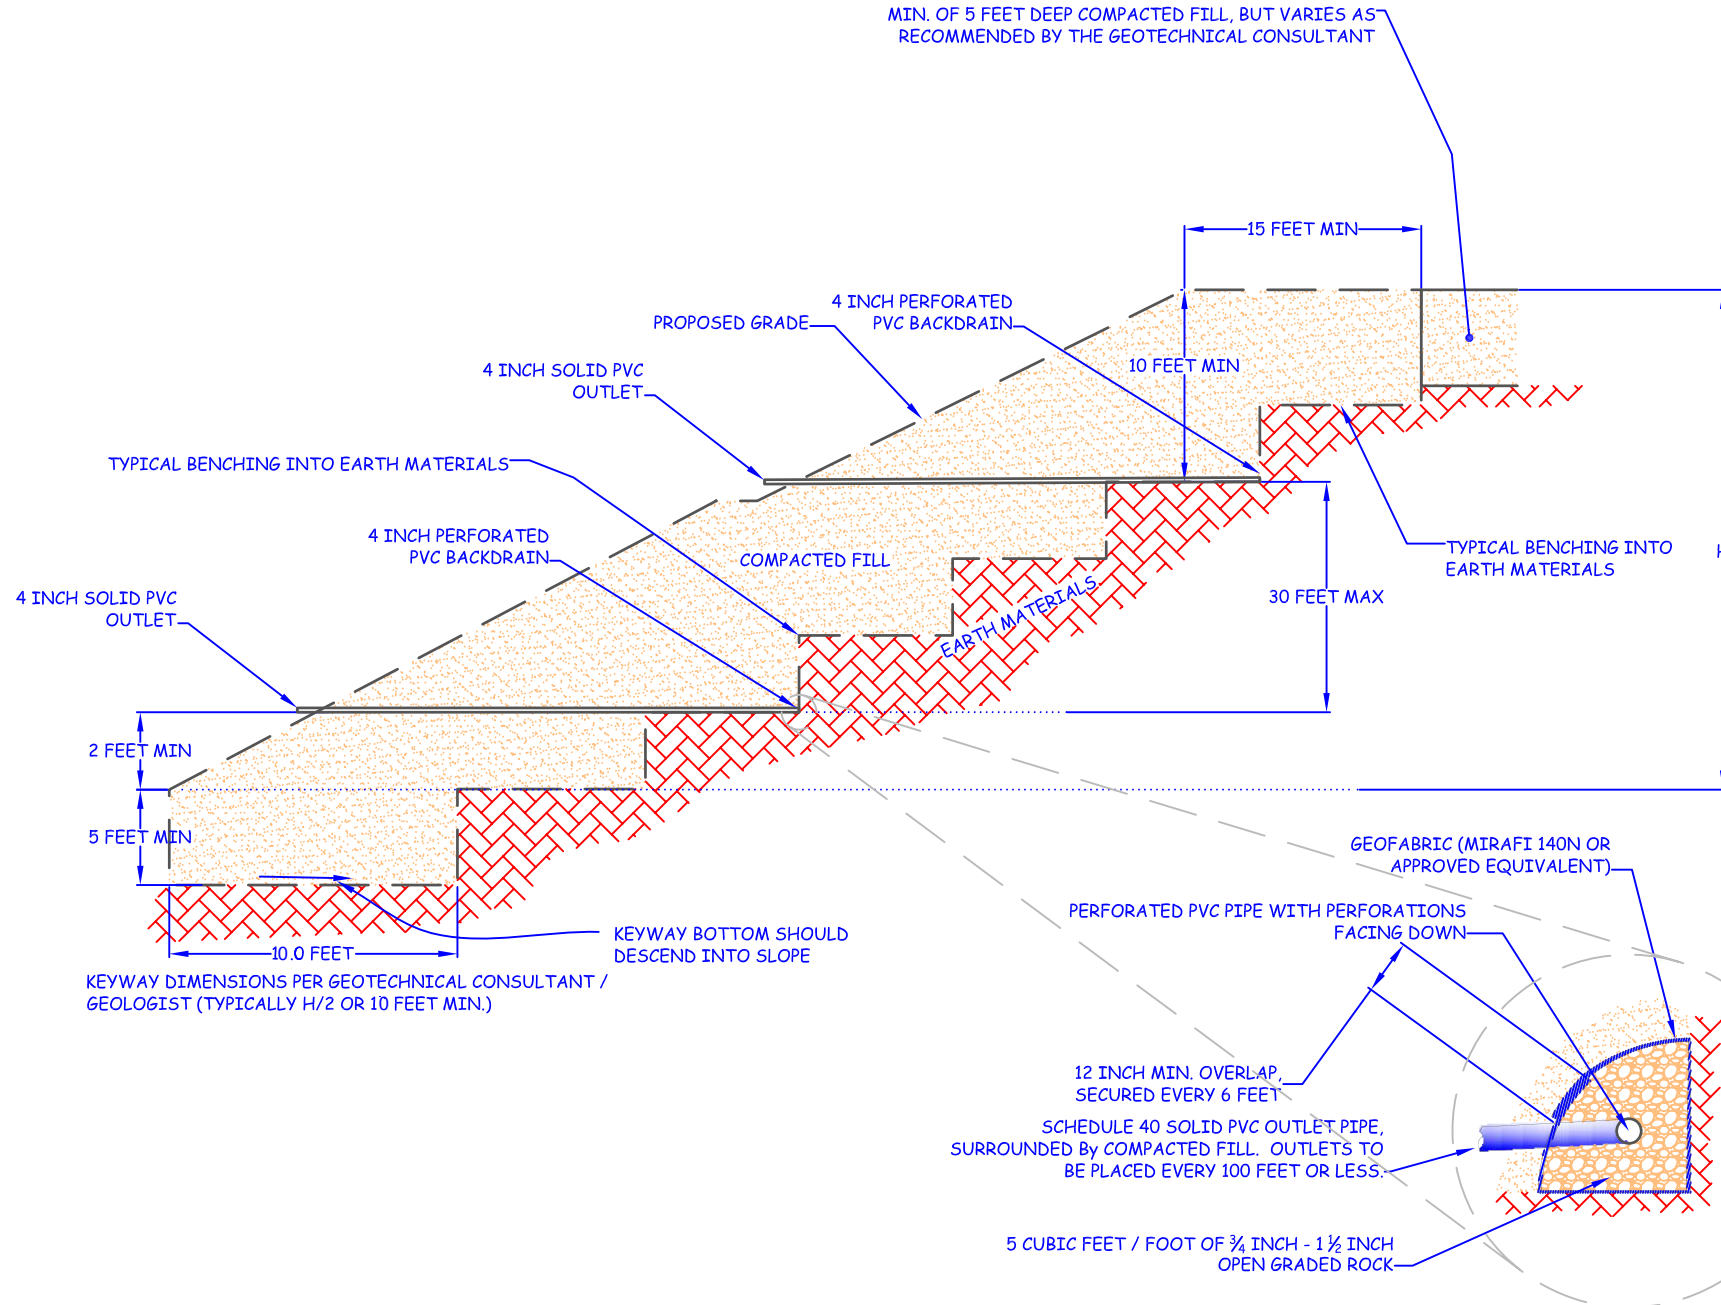


# BUTTRESS TYPICAL DETAIL

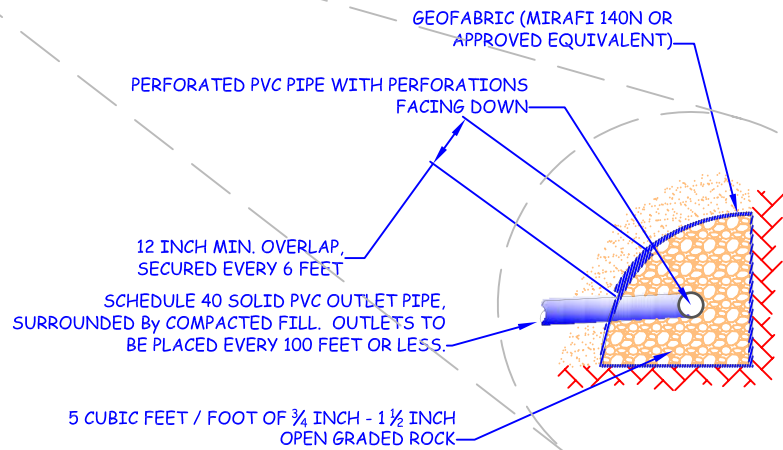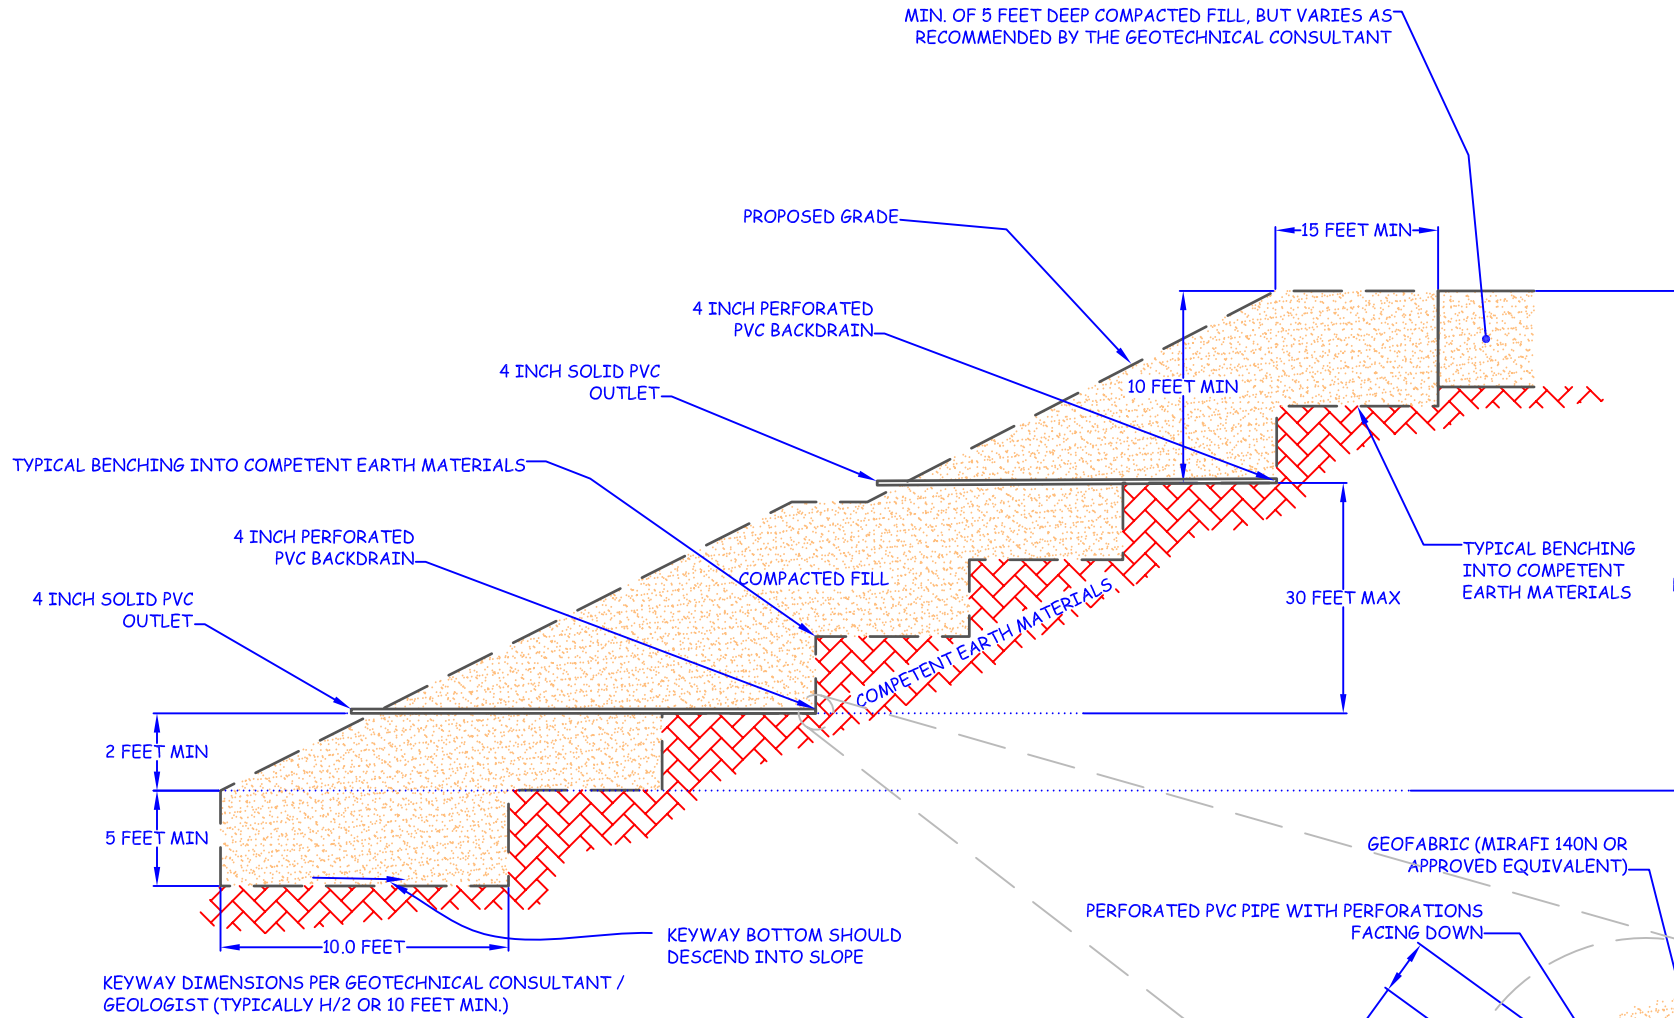





# CANYON SUBDRAIN SYSTEM TYPICAL DETAIL

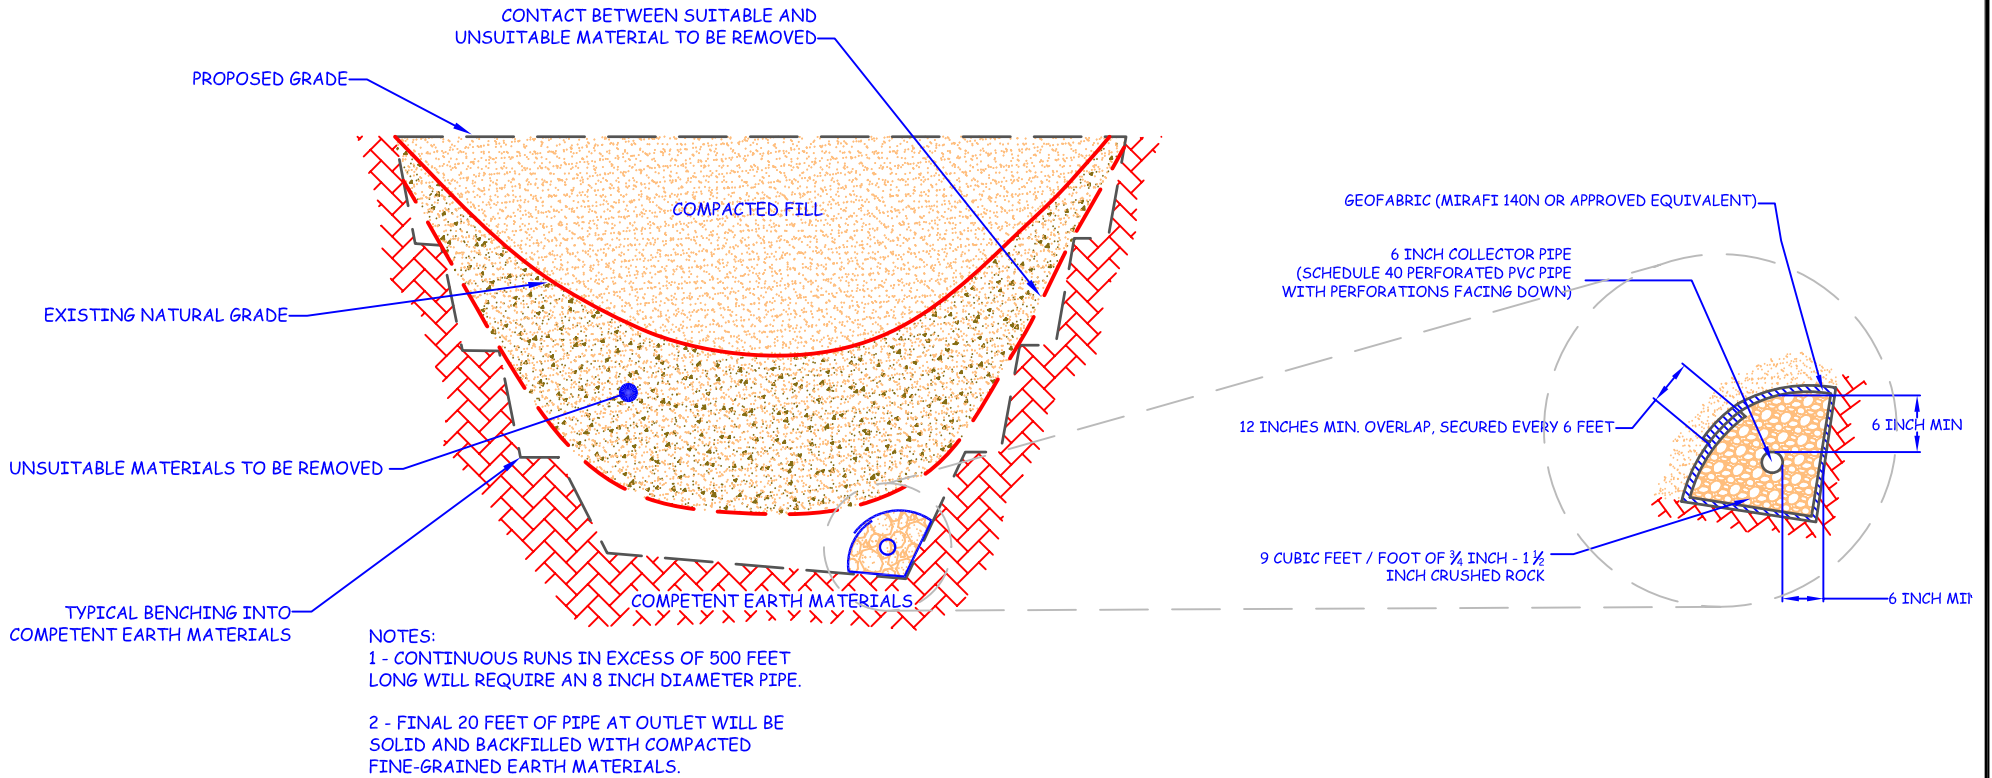

## CANYON SUBDRAIN TYPICAL OUTLET

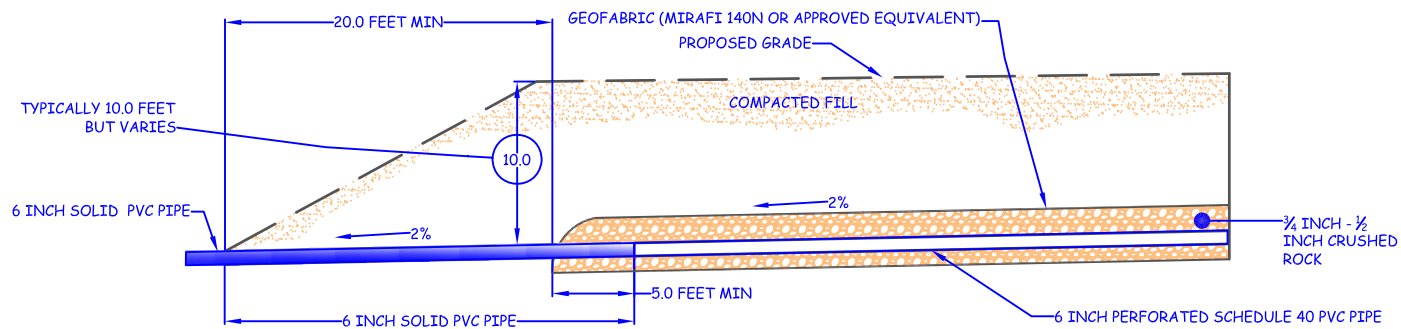


## CUT LOT TYPICAL DETAIL

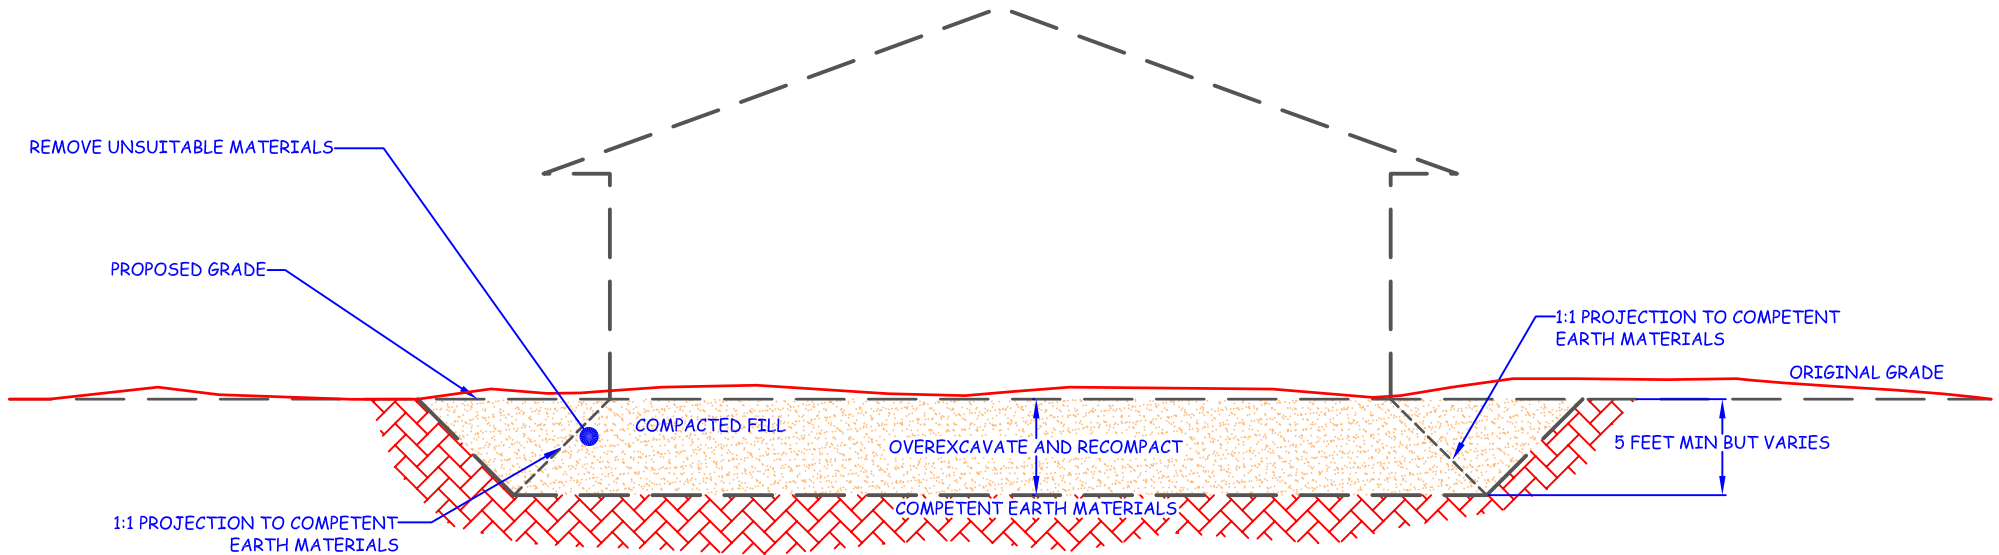

NOTE: REMOVAL BOTTOMS SHOULD BE GRADED WITH A MINIMUM 2% FALL TOWARDS STREET OR OTHER SUITABLE AREA (AS DETERMINED BY THE GEOTECHNICAL CONSULTANT) TO AVOID PONDING BELOW THE BUILDING

NOTE: WHERE DESIGN CUT LOTS ARE EXCAVATED ENTIRELY INTO COMPETENT EARTH MATERIALS, OVEREXCAVATION MAY STILL BE NEEDED FOR HARD-ROCK CONDITIONS OR MATERIALS WITH VARIABLE EXPANSION POTENTIALS


# CUT / FILL TRANSITION LOT TYPICAL DETAIL

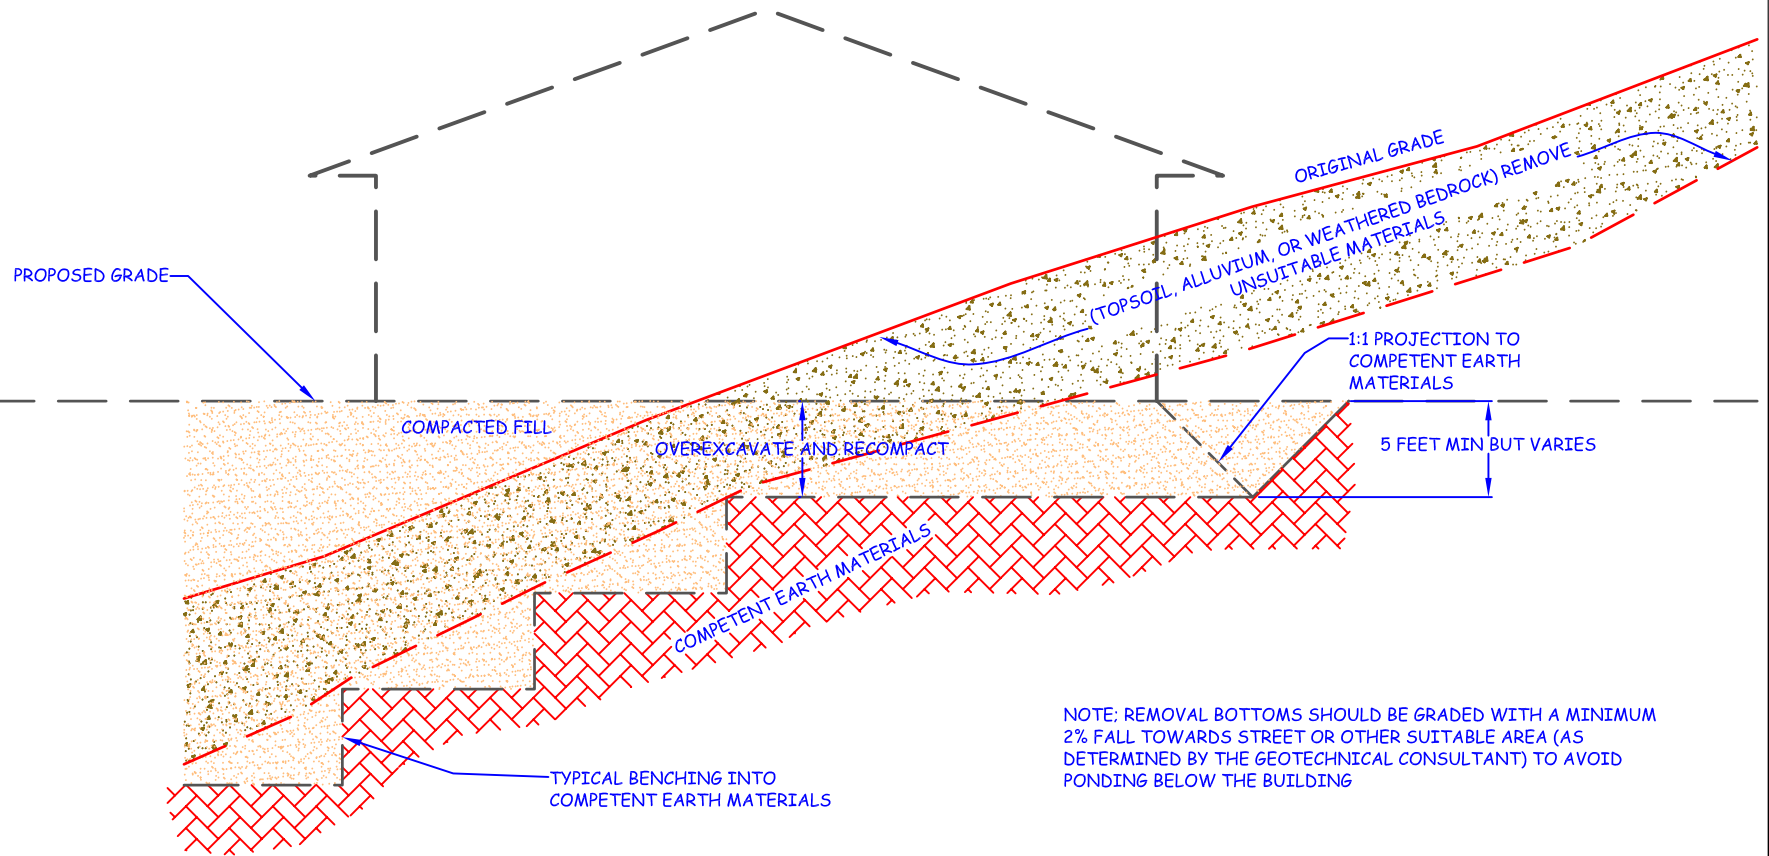

NOTE: REMOVAL BOTTOMS SHOULD BE GRADED WITH A MINIMUM 2% FALL TOWARDS STREET OR OTHER SUITABLE AREA (AS DETERMINED BY THE GEOTECHNICAL CONSULTANT) TO AVOID PONDING BELOW THE BUILDING

NOTE: WHERE DESIGN CUT LOTS ARE EXCAVATED ENTIRELY INTO COMPETENT EARTH MATERIALS, OVEREXCAVATION MAY STILL BE NEEDED FOR HARD-ROCK CONDITIONS OR MATERIALS WITH VARIABLE EXPANSION POTENTIALS


# KEYWAY & BENCHING TYPICAL DETAILS CUT OVER FILL SLOPE

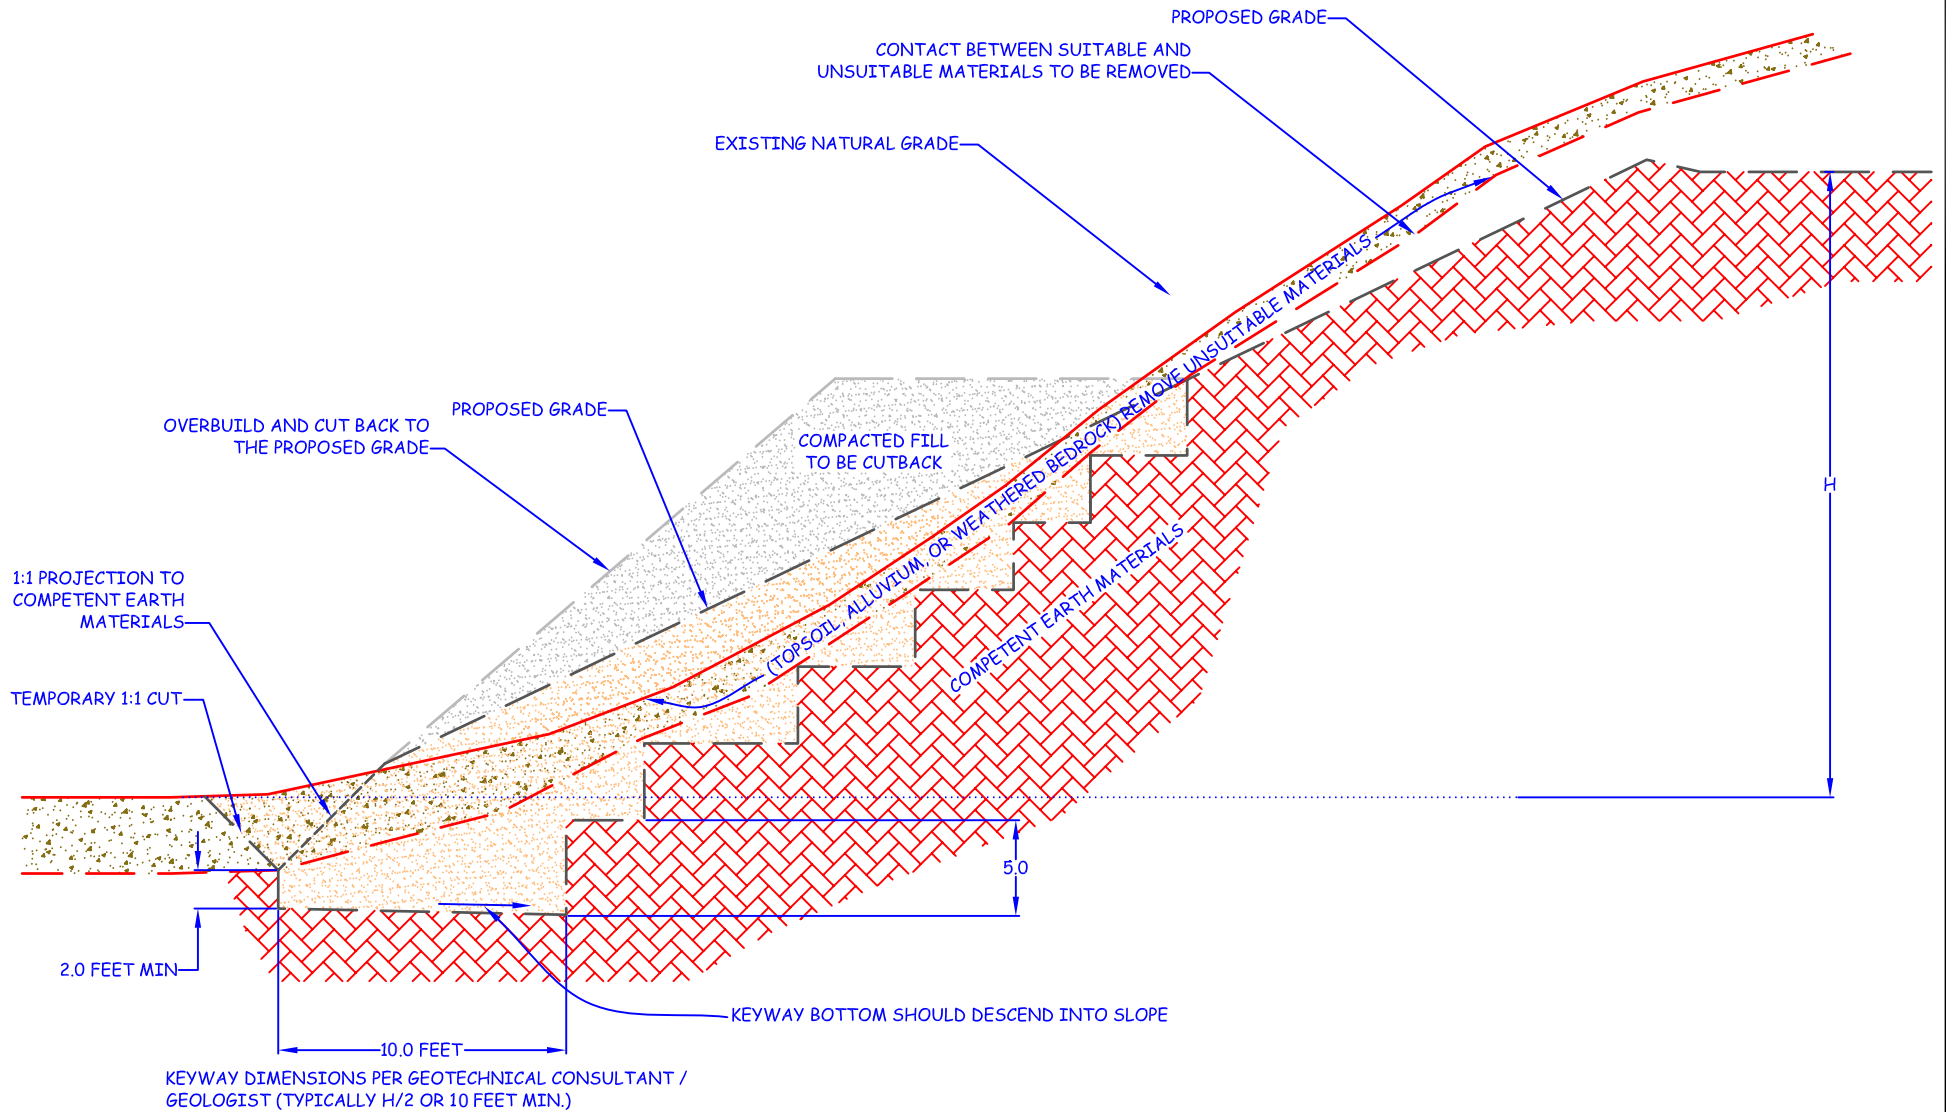

NOTE:

NATURAL SLOPES STEEPER THAN 5:1 (H:V) MUST BE BENCHING INTO COMPETENT EARTH MATERIALS

# KEYWAY & BENCHING TYPICAL DETAILS FILL OVER CUT SLOPE

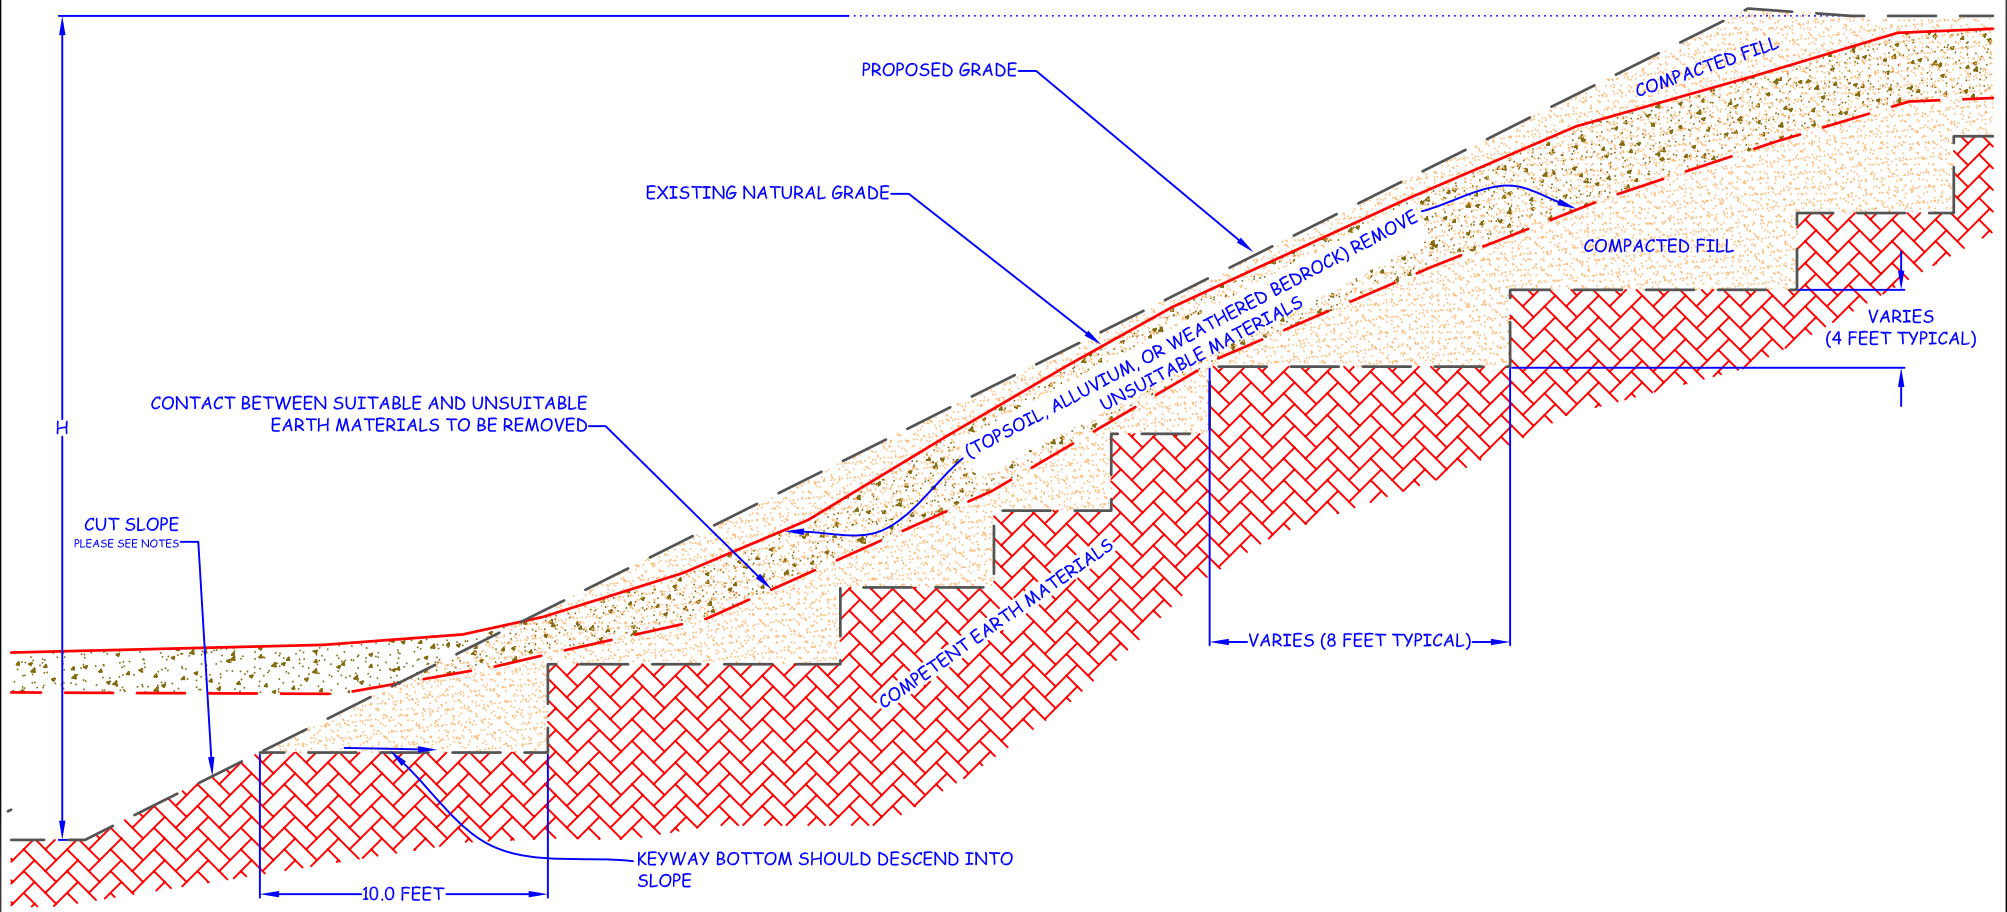


KEYWAY DIMENSIONS PER GEOTECHNICAL CONSULTANT / GEOLOGIST (TYPICALLY H/2 OR 10 FEET MIN.)

**NOTES:**

NATURAL SLOPES STEEPER THAN 5:1 (H:V) MUST BE BENCHED INTO COMPETENT EARTH MATERIALS

THE CUT SLOPE MUST BE CONSTRUCTED FIRST


# KEYWAY & BENCHING TYPICAL DETAILS FILL SLOPE

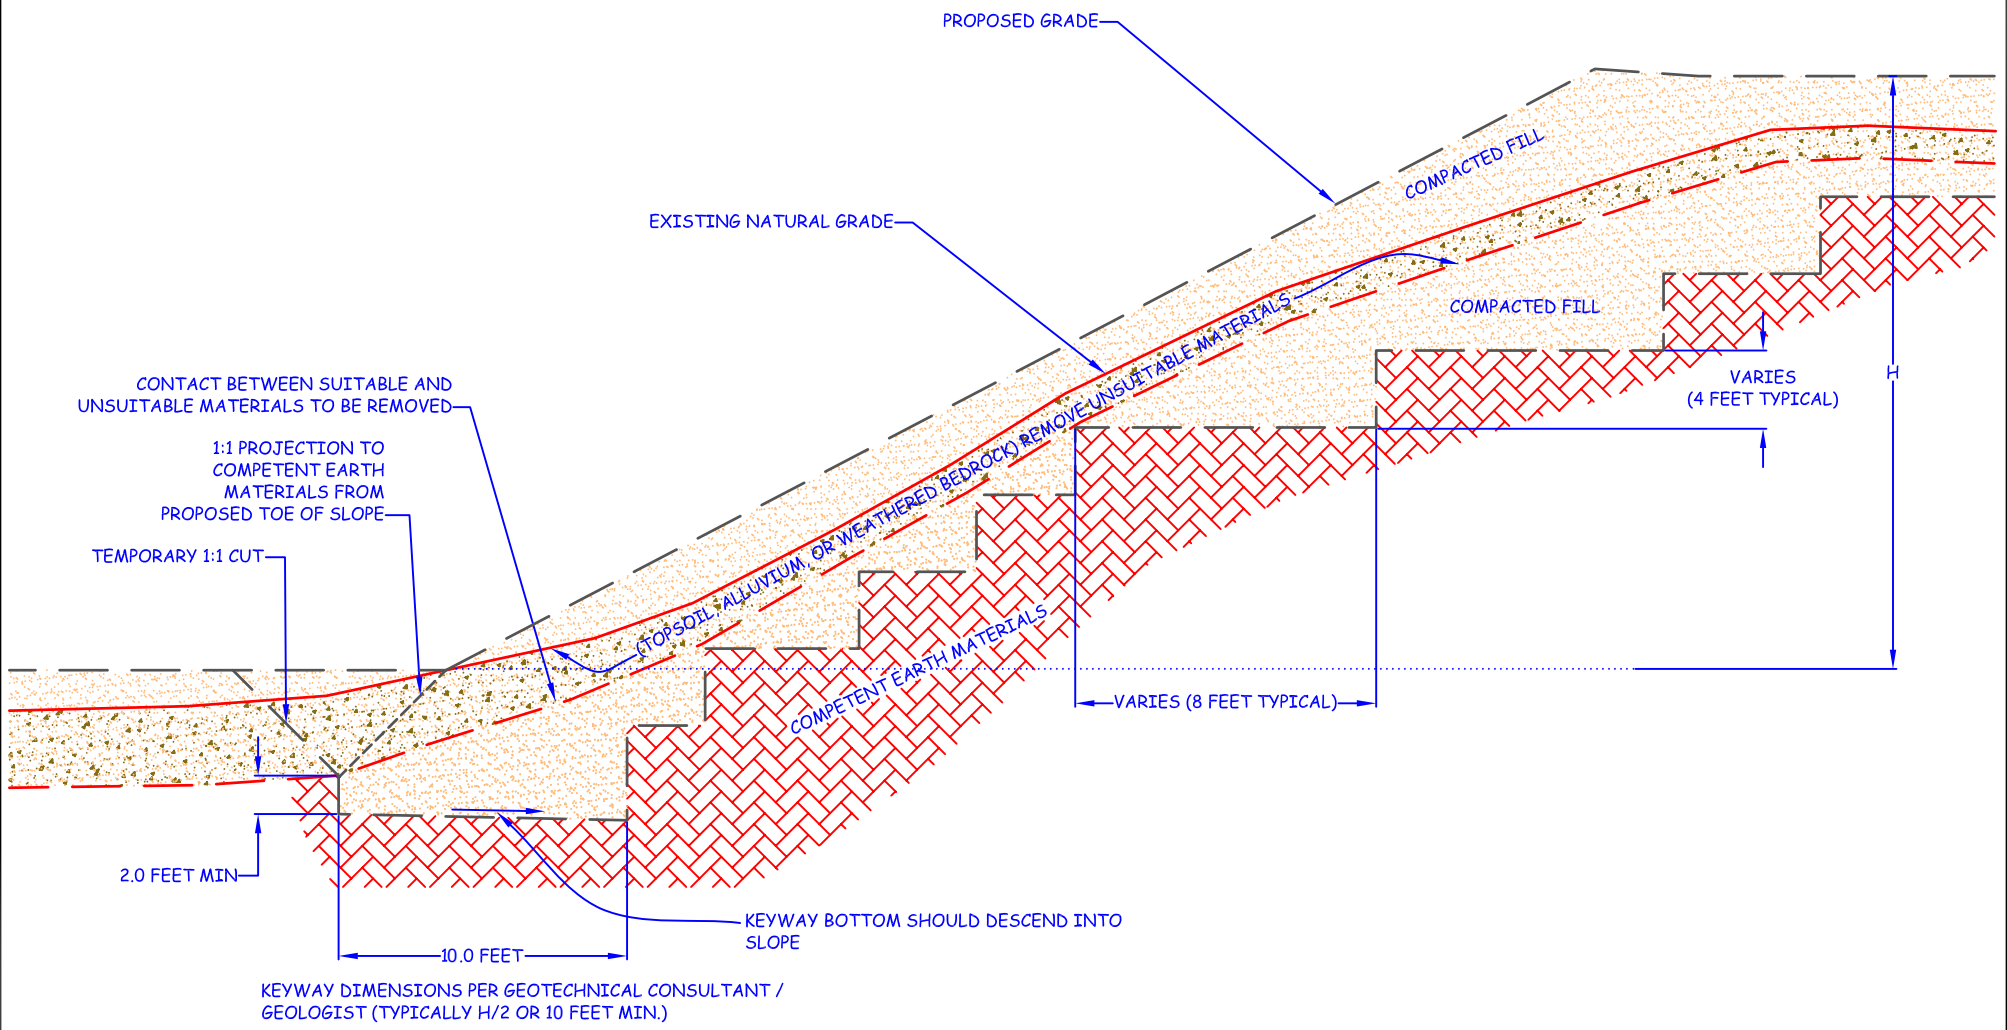

**NOTES:**

NATURAL SLOPES STEEPER THAN 5:1 (H:V) MUST BE BENCHING INTO COMPETENT EARTH MATERIALS


# OVERSIZE ROCK TYPICAL DETAIL

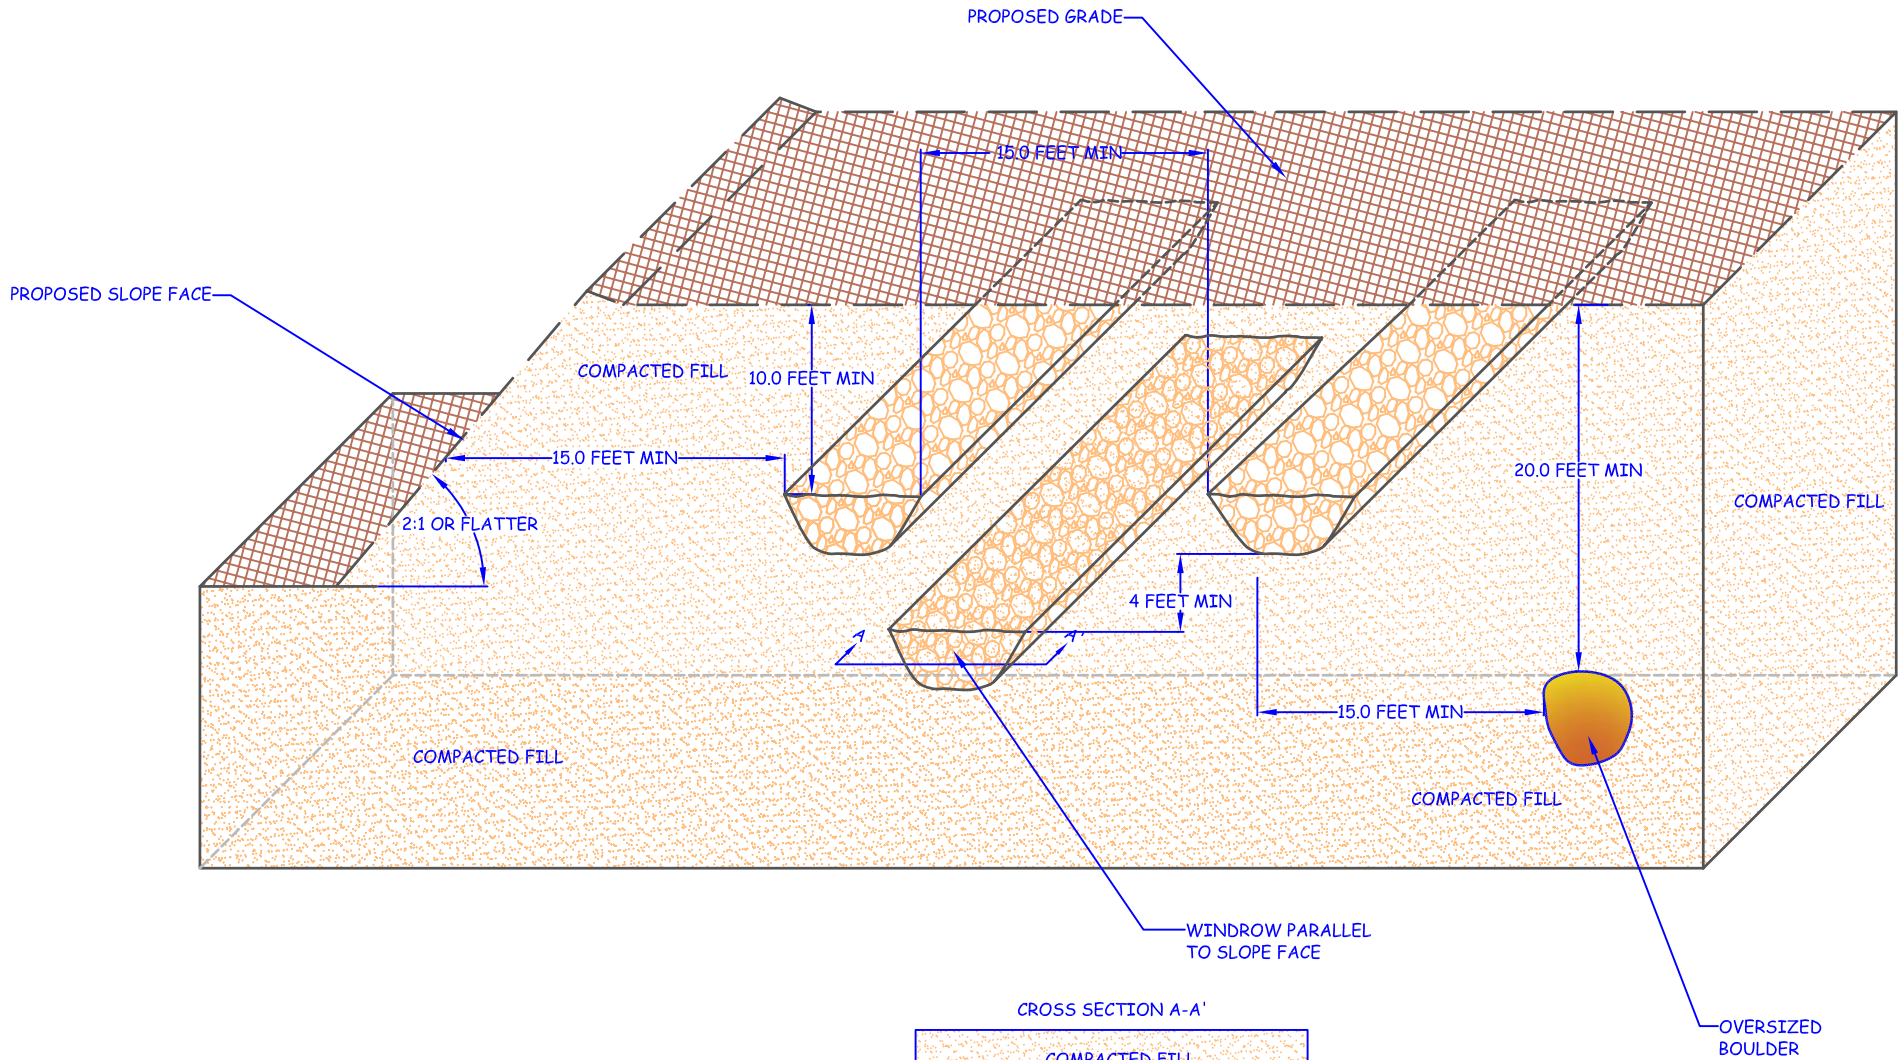

CROSS SECTION A-A'

JETTING OF APPROVED GRANULAR MATERIAL

EXCAVATED TRENCH OR DOZER V-CUT

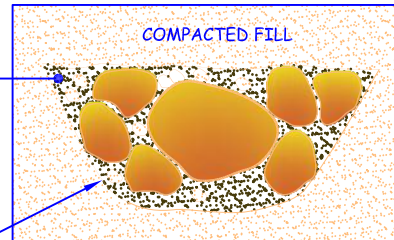

**NOTES:**

OVERSIZE ROCK IS LARGER THAN 8 INCHES IN MAX DIAMETER







**LEGEND**


Locations are Approximate

**Geologic Units**

Kt - Cretaceous Tonalite

**Symbols**

-  - Limits of Report
-  - Test Pit Location  
Including Total Depth and Depth to Groundwater
-  - Recommended Removal Depths
-  - Cross Section Location

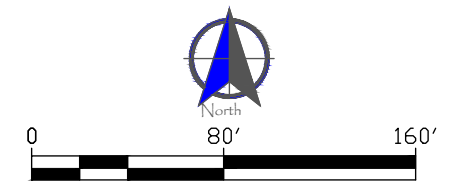

**GEOTECHNICAL MAP**

22750 CARANCHO ROAD  
 TEMECULA AREA, RIVERSIDE COUNTY, CALIFORNIA  
 APN 933-020-005-6

PROJECT	PROPOSED CANNABIS CULTIVATION FACILITY		
CLIENT	FUEGO FARMS, LLC.		
PROJECT NO.	203306-10A		
DATE	JANUARY 2021		
SCALE	1:80		
DWG XREFS			
REVISION			
DRAWN BY	JDG	PLATE	1 OF 3



**Earth Strata Geotechnical Services, Inc.**  
 Geotechnical, Environmental and Materials Testing Consultants  
[www.ESGSINC.com](http://www.ESGSINC.com) (951) 397-8315





**LEGEND**  
Locations are Approximate

**Symbols**

-  - Limits of Report
-  - Test Pit Location  
Including Total Depth and  
Depth to Groundwater



**OVERALL SITE MAP**


22750 CARANCHO ROAD  
TEMECULA AREA, RIVERSIDE COUNTY, CALIFORNIA  
APN 933-020-005-6

PROJECT	PROPOSED CANNABIS CULTIVATION FACILITY		
CLIENT	FUEGO FARMS, LLC.		
PROJECT NO.	203306-10A		
DATE	JANUARY 2021		
SCALE	1:200		
DWG XREFS			
REVISION			
DRAWN BY	JDG	PLATE	2 OF 3

**LEGEND**  
Locations are Approximate

**Geologic Units**

Kt - Cretaceous Tonalite

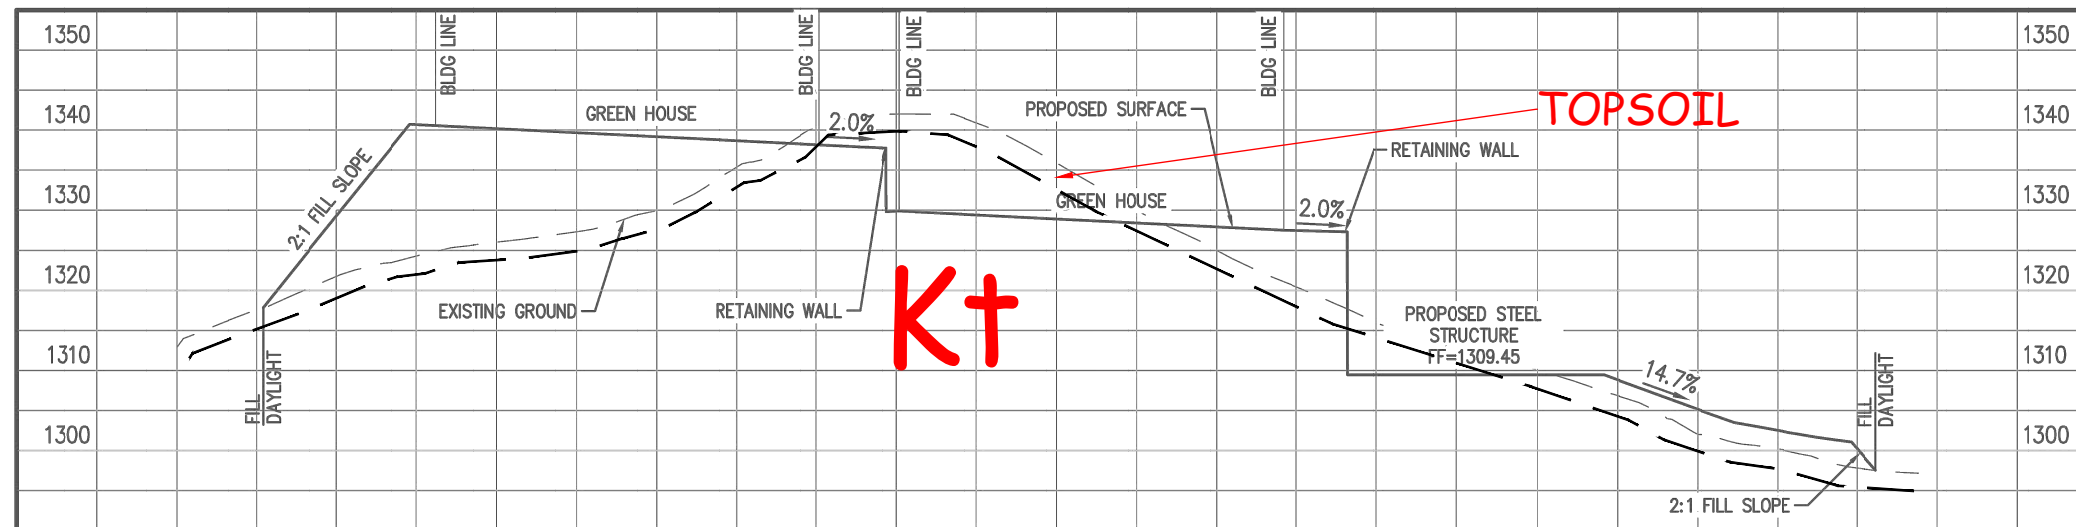

**SECTION A-A**  
HORIZONTAL SCALE: 1"=50'  
VERTICAL SCALE: 1"=20'

**GEOTECHNICAL CROSS SECTION**

22750 CARANCHO ROAD  
TEMECULA AREA, RIVERSIDE COUNTY, CALIFORNIA  
APN 933-020-005-6

PROJECT	PROPOSED CANNABIS CULTIVATION FACILITY		
CLIENT	FUEGO FARMS, LLC.		
PROJECT NO.	203306-10A		
DATE	JANUARY 2021		
SCALE	1:60		
DWG XREFS			
REVISION			
DRAWN BY	JDG	PLATE	3 OF 3

Earth Strata Geotechnical Services, Inc.

Geotechnical, Environmental and Materials Testing Consultants

www.ESGSINC.com (951) 397-8315