

**Filipponi &  
Thompson  
Drilling Inc.**

P.O. BOX 845 ATASCADERO, CA 93423  
TEL: (805) 466-1271 STATE LIC. #432680

# Invoice

DATE	INVOICE #
2/13/2020	32374

**BILL TO:**

SALVADOR CANO  
8770 CARRISA HWY  
SANTA MARGARITA, CA 93453

*All Credit Card Payments will have a 3%  
Processing Fee added to the invoice.  
A Finance Charge of 1.5%(18%APR) will  
accrue on all accounts 30+ days old.*

P.O. NUMBER	TERMS	PROJECT
-------------	-------	---------

DUE ON RECEIPT

QUANTITY	DESCRIPTION	RATE	AMOUNT
----------	-------------	------	--------

2/12/20

8770 CARRISA HWY - SANTA MARGARITA

1	4 HOUR - PUMP TEST	700.00	700.00
1	POTABLE - WATER ANALYSIS	100.00	100.00
	FUEL SURCHARGE	10.00	10.00


PERFORMED 4 HOUR PUMP TEST. TOOK WATER SAMPLE TO LAB FOR ANALYSIS.

**PAID**  
FEB 13 2020  
BY Ch 116

THANK YOU FOR YOUR BUSINESS!

Sales Tax (7.75%) \$0.00  
**TOTAL** \$810.00

*"No one ever lost business because quality was too high, or service too good"*

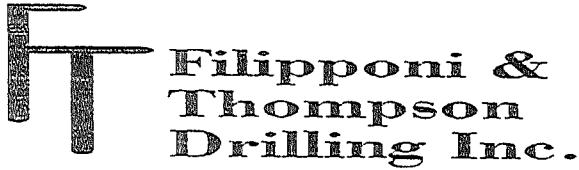

State License No. C57 432680  
 P.O. BOX 845  
 ATASCADERO, CA 93423  
 805-466-1271

Name SALVADOR & RENE CANO  
 Mailing Address 8770 CARISSA HWY - SANTA MARGARITA, CA 93453  
 Job Location 8770 CARISSA HWY - SANTA MARGARITA, CA 93453  
 Well Size 6" Depth \_\_\_\_\_  
 Tested by M. BOLLINGER Rate of Flow (gpm) 92.3

Date 2/13/2020  
 Phone 805-423-1540  
 APN 072-301-012  
 Duration 4 HOUR + RECOVERY  
 Static Level 18.2'

**Well Test Report**

<u>Date</u>	<u>Time</u>	<u>Water Level (FT)</u>	<u>G.P.M.</u>	<u>Drawdown</u>
2/12/2020	8:50AM	18.2	100.0	
	8:55	47.9	92.3	-29.7
	9:00	50.4	92.3	-32.2
	9:05	51.1	92.3	-32.9
	9:10	51.7	92.3	-33.5
	9:20	52.3	92.3	-34.1
	9:30	52.6	92.3	-34.4
	9:50	52.9	92.3	-34.7
	10:20	52.3	92.3	-34.1
	10:50	53.5	92.3	-35.3
	11:20	53.5	92.3	-35.3
	11:50	53.6	92.3	-35.4
	12:20PM	53.6	92.3	-35.4
	12:50	53.7	92.3	-35.5

**Recovery**

<u>Date</u>	<u>Time</u>	<u>Water Level (FT)</u>
2/12/2020	12:50PM	53.7
	12:55	23.0
	1:00	19.7
	1:05	18.5

Additional Comments:

Thank you,

Ned M. Thompson



State License No. C57 432680  
 P.O. BOX 845  
 ATASCADERO, CA 93423  
 805-466-1271

### PUMP INFORMATION FOR OUR RECORDS

Name SALVADOR & RENE CANO Date 2/12/2020  
 Mailing 8770 CARISSA HWY - SANTA MARGARITA, CA 93453 Code 23  
 Address 8770 CARISSA HWY - SANTA MARGARITA Well # \_\_\_\_\_ Phone 805-423-1540  
 APN 072-301-012 Location \_\_\_\_\_

#### PUMP

Make EXISTING Model # \_\_\_\_\_  
 H.P. \_\_\_\_\_ Serial # \_\_\_\_\_ Voltage 240 VOLT / 3 PHASE  
 Pipe size 2" Type \_\_\_\_\_ Wire size #12/3 Type TWIST  
 Depth Setting \_\_\_\_\_ Well Seal 6" X 2" Check Valve \_\_\_\_\_  
 Motor Date \_\_\_\_\_ Motor Model # \_\_\_\_\_  
 Motor Serial # \_\_\_\_\_ Safety Rope \_\_\_\_\_  
 Misc. WELL IN BUILDING WITH NO ACESS TO PULL

#### CONTROL

Control box \_\_\_\_\_ Make \_\_\_\_\_  
 Pressure Switch \_\_\_\_\_ On \_\_\_\_\_ Lbs. Off \_\_\_\_\_ Lbs.  
 Liquid Level \_\_\_\_\_ Low \_\_\_\_\_ High \_\_\_\_\_  
 Relief Valve \_\_\_\_\_ Make \_\_\_\_\_ Setting \_\_\_\_\_  
 Pump Panel Make SQUARE D Voltage 240 Mag Size 1  
 Heater/Overload SQUARE D CLASS 9065 Fuses 30 AMP  
 Misc. \_\_\_\_\_

#### BOOSTER PUMP

Booster Pump Make EVER BUILT Model # \_\_\_\_\_ 3/4 HP  
 Pressure Switch \_\_\_\_\_ On \_\_\_\_\_ Lbs. Off \_\_\_\_\_ Lbs.

#### STORAGE

Size 2,600 GALLON Galv  Poly  Fiberglass   
 Pressure Tank Make CENTI PRO Size 85 GALLON Model \_\_\_\_\_  
 Misc. \_\_\_\_\_

#### WELL

Casing Size 6" Type PVC  
 Depth To Water 18.2' To Bottom \_\_\_\_\_  
 G.P.M. \_\_\_\_\_ @ \_\_\_\_\_ Ft. Tested By \_\_\_\_\_  
 Misc. \_\_\_\_\_

**Abalone Coast Analytical, Inc.**

141 Suburban Rd, Ste C-1 San Luis Obispo CA, 93401  
Phone: 595-1080 Fax: 595-1075

Order #: 20-0875

Date/Time Rec'd: 2/13/20 1438

**Filippini & Thompson Drilling**

**P.O. Box 845**

**Atascadero, CA 93423**

**Contact: Ned Thompson**

**Phone: 805-466-1271**

**Sampler: Marc Bollinger**

**Project: Cano 8770 Carissa Hwy**

Sample #	Sample Description	Date / Time	Analysis	Method	Result	Units	RL	Completed
-1	Cano 8770 Carissa Hwy	2/13/20 1240	MPN Total Coliform	SM 9223 B.	ND.	MPN/100mL	1	02/14/20
			MPN E-coli	IDEXX	ND.	MPN/100mL	1	02/14/20

**This sample passes water quality standards for Total Coliform and E. Coli Bacteria.**

Report Completion Date:

2/14/20

Reviewed By:



Amanda Smith, Lab Director

**Definitions:**

MPN = Most Probable Number

RL = Reporting Limit

ND = Analyte NOT DETECTED at or above MDL

State of California CDPH ELAP 2661

Coliform are bacteria that are naturally present in the environment and are used as an indicator that other, potentially-harmful, bacteria may be present.

The presence of Fecal coliforms and/or *E. coli* indicates that the water may be contaminated with human or animal wastes. Microbes in these wastes can cause short-term effects, such as diarrhea, cramps, nausea, headaches, or other symptoms. They may pose a special health risk for infants, young children, some of the elderly, and people with severely compromised immune systems.